



Expertise

Protocol number: 46611327
Order No. / Reference: 26663030
Inspection date: 15 Jul 2026

Manufacturer: Volkswagen

Model: Tiguan Allspace 2.0 TDI SCR DSG Comfortline

VIN: WVGZZZ5NZMM129078



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan Allspace 2.0 TDI SCR DSG Comfortline	
Vehicle Identification number	WVGZZZ5NZMM129078
Mileage (Read)	124,799 km
First registration	20 Jul 2021
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Deep Black Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	21,200 km
Last service on / at	06/2026 at 123,069 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC318599
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	0603 / BZG 15342		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R19 100V	Summer tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm
2)	255/45 R19 100V	Summer tires (with run-flat tires) on Light alloy	Continental	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Continental	7mm / 7mm
2)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 01/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- 2 USB-C ports on the front
- Airbag for driver and front passenger including knee airbag on the driver's side (passenger airbag deactivation - knee airbag on driver and front passenger side)
- Exterior mirror housings painted silver
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles (interior door operation in matte chrome)
- Diesel particulate filter
- Dual-tone signal horn
- Electronic parking brake including Auto Hold function (Volkswagen's Auto Hold function is an extension of the electronic parking brake. The Auto Hold function prevents the vehicle from rolling away unintentionally when stationary or starting off, without the driver having to constantly apply the brakes. In this way, Auto Hold offers maximum driving comfort. - If the ABS wheel speed sensors detect rolling, the braking torque is automatically increased until the vehicle comes to a complete stop.)
- Pedestrian detection
- Luggage compartment cover
- Luggage compartment lid with electric opening and closing (adjustable opening angle)
- Halogen dual headlights and turn signals under a common clear glass cover (with LED daytime running lights)
- ISOFIX mounting points, also for i-Size child seats (device for attaching 2 child seats to the rear seats)
- Instrument cluster with electronic speedometer (odometer, trip meter, tachometer)
- Paint finish: Solid
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Manual headlight range adjustment
- Multifunction display "Premium" (with multi-color display)
- Fog lights and cornering lights
- Emergency braking assistant "Front Assist" (detects critical distance situations and helps to shorten the stopping distance - warns the driver visually and audibly in dangerous situations as well as with a preventive brake jolt)
- Radio accessories: 8 speakers
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Tire pressure monitoring system
- Wheels: Light alloy (4) "Tulsa" 7 J x 17 (in Dark Graphite, surface polished)
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Power steering
- Seats: Front passenger seat backrest folds down completely
- Seats: Folding tables on the backs of the front seats
- Seats: Comfort seats in the front (passenger seat backrest folds down completely - drawers under the front seats)
- Storage compartments in the overhead console
- Airbag, head airbag system including front side airbags (for front and rear passengers)
- Aspherical exterior mirror on driver's side (right exterior mirror, convex)
- Chrome trim on the side windows
- Silver anodized roof rails
- Decorative inserts "Checker Flag Titanium" (for instrument panel and front door panels)
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Electronic stability program with counter-steering support (including ABS, ASR, EDS, MSR and trailer stabilization)
- Automatic headlight control, with daytime running lights ("Leaving home" function and manual "Coming home" function)
- Electric windows front and rear
- High beam control Light Assist
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment lighting (additional, removable and usable as a flashlight)
- Transmission: 7-speed DSG
- Rear window heated
- Rear window wiper with intermittent function
- Interior mirror automatically dimming
- LED license plate lighting
- Air conditioning
- Rear headrests (3)
- Front headrests (safety-optimized - adjustable lengthwise and height)
- Reading lights: 2 front and 2 rear
- Light in the front footwell
- front center armrest
- Fatigue detection
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Cloth
- Radio "Composition" (16.5 cm touchscreen - dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface with Apple compatibility - 4 x 20 watt output power - 3-band tone control - telephone interface)
- Wheels: Tires 215/65 R 17, optimized for low rolling resistance
- Gearshift knob in leather
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner (3 three-point automatic seat belts at the rear including belt tensioner for the outer rear seats - warning tone and light for unfastened seat belts at the front and rear)
- Seats: Lumbar support in the front



- Seats: Front seats with height adjustment
- Lane keeping assistant "Lane Assist"
- 12-volt power outlet (on the rear center console and in the luggage compartment)
- Textile floor mats front and rear
- Prepared for "We Connect" and "We Connect Plus"
- Green thermal insulation glazing, sides and rear

- Seats: Rear bench seat asymmetrically split (longitudinally sliding and folding - with pass-through and center armrest)
- Start-stop system with brake energy recuperation
- Bumper in body color (lower bumper section black - center sections in granite grey metallic)
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking without safe locking, with remote control and 2 remote keys

Extra equipment

- Trailer Assist including Park Assist and Rear View camera (provides the driver with support when maneuvering with a trailer; the maneuvering direction is set via the mirror adjustment switch, the vehicle steers automatically - Park Assist: automatically steers the vehicle into parallel and perpendicular parking spaces and also exits parallel parking spaces - Rear View camera: displays the rear of the vehicle in real time on the radio/navigation system display)
- Paint finish: Pearl effect
- Package: Driver Assistance Package "Plus" (DSG) (Adaptive Cruise Control ACC "stop & go", including speed limiter - Dynamic High Beam Control "Dynamic Light Assist" - Head-up display - LED headlights with LED daytime running lights and cornering lights - Dynamic headlight range control with dynamic cornering lights - Multifunction camera - Emergency Brake Assist "Front Assist" (for ACC up to 210 km/h) - Lane Change Assist "Side Assist Plus" including Lane Keeping Assist "Lane Assist" and Rear Traffic Alert)
- Package: Mirror package (electrically adjustable, folding and heated exterior mirrors with passenger-side mirror lowering function - automatically dimming interior mirror)
- Package: Winter 1 in conjunction with "Vienna" leather interior with top comfort seats in the front or ergoActive seats (automatically heated windshield washer nozzles - headlight cleaning system - heated front seats)
- Wheels: Alloy (4) "Sebring" 8.5 J x 19 Volkswagen R in black (AirStop tires 255/45 R 19 - Wheel locks with enhanced theft protection)
- Surround view "Area View" (incl. reversing camera "Rear View")
- Foldable towbar (electric release)
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Display: Head-up display
- Air conditioning "Air Care Climatronic" (3-zone temperature control - allergen filter - rear controls)
- Paint finish: Metallic in V with R-Line "Black Style"
- Navigation system "Discover Media" incl. "Streaming & Internet" (8 speakers - 20.3 cm touchscreen - dual tuner with phase diversity for best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface with Apple compatibility - 4 x 20 watt output power - map with 2D display - telephone interface - traffic sign recognition - points of interest - DAB+ digital radio reception)
- Package: R-Line "Exterior Black Style", Volkswagen R (4 light alloy wheels 8.5 J x 19 - AirStop tires 255/45 R 19, optimized for rolling resistance - wheel locks with enhanced theft protection - black exterior mirror housings - black roof rails - rear spoiler in "R" styling in black - rear side windows and rear window tinted, 90% light-absorbing - comfort bumpers - black trim strips)
- Progressive steering (the steering ratio is progressively increased with increasing steering angle - the steering behavior becomes noticeably more direct depending on the driving situation, the steering wheel movements are significantly reduced and thus steering comfort is increased)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.



Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Wing mirror - left side	Cap - Scratch(es) - Smart repair
3	Door - front left side	Door - dent(s) - Smooth repair work
4	Sill - left side	Sill - Scratch(es) - Smart repair
5	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
6	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
7	Mudguard - right side	Wheel well extension - Scratch(es) - Replace
8	Wheel / tyres	Tyre - front right side - Broken / torn - Replace
9	Gearbox	Selector lever - Scratch(es) - Replace
10	Side panel - rear right side	Side panel - Scratch(es) - Paint
11	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint
12	Door - rear right side	Door - Scratch(es) - Paint
13	Door - rear left side	Door - Dent / paintcoat damage - Paint
14	Wheel / tyres	Alloy rim - rear left side (Materialabtrag) - Scratched - Replace
15	Front bumper	Front bumper (Inklusive anbauteile) - Scratch(es) - Paint
16	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Repair and paint
17	Door - front right side	Door - Dent / paintcoat damage - Repair and paint
18	Bonnet	Bonnet - Scratch(es) - Paint
19	Roof	Roof (Anätzung) - Paint defect - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Wheel / tyres	Alloy rim - front left side - Scratch(es) - No deduction
3	Side panel - rear left side	Sill - dent(s) - No deduction
4	Side panel - rear right side	Sill - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer, from 12 Mar 2024	601,26 €
2	Side right, Provided by user / customer, from 22 Jul 2025	1.240,15 €
3	Side - left, Provided by user / customer, from 30 May 2023	2.786,34 €
4	Rear, Provided by user / customer, from 16 Aug 2023	4.502,47 €

Accident damages

No.	Accident
1	Side right



Repainting

No. Repainting

- 1 Boot lid / rear door, Professionally carried out, Invoice of repair done Non-existent
- 2 Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent
- 3 Door - front left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Boot lid / rear door	169 µm	Side panel - rear left side	213 µm
Door - front left side	215 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

- Der beiliegende Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

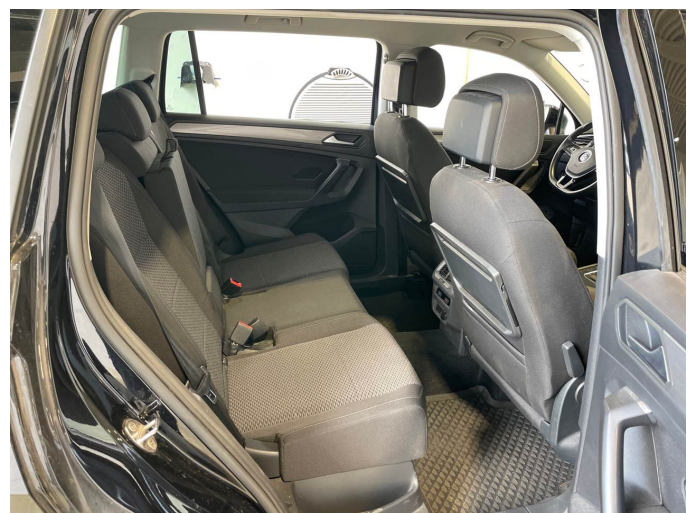


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

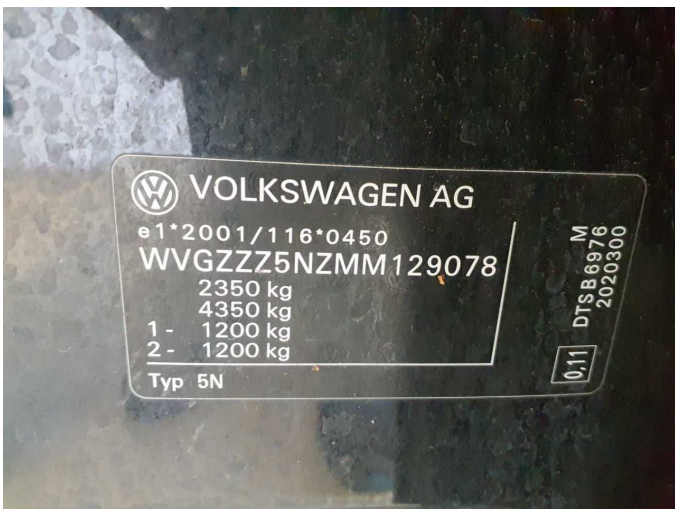


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

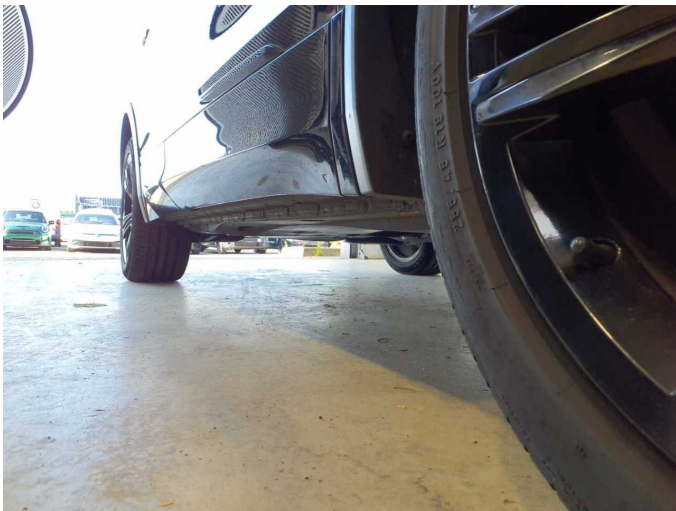


Figure 27: Misc.

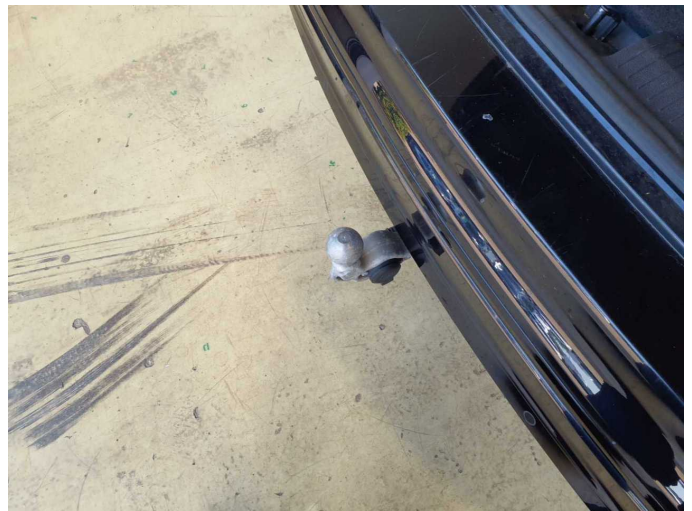


Figure 28: Misc.




Figure 29: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace




Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair

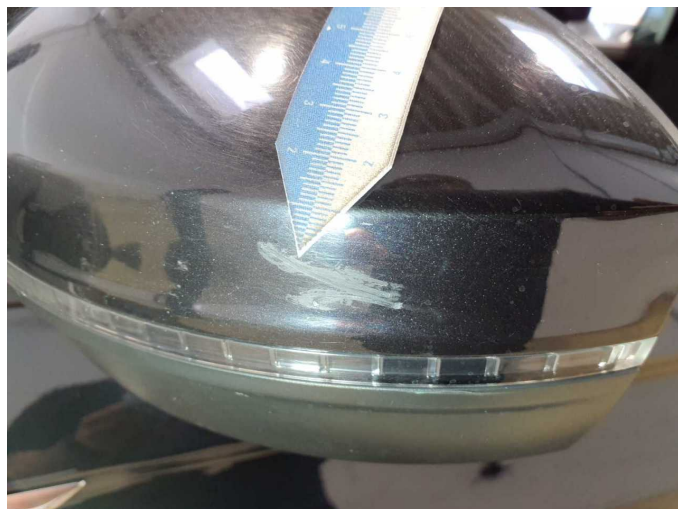


Damage 2: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 3: Door - front left side: Door - dent(s) - Smooth repair work

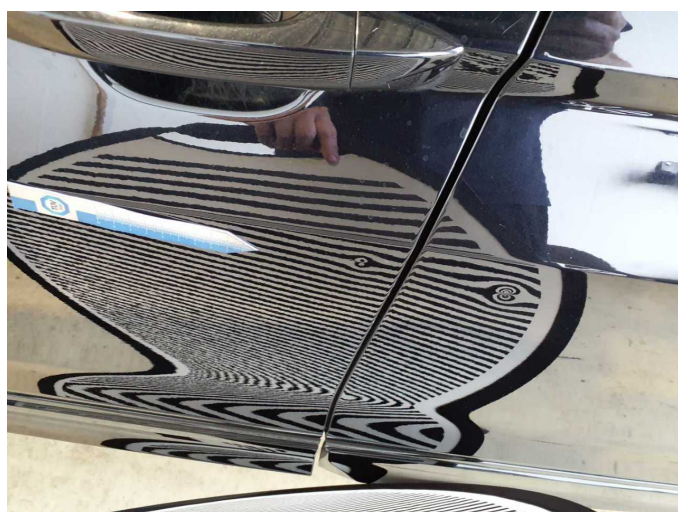

Damage 3: Door - front left side: Door - dent(s) - Smooth repair work

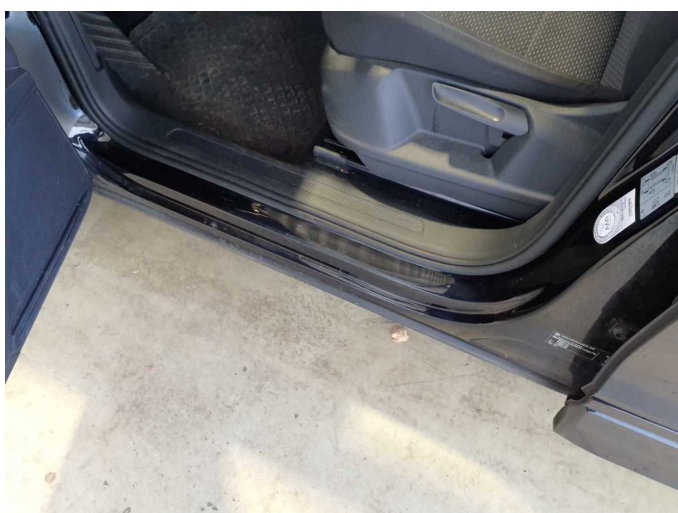

Damage 4: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 4: Sill - left side: Sill - Scratch(es) - Smart repair




Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value




Damage 5: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 6: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

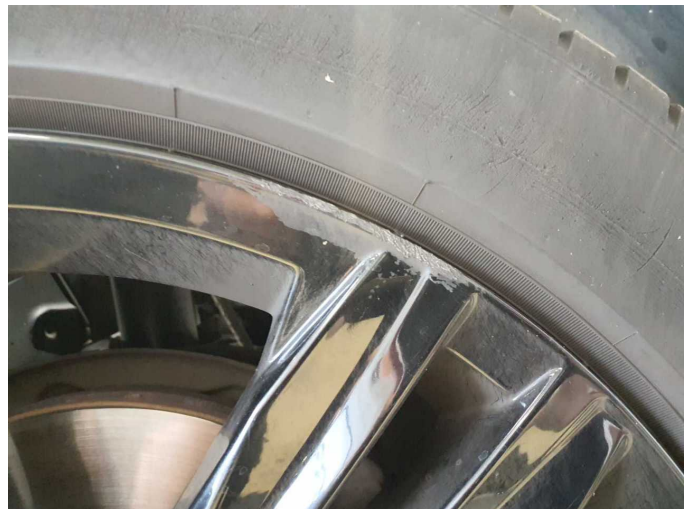

Damage 6: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

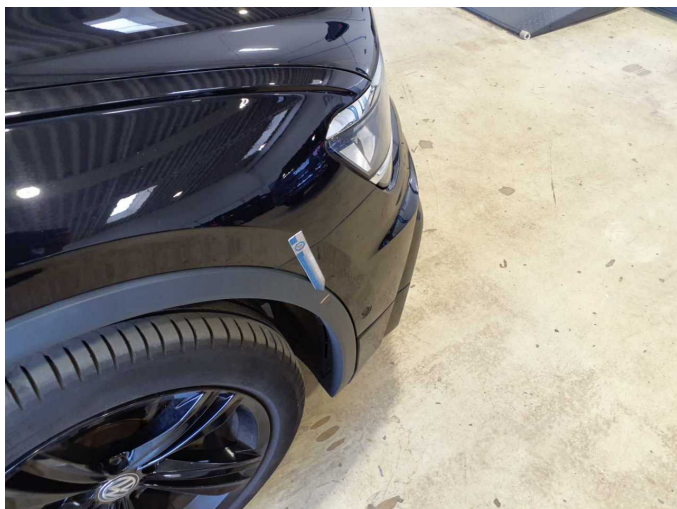

Damage 7: Mudguard - right side: Wheel well extension - Scratch(es) - Replace



Damage 7: Mudguard - right side: Wheel well extension - Scratch(es) - Replace



Damage 8: Wheel / tyres: Tyre - front right side - Broken / torn - Replace




Damage 8: Wheel / tyres: Tyre - front right side - Broken / torn - Replace




Damage 9: Gearbox: Selector lever - Scratch(es) - Replace



Damage 9: Gearbox: Selector lever - Scratch(es) - Replace

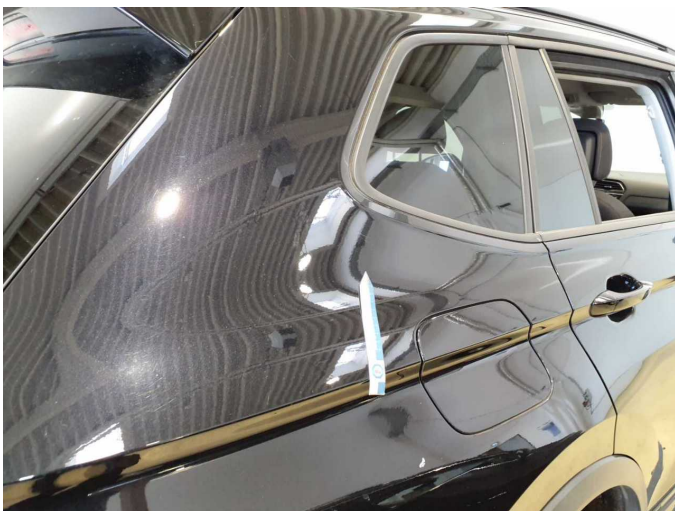


Damage 10: Side panel - rear right side: Side panel - Scratch(es) - Paint

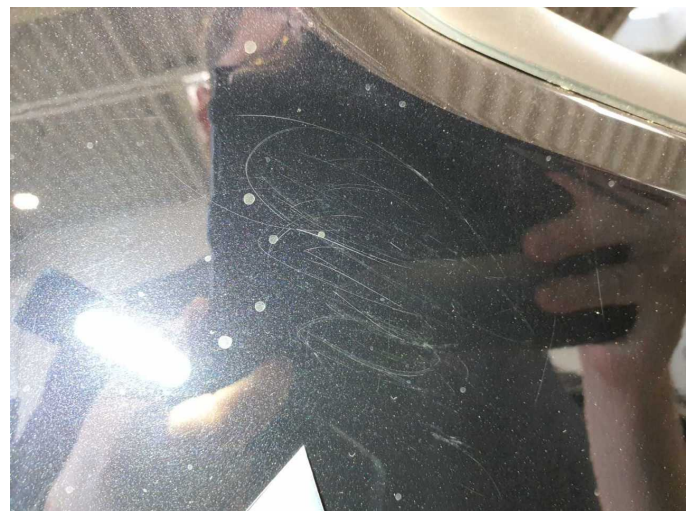


Damage 10: Side panel - rear right side: Side panel - Scratch(es) - Paint



Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

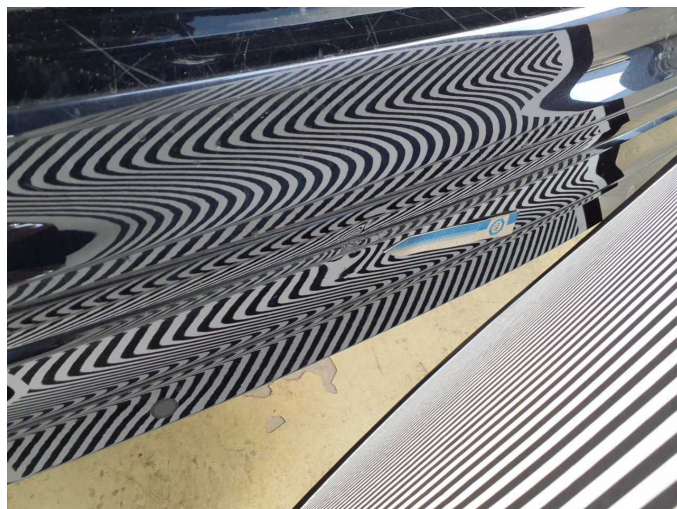


Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

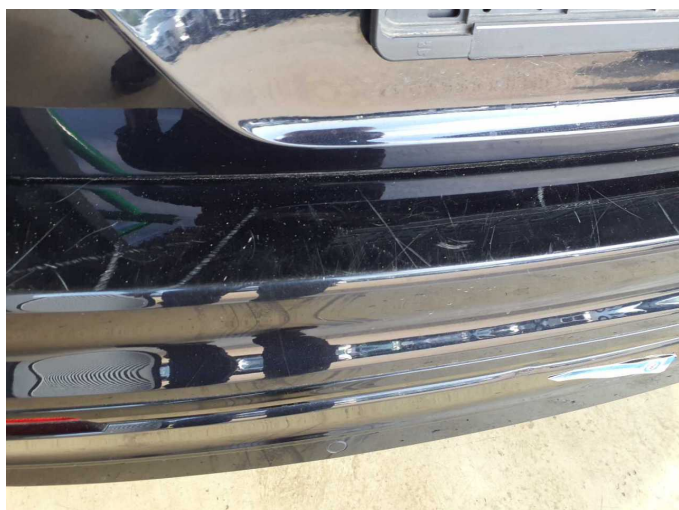


Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 11: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

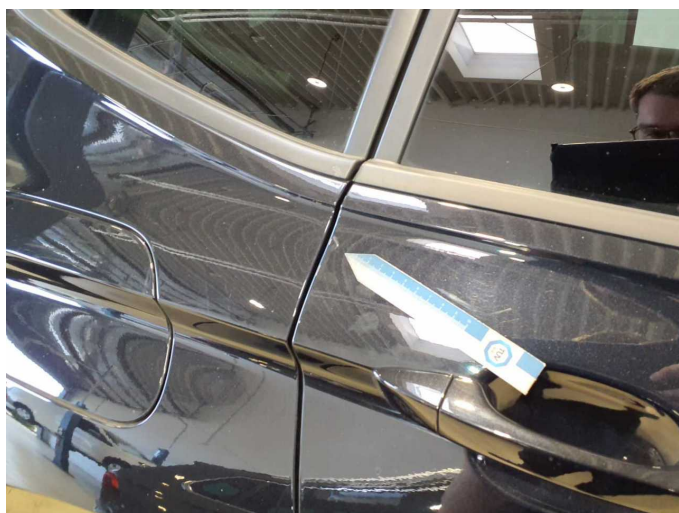

Damage 12: Door - rear right side: Door - Scratch(es) - Paint

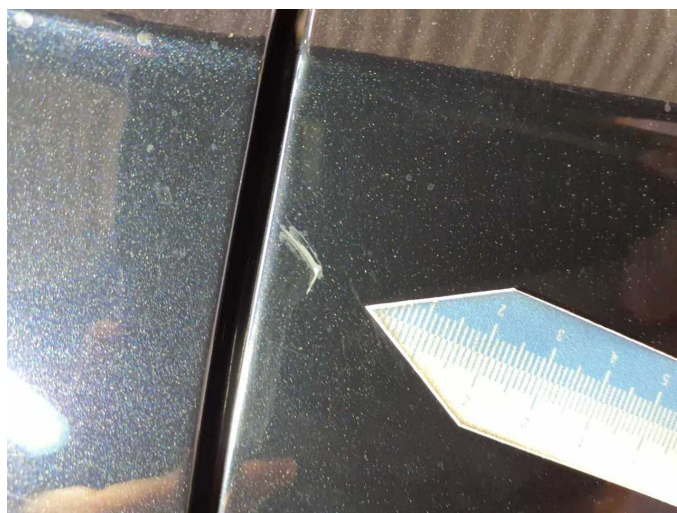

Damage 12: Door - rear right side: Door - Scratch(es) - Paint



Damage 13: Door - rear left side: Door - Dent / paintcoat damage - Paint



Damage 13: Door - rear left side: Door - Dent / paintcoat damage - Paint



Damage 13: Door - rear left side: Door - Dent / paintcoat damage - Paint




Damage 13: Door - rear left side: Door - Dent / paintcoat damage - Paint



Damage 14: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace



Damage 14: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace

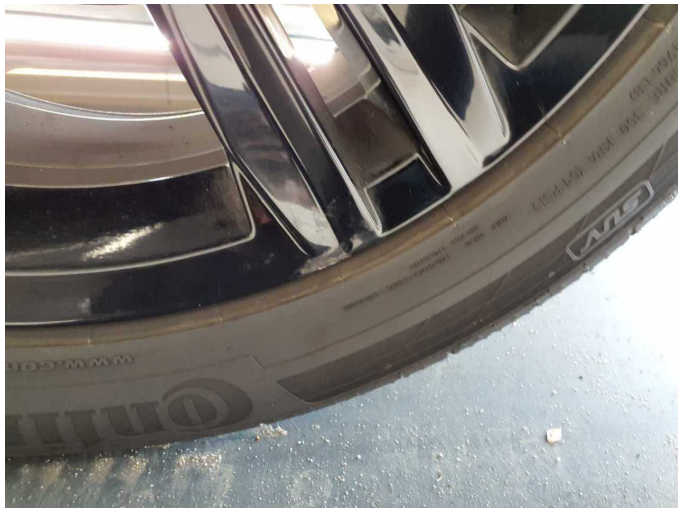

Damage 14: Wheel / tyres: Alloy rim - rear left side (Materialabtrag) - Scratched - Replace



Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint



Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint




Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint




Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint



Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint

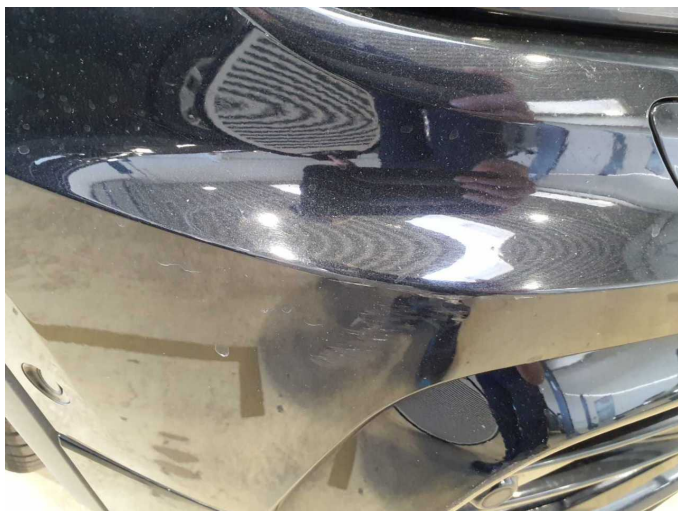


Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint

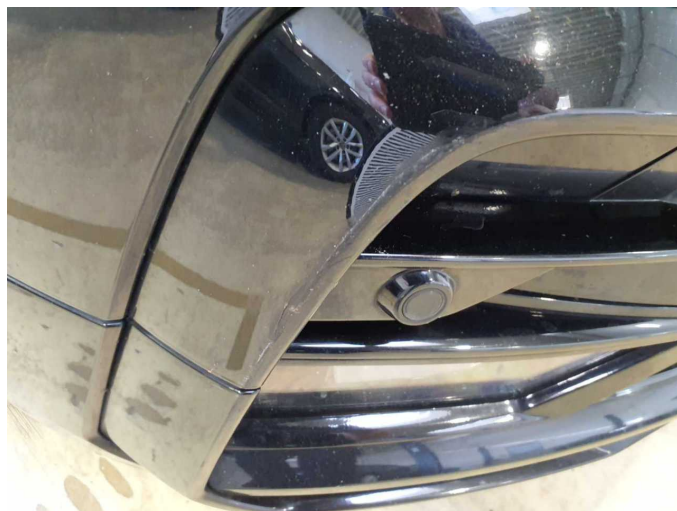


Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint




Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint

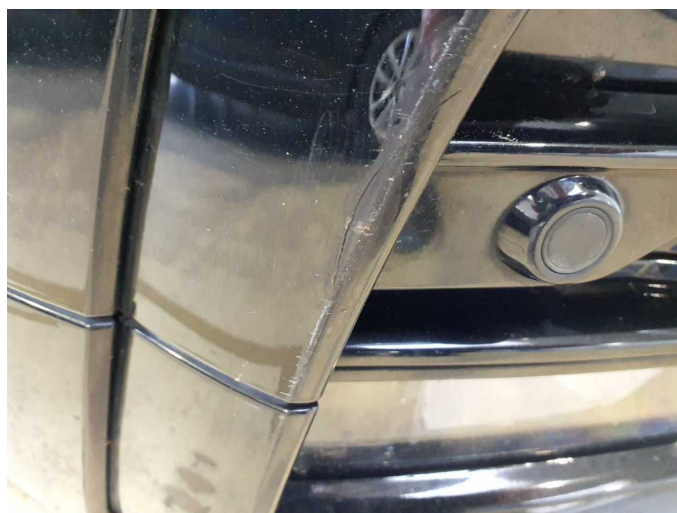


Damage 15: Front bumper: Front bumper (Inklusive anbauteile) - Scratch(es) - Paint

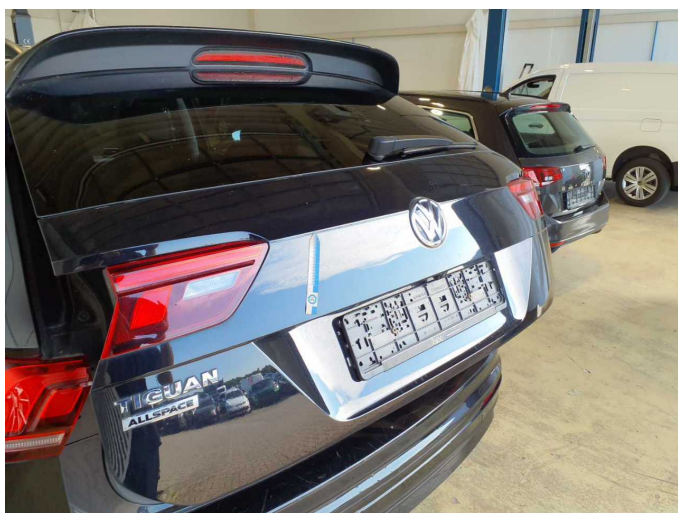

Damage 16: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

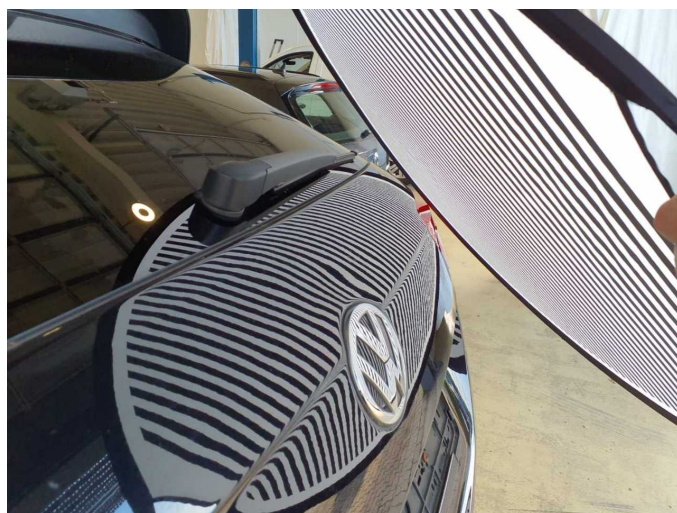

Damage 16: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint

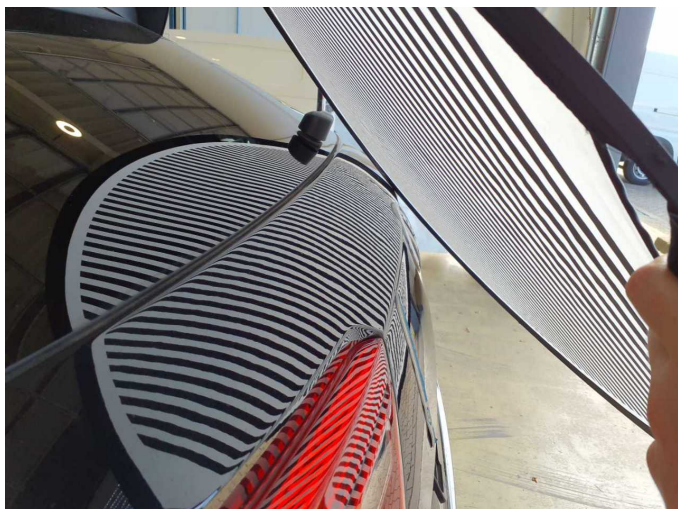

Damage 16: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 16: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 16: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Repair and paint




Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

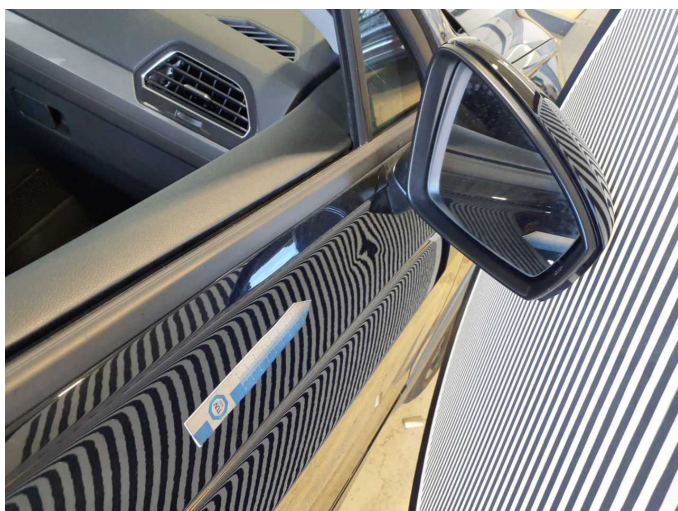

Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

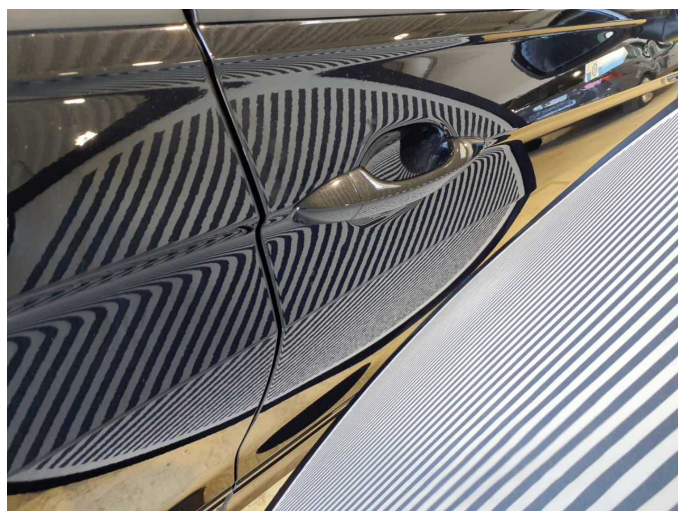

Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint

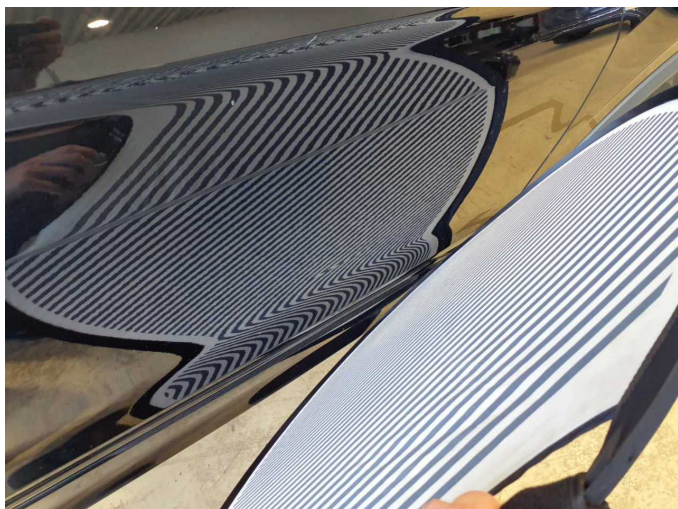

Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 17: Door - front right side: Door - Dent / paintcoat damage - Repair and paint



Damage 18: Bonnet: Bonnet - Scratch(es) - Paint



Damage 18: Bonnet: Bonnet - Scratch(es) - Paint



Damage 18: Bonnet: Bonnet - Scratch(es) - Paint



Damage 19: Roof: Roof (Anätzung) - Paint defect - Paint



Damage 19: Roof: Roof (Anätzung) - Paint defect - Paint



Damage 19: Roof: Roof (Anätzung) - Paint defect - Paint



Damage 19: Roof: Roof (Anätzung) - Paint defect - Paint



Wear and tear 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - No deduction




Wear and tear 2: Wheel / tyres: Alloy rim - front left side - Scratch(es) - No deduction



Wear and tear 3: Side panel - rear left side: Sill - dent(s) - No deduction



Wear and tear 3: Side panel - rear left side: Sill - dent(s) - No deduction

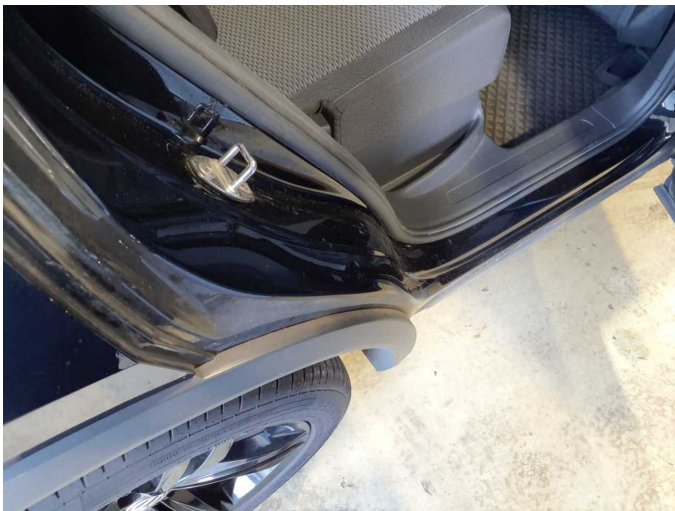

Wear and tear 4: Side panel - rear right side: Sill - dent(s) - No deduction



Wear and tear 4: Side panel - rear right side: Sill - dent(s) - No deduction



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right



Accident 1: Side right




Accident 1: Side right




Accident 1: Side right



Accident 1: Side right

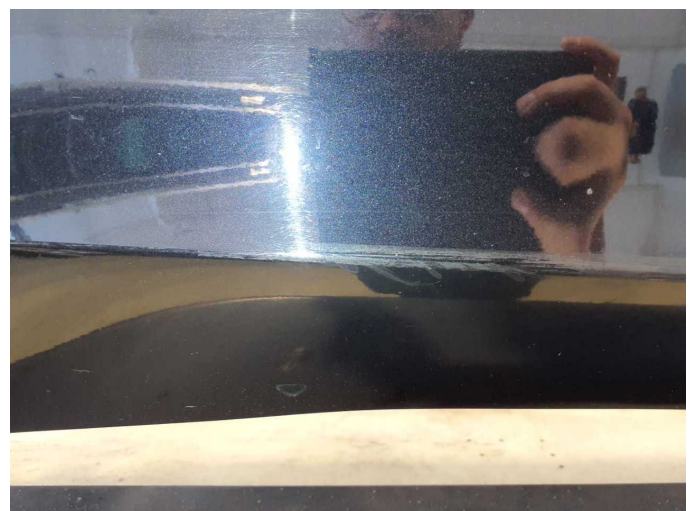

Accident 1: Side right

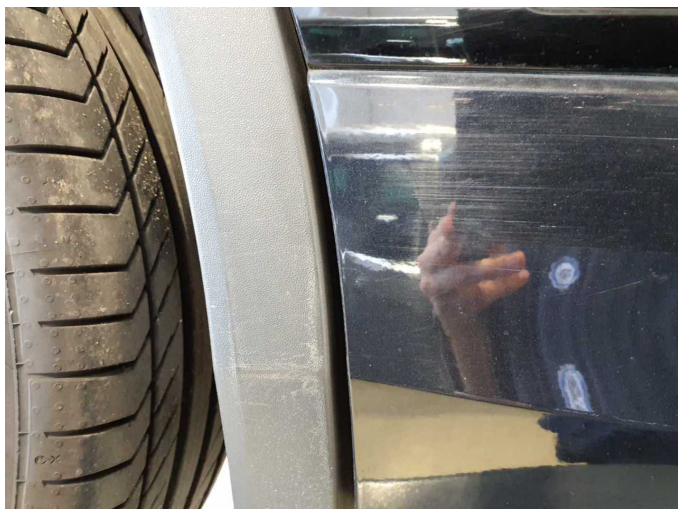


Accident 1: Side right



Repainting 1: Boot lid / rear door



Repainting 1: Boot lid / rear door

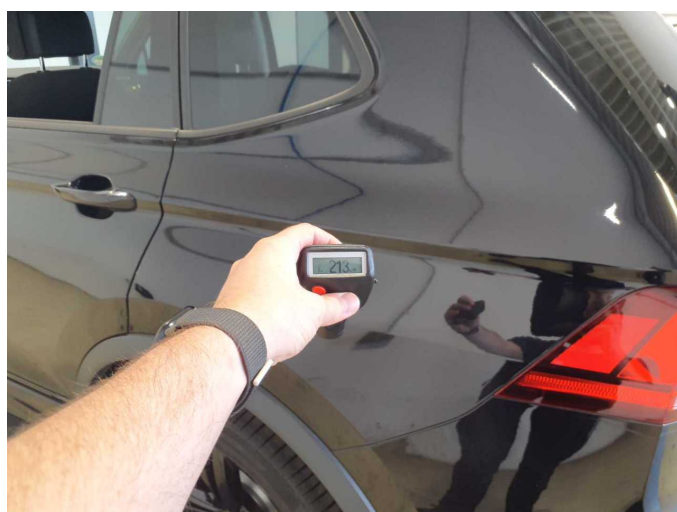

Repainting 2: Side panel - rear left side



Repainting 2: Side panel - rear left side



Repainting 3: Door - front left side



Repainting 3: Door - front left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5NZMM129078

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Tiguan Allspace 2.0 TDI SCR
DSG Comfortline

Datum	KM-Stand	Beschreibung
10.06.2026	123.069	AU; Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
27.04.2026	120.457	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Wartung Sonstiges
26.05.2025	101.724	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
07.01.2025	91.299	Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Wartung Sonstiges
15.07.2024	77.422	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
11.06.2024	74.391	Reparatur Sonstiges
04.06.2024	74.302	AU
05.02.2024	66.589	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben vorne
16.10.2023	60.465	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Wartung Sonstiges
04.07.2023	52.273	Motoröl b. Wartung; Ölwechsel
14.09.2022	29.188	Regelwartungsdienst
05.07.2022	23.760	Motoröl b. Wartung; Ölwechsel