MACADAM










Ford Mustang: N594KB

Vinnumber:	**WF0TK1EM1MMA38313**	Versionname:	**Mustang Mach-E 198kW/ 75,7kWh RWD automaat**
First Registrationdate:	**1/11/2021**	Fiscalpower:	
Expertise Mileage:	**116926**	Power Kw:	**198**
Bodytype:		Body colour	**Trendy Metaallak: Infinity Blue**
Gearbox:	**Automatic**	Paint type	**Metalic**
Transmission:		Type of rims (mounted)	**Aluminium**
Fueltype:	**Electric**	Parking lot	**346**
Number of seats	**5**		
Type of rims (mounted)	**Aluminium**		
Maintenance needed	**No**		

Options

Number of keys total	**1**	Lining leather	
GPS		Panoramic roof	
Autom climate control		Rear parking sensors	
Radio multimedia		Rear view camera	

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	225 / 60 / 18 / 100 / H / Aluminium	5,0 mm	Continental	Summer
	Right	225 / 60 / 18 / 100 / H / Aluminium	4,5 mm	Continental	Summer
Rear	Left	225 / 60 / 18 / 100 / H / Aluminium	5,2 mm	Continental	Summer
	Right	225 / 60 / 18 / 100 / H / Aluminium	5,2 mm	Continental	Summer

Assistance equipment

Number of charging cables (rapid charge)	**1**

Ignition key, Missing, Replace

No pictures to display


Seat cover FL, Worn, Replace




Door FL, Dent(s) and scratch(es), Repair and paint (complete)





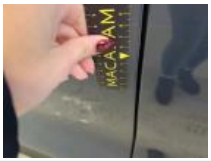

Wing FL, Scratch(es), Repair and paint (complete)




Door RL, Scratch(es), Repair and paint (complete)




Bumper trim F, Scratch(es), Replace




Wheel arch cover RR, Scratch(es), Replace





Door RR, Dent(s) and scratch(es), Repair and paint (complete)






Door trim RR, Scratch(es), Replace





Door FR, Dent(s) and scratch(es), Repair and paint (complete)







Outside rear-view mirror housing R, Broken, Replace and paint





Wing FR, Dent(s) and scratch(es), Repair and paint (complete)








Wheel arch cover FR, Scratch(es), Replace





Bumper R, Scratch(es), Repair and paint (complete)




Onderhoudshistorie van: WF0TK1EM1MMA38313

ALPHABET

Kenteken	N594KB
Merk Model	Ford Mustang Mach-E 198kW/ 75,7kWh RWD automaat
Brandstofsoort	Elektrisch
Datum deel1	11/1/21

Datum reparatie	Kilometerstand	Reparatie omschrijving
9/26/25	84,286	APK
7/8/25	80,072	Boordcomputer
1/10/25	71,602	Onderhoudsbeurt
1/10/25	71,602	Remvloeistof
1/10/25	71,602	Ruitenwisserblad(en) voorzijde
1/10/25	71,602	Sleutel/Kaart