



Expertise

Protocol number: 46464675
Order No. / Reference: 26490269
Inspection date: 13 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1NKM0FBXPF035392

Model: GLC 220 d 4Matic 9G-TRONIC Avantgarde Advanced



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 220 d 4Matic 9G-TRONIC Avantgarde Advanced	
Vehicle Identification number	W1NKM0FBXPF035392
Mileage (Read)	144,860 km
First registration	24 May 2023
Number of holders	1
Power / Engine displacement	145 kw / 1,993 ccm
Fuel type / Cylinder	Hybrid Diesel / E / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Graphitgrau Metallic
Doors / Seats	5 / 5
Upholstery type	Artificial leather
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	231 Tag(e)
Last service on / at	01/2026 at 126,820 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS720224
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BJX 00045		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,550 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	235/60 R18 103H	Winter tyres on Light alloy	Continental	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103W	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	235/60 R18 103W	Summer tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Adaptive Highbeam Assist
- Airbag: Kneebag for driver
- Airbag: Windowbag
- Active Lane Keeping Assist
- Ambient lighting
- Traction control (ASR)
- Automatic passenger airbag deactivation
- Roof rails made of glossy anodized aluminum
- Double cup holder
- Tachometer
- EASY-PACK tailgate
- Electronic Stability Program (ESP)
- Chassis: AGILITY CONTROL chassis with selective damping system
- Transmission: 9G-TRONIC
- Rear window wiper/washer system
- Instrument panel in black with contrasting decorative stitching
- LED High Performance Headlights
- Mercedes-Benz emergency call system
- Center console in high-gloss black
- Navigation: MBUX Navigation Premium
- Package: Avantgarde Advanced (P14 AVANTGARDE Interior - P15 AVANTGARDE Exterior - 00U Remote Services - 70B Warning Vest for Driver - PBG MBUX Navigation Premium - PDA Advanced Package)
- Package: Seating comfort
- Package: USB package
- Radio accessories: MBUX multimedia system
- Remote Services
- Wheels: Summer tires
- Wheel accessories: TIREFIT with tire inflator compressor
- Power steering
- Phone accessories: Wireless charging system for mobile devices
- Pre-installation for digital key handover
- Immobiliser
- Central display
- Decorative elements in diamond pattern, silver-grey
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- 4MATIC all-wheel drive
- Anti-lock braking system (ABS)
- ATTENTION ASSIST
- Basic services
- Diesel particulate filter
- Downhill Speed Regulation (DSR)
- Dynamic front bumper with visual underguard
- EASY-Pack: Cargo area cover
- Driver display
- Fingerprint scanner
- Velour floor mats
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control
- Radiator grille with integrated Mercedes star
- Steering wheel: Multifunction sports steering wheel in leather
- Navigation accessories: Extended MBUX functions
- Package: Storage
- Package: Chrome Interior Package
- Package: Interior light
- Package: Boot Comfort Package
- Package: Parking package with reversing camera
- Package: Mirror Package
- Radio accessories: Digital radio (DAB)
- Tire pressure loss warning
- Wheels: 45.7 cm (18") alloy wheels in a 5-twin-spoke design, painted black
- Windscreen wipers with rain sensor
- Heated seats for driver and front passenger
- Phone accessories: Smartphone integration
- Cruise control
- High-visibility vest for drivers
- Heat-insulating dark tinted glass
- Central locking with remote control



Extra equipment

- Digital Light (HD system with projection module - MULTIBEAM LED background module - Topography compensation keeps the beam range as constant as possible even with changes in altitude - Adaptive Highbeam Assist Plus - ULTRA RANGE highbeam - Active cornering light - Extended fog light, cornering light, country road light, city light, bad weather light, motorway light and motorway high beam - Cornering light with roundabout and intersection function - Off-road light - Adaptive full-LED taillights)
- Package: Off-road Engineering Package (comfort suspension with 20 mm higher ground clearance - metal underbody protection at the front - Gemtex durable plastic underbody protection on the sides)
- Package: Parking package with 360° camera (12 ultrasonic sensors: 6 each in the front and rear bumpers - 360° camera: four networked cameras, display on the media display, trailer mode - Active Parking Assist PARKTRONIC: detects parking spaces, assisted parking, assisted exiting, visual and acoustic warning of detected obstacles, display of camera and ultrasonic data on the central display, button for Active Parking Assist with PARKTRONIC - cross traffic warning - maneuvering brake - drive-away assist)
- Radio accessories: Sound personalization (A tailor-made listening experience: Personalizing the sound system makes it easy to achieve your perfect sound setup. A setup assistant with an innovative algorithm works with you to determine your music preferences and adjusts the Burmester® sound system to your wishes. The result is saved in a personal profile.)
- Traffic Sign Assistant (Camera and navigation data always keep an eye on the current speed limit – so you stay oriented even in a maze of signs. Because the system constantly informs you, the risk of violations decreases. This is not only convenient, but also increases safety in everyday road traffic.)
- Wheels: Winter complete wheels M+S 4-way 45.7 cm (18") (Light alloy wheels in 5-twin-spoke design, vanadium silver painted with 235/60 R 18 on 8 J x 18 ET 32.5)
- Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.)
- Center console diamond pattern silver grey
- Fire extinguisher
- Package: Driving Assistance Package Plus (Active Distance Assist DISTRONIC, Active Speed Limit Assist, Extended Automatic Restart, Route-Based Speed Adaptation with Traffic Jam Definition, Active Steering Assist, Active Lane Change Assist, Active Emergency Stop Assist with SOS Radio, Emergency Lane Radio, Active Brake Assist, Turn and Intersection Radio, Traffic Jam Emergency Brake Radio, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, Exit Warning Radio, PRE-SAFE PLUS Pedestrian Warning Function, Traffic Sign Assist, Active Traffic Jam Assist, PRE-SAFE Impulse Side)
- Paint finish: Metallic
- Radio accessories: Burmester 3D surround sound system (15 powerful speakers - DSP amplifier with a total output of 710 W (2 x 120 watts, 7 x 50 watts, 6 x 20 watts) - 2 broadband speakers in the front for 3D sound - Frontbass technology with woofers integrated into the body shell - Sound optimization for the front, rear or all seats - 2 sound presets: "Pure" and "3D Sound" - Equalizer function for adjusting bass, midrange and treble - Noise cancellation (VNC))
- Radio accessories: Pre-installation for MBUX Entertainment (integration of music streaming services (user account required): Spotify, Amazon Music, Apple Music, TIDAL, TuneIn (no user account required) - Extended radio information - Extended radio station tracking - Internet radio - Third-party convenience data volume)
- Towbar with ESP trailer stabilization
- Trailer maneuvering assistant
- Type designation removed from trunk lid
- Upholstery: ARTICO man-made leather
- Wheels: Complete summer wheel sets fitted at the factory

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Interior	Cigarette lighter (Abdeckung) - Broken / torn - Replace
2	Vehicle glazing	Windscreen seal (Blende) - Scratch(es) - Replace
3	Side panel - rear right side	Sill - dent(s) - Smart repair
4	Sill - right side	Sill - Dent / paintcoat damage - Smart repair
5	Rear bumper	Rear bumper - Scratch(es) - Smart repair
6	Vehicle glazing	Windscreen with lane departure assistant - Broken / torn - repair according to calculation

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

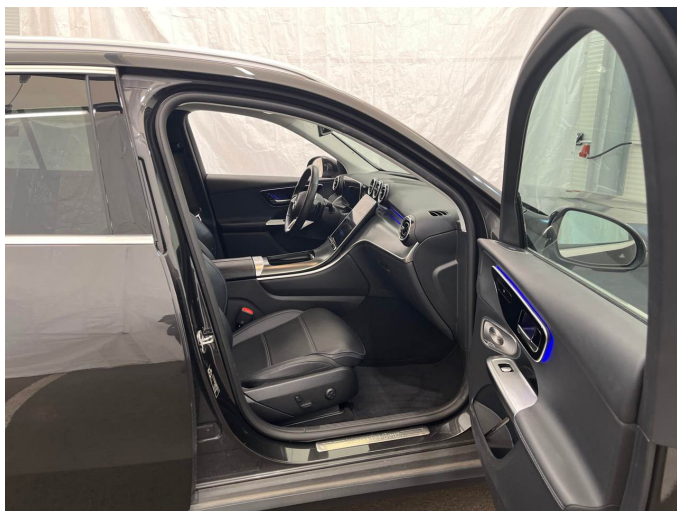


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

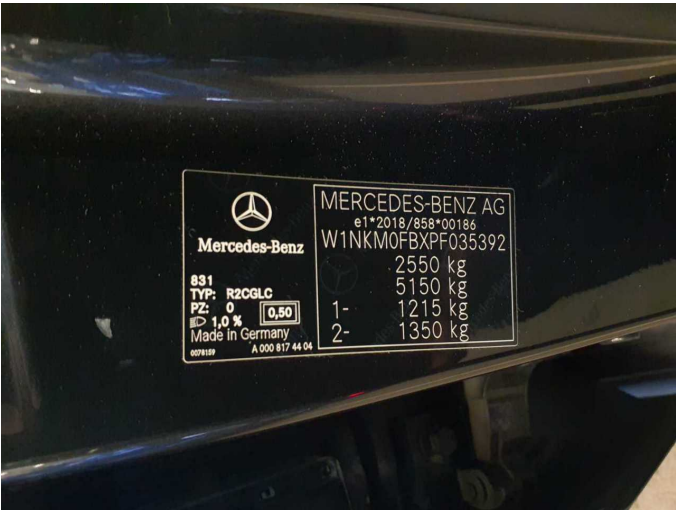


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

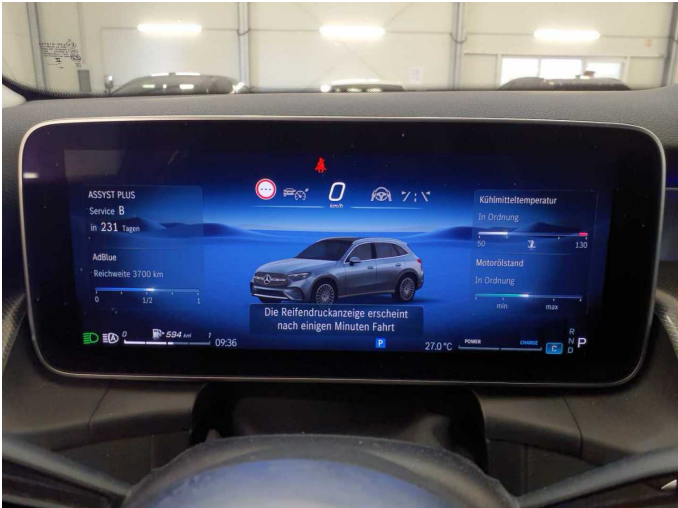


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

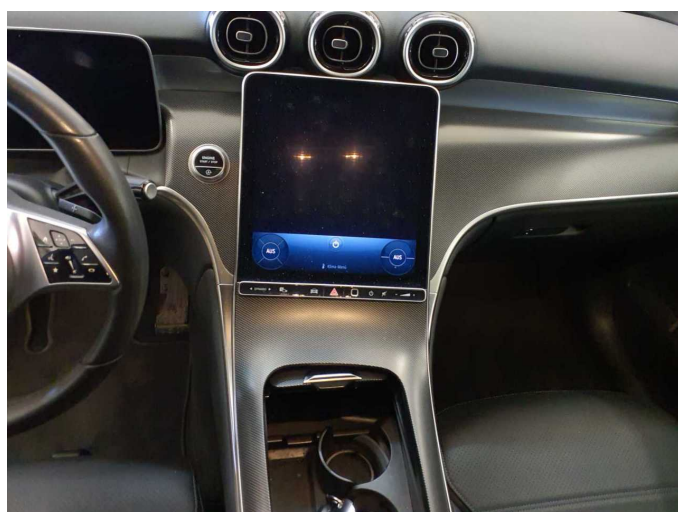


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

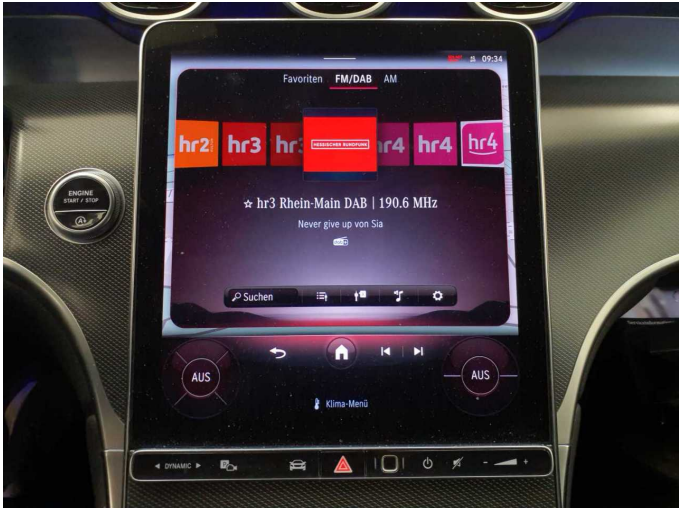


Figure 26: Misc.

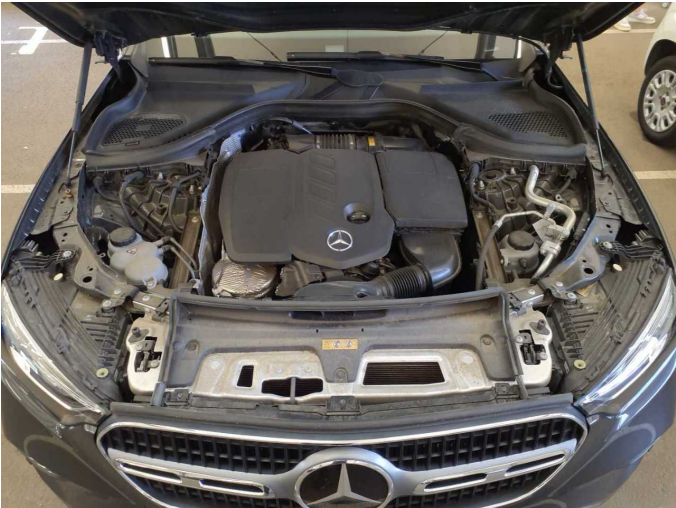


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.




Figure 31: Misc.




Figure 32: Misc.




Damage 1: Interior: Cigarette lighter (Abdeckung) - Broken / torn - Replace

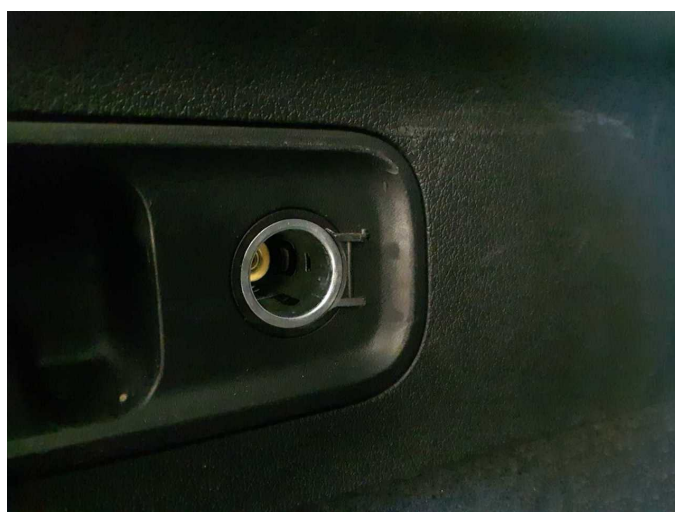


Damage 1: Interior: Cigarette lighter (Abdeckung) - Broken / torn - Replace

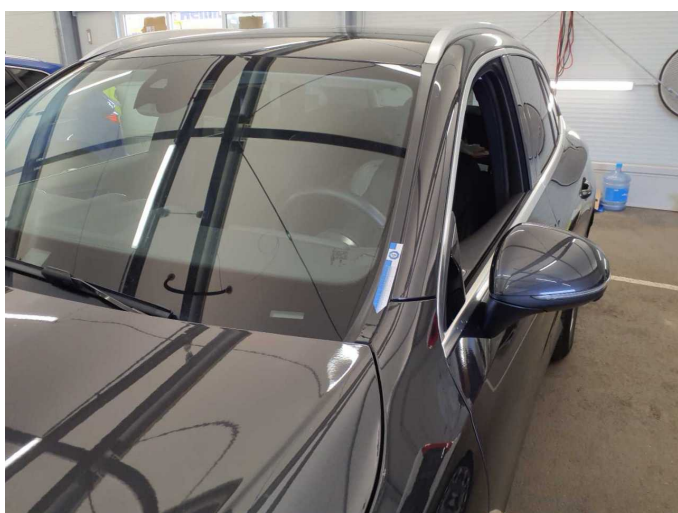

Damage 2: Vehicle glazing: Windscreen seal (Blende) - Scratch(es) - Replace

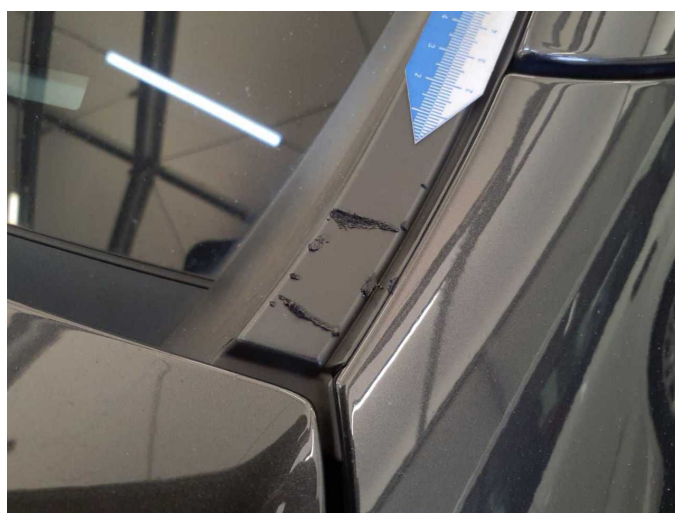


Damage 2: Vehicle glazing: Windscreen seal (Blende) - Scratch(es) - Replace

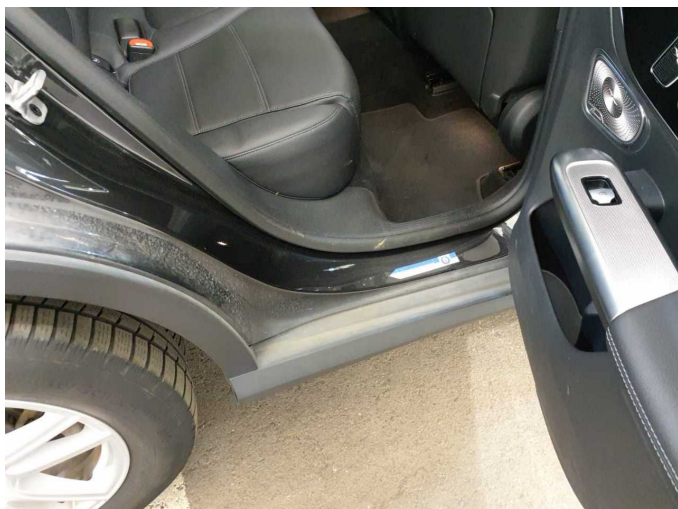


Damage 3: Side panel - rear right side: Sill - dent(s) - Smart repair




Damage 3: Side panel - rear right side: Sill - dent(s) - Smart repair

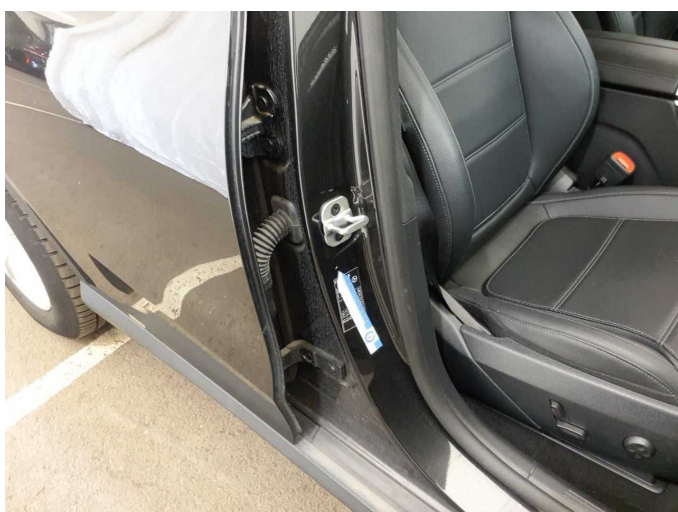


Damage 4: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

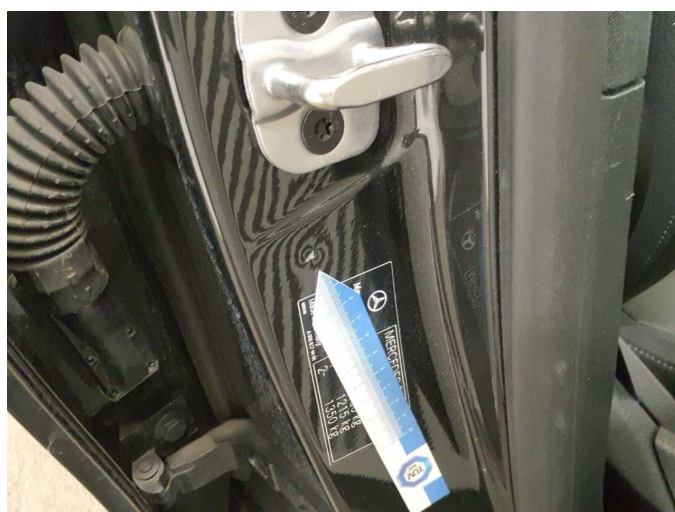

Damage 4: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

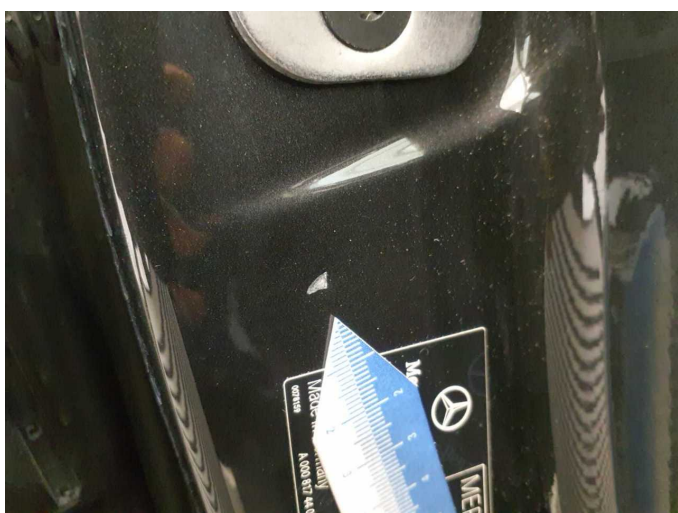


Damage 4: Sill - right side: Sill - Dent / paintcoat damage - Smart repair

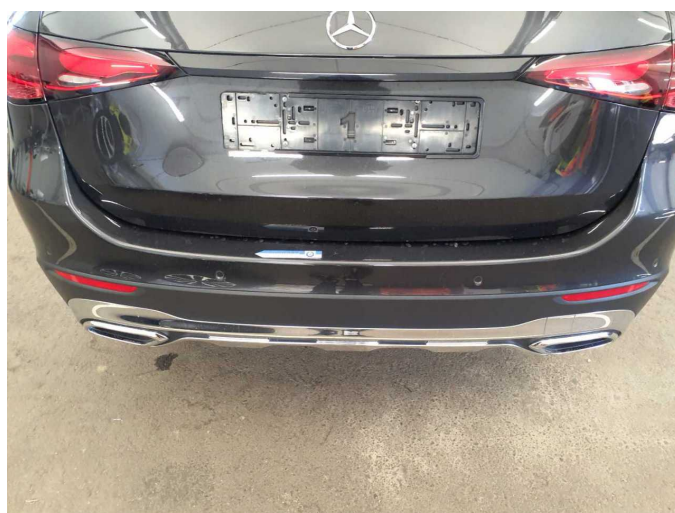


Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair

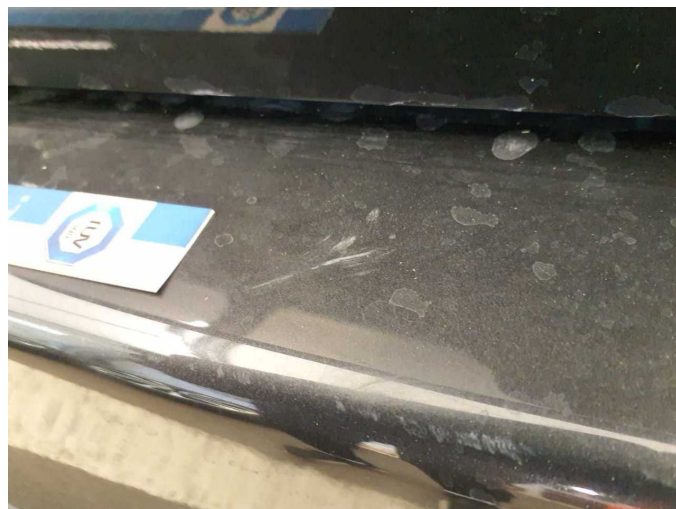

Damage 5: Rear bumper: Rear bumper - Scratch(es) - Smart repair

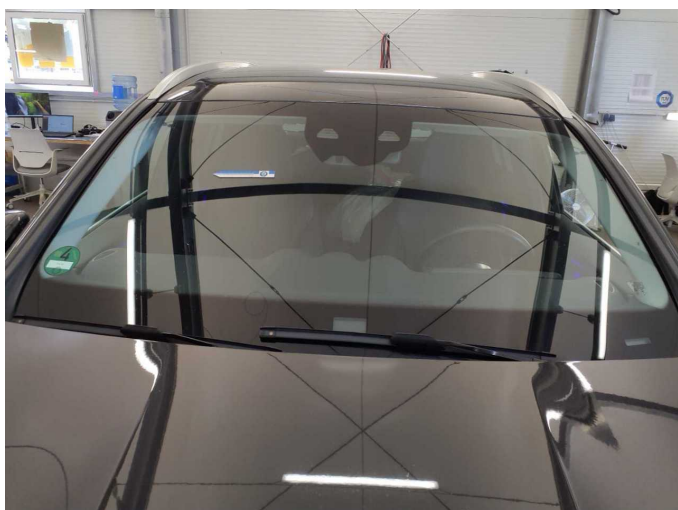

Damage 6: Vehicle glazing: Windscreen with lane departure assistant - Broken / torn - repair according to calculation

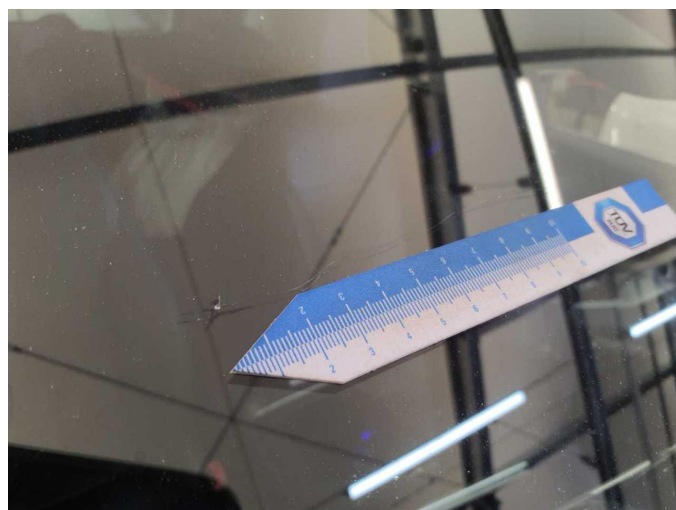

Damage 6: Vehicle glazing: Windscreen with lane departure assistant - Broken / torn - repair according to calculation



Damage 6: Vehicle glazing: Windscreen with lane departure assistant - Broken / torn - repair according to calculation



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1NKM0FBXPF035392

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLC 220 d 4Matic 9G-TRONIC Avantgarde Advanced

Datum	KM-Stand	Beschreibung
26.01.2026	126.820	Regelwartungsdienst
14.08.2025	101.928	Regelwartungsdienst
06.01.2025	77.371	Regelwartungsdienst
16.07.2024	51.645	Regelwartungsdienst
29.01.2024	26.332	Regelwartungsdienst