



Expertise

Protocol number: 46417495
Order No. / Reference: 26484703
Inspection date: 30 Jun 2026

Manufacturer: Ford

Model: Transit Connect 230 L2 S&S Autm. Trend

VIN: WF0SXXWPGSLT29035



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit Connect 230 L2 S&S Autm. Trend

Vehicle Identification number	WF0SXXWPGSLT29035
Mileage (Read)	180,565 km
First registration	11 Feb 2021
Number of holders	1
Next periodical technical inspection	03/2027
(Report on hand)	

Power / Engine displacement	88 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Van

Colour / colour code	Frost-Weiß
Doors / Seats	4 / 2
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	94 %
Last service on / at	05/2026 at 179,929 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FZ445374
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BMN 01607		
Emission standard	EURO6;WLTP;AQ;PI/CI; N1 II	fine dust sticker	
Permitted total weight	2,380 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Summer tyres on Light alloy	Continental	5mm / 5mm
2)	205/60 R16 96H	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Steel	Continental	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Steel	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	205/60 R16 96H C	Summer tyres on Steel	Continental	7 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ABS with EBD
- Exterior mirrors, narrow mirror format
- Hill start assist
- On-board computer including outside temperature display
- Double-leaf rear doors without windows
- Third brake light
- Front electric windows
- Heated windshield and windshield washer nozzles
- Glove compartment with lid
- Front interior lighting with delay function
- Paint finish: Solid
- Cargo area lining, side, half-height
- Center console, front
- Emergency brake light
- Sliding door at rear, right
- Side protection strips, plastic
- Safety brake assist
- Automatic door locking mechanism (45 sec.)
- Start-stop system
- Concealed storage compartment on dashboard
- Power outlet: 12-volt connection in storage compartment on dashboard (driver's side)
- Daytime running light
- Child safety lock on sliding doors
- Electronic immobilizer (EPATS)
- Central locking with remote control
- Driver's side airbag
- Battery, reinforced
- Rubberized flooring, front
- Diesel particulate filter (DPF)
- Tachometer
- Electronic Safety and Stability Program (ESP)
- Ford Easy Fuel
- Transmission: 8-speed automatic
- Interior lighting in the passenger/cargo area with delay function
- Cargo area floor protection plastic, molded
- Steering column, adjustable in height and reach
- Fog light
- Wheels: Steel wheels 6.5 J x 16 with 205/60 R 16 tires and wheel trims
- Electro-mechanical power steering
- Front seat belts are height-adjustable
- Front spoiler lip
- Dust and pollen filter
- Power outlet: 12-volt connection on the front center console
- Front bumper and rear bumper end caps painted in body color
- Partition wall to the cargo area without window
- Lashing eyes
- Heat-insulating glazing, lightly tinted
- Auxiliary electric heater (PTC), front



Extra equipment

- Fixed towbar (incl. ESP trailer stabilization and continuous power supply)
- DPF regenerator, manual
- Remote control: 2nd remote control key for central locking (instead of conventional key)
- Adaptive cruise control (with intelligent speed limiter - including radar- and camera-based pre-collision assist, with pedestrian and cyclist detection, distance display and distance warning, as well as lane keeping assist including lane keeping assist and driver drowsiness detection - including traffic sign recognition system - leather multifunction steering wheel with 4 spokes in aluminum trim)
- Active parking assistant with parking and exiting function (front and rear parking pilot system)
- Tire pressure monitoring system
- Spare wheel: Steel wheel
- Headlight assistant with day/night sensor including automatically dimming interior mirror (including headlight dimming with switch-off delay, windscreen wipers with rain sensor, heated windscreen and windscreen washer nozzles)
- Crosswind Assist and Roll Stability Control (RSC)
- SORTIMO CNRN 124833
- SORTIMO CNRN 141548
- SORTIMO CNRN 142852
- Partition wall to the cargo area with window
- Xenon: Bi-xenon headlights with LED daytime running lights (with automatic headlight range control)
- Electrically adjustable and heated exterior mirrors with blind spot assist (blind spot assist including cross traffic alert)
- FRNK: Labeling
- FRNK: Third key, rubber mats, driver's seat cover, vinyl wrap. Hs
- Rear swing door with heated rear window
- Air conditioning with automatic temperature control (2 zones) (for driver and passenger side, separately adjustable)
- Inductive charging station for mobile devices (according to Qi standard, compatibility depends on the device)
- Fog lights with static cornering lights
- Radio: Ford Audio System 9 (Ford navigation system incl. Ford SYNC 3 with AppLink, 6" touchscreen radio (FM/AM), 2 USB ports, audio remote control on the steering wheel, Bluetooth hands-free system and audio streaming, emergency call assistant, SMS text-to-speech function, SMS sending function, voice control, reversing camera, phase diversity antenna, DAB/DAB+, acoustic and visual route guidance, road map for Europe, TMCpro live traffic, detailed 3D visualization, Michelin travel guide for Europe)
- Seats: Seat Package 42 (Driver's seat, 3-way manually adjustable (forward/backward, height, backrest) - Single passenger seat, 2-way adjustable (forward/backward, backrest) - Height-adjustable headrests - Heated seats for driver and front passenger - Manually adjustable lumbar support in driver's seat - Airbag Package (Front airbag for front passenger, side airbags for driver and front passenger) - "Capitol/City" fabric in Ebony (black) - Seatbelt warning system for driver)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Seat - front	Protective Cover - left side - Damaged - Replace
2	Sliding door, right	Sliding door - Dent / paintcoat damage - Repair and paint
3	Front bumper	Front bumper (inkl. Parksensor) - Broken / torn - Replace
4	Roof	Roof (Dachkante) - Corrosion - Repair and paint



Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Engine - Engine cover

Accident damages

No. Accident

- 1 Rear, Side - left
- 2 Side right

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.



Comments

- Der angegebene Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.
- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich. Mehrkosten möglich.

Das Fahrzeug befand sich zum Besichtigungszeitpunkt in beschädigtem, nicht demontiertem Zustand. Schadenausweitung möglich, Zusatzkosten können entstehen



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

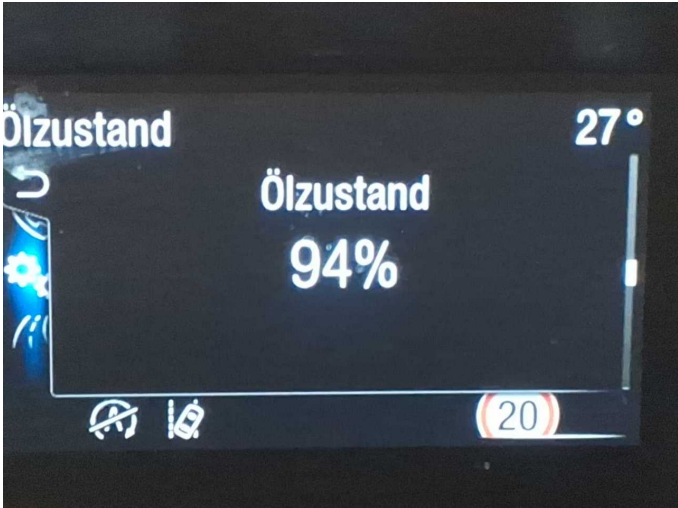


Figure 14: Documents

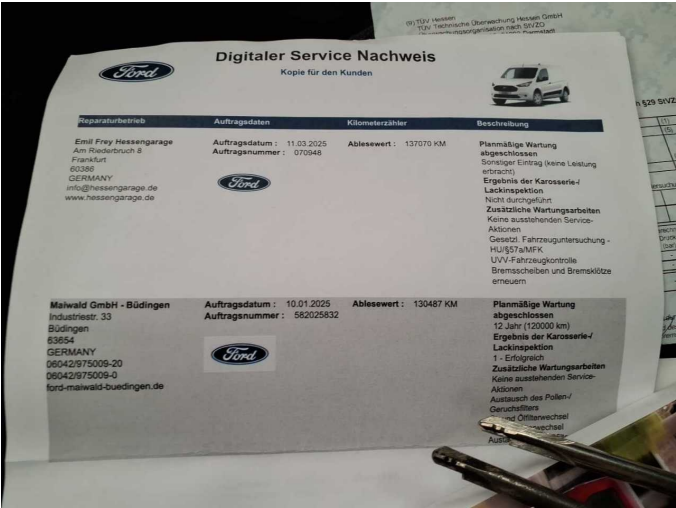


Figure 15: Documents

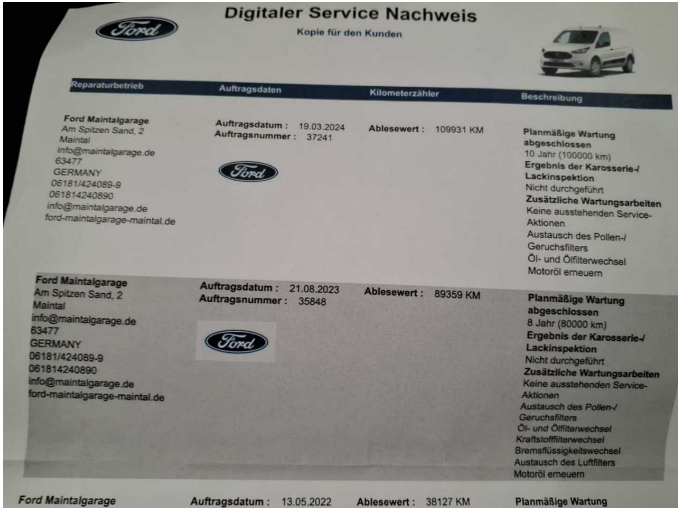


Figure 16: Documents

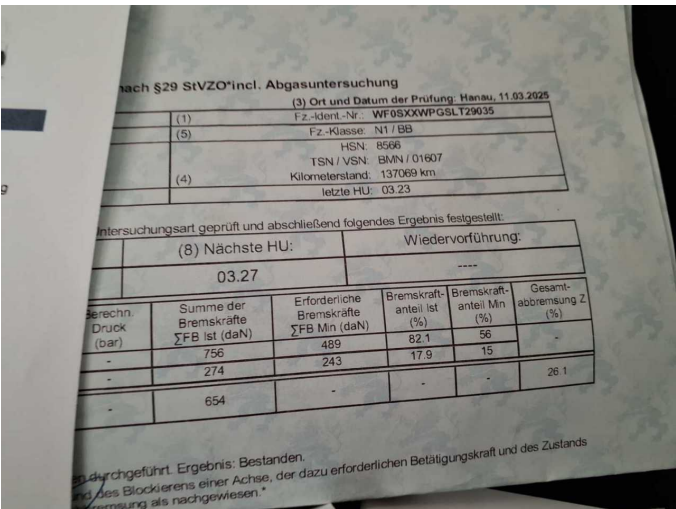


Figure 17: Documents

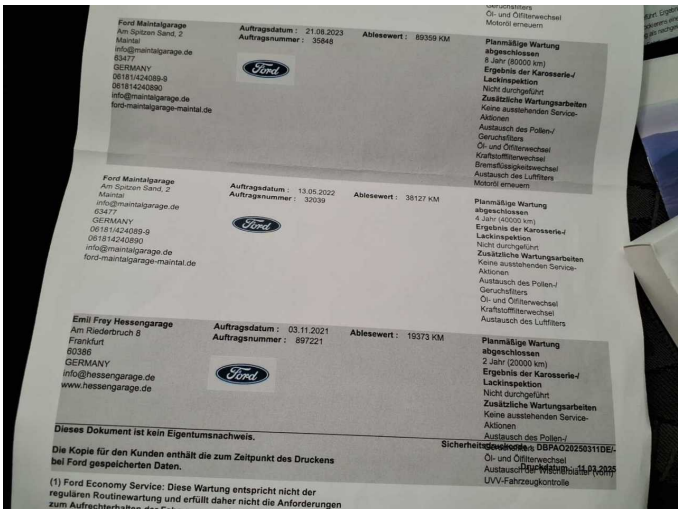


Figure 18: Documents



Figure 19: Additional tyres



Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.

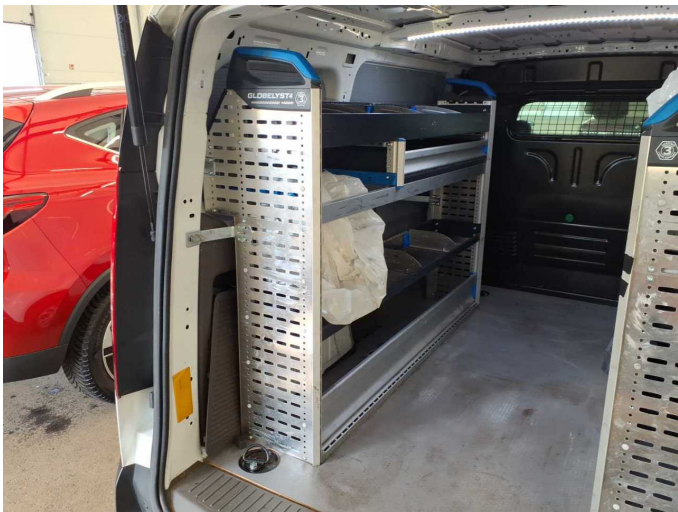


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

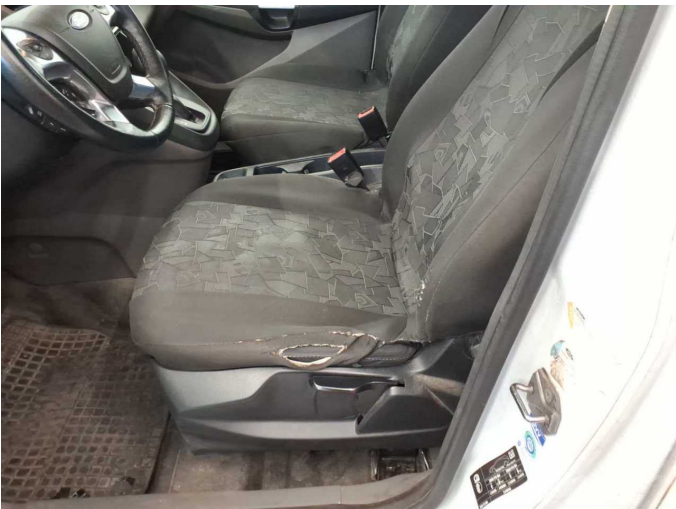

Damage 1: Seat - front: Protective Cover - left side - Damaged - Replace



Damage 1: Seat - front: Protective Cover - left side - Damaged - Replace



Damage 2: Sliding door, right: Sliding door - Dent / paintcoat damage - Repair and paint



Damage 2: Sliding door, right: Sliding door - Dent / paintcoat damage - Repair and paint



Damage 2: Sliding door, right: Sliding door - Dent / paintcoat damage - Repair and paint



Damage 3: Front bumper: Front bumper (inkl. Parksensor) - Broken / torn - Replace




Damage 3: Front bumper: Front bumper (inkl. Parksensor) - Broken / torn - Replace



Damage 3: Front bumper: Front bumper (inkl. Parksensor) - Broken / torn - Replace



Damage 3: Front bumper: Front bumper (inkl. Parksensor) - Broken / torn
- Replace

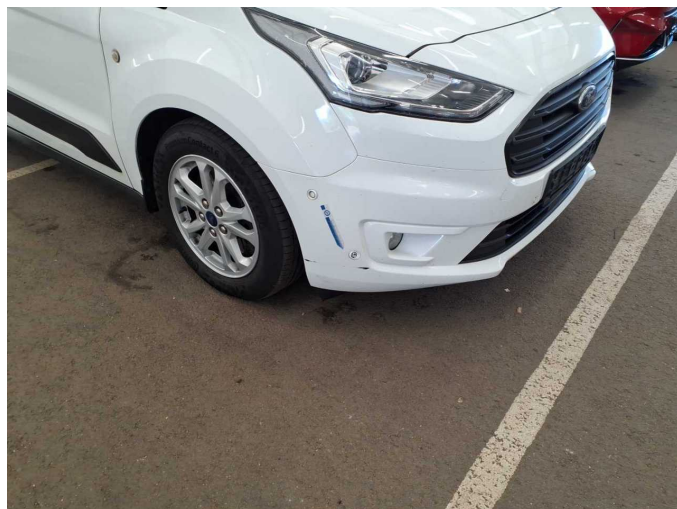

Damage 3: Front bumper: Front bumper (inkl. Parksensor) - Broken / torn
- Replace




Damage 3: Front bumper: Front bumper (inkl. Parksensor) - Broken / torn
- Replace



Damage 4: Roof: Roof (Dachkante) - Corrosion - Repair and paint




Damage 4: Roof: Roof (Dachkante) - Corrosion - Repair and paint

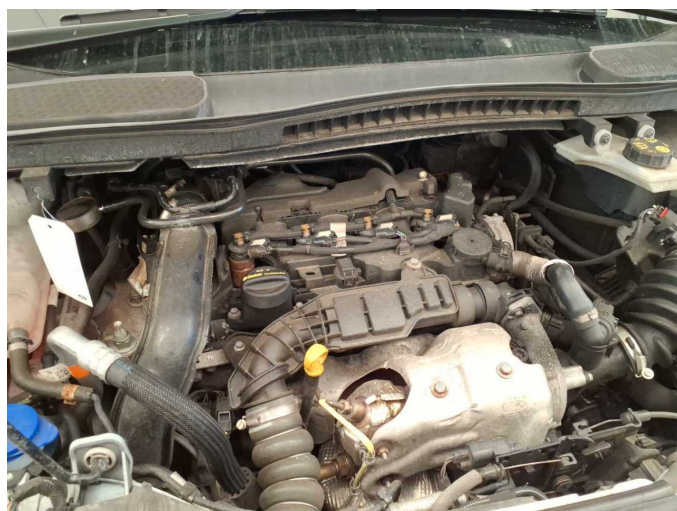

Missing part 1: Engine: Engine cover - Missing - Replace



Accident 1: Rear, Side - left

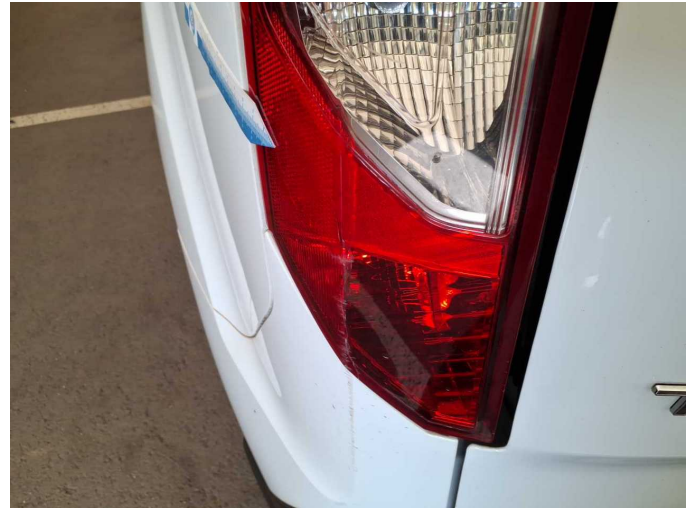


Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left

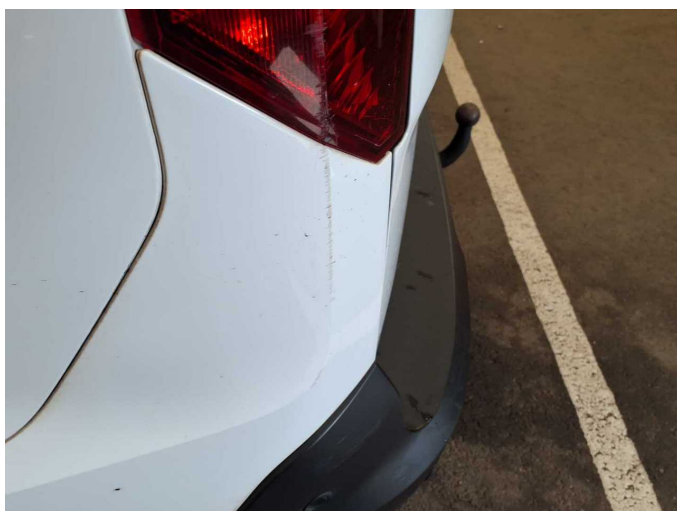

Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 1: Rear, Side - left



Accident 2: Side right



Accident 2: Side right



Accident 2: Side right



Accident 2: Side right



Accident 2: Side right



Accident 2: Side right



Accident 2: Side right



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0SXXWPGSLT29035

Hersteller / Modell: FORD FORD Transit Connect 230 L2 S&S Autm. Trend

Datum	KM-Stand	Beschreibung
20.05.2026	179.929	Bremse Sonstiges; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.09.2025	157.025	Ladeluftschlauch ern; Systemtest/Eigendiagnose
28.08.2025	154.863	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
23.06.2025	146.720	Reparatur Sonstiges; Systemtest/Eigendiagnose
17.03.2025	137.060	AU; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Systemtest/Eigendiagnose
08.01.2025	130.487	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.05.2024	113.540	Getriebeöl ern/prüfen; Reparatur Sonstiges; Systemtest/Eigendiagnose
19.03.2024	109.930	Bremse Sonstiges; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
21.08.2023	89.236	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Kraftstofffilter ern; Ladeluftschlauch ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
08.03.2023	70.566	AU
14.11.2022	57.742	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.05.2022	38.127	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.11.2021	19.373	Kleine Inspektion; Motoröl b. Wartung; Ölfilter ern; Wartung Sonstiges