



Expertise

Protocol number: 46430485
Order No. / Reference: 26684565
Inspection date: 9 Jul 2026

Manufacturer: Peugeot

Model: 3008 GT Plug-In Hybrid 225 e-EAT8

VIN: VF3M4DGZUPS096100



Vehicle details	
Manufacturer / Type / Model / Equipment	
Peugeot 3008 GT Plug-In Hybrid 225 e-EAT8	
Vehicle Identification number	VF3M4DGZUPS096100
Mileage (Read)	99,068 km
First registration	28 Aug 2023
Number of holders	1
Next periodical technical inspection	08/2026
(Report not on hand)	
Power / Engine displacement	133 kw / 1,598 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Perla Nera Schwarz Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Dark grey
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	24,800 km
Last service on / at	01/2026 at 94,477 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ765610
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	3003 / BBT 00034		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,290 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	225/55 R18 102V	Summer tyres on Light alloy	Michelin	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102H	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/55 R18 102H	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 11/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment: Illuminated glove compartment
- Active Safety Brake Plus (for nighttime use and for cyclists)
- Acoustic pedestrian warning system (AVAS)
- Adaptive Cruise Control (ACC) with Stop & Go function including Lane Positioning Assistant (and Active Safety Brake Plus (for night driving and cyclists), including front parking aid and blind spot assist)
- Exterior mirrors in Perla Nera Black
- Hill start assist
- On-board computer (outside temperature and maintenance display - average and current fuel consumption - remaining range - distance traveled - average speed)
- Black Diamond roof (roof in Perla Nera black) (exterior mirror caps in Perla Nera black - rear spoiler in glossy black)
- Decorative trim on the dashboard and door panels in satin chrome
- Pressure tank system including switch for opening the tank flap
- Rear parking aid, acoustic and visual
- ESP (Electronic Stability Program) with ASR (Anti-Slip Regulation)
- High beam assist
- electric parking brake
- Front collision warning
- Full LED headlights with automatic headlight range control (with static cornering lights and (Foggy Mode) function)
- Front and rear floor mats (with copper decorative stitching)
- Cruise control system with speed limiter
- Cup holder in the center console
- Heated rear window
- rear window wiper
- Rear spoiler, glossy black
- Interior mirror automatically dimming
- Frameless interior mirror
- Map pockets on the front seatbacks
- Keyless system (keyless access and start system)
- Manual child lock
- Automatic climate control (2-zone), with activated carbon filter (separately adjustable for driver and front passenger)
- Rear headrests (3) (height adjustable and lowerable)
- Blue LED ambient lighting on the door panel
- White LED lighting in the front footwell
- LED daytime running lights and LED turn signals at the front
- light sensor
- Makeup mirror (illuminated for driver and front passenger)
- Front center armrest, two-piece, with storage compartment, illuminated and climate-controlled
- rear fog lights
- Emergency brake assist with automatic activation of the hazard warning lights
- Particle filter: OPF (Otto particulate filter)
- Aluminum pedals and stainless steel door sills
- ABS (Anti-lock Braking System)
- Airbags (6) (Driver and front passenger airbag - front passenger airbag deactivatable - front and rear side airbags - front and rear curtain airbags)
- Electrically folding exterior mirrors (with LED approach lighting)
- Electrically adjustable and heated exterior mirrors with integrated LED turn signals
- Turn signals with lane change indicator function
- third brake light
- Chrome trim strips on the lower part of the doors
- Chrome trim strips above the side windows
- Chrome trim strips below the side windows
- Black headliner
- Aluminum roof rails
- Alcantara "Grevat" decorative inserts for door panels and dashboard
- Digital instrument cluster with high-resolution 12.3" screen, adjustable and customizable
- EBV (Electronic Brakeforce Distribution)
- Front parking aid, acoustic and visual
- Driving mode selector (Electric, Hybrid, Sport)
- Electric windows, front and rear (with comfort operation and anti-pinch protection)
- Follow-me-home function (automatic)
- Front bumper painted in grey
- Functions Brake and e-Save (for energy recovery when releasing the accelerator pedal and for preserving purely electric range (10 km, 20 km or the full charging capacity))
- Transmission: 8-speed automatic transmission EAT8
- Seat belts: 3-point seat belts (Front seats: - Height-adjustable three-point seat belts with belt locking devices - Pyrostatic belt tensioners and electronically controlled belt force limiters - Isofix on the front passenger seat - Safety-optimized headrests - Warning light and signal when the seat belt is not fastened or is released for the driver and front passenger) Rear seats: - 3 three-point seat belts - Belt force limiters on the side seats - Isofix on the outer seats - Warning light and signal when the seat belt is released)
- Front headrests (2) (height adjustable)
- Charging cable: Mode 2 charging cable (Type 2, up to 2.3 kW), 6 meters long
- LED ceiling light front and rear (2 reading lights front and rear)
- Steering wheel: Small multifunction leather steering wheel, flattened at the top and bottom.
- Rear center armrest with pass-through flap
- Fatigue warning system with fatigue detection



- Peugeot Connect Box (with the free telematics services Peugeot Connect SOS and Peugeot Connect Assistance - GPS module - Integrated European SIM card - Speaker and microphone - Emergency battery)
- Radio accessories: Digital radio reception DAB+
- Radio accessories: Mirror Screen (transmission of multimedia content and apps from a compatible smartphone to the vehicle's touchscreen, allowing direct control of compatible functions and apps - Android Auto and Mirror Link (for compatible smartphone models with Android operating system) - CarPlay (for compatible iPhone models from Apple))
- Reversing camera with 180° surround view
- paddle shifters on the steering wheel
- Keyless start system
- Electric power steering
- Seats: Passenger seat foldable
- Seats: Manual lumbar support for driver's seat (2-way)
- Lane keeping assist with steering intervention
- 12 Volt power outlet (3) (in the trunk, rows 1 and 2)
- Power outlet: Dual USB port (Type A) in row 2
- Blind spot assist
- Lashing eyes in the trunk (2 pieces)
- Preconditioning function
- Immobiliser
- Central locking can be activated from inside using a remote control.
- Navigation system: 3D navigation system NAC (3D navigation including 3D display of buildings and monuments - voice recognition for navigation, telephone and media - real-time navigation by TomTom Services - operation via touchscreen with 10" HD color screen - map transfer to the digital instrument cluster - multifunctional touchscreen with 10" color screen - capacitive screen - piano key toggle switches)
- Upholstery: Fabric/faux leather
- Radio: Audio system (Bi-tuner - 6 speakers - MP3-compatible - Bluetooth hands-free system with audio streaming via Bluetooth - USB port - operation via steering wheel and touchscreen)
- Rain sensor
- Tire pressure monitoring system
- Wheels: 18" "Detroit" alloy wheels, two-tone with black (with 225/55 R 18 tires)
- Wheels: Tire repair kit (compressor + tire sealant spray)
- Rear seat backrest split 40/60 and automatically foldable, control element in the boot
- Side and rear windows are more heavily tinted.
- Seats: Passenger seat height adjustable
- Seats: Driver's seat height adjustable
- Sport mode (to activate the following functions: - Display of driving dynamics parameters on the instrument cluster - More responsive accelerator pedal response - More responsive power steering - Increased engine noise)
- Traffic sign recognition (with display of the speed recommendation in the instrument cluster (additional recognition of stop signs, one-way street signs and the beginning and end of no-overtaking zones))

Extra equipment

- Seats: Ergonomic comfort seats with AGR seal of approval (electrically adjustable driver's seat with memory function - heated front seats - massage function for driver and front passenger seats - extendable thigh support on driver and front passenger sides - electric lumbar support on driver and front passenger sides - electric seat tilt adjustment on the front passenger side - exterior mirrors with projection of the PEUGEOT lion onto the ground)
- Set of molded rubber mats front + rear
- 3008 Base carriers
- Detachable towbar (with removable ball head without tools)
- On-board charger 7.4 kW, 1-phase
- Panoramic tilt/slide sunroof with electric blind (blue LED lighting - exterior mirrors with projection of the PEUGEOT lion onto the ground)
- tailgate sensor-controlled

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.



Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (1. und 2. Wartung überzogen)
2	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
3	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
4	Boot lid / rear door	Rear spoiler - Scratch(es) - Smart repair
5	Door - front left side	Door edge - Scratch(es) - Smart repair
6	Door - rear left side	Door - Scratch(es) - Paint
7	Bonnet	Bonnet - Scratch(es) - Paint
8	Seat - front	Seat cover - left side - Broken / torn - Replace
9	Vehicle glazing	Windscreen - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
2	Door - rear right side	Door - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

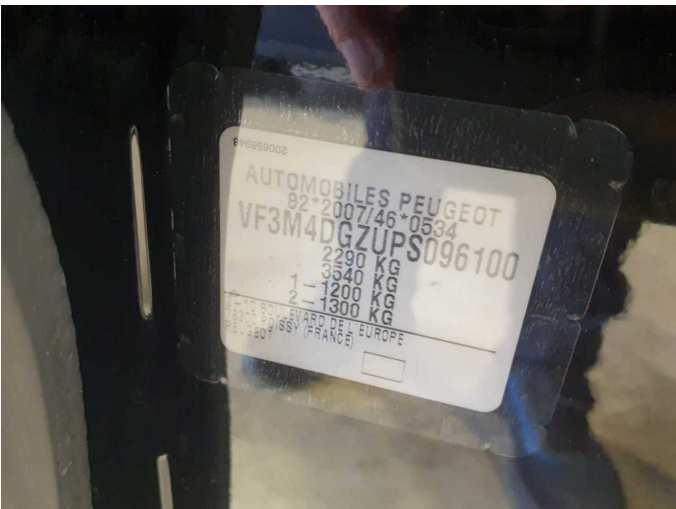


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

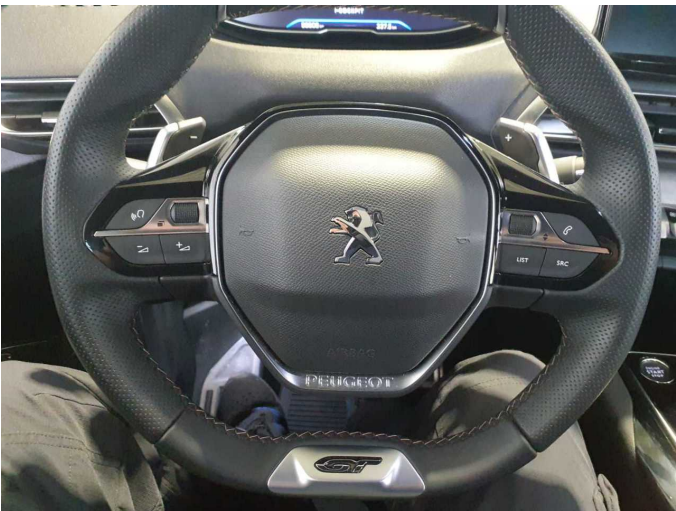


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

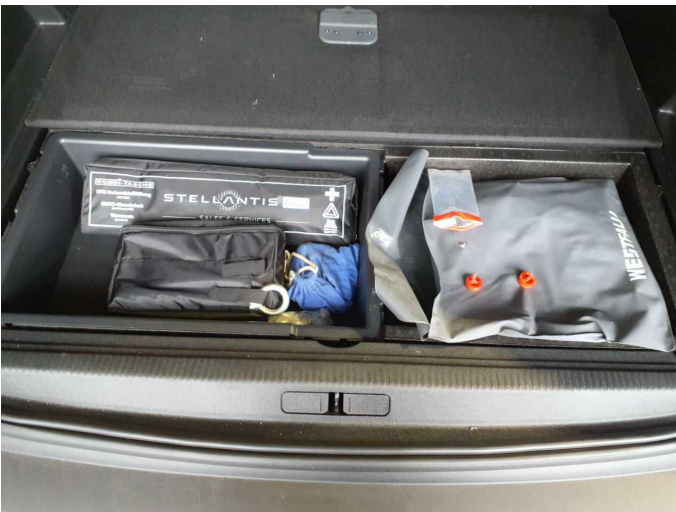



Figure 29: Misc.




Figure 30: Misc.



Figure 31: Misc.

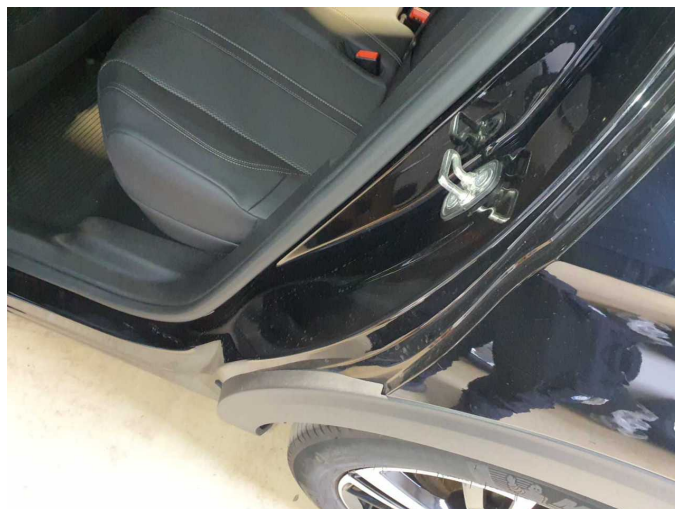

Damage 2: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

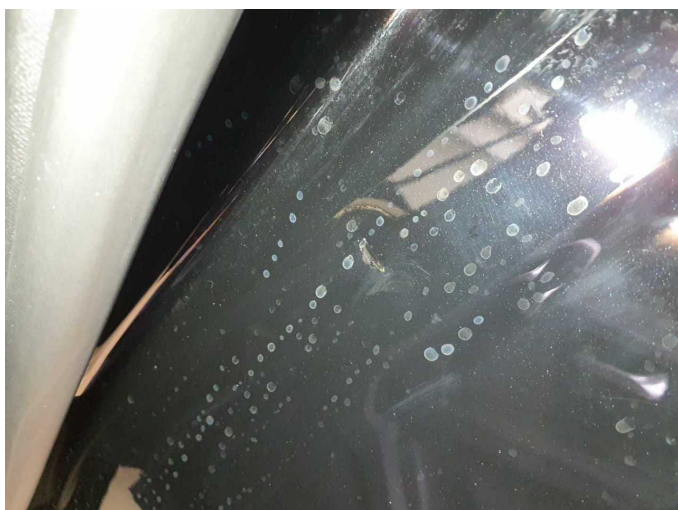

Damage 2: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair




Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 4: Boot lid / rear door: Rear spoiler - Scratch(es) - Smart repair



Damage 4: Boot lid / rear door: Rear spoiler - Scratch(es) - Smart repair

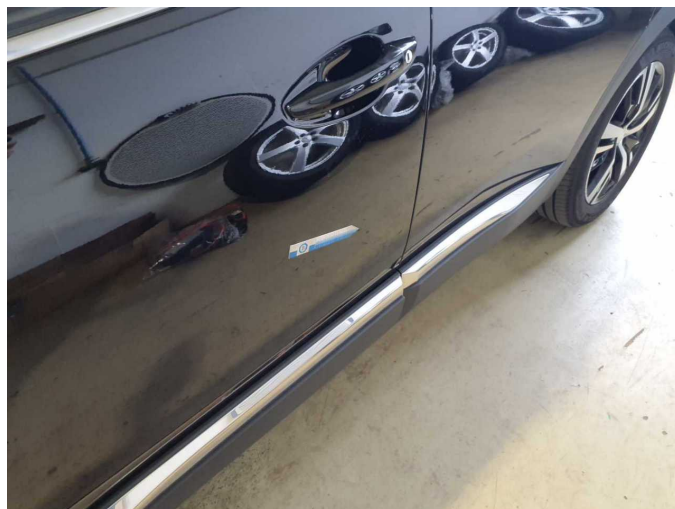


Damage 5: Door - front left side: Door edge - Scratch(es) - Smart repair




Damage 5: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 6: Door - rear left side: Door - Scratch(es) - Paint

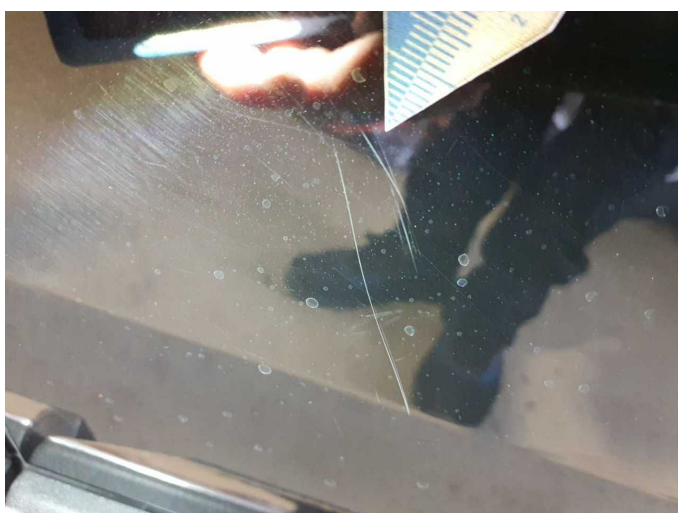

Damage 6: Door - rear left side: Door - Scratch(es) - Paint

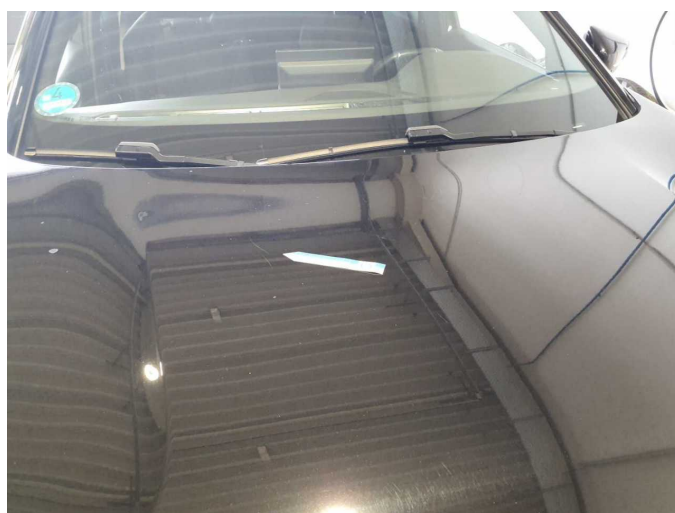


Damage 7: Bonnet: Bonnet - Scratch(es) - Paint




Damage 7: Bonnet: Bonnet - Scratch(es) - Paint



Damage 7: Bonnet: Bonnet - Scratch(es) - Paint

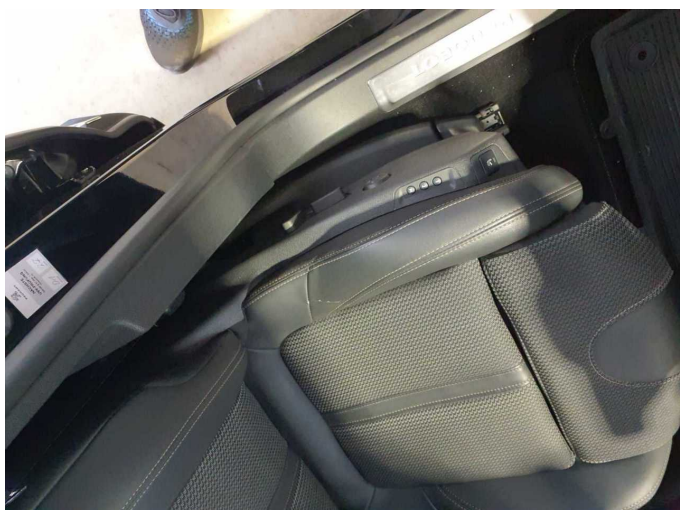


Damage 8: Seat - front: Seat cover - left side - Broken / torn - Replace

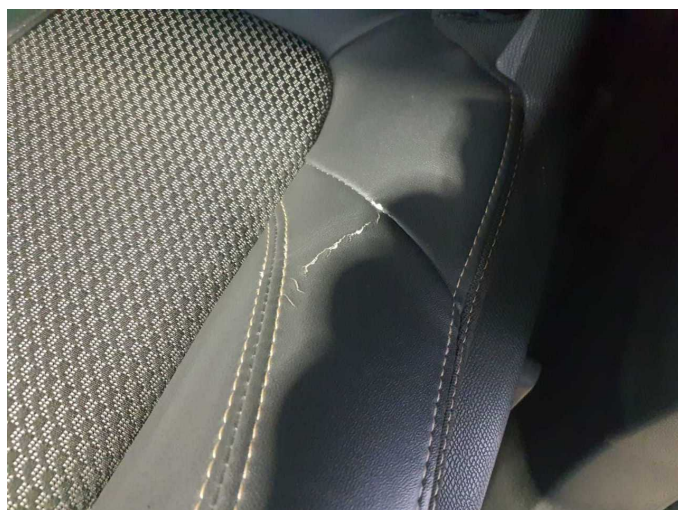

Damage 8: Seat - front: Seat cover - left side - Broken / torn - Replace



Damage 9: Vehicle glazing: Windscreen - Broken / torn - Replace

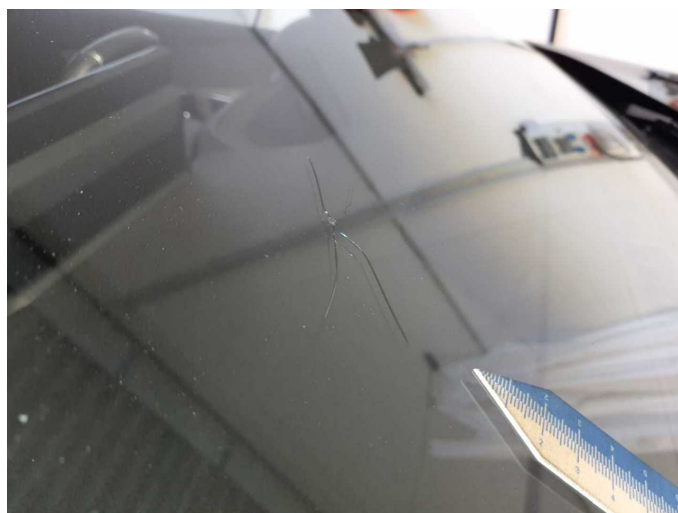

Damage 9: Vehicle glazing: Windscreen - Broken / torn - Replace