



Peugeot 508: P430PH

Vinnumber:	VR3F4DGZTNY538075	Versionname:	508 1.6 PHEV 165kW GT Pack Business SW E-EAT8
First Registrationdate:	12/05/2022	Fiscalpower:	
Expertise Mileage:	134611	Power Kw:	132
Bodytype:		Body colour	Gris Platinum
Gearbox:	Automatic	Paint type	Metalic
Transmission:		Type of rims (mounted)	Aluminium
Fueltype:	Hybrid Petrol	Parking lot	497
Number of seats	5		
Type of rims (mounted)	Aluminium		
Maintenance needed	No		

Options

Number of keys total	2	Lining semi-leather
GPS		Lining Alcantara
Autom climate control		Sun Roof electric
Radio multimedia		Panoramic roof
		Rear parking sensors
		Rear view camera

Tyres

Location	Position	Measures	Depth	Make	Type
Front	Left	235 / 45 / 18 / 98 / W / Aluminium	5,3 mm	Michelin	Summer
	Right	235 / 45 / 18 / 98 / W / Aluminium	4,8 mm	Michelin	Summer
Rear	Left	235 / 45 / 18 / 94 / W / Aluminium	5,1 mm	Pirelli	Summer
	Right	235 / 45 / 18 / 94 / W / Aluminium	5,2 mm	Pirelli	Summer

Assistance equipment

Number of charging cables (rapid charge)	1
Rear-view camera, Not functioning (well), Replace	



Seat cover FL, Worn, Replace



Interior, Stain, Cleaning





Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Wing FL, Dent(s) and scratch(es), Repair and paint (complete)



Outside rear-view mirror housing L, Scratch(es), Replace and paint



Door RL, Dent(s) and scratch(es), Repair and paint (complete)



Wing RL, Rust, Repair and paint (complete)



Bonnet, Stone chip(s), Repair and paint (complete)






Bumper grille FL, Broken, Replace



Bumper F, Scratch(es), Repair and paint (complete)



Door FR, Dent(s) and scratch(es), Repair and paint (complete)

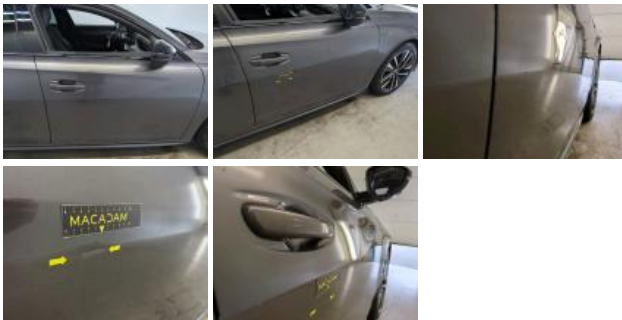

Door RR, Dent(s), Repair and paint (complete)



Wing RR, Scratch(es), Polish



Bumper R, Scratch(es), Repair and paint (complete)



Roof, Scratch(es), Repair and paint (complete)



Kenteken	P430PH
Merk Model	Peugeot 508 1.6 PHEV 165kW GT Pack Business SW E-EAT8
Brandstofsoort	Benzine
Datum deel1	12-05-22

Datum reparatie	Kilometerstand	Reparatie omschrijving
08-05-26	126.810	APK
08-05-26	126.810	Onderhoudsbeurt
08-05-26	126.810	Ruitenwisserblad(en) voorzijde
17-11-25	114.629	Bougie
17-11-25	114.629	Koelvloeistof High Voltage accu
17-11-25	114.629	Luchtfilter
17-11-25	114.629	Onderhoudsbeurt
09-05-25	100.342	Onderhoudsbeurt
24-11-23	55.448	Bougie
24-11-23	55.448	Luchtfilter
24-11-23	55.448	Onderhoudsbeurt
24-11-23	55.448	Vervanging band
17-02-23	27.757	Onderhoudsbeurt