



Expertise

Protocol number: 46478844
Order No. / Reference: 26512765
Inspection date: 13 Jul 2026

Manufacturer: Ford	Model: Galaxy 2.0 EcoBlue S&S Aut. TITANIUM
VIN: WF0KXXWPCKLR09779	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Galaxy 2.0 EcoBlue S&S Aut. TITANIUM	
Vehicle Identification number	WF0KXXWPCKLR09779
Mileage (Read)	199,148 km
First registration	16 Mar 2020
Number of holders	1
Power / Engine displacement	110 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Chroma-Blau Metallic
Doors / Seats	5 / 7
Upholstery type	Cloth
Colour of upholstery	Anthracite-Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	20,000 km
Last service on / at	02/2026 at 189,324 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FS975394
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BKM 00911		
Emission standard	EURO6;WLTP;DG;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,605 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103V	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	235/55 R17 103V	Winter tyres on Light alloy	Pirelli	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R17 103Y	Summer tyres on Light alloy	Pirelli	3mm / 3mm
2)	235/55 R17 103Y	Summer tyres on Light alloy	Pirelli	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Ambient lighting at the front • Exterior mirrors, electrically adjustable, heated and foldable • Tires: Tire repair kit • third brake light • Diesel particulate filter (DPF) • Tachometer • Driver information system display 25.4 cm color • Lane keeping assist including lane keeping assist and driver fatigue warning • Ford Power start function with Ford Key Free system • Luggage compartment lighting • Transmission: 8-speed automatic transmission • Back window, heater • Interior lighting with delay circuit • Isofix bracket • Air conditioning with automatic temperature control, CFC-free • Steering wheel: Paddle shifters on the steering wheel • Front center console with padded armrests • Ford navigation system including Ford SYNC 3 with AppLink, touchscreen, DAB/DAB+ and FordPass Connect • Package: Winter • Upholstery: Cloth • Tire Pressure Monitoring System (TPMS) • Headlight assistant with day/night sensor • Electromechanical power steering • Seats: 2nd row of seats with 3 individual seats (FoldFlat System) • Seats: Driver and passenger seats, 4-way manually adjustable • Start-stop system • Power outlet: 230-volt connection (150 watts) • LED daytime running lights • Electronic immobilizer • Central locking with remote control | <ul style="list-style-type: none"> • Anti-lock braking system (ABS) with electronic brake force distribution (EBD) • Tires: 7.5 J x 17 alloy wheels (4) with 235/55 R 17 tires • Hill start assist • Roof rails "aluminum look" • Dual exhaust system • Electronic Safety and Stability Program (ESP) including Traction Control (ASR) • Electric windows front and rear • Electronic parking brake • Removable luggage compartment cover • Cruise control system with intelligent speed limiter • Illuminated glove compartment • rear window wiper • Intelligent security system • Electric child safety lock • Steering wheel: Steering column, adjustable in height and reach • Reading lights front and rear • MyKey key system (individually programmable second key) • Fog light • Emergency brake light • Front and rear parking pilot system • Rain sensor • Headlight dipped beam with switch-off delay including "greeting function" • Safety Brake Assist (EBA) • Seats: 3rd row of seats with 2 individual seats (FoldFlatSystem) • Seats: Front sports seats • Seats: Trays on the front seat backrests • 12-volt power outlets front and rear • Front bumper painted in body color • Velour carpet floor mats • thermal insulation glazing • Cigarette lighter |
|---|--|

Extra equipment

- Paint finish: Metallic

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Engine	Toothed belt - No evidence - No deduction
2	Misc.	Main inspection - No evidence - No deduction
3	Seat - front	Seat cover - left side - Soiled - Clean
4	Indicator - front	Mirror - left side - Scratched - Replace
5	Door - front right side	Door - Scratched - Smart repair
6	Door - rear left side	Door - dent(s) - Smooth repair work
7	Seat - rear	Back seat (Hin) - Soiled - Clean
8	Door - rear right side	Door - Scratched - Smart repair
9	Mudguard - right side	Mudguard - right side - Scratched - Smart repair
10	Trim / covers	Brightware / decorative strip (Windschutzscheibe) - Damaged - Replace
11	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
12	Tail light	Tail lamp - left side - Scratched - Loss in value
13	Trim / covers	C-pillar - trim - interior, left side - Scratched - Replace
14	Door - front left side	Door - Scratched - Smart repair
15	Engine	Engine cover - Damaged - Replace
16	Seat belts - passenger compartment	Seat belt - 3rd row, right side - Damaged - Replace
17	Roof	Roof - Corrosion - Smart repair
18	Bonnet	Radiator grille - Damaged - Replace
19	Trim / covers	Roof lining - Scratched - Loss in value
20	Rear bumper	Rear bumper - Scratched - Paint
21	Front bumper	Front bumper - Broken / torn - Replace

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Door - rear left side	Door - Scratched - No deduction
3	Mudguard - left side	Mudguard - left side - Scratched - Cover / polish
4	Bonnet	Bonnet - Stone chips - No deduction
5	Side panel - rear right side	Wheel arch - dent(s) - Smooth repair work
6	Side panel - rear right side	Wheel arch - Scratched - Smart repair
7	Trim / covers	Floor mats - Damaged - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Professionally repaired, Invoice of repair done	Non-existent



Repainting

No. Repainting

- 1 Mudguard - right side
- 2 Side panel - rear right side
- 3 Door - rear right side
- 4 Door - front right side

Paint coat thickness measurement

Mudguard - right side	170 µm	Side panel - rear right side	163 µm
Door - rear right side	187 µm	Door - front right side	159 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

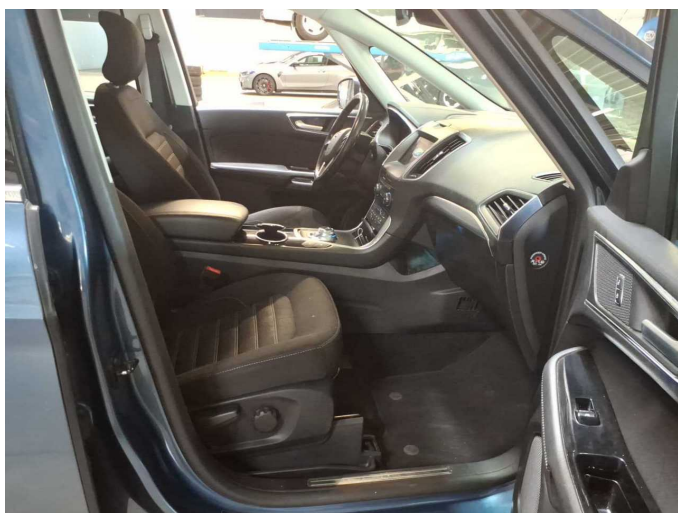


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

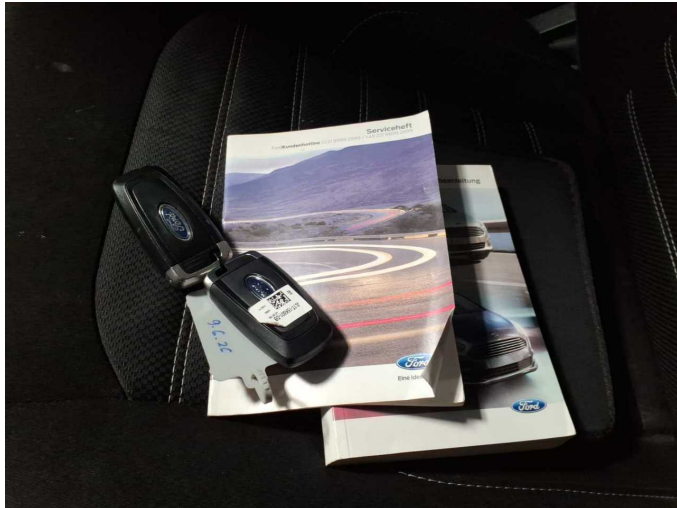


Figure 13: Documents



Figure 14: Additional tyres

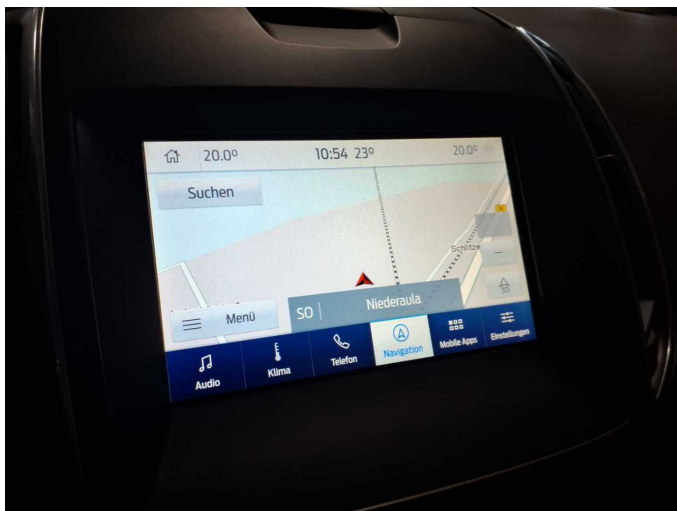


Figure 15: Navigation



Figure 16: Misc.

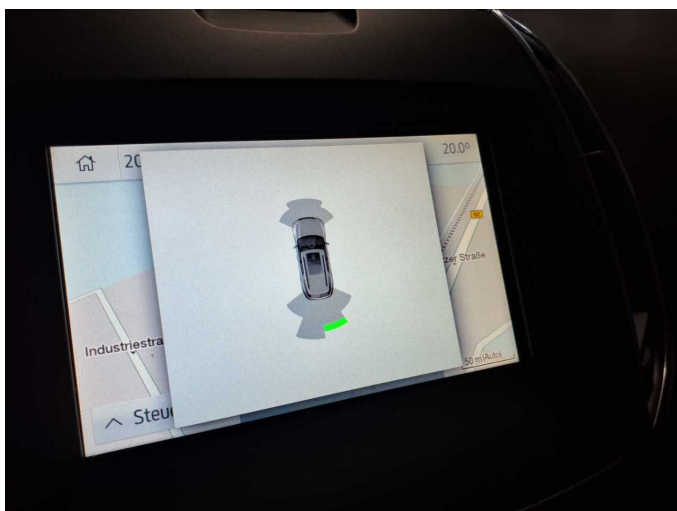


Figure 17: Misc.

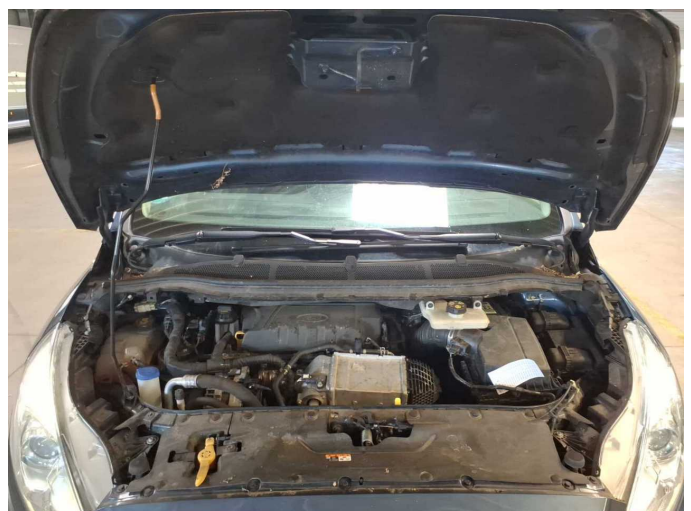


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

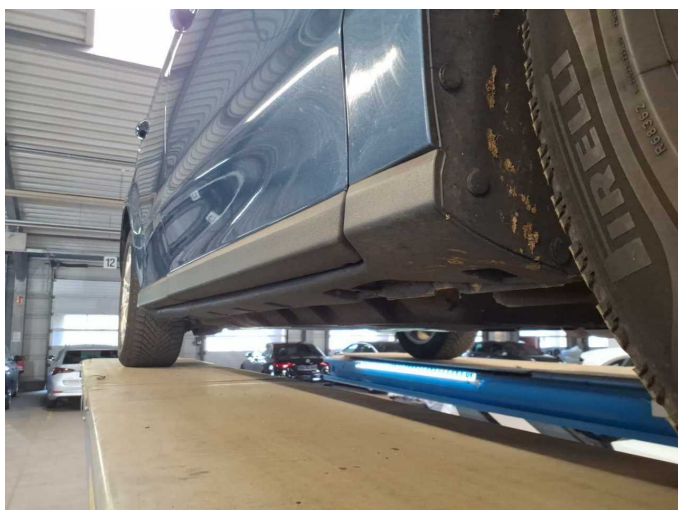



Figure 21: Misc.



Figure 22: Misc.




Figure 23: Misc.

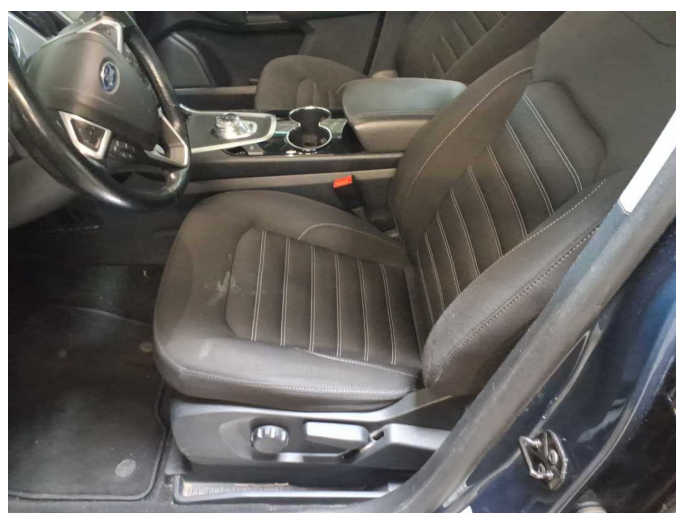

Damage 3: Seat - front: Seat cover - left side - Soiled - Clean



Damage 3: Seat - front: Seat cover - left side - Soiled - Clean

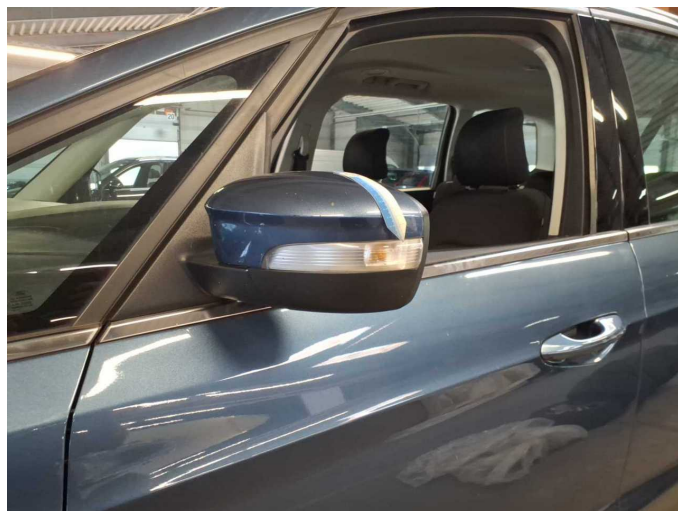


Damage 4: Indicator - front: Mirror - left side - Scratched - Replace




Damage 4: Indicator - front: Mirror - left side - Scratched - Replace




Damage 5: Door - front right side: Door - Scratched - Smart repair

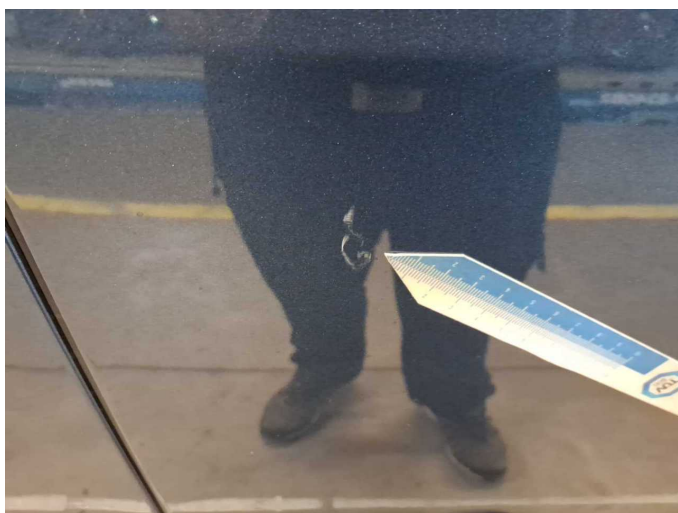


Damage 5: Door - front right side: Door - Scratched - Smart repair

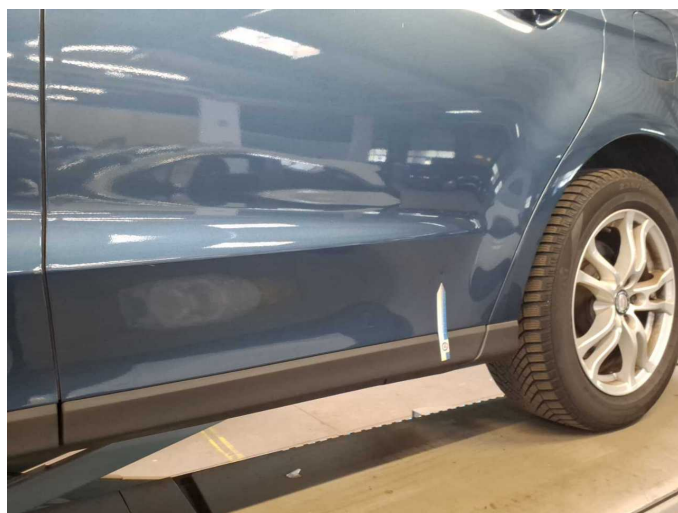

Damage 6: Door - rear left side: Door - dent(s) - Smooth repair work

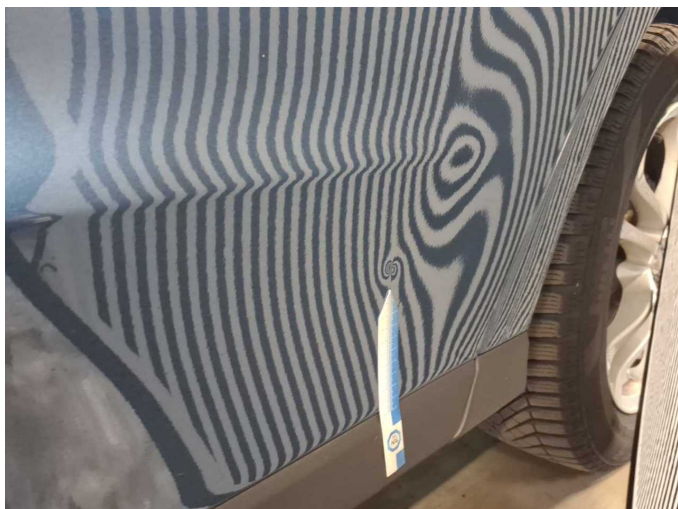


Damage 6: Door - rear left side: Door - dent(s) - Smooth repair work

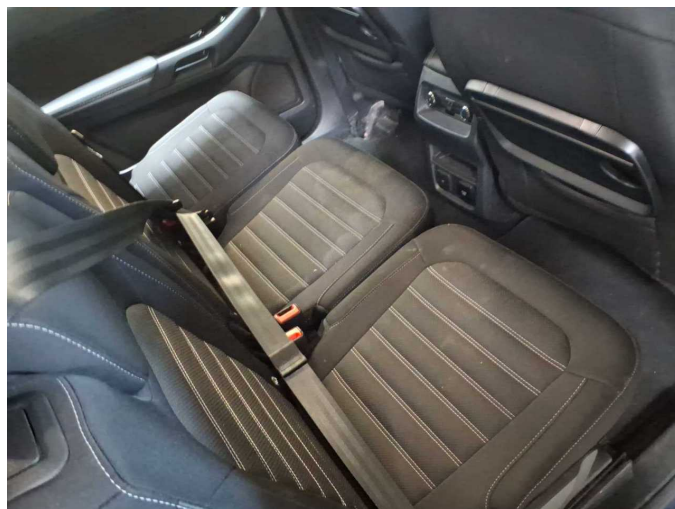

Damage 7: Seat - rear: Back seat (Hin) - Soiled - Clean



Damage 8: Door - rear right side: Door - Scratched - Smart repair

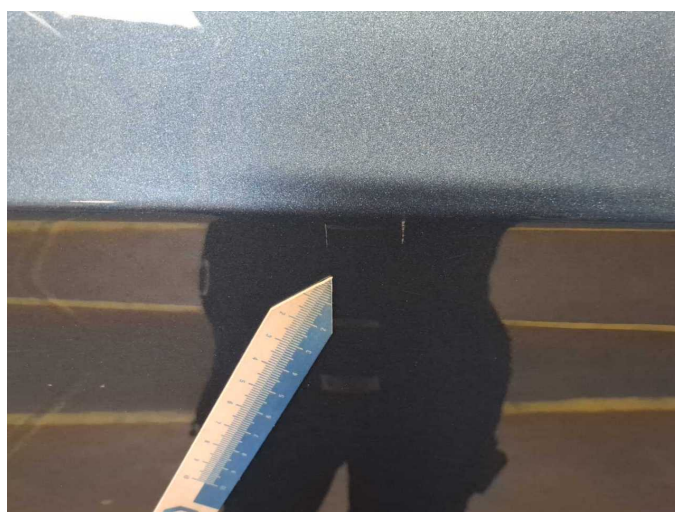

Damage 8: Door - rear right side: Door - Scratched - Smart repair




Damage 8: Door - rear right side: Door - Scratched - Smart repair



Damage 8: Door - rear right side: Door - Scratched - Smart repair




Damage 8: Door - rear right side: Door - Scratched - Smart repair

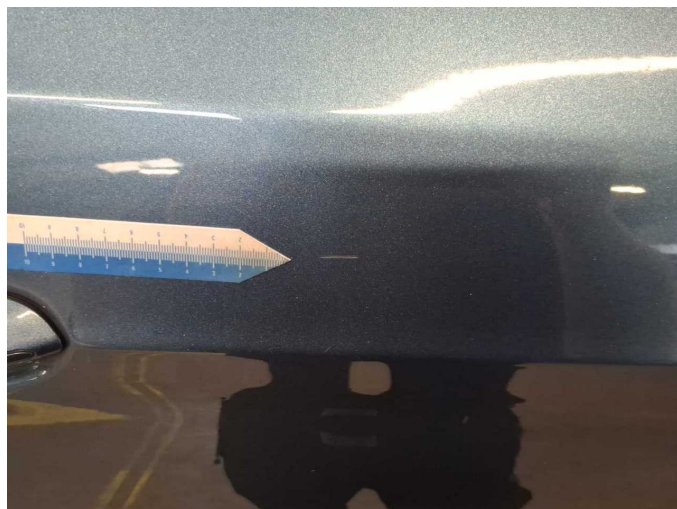

Damage 8: Door - rear right side: Door - Scratched - Smart repair




Damage 9: Mudguard - right side: Mudguard - right side - Scratched - Smart repair

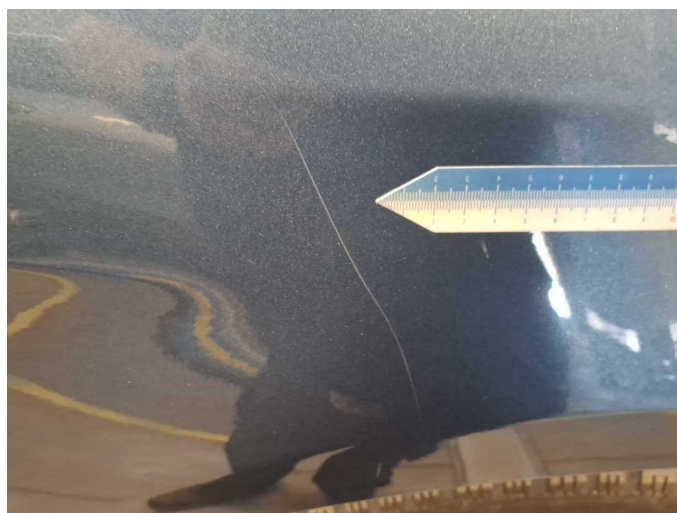


Damage 9: Mudguard - right side: Mudguard - right side - Scratched - Smart repair



Damage 10: Trim / covers: Brightware / decorative strip (Windschutzscheibe) - Damaged - Replace

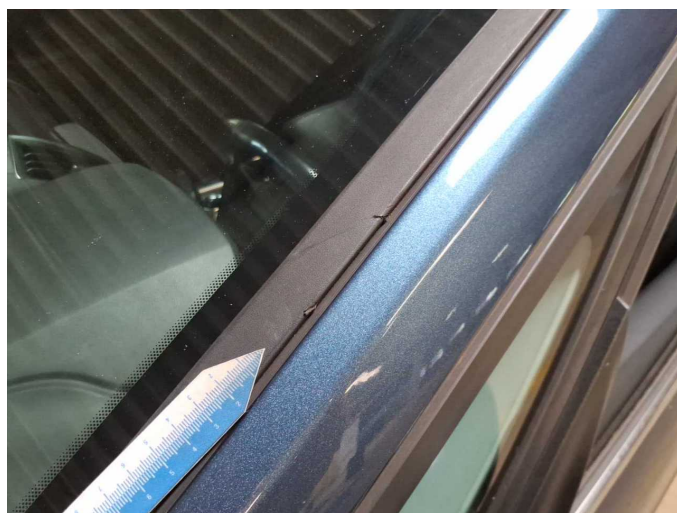

Damage 10: Trim / covers: Brightware / decorative strip (Windschutzscheibe) - Damaged - Replace

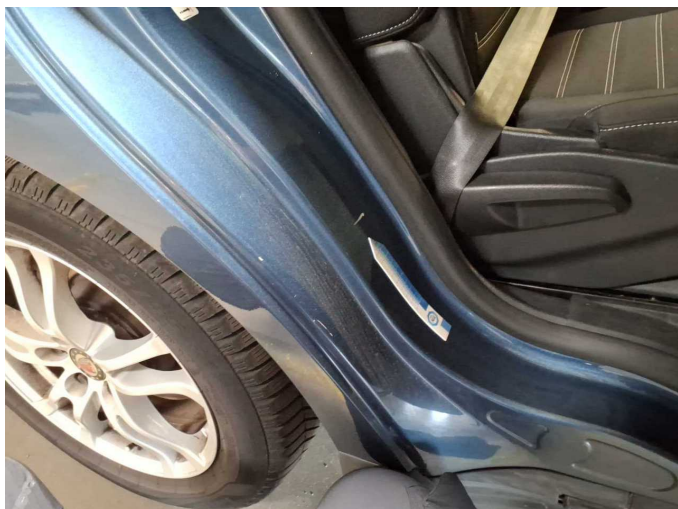

Damage 11: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair




Damage 11: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair




Damage 11: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 11: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

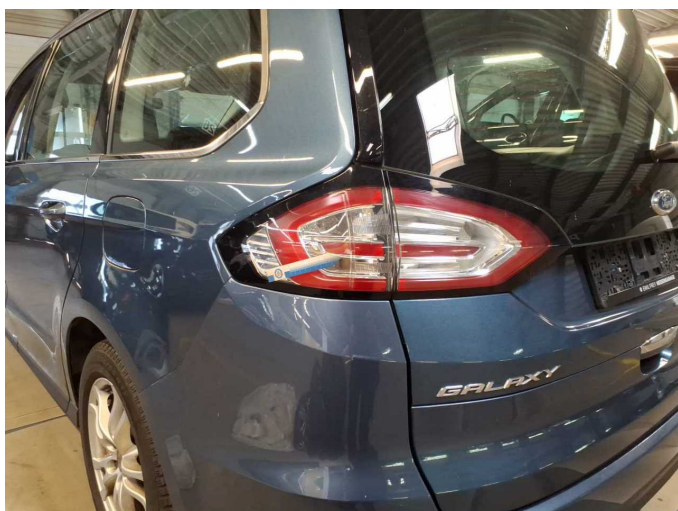


Damage 12: Tail light: Tail lamp - left side - Scratched - Loss in value

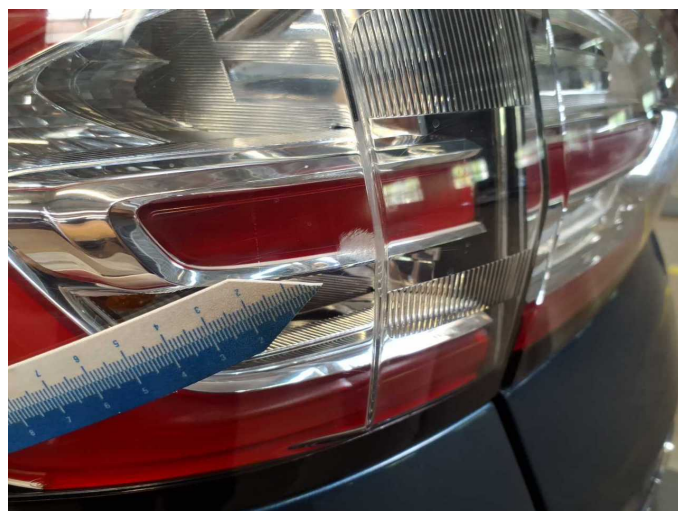

Damage 12: Tail light: Tail lamp - left side - Scratched - Loss in value



Damage 12: Tail light: Tail lamp - left side - Scratched - Loss in value

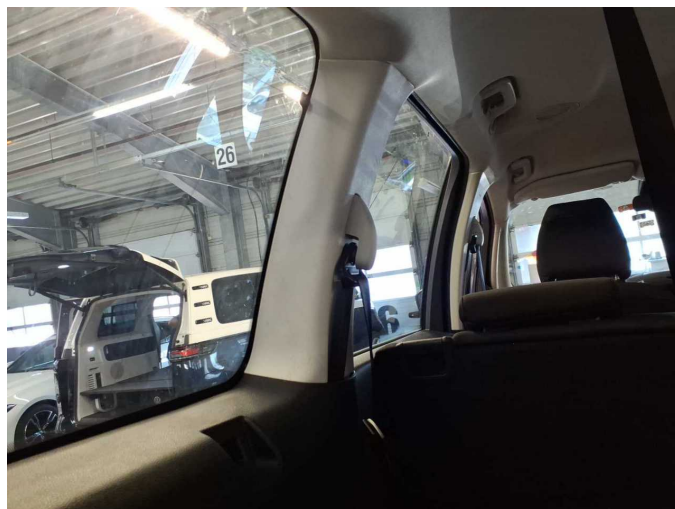

Damage 13: Trim / covers: C-pillar - trim - interior, left side - Scratched - Replace




Damage 13: Trim / covers: C-pillar - trim - interior, left side - Scratched - Replace



Damage 14: Door - front left side: Door - Scratched - Smart repair



Damage 14: Door - front left side: Door - Scratched - Smart repair

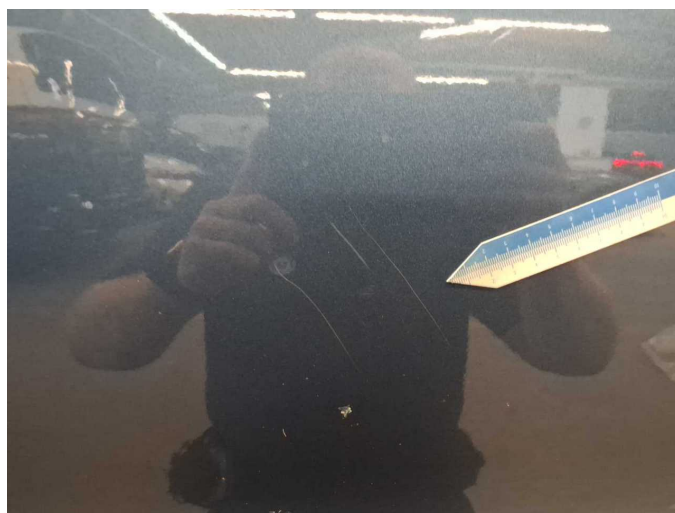

Damage 14: Door - front left side: Door - Scratched - Smart repair



Damage 14: Door - front left side: Door - Scratched - Smart repair




Damage 14: Door - front left side: Door - Scratched - Smart repair



Damage 15: Engine: Engine cover - Damaged - Replace



Damage 15: Engine: Engine cover - Damaged - Replace

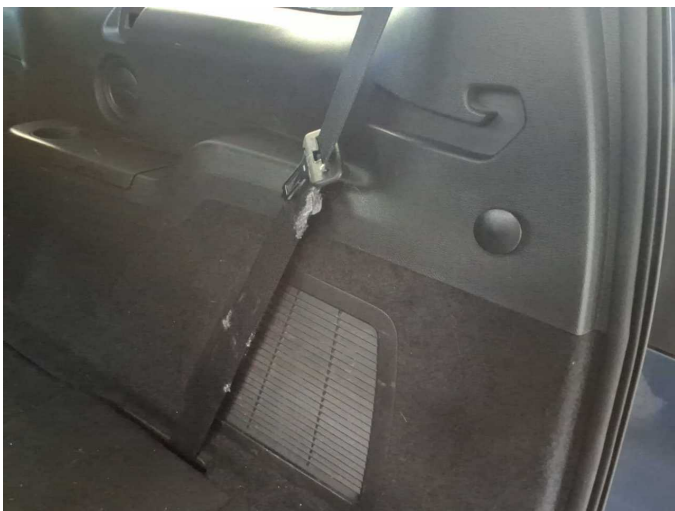

Damage 16: Seat belts - passenger compartment: Seat belt - 3rd row, right side - Damaged - Replace



Damage 16: Seat belts - passenger compartment: Seat belt - 3rd row, right side - Damaged - Replace



Damage 17: Roof: Roof - Corrosion - Smart repair



Damage 17: Roof: Roof - Corrosion - Smart repair



Damage 18: Bonnet: Radiator grille - Damaged - Replace



Damage 18: Bonnet: Radiator grille - Damaged - Replace



Damage 19: Trim / covers: Roof lining - Scratched - Loss in value



Damage 19: Trim / covers: Roof lining - Scratched - Loss in value



Damage 19: Trim / covers: Roof lining - Scratched - Loss in value



Damage 19: Trim / covers: Roof lining - Scratched - Loss in value



Damage 20: Rear bumper: Rear bumper - Scratched - Paint




Damage 20: Rear bumper: Rear bumper - Scratched - Paint



Damage 20: Rear bumper: Rear bumper - Scratched - Paint




Damage 20: Rear bumper: Rear bumper - Scratched - Paint

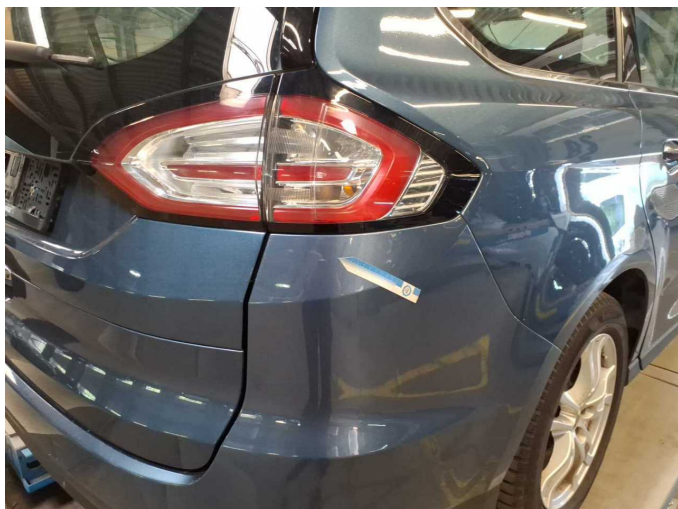

Damage 20: Rear bumper: Rear bumper - Scratched - Paint



Damage 20: Rear bumper: Rear bumper - Scratched - Paint

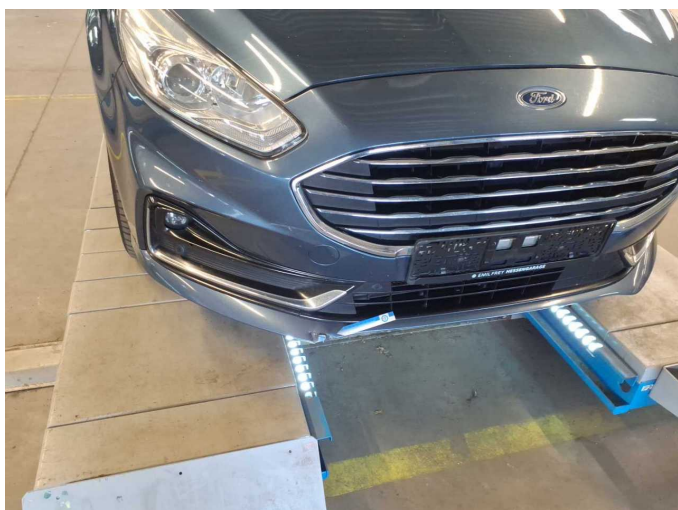


Damage 21: Front bumper: Front bumper - Broken / torn - Replace




Damage 21: Front bumper: Front bumper - Broken / torn - Replace




Damage 21: Front bumper: Front bumper - Broken / torn - Replace

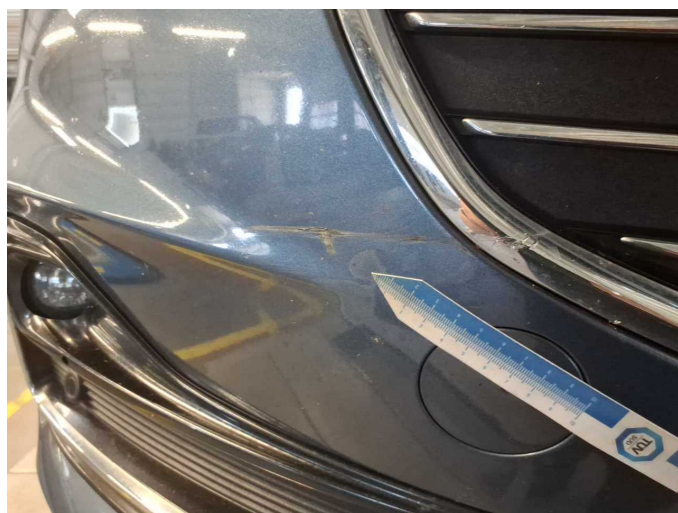


Damage 21: Front bumper: Front bumper - Broken / torn - Replace

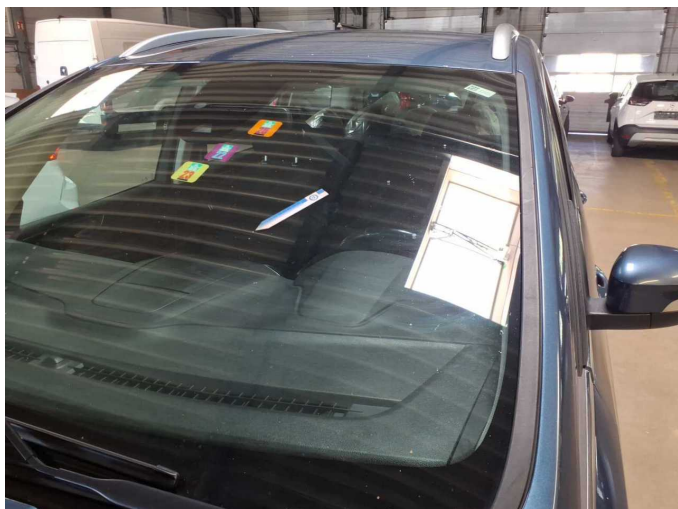

Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction

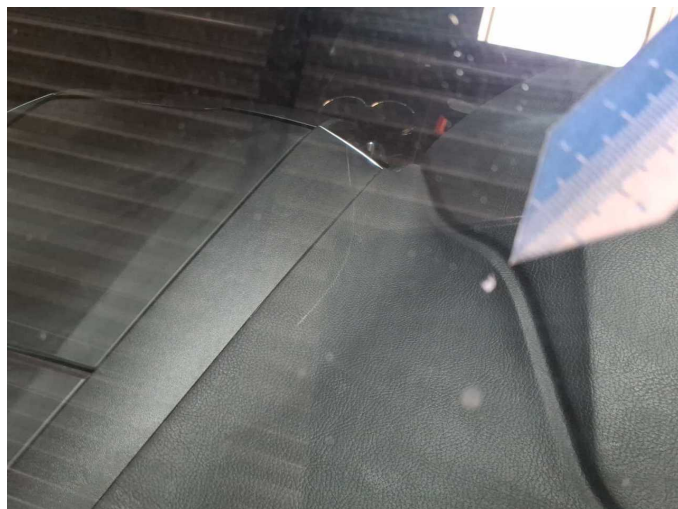

Wear and tear 1: Vehicle glazing: Windscreen - Stone chips - No deduction

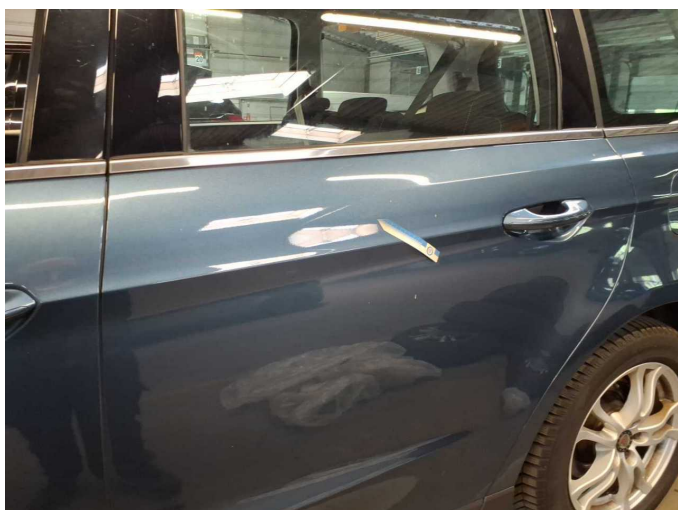

Wear and tear 2: Door - rear left side: Door - Scratched - No deduction



Wear and tear 2: Door - rear left side: Door - Scratched - No deduction




Wear and tear 3: Mudguard - left side: Mudguard - left side - Scratched - Cover / polish




Wear and tear 3: Mudguard - left side: Mudguard - left side - Scratched - Cover / polish



Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction

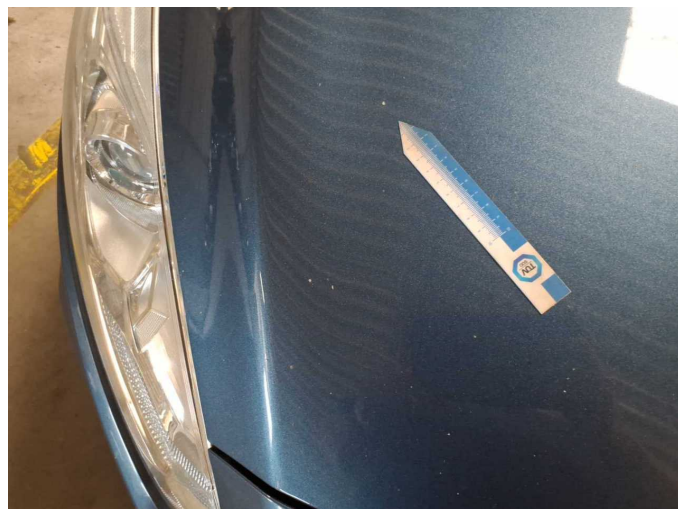

Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction

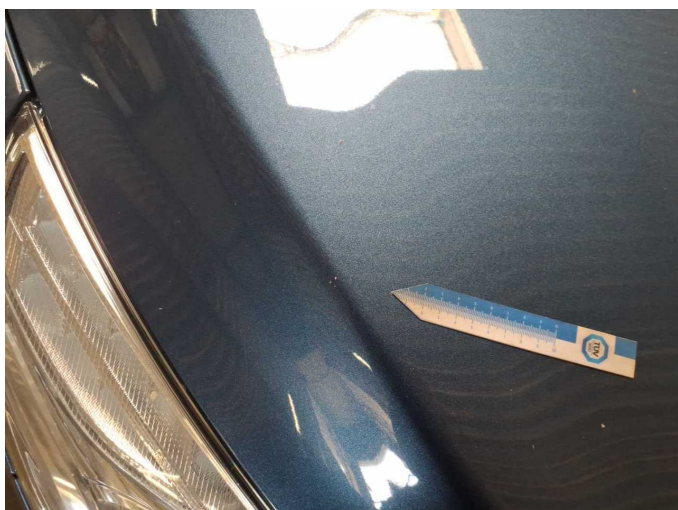


Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 4: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 5: Side panel - rear right side: Wheel arch - dent(s) - Smooth repair work

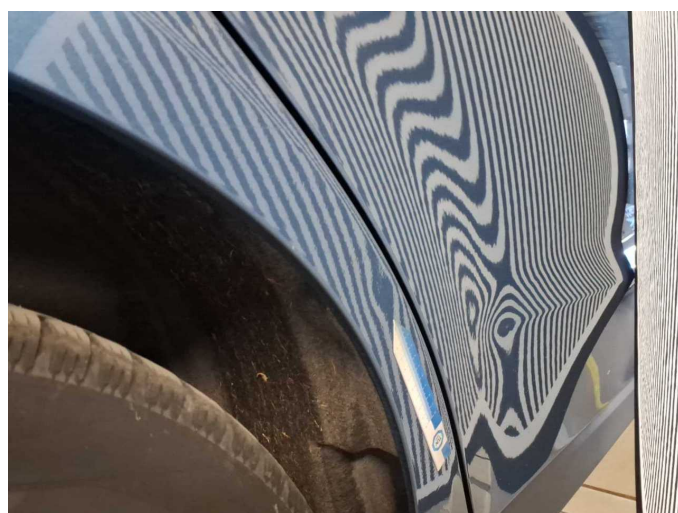

Wear and tear 5: Side panel - rear right side: Wheel arch - dent(s) - Smooth repair work




Wear and tear 6: Side panel - rear right side: Wheel arch - Scratched - Smart repair



Wear and tear 6: Side panel - rear right side: Wheel arch - Scratched - Smart repair



Wear and tear 7: Trim / covers: Floor mats - Damaged - No deduction

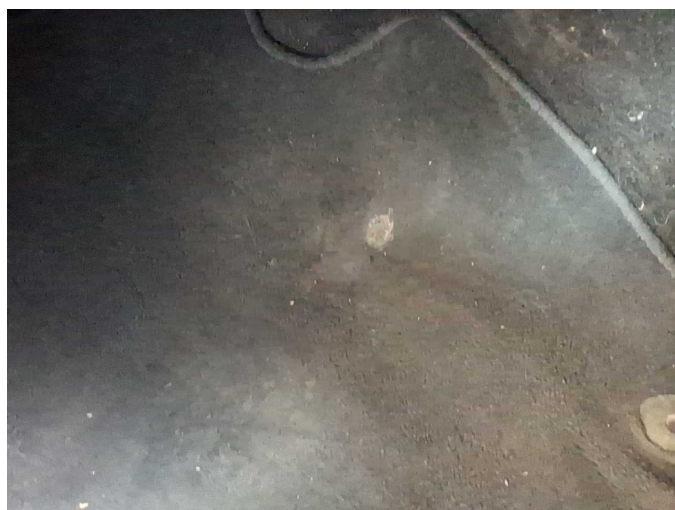

Wear and tear 7: Trim / covers: Floor mats - Damaged - No deduction



Repainting 1: Mudguard - right side



Repainting 2: Side panel - rear right side



Repainting 3: Door - rear right side



Repainting 4: Door - front right side



Side panel - rear right side: 163 µm



Door - rear right side: 187 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0KXXWPCKLR09779
Hersteller / Modell: FORD FORD Galaxy 2.0 EcoBlue S&S Aut. TITANIUM

Datum	KM-Stand	Beschreibung
11.02.2026	189.324	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.09.2025	172.409	Systemtest/Eigendiagnose
26.08.2025	169.601	AU; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
25.02.2025	150.782	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
14.11.2024	141.446	Getriebeöl ern/prüfen; Reparatur Sonstiges; Systemtest/Eigendiagnose
02.10.2024	136.379	Batterie ern; Systemtest/Eigendiagnose
22.05.2024	127.644	Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
13.07.2023	92.624	AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
25.01.2023	73.030	Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
21.09.2021	32.551	Kleine Inspektion; Motoröl b. Wartung; Ölfilter ern; Wartung Sonstiges