



Expertise

Protocol number: 46680656
Order No. / Reference: 26788107
Inspection date: 23 Jul 2026

Manufacturer: Volkswagen

Model: Tiguan Allspace 2.0 TDI SCR DSG Life

VIN: WVGZZZ5NZNM146292



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Tiguan Allspace 2.0 TDI SCR DSG Life	
Vehicle Identification number	WVGZZZ5NZNM146292
Mileage (Read)	92,582 km
First registration	21 Sept 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Deep Black Perleffekt (C9X)
Doors / Seats	5 / 7
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	16,400 km
Last service on / at	03/2026 at 80,099 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM637769
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BZG 22457		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,270 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R18 100V	Summer tires (with run-flat tires) on Light alloy	Pirelli	5mm / 5mm
2)	235/55 R18 100W	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 99H	Winter tires (with run-flat tires) on Light alloy	Pirelli	3mm / 3mm
2)	215/65 R17 99V	Winter tyres on Light alloy	Yokohama	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments in the overhead console
- Airbag, head airbag system including front side airbags (for front and rear passengers)
- Adaptive Cruise Control (ACC) "stop & go" with speed limiter
- Hill descent control
- Chrome applications on mirror adjustment switches, window regulator switches, door pull handles (interior door operation in matte chrome)
- Diesel particulate filter
- Display: Digital Cockpit Pro, multicolor, various selectable info profiles
- Electronic parking brake including Auto Hold function (Volkswagen's Auto Hold function is an extension of the electronic parking brake. The Auto Hold function prevents the vehicle from rolling away unintentionally when stationary or starting off, without the driver having to constantly apply the brakes. In this way, Auto Hold offers maximum driving comfort. - If the ABS wheel speed sensors detect rolling, the braking torque is automatically increased until the vehicle comes to a complete stop.)
- Pedestrian detection
- Luggage compartment floor height adjustable in 2 stages
- Transmission: 7-speed DSG
- Rear window heated
- Rear window wiper with intermittent function
- ISOFIX mounting points, also for i-Size child seats (device for attaching 2 child seats to the rear seats)
- Rear headrests (3)
- Front headrests (safety-optimized - adjustable lengthwise and height)
- Reading lights: 2 front and 2 rear
- Light in the front footwell
- front center armrest
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Cloth
- Proactive occupant protection system in conjunction with "Front Assist"
- Radio accessories: Digital radio reception DAB+
- Tire pressure monitoring system
- Wheels: Tire Mobility Set omitted
- Wheels: Light alloy (4) "Frankfurt" 7 J x 18 (tires 235/55 R 18)
- Electromechanical power steering (speed-dependent control)
- Seats: Front passenger seat backrest folds down completely
- Seats: Comfort seats in the front (passenger seat backrest folds down completely - drawers under the front seats)
- Lane keeping assistant "Lane Assist"
- 12-volt power outlet (on the rear center console and in the luggage compartment)
- Telephone interface
- Airbag for driver and front passenger including knee airbag on the driver's side (passenger airbag deactivation - knee airbag on driver's side)
- Electrically adjustable and heated exterior mirrors
- Exterior mirror housings painted silver
- third brake light
- Chrome trim on the side windows
- Silver anodized roof rails
- Decorative inserts "Horizont Black" (for instrument panel and front door panels)
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Electronic stability program with counter-steering support (including ABS, ASR, EDS, MSR and trailer stabilization)
- Automatic headlight control, with daytime running lights ("Leaving home" function and manual "Coming home" function)
- Electric windows front and rear
- High beam control Light Assist
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment lighting (additional, removable and usable as a flashlight)
- Tailgate with electric opening and closing, adjustable opening angle
- Interior mirror automatically dimming
- LED license plate lighting
- Air conditioning "Air Care Climatronic" (3-zone temperature control - allergen filter - rear controls)
- LED headlights
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- Illuminated makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist" (detects critical distance situations and helps to shorten the stopping distance - warns the driver visually and audibly in dangerous situations as well as with a preventive brake jolt)
- Radio
- Radio accessories: 8 speakers
- Rain sensor
- Wheels: AirStop tires 235/55 R 18, optimized for low rolling resistance
- Gearshift knob in leather
- Drawers under the front seats
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner (3 three-point automatic seat belts at the rear including belt tensioner for the outer rear seats - warning tone and light for unfastened seat belts at the front and rear)
- Seats: Lumbar support in the front
- Seats: Front seats with height adjustment
- Start-stop system with brake energy recuperation



- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear

- Power outlet: 2 USB-C ports on the front
- Bumpers in body color (lower bumper parts black)
- Textile floor mats front and rear
- Prepared for later activation: Navigation function "Discover Media" incl. "Streaming & Internet"
- Central locking without safe locking, with remote control and 2 remote keys

Extra equipment

- Foldable towbar (electric release)
- Anti-theft alarm system with safe locking (anti-theft alarm system with interior monitoring, backup horn and tow-away protection, central locking with safe locking, remote control and 2 remote folding keys)
- Mesh partition
- Package: "Easy Open & Close" with safe locking mechanism ("Easy Open & Close" - tailgate with sensor-controlled opening and closing, with remote unlocking - keyless locking and starting system "Keyless Access" with safe locking mechanism)
- Package: Top Package (Adaptive chassis control DCC incl. driving profile selection - Panoramic tilt/slide sunroof with panoramic roof at the rear - Darkened rear side windows and rear window)
- Package: Winter additionally with heated outer rear seats (Air Care Climatronic air conditioning with active combination filter, rear controls and 3-zone temperature control - windshield washer nozzles automatically heated at the front - front seats and outer rear seats heated)
- Auxiliary heating and ventilation (with radio remote control and timer)
- 230 volt socket
- Electrically adjustable, folding and heated exterior mirrors (with passenger-side mirror lowering function)
- Wirelessly heated windshield (infrared-reflective)
- Paint finish: Pearl effect
- Navigation system "Discover Pro" incl. "Streaming & Internet" (8 speakers - App-Connect incl. App-Connect Wireless for Apple CarPlay and Android Auto - Digital radio reception DAB+ - Navigation system "Discover Pro" incl. "Streaming & Internet" - Radio - Voice control - Traffic sign recognition)
- Package: Business Premium (DSG) (2 USB-C ports in the front, 1 USB-C charging port on the rear center console - Head-up display - Leather multifunction steering wheel, heated, with shift paddles - Automatically heated windshield washer nozzles in the front - Voice control - "Comfort" telephone interface with inductive charging function - Heated front seats)
- Rear View reversing camera
- Seats: 2 individual seats in the 3rd row (2 seats in the 3rd row, including rear bench seat and backrest asymmetrically split and foldable, with center armrest - luggage compartment floor with storage compartment)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Screen cleaning	Cover washing container - Missing - Replace
2	Seat - rear	Lever seat adjustment - Broken / torn - Replace
3	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
4	Door - rear left side	Door - dent(s) - Smart repair
5	Door - rear right side	Door - dent(s) - Smart repair
6	Rear bumper	Rear bumper - Scratch(es) - Smart repair
7	Front bumper	Front bumper - Scratch(es) - Smart repair
8	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
9	Trim / covers	Door trim - rear left side - Broken / torn - Replace
10	Trim / covers	Door trim - rear right side - Broken / torn - Replace
11	Front bumper	Spoiler - Scratch(es) - Replace
12	Roof	Roof - Corrosion - Paint
13	Door - front right side	Door (Kratzer im spachtel) - Unprofessionally repaired - Paint
14	Mudguard - right side	Mudguard - right side (Wellig und einschüsse) - Unprofessionally repaired - Paint
15	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Mudguard - left side	Wheel well extension - Scratch(es) - No deduction
2	Wheel / tyres	Alloy rim - front right side - Scratch(es) - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Wheel / tyres	Tyre - right (Kein Airstop) - Differs from the original configuration - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Professionally repaired, Invoice of repair done Non-existent, from 21 Dec 2025	3.350,87 €

Repainting

No.	Repainting
1	Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
2	Mudguard - right side, Unprofessionally carried out, Invoice of repair done Non-existent
3	Door - front right side, Unprofessionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Mudguard - right side	173 µm	Door - rear right side	197 µm
Door - front right side	293 µm		



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Ausstattung.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

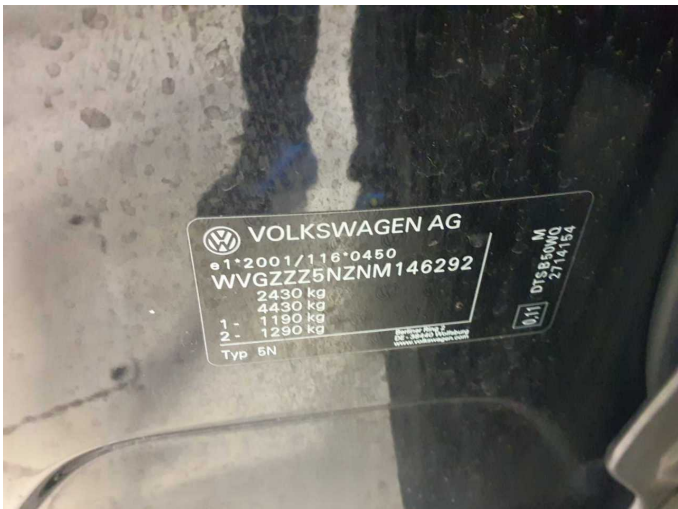


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

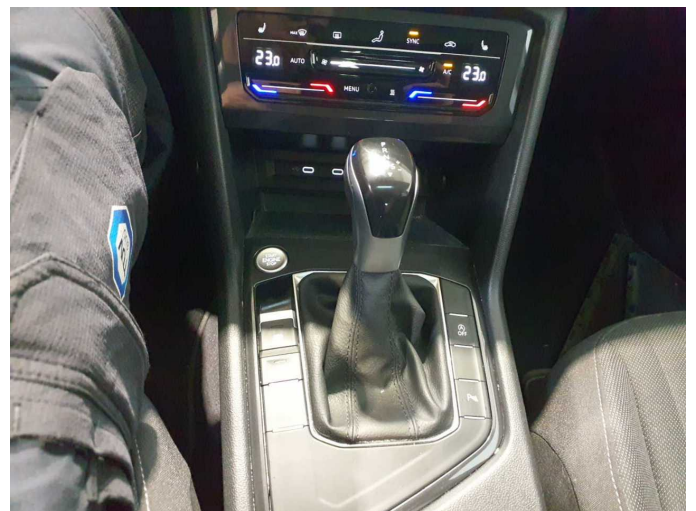


Figure 22: Misc.



Figure 23: Misc.

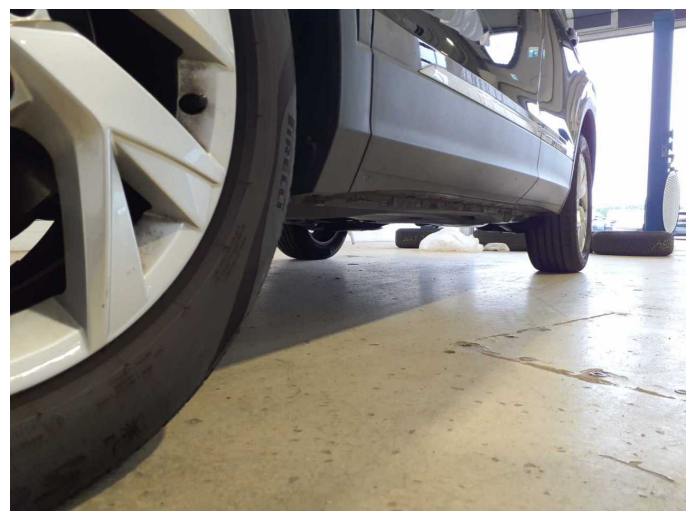


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.




Figure 32: Misc.




Figure 33: Misc.



Damage 1: Screen cleaning: Cover washing container - Missing - Replace

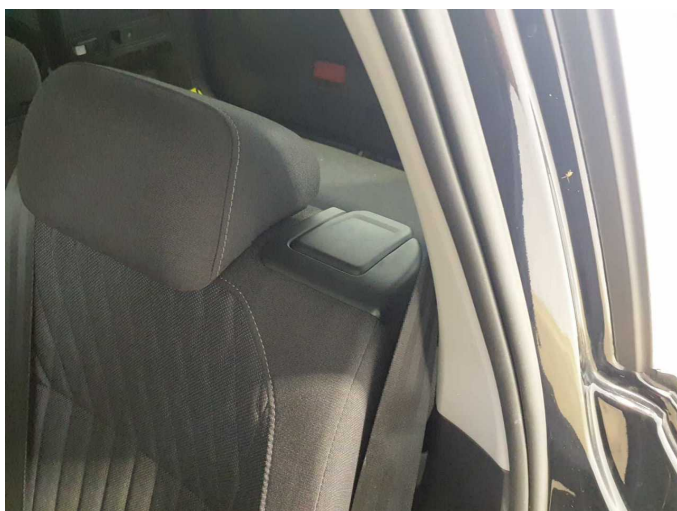


Damage 2: Seat - rear: Lever seat adjustment - Broken / torn - Replace

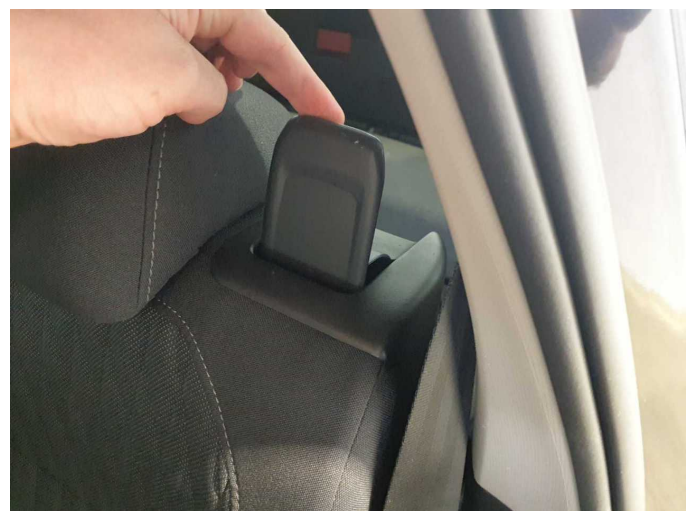


Damage 2: Seat - rear: Lever seat adjustment - Broken / torn - Replace




Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

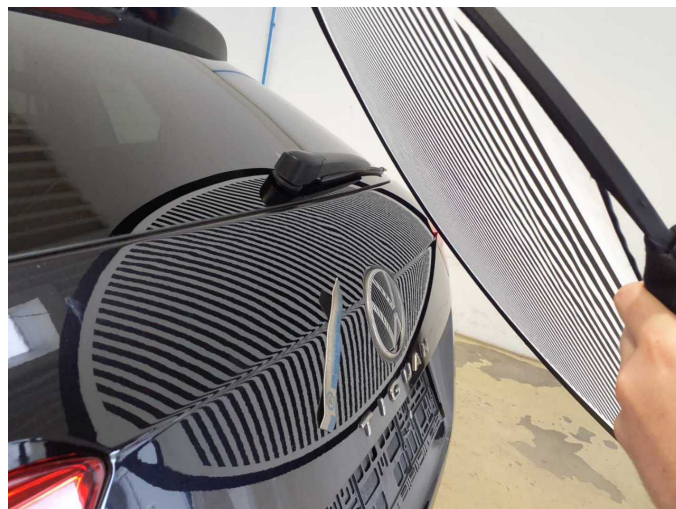


Damage 3: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

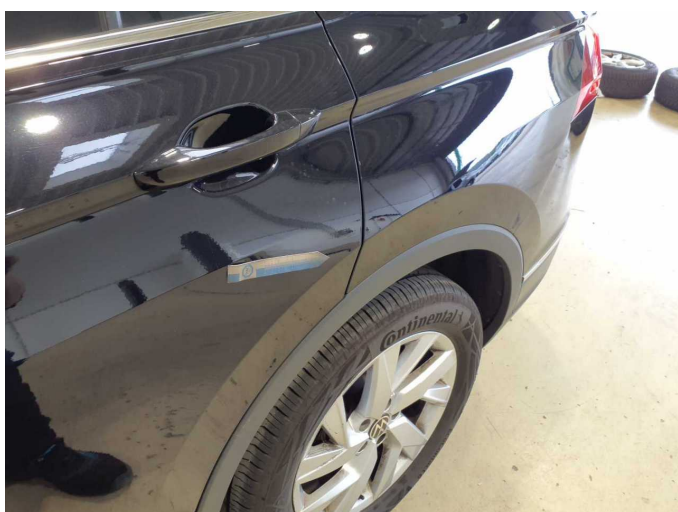

Damage 4: Door - rear left side: Door - dent(s) - Smart repair

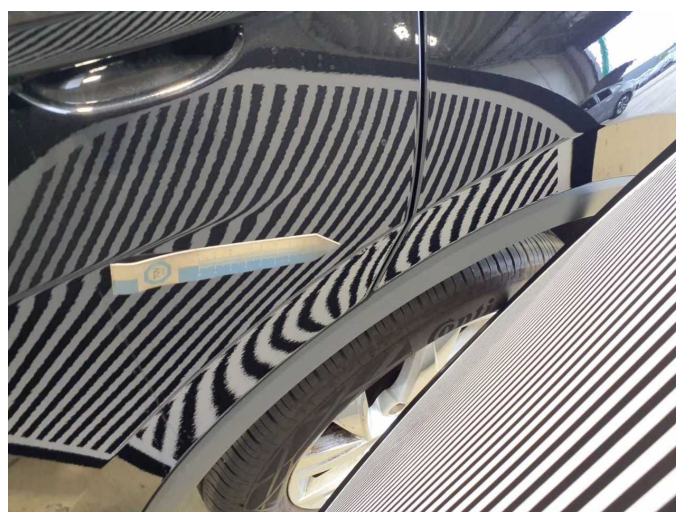


Damage 4: Door - rear left side: Door - dent(s) - Smart repair

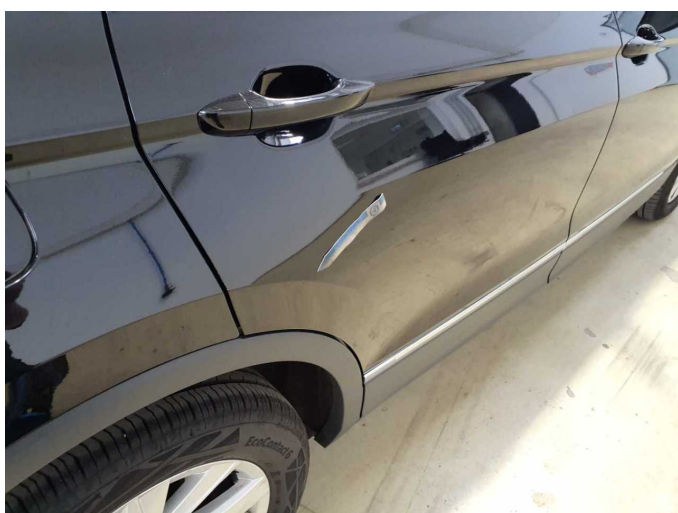

Damage 5: Door - rear right side: Door - dent(s) - Smart repair



Damage 5: Door - rear right side: Door - dent(s) - Smart repair

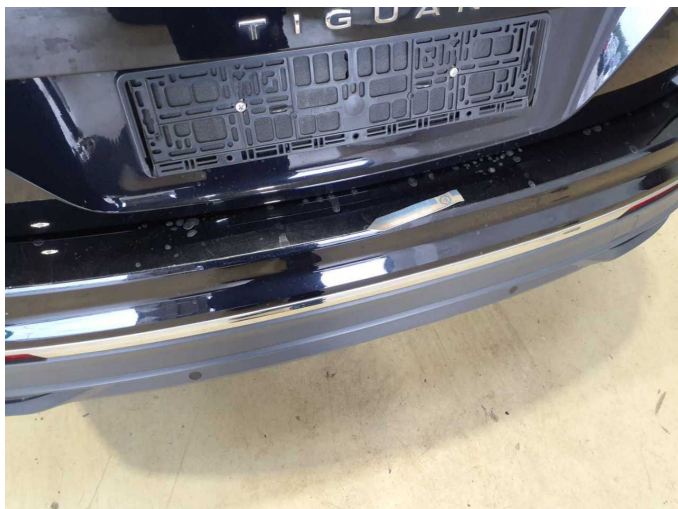

Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 7: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 7: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 8: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 9: Trim / covers: Door trim - rear left side - Broken / torn - Replace



Damage 9: Trim / covers: Door trim - rear left side - Broken / torn - Replace



Damage 9: Trim / covers: Door trim - rear left side - Broken / torn - Replace



Damage 10: Trim / covers: Door trim - rear right side - Broken / torn - Replace




Damage 10: Trim / covers: Door trim - rear right side - Broken / torn - Replace




Damage 10: Trim / covers: Door trim - rear right side - Broken / torn - Replace




Damage 10: Trim / covers: Door trim - rear right side - Broken / torn - Replace

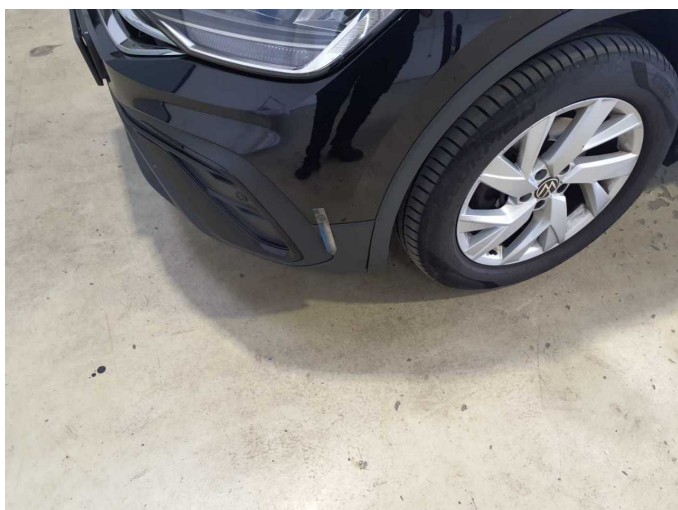

Damage 11: Front bumper: Spoiler - Scratch(es) - Replace

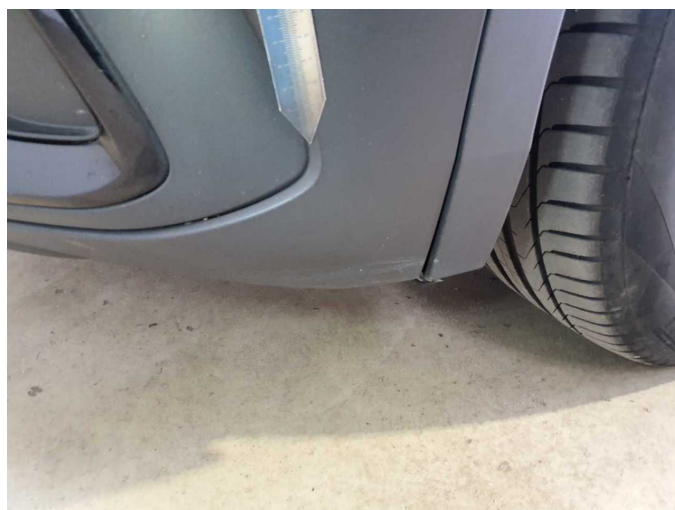


Damage 11: Front bumper: Spoiler - Scratch(es) - Replace

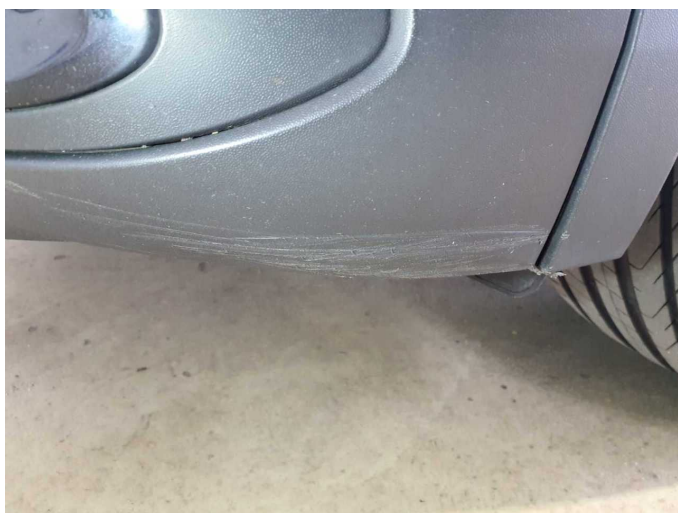

Damage 11: Front bumper: Spoiler - Scratch(es) - Replace



Damage 12: Roof: Roof - Corrosion - Paint

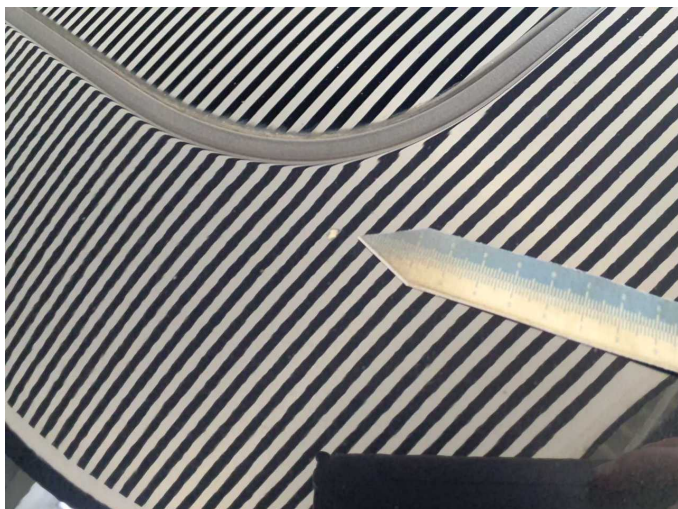

Damage 12: Roof: Roof - Corrosion - Paint




Damage 12: Roof: Roof - Corrosion - Paint



Damage 12: Roof: Roof - Corrosion - Paint




Damage 13: Door - front right side: Door (Kratzer im spachtel) - Unprofessionally repaired - Paint

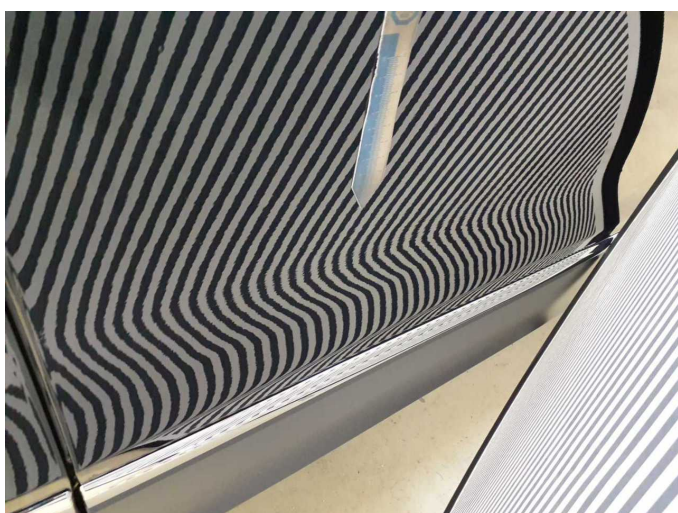

Damage 13: Door - front right side: Door (Kratzer im spachtel) - Unprofessionally repaired - Paint



Damage 13: Door - front right side: Door (Kratzer im spachtel) - Unprofessionally repaired - Paint

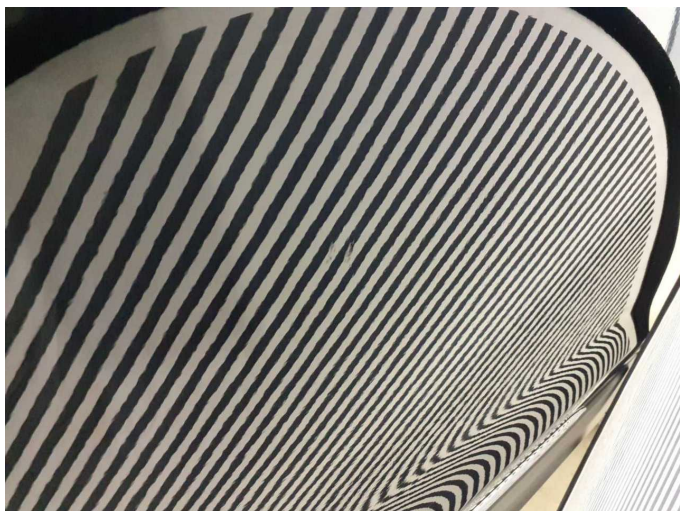

Damage 13: Door - front right side: Door (Kratzer im spachtel) - Unprofessionally repaired - Paint



Damage 14: Mudguard - right side: Mudguard - right side (Wellig und einschüsse) - Unprofessionally repaired - Paint




Damage 14: Mudguard - right side: Mudguard - right side (Wellig und einschüsse) - Unprofessionally repaired - Paint



Damage 14: Mudguard - right side: Mudguard - right side (Wellig und einschüsse) - Unprofessionally repaired - Paint




Damage 15: Vehicle glazing: Windscreen - Stone chips - Replace

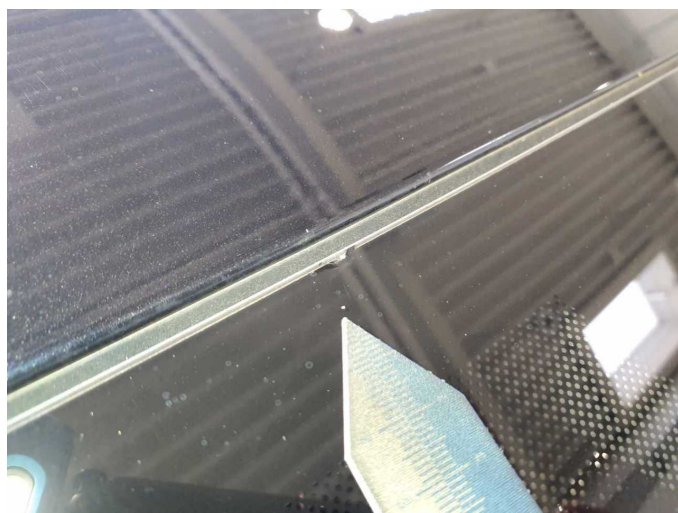

Damage 15: Vehicle glazing: Windscreen - Stone chips - Replace




Wear and tear 4: Wheel / tyres: Tyre - right (Kein Airstop) - Differs from the original configuration - No deduction

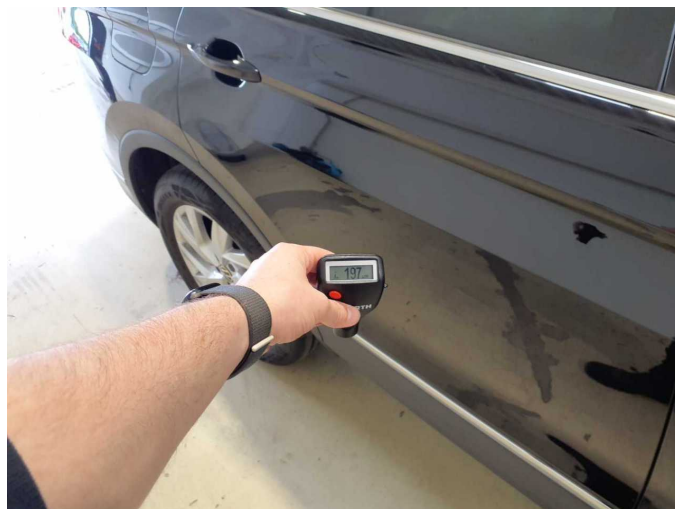

Repainting 1: Door - rear right side




Repainting 1: Door - rear right side

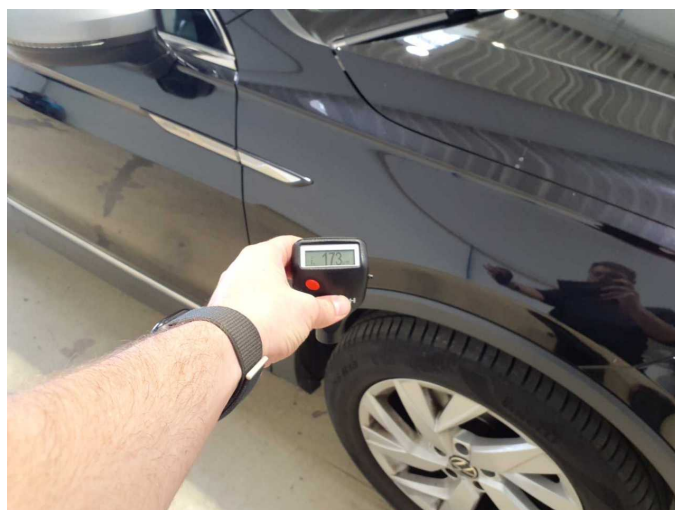

Repainting 2: Mudguard - right side



Repainting 2: Mudguard - right side

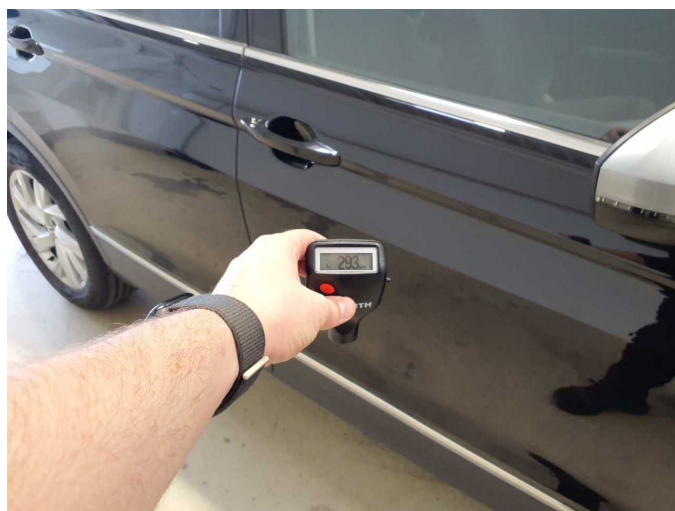

Repainting 3: Door - front right side



Repainting 3: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ5NZNM146292

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Tiguan Allspace 2.0 TDI SCR
DSG Life

Datum	KM-Stand	Beschreibung
09.03.2026	80.096	Systemtest/Eigendiagnose
27.02.2026	80.099	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
05.11.2025	73.462	AU
17.02.2025	56.697	Regelwartungsdienst; Wartung Sonstiges
11.10.2024	50.524	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
19.10.2023	26.244	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges