



Expertise

Protocol number: 46905320
Order No. / Reference: 26856924
Inspection date: 4 Aug 2026

Manufacturer: Peugeot

Model: 308 SW BlueHDi 130 EAT8 Allure Pack

VIN: VR3FCYHZTPY505188



Vehicle details	
Manufacturer / Type / Model / Equipment	
Peugeot 308 SW BlueHDi 130 EAT8 Allure Pack	
Vehicle Identification number	VR3FCYHZTPY505188
Mileage (Read)	62,659 km
First registration	21 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,499 ccm / 4
Power	96 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Schneeweiß
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Vehicle with smoke odor	no
readiness to drive	Not roadworthy / moveable



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	9 Monat(e)
Last service on / at	04/2026 at 58,357 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GG049978
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
readiness to drive	Not roadworthy / moveable		
Manufacturer key number/ type code number	1889 / AEI 00038		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,950 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R17 94V	Summer tyres on Light alloy	Michelin	5mm / 5mm
2)	225/45 R17 94V	Summer tyres on Light alloy	Michelin	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R17 91H	Winter tyres on Light alloy	Dunlop	7mm / 7mm
2)	225/45 R17 91H	Winter tyres on Light alloy	Dunlop	8mm / 8mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 06/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Storage compartment: Illuminated glove compartment
- Active Safety Brake Plus (Active day and night between 5 and 140 km/h, depending on the detected obstacle (moving obstacle: 5-140 km/h; stationary obstacle/cyclist: 5-80 km/h; pedestrian: 5-60 km/h). At speeds below 30 km/h, the vehicle is braked to a complete stop; between 30 and 140 km/h, the system reduces the impact speed by a maximum of 50 km/h. Above this threshold, the driver must brake manually.)
- Electrically adjustable, heated and folding exterior mirrors (with LED approach lighting - integrated LED turn signals)
- Turn signals with lane change indicator function
- third brake light
- Digital instrument cluster with high-resolution 10" screen, adjustable and customizable
- Eco-LED headlights
- Front parking aid, acoustic and visual
- Driving mode selector (Sport - Normal - Eco)
- Electric windows, front and rear (with comfort operation and anti-pinch protection)
- Follow-me-home function (automatic)
- Laminated glass windshield, noise-reducing
- Transmission: 8-speed automatic transmission EAT8
- Heated rear window
- Rear apron in black
- Interior mirror automatically dimming
- Map pockets on the front seatbacks
- Keyless System Plus (keyless access and start system)
- Child safety lock at the rear
- Automatic climate control (2-zone), with activated carbon filter (separately adjustable for driver and front passenger)
- Paint finish: Metallic Avatar Blue
- LED lighting in the front footwell
- LED ceiling lighting at the front (2 reading lights at the front and rear)
- LED daytime running lights
- Steering wheel: Leather steering wheel with paddle shifters
- Mirror Screen (Wireless transmission of multimedia content and apps from a compatible smartphone to the vehicle's touchscreen, allowing direct control of compatible functions and apps - CarPlay (for compatible Apple iPhone models) - Android Auto (for compatible smartphone models with Android operating system))
- Fatigue warning
- Particulate filter: FAP diesel particulate filter
- Break warning
- Upholstery: Fabric/faux leather
- Rain sensor
- Tire pressure monitoring system
- Wheels: Halong 17" alloy wheels, two-tone (tires 225/45 R17 94V)
- Side windows in the second row and rear window are more heavily tinted.
- ABS (Anti-lock Braking System) with electronic brake force distribution
- Airbags (6) (Driver and front passenger airbag - front passenger airbag deactivatable - front side airbags - front and rear curtain airbags)
- Rear Cross Traffic Alert (Rear Cross Traffic Alert)
- Adaptive Cruise Control (ACC) with Stop & Go function (EAT8) (detection of stop signs, one-way street signs and start/end of no-overtaking zones)
- Exterior mirror caps in Perla Nera Black
- Hill start assist
- On-board computer
- Decorative fabric inserts "Texa" for door panels and dashboard
- Tachometer
- Rear parking aid, acoustic and visual
- Electronic Stability Program (ESP) (with ASR (traction control))
- High beam assist
- electric parking brake
- Front collision warning
- luggage compartment roller blind
- Cup holder in the center console
- rear window wiper
- Infotainment system: PEUGEOT i-Connect Advanced (Infotainment system: up to 8 profiles and 2 smartphones simultaneously via Bluetooth, - Bi-tuner, 6 speakers (midrange and tweeters) - Digital radio reception DAB+ - MP3-compatible - Bluetooth hands-free system with audio streaming via Bluetooth - 2 front USB-C ports - Steering wheel and touchscreen controls - Real-time navigation "by TomTom Services" - Over-the-air map updates - OK PEUGEOT voice control for navigation, telephone, climate control and media)
- LED taillights
- Steering wheel: Small multifunction leather steering wheel, flattened at the top and bottom.
- light sensor
- Rear center armrest (with pass-through flap)
- front center armrest
- Multifunctional touchscreen with 10" HD color display (capacitive screen - multi-window capable with widgets or shortcuts)
- Multi-collision brake
- Emergency brake assist with automatic activation of the hazard warning lights
- Peugeot i-Toggles (screen with configurable virtual buttons for the most important functions such as radio, air conditioning, navigation system, vehicle settings, telephone and connectivity)
- Wheels: Tire repair kit (compressor + tire sealant spray)
- Reversing camera with 180° surround view
- Electric power steering
- Seats: Passenger seat height adjustable
- Seats: Manual lumbar support for driver



- | | |
|---|---|
| <ul style="list-style-type: none"> • Seats: Driver's seat height adjustable • Seats: Rear bench seat and backrest split 40/20/40, foldable (Magic Flat system with control element in the boot) • Seats: Front seats (three-point seat belts with belt locking devices - pyrotechnic belt tensioners and electronically controlled belt force limiters - warning light and warning signal when the seat belt is not fastened or is released for driver and front passenger - safety-optimized headrests) • Doors lock automatically when driving off • Traffic sign recognition (with display of the speed recommendation in the instrument cluster) • Decorative trim in high-gloss black on the side windows • Adjustable intermediate loading shelf | <ul style="list-style-type: none"> • Seats: Rear seats (3 three-point safety belts - belt force limiters on the side seats - warning light and warning signal when the safety belt is released - Isofix child seat anchors on the outer seats) • Lane keeping assist with steering intervention • 12-volt socket • Stop&Start automatic • Blind spot assist • Chrome-plated decorative exhaust tailpipes • Immobiliser • Central locking system, activatable from inside via remote control |
|---|---|

Extra equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • Luggage compartment partition net • Seats: Heated front seats | <ul style="list-style-type: none"> • Paint finish: Solid |
|--|---|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was not capable of driving under its own power at the time of inspection, but can be moved on its own axle with the aid of assistance.

Value reducing factors

No.	Component group	Description
1	Side panel - rear right side	Sill - Scratch(es) - Smart repair
2	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
3	Wheel / tyres	Tyre - rear right side - Broken / torn - Replace
4	Wheel / tyres	Tyre - front left side - Broken / torn - Replace
5	Engine	Engine - Leaking - Perform diagnosis
6	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
7	Wheel / tyres	Alloy rim - rear right side - Scratched - Replace

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front left side - Scratch(es) - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	2nd wheel set	2 alloy rims - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

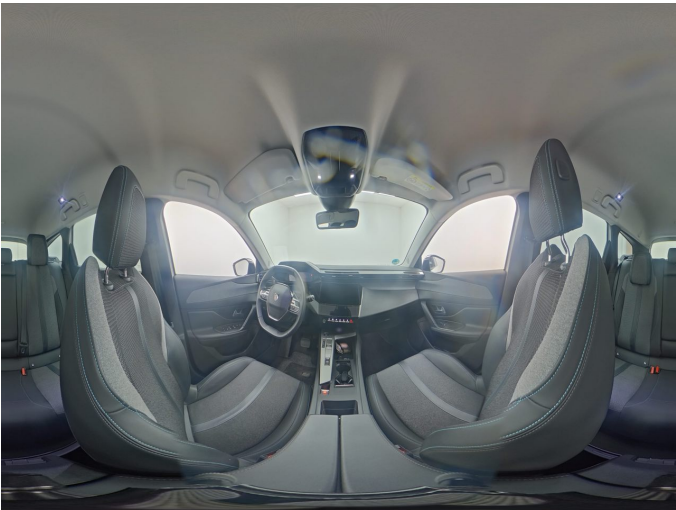


Figure 9: Interior 360° view



Figure 10: Cargo area

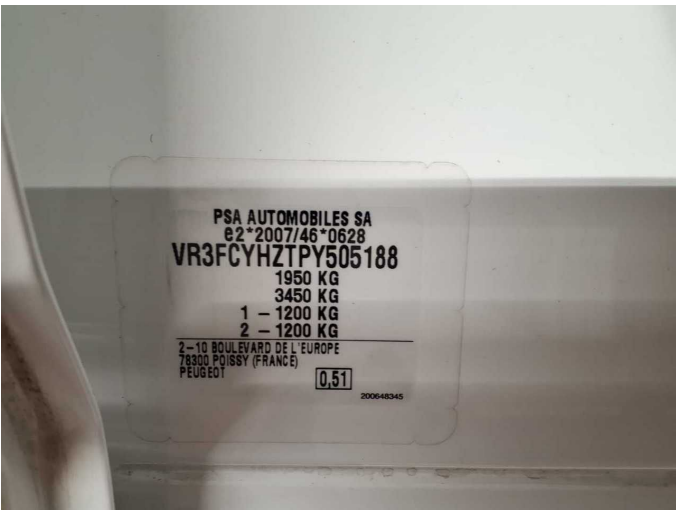


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

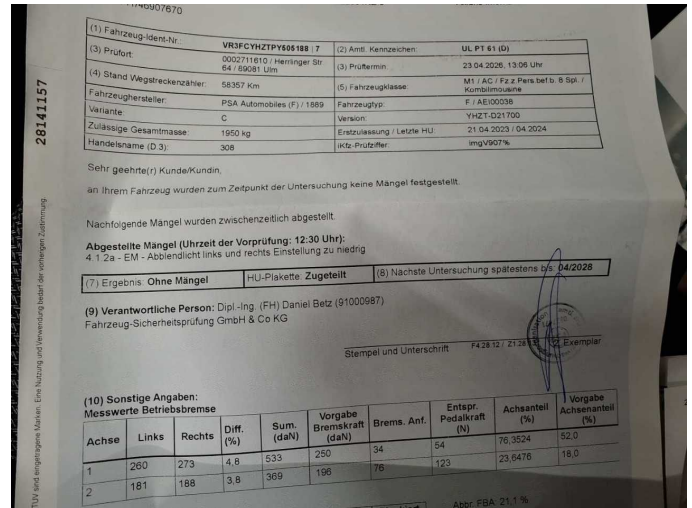


Figure 14: Documents

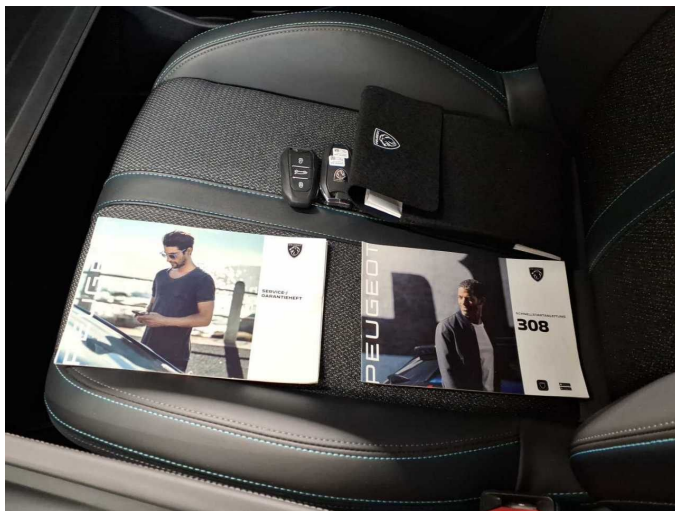


Figure 15: Documents

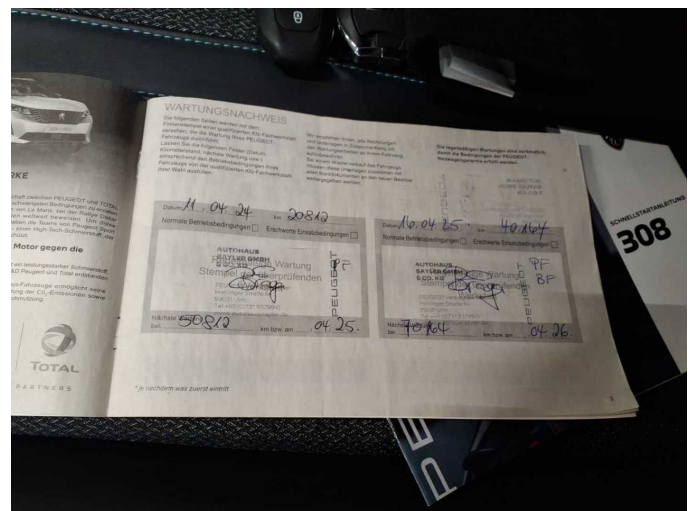


Figure 16: Documents

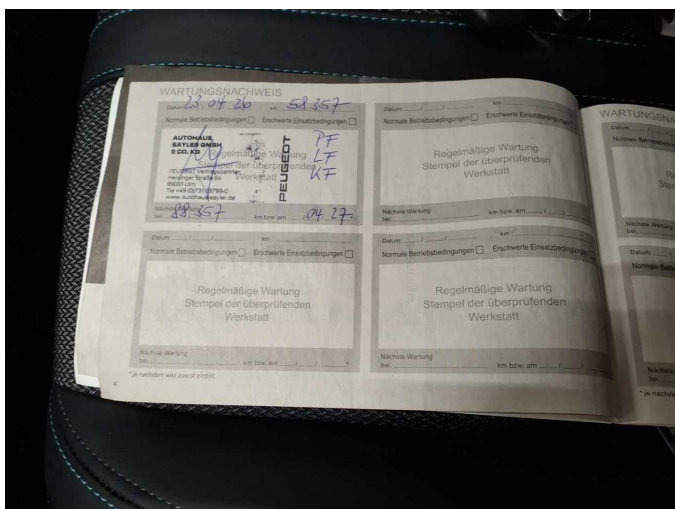


Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Additional tyres



Figure 20: Navigation

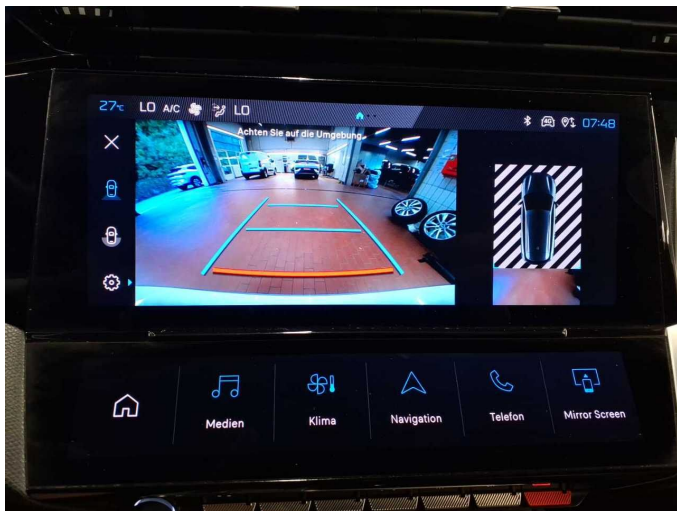


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

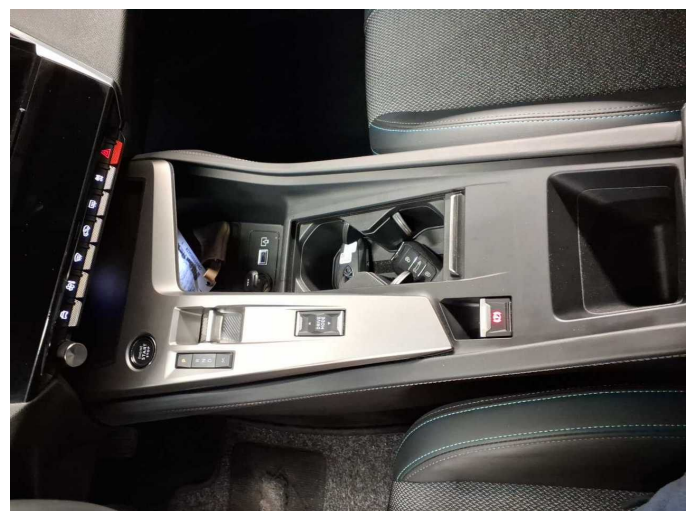


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Damage 1: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 1: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 2: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair




Damage 3: Wheel / tyres: Tyre - rear right side - Broken / torn - Replace



Damage 3: Wheel / tyres: Tyre - rear right side - Broken / torn - Replace



Damage 3: Wheel / tyres: Tyre - rear right side - Broken / torn - Replace

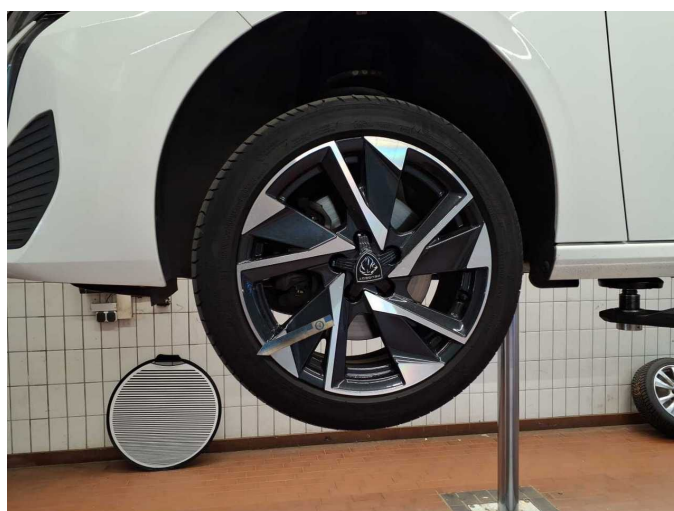


Damage 4: Wheel / tyres: Tyre - front left side - Broken / torn - Replace




Damage 4: Wheel / tyres: Tyre - front left side - Broken / torn - Replace



Damage 5: Engine: Engine - Leaking - Perform diagnosis

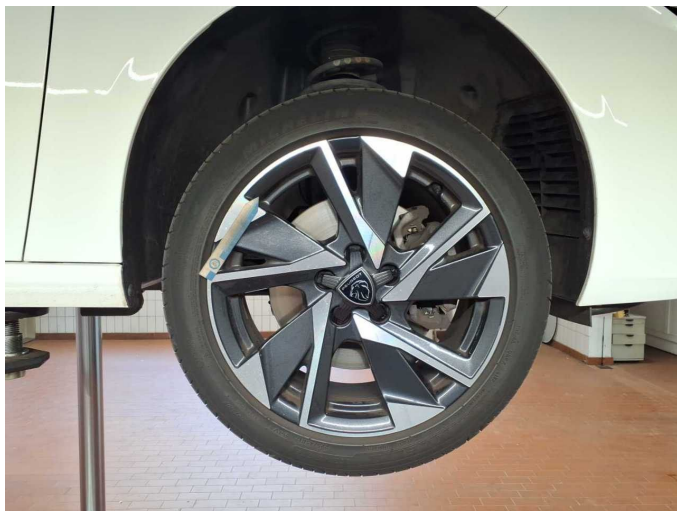

Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value

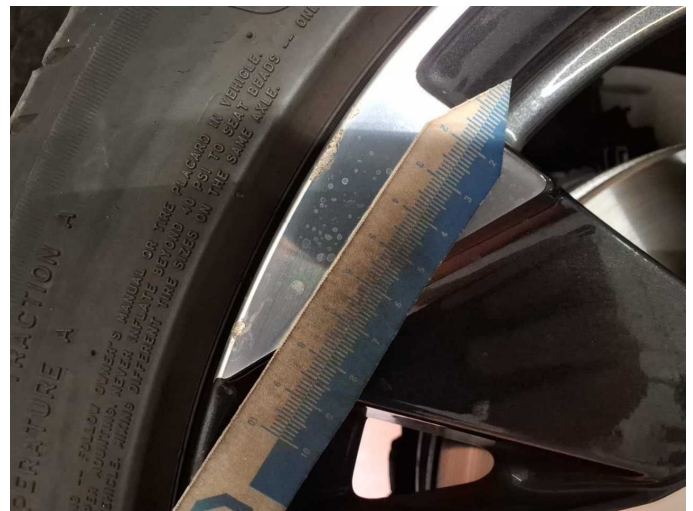

Damage 6: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Damage 7: Wheel / tyres: Alloy rim - rear right side - Scratched - Replace



Wear and tear 1: Wheel / tyres: Alloy rim - front left side - Scratch(es) - No deduction



Wear and tear 1: Wheel / tyres: Alloy rim - front left side - Scratch(es) - No deduction



Wear and tear 1: Wheel / tyres: Alloy rim - front left side - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: VR3FCYHZTPY505188

Hersteller / Modell: PEUGEOT PEUGEOT 308 SW BlueHDi 130 EAT8 Allure Pack

Datum	KM-Stand	Beschreibung
24.04.2026	58.357	AU; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
16.04.2025	40.164	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.04.2024	20.817	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/ Eigendiagnose; Wartung Sonstiges