



Expertise

Protocol number: 46085430
Order No. / Reference: 26530262
Inspection date: 22 Jun 2026

Manufacturer: Ford

Model: Kuga 2.0 EcoBlue 4x4 Aut. TITANIUM

VIN: WF0FXXWPMFNT25516



Vehicle details	
Manufacturer / Type / Model / Equipment	
Ford Kuga 2.0 EcoBlue 4x4 Aut. TITANIUM	
Vehicle Identification number	WF0FXXWPMFNT25516
Mileage (Read)	148,164 km
First registration	13 May 2022
Number of holders	1
Next periodical technical inspection	05/2027
(Report not on hand)	
Power / Engine displacement	140 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Magnetic-Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	94 %
Last service on / at	05/2026 at 146,814 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GK810296
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8566 / BTH 00136		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,245 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 106V	Summer tyres on Light alloy	Pirelli	7mm / 7mm
2)	225/65 R17 106V	Summer tyres on Light alloy	Pirelli	7mm / 7mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/65 R17 106H	Winter tyres on Light alloy	Continental	4mm / 4mm
2)	225/65 R17 106H	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	165/70 R17 114M	Summer tires (with run-flat tires) on Steel	Maxxis	3 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- All-wheel drive
- Anti-lock braking system
- Passenger airbag deactivation
- third brake light
- Fabric headliner
- Roof spoiler
- 12.3-inch digital instrument panel
- Tachometer
- Driving mode switch selective
- Electric windows front and rear
- Ford Easy Fuel
- Ford Power Start Function & Ford Key Free System
- Luggage compartment cover, roller blind, removable
- Cruise control
- Illuminated glove compartment
- rear window wiper
- Intelligent Protection System (IPS)
- Air conditioning with automatic temperature control
- Front and rear headrests (5) height adjustable
- Steering wheel: Steering wheel, 3-spoke design, in Sensico synthetic leather
- MyKey key system
- Fog light
- Emergency brake light, pulsating illumination of the brake lights during hard braking
- Post-Collision Assist
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor
- Headlights with delayed shut-off
- Power steering
- Seats: Map pockets on the driver's and front passenger's seat backrests
- Seats: Front sports seats with integrated headrests
- Sun visor on driver and passenger side
- Power outlet: 12-volt connection in the luggage compartment
- Central locking with remote control and remote luggage compartment release
- Ambient lighting
- Electrically adjustable, heated and folding exterior mirrors
- Tires: 7 J x 17 alloy wheels (4) in 5x2-spoke design
- Chrome decorative trim around the side windows
- Roof rails, silver-colored
- Diesel particulate filter
- Dual exhaust system
- Electronic Stability Program (ESP)
- Lane keeping assist including lane keeping assist
- Electric parking brake with auto hold function
- Ford EcoCoach
- FordPass Connect
- Luggage compartment lighting
- Transmission: 8-speed automatic
- Heated rear window
- Interior mirror, automatically dimming
- ISOFIX mounts including top tether attachment points on the outer seats of the 2nd row.
- LED taillights
- Steering column, adjustable in height and reach
- Front center console with integrated armrest
- Navigation system: Ford navigation system including Ford SYNC 3
- Front and rear parking pilot system
- Upholstery: Cloth
- Pre-Collision Assist
- Rear view camera
- Projection lens headlights with LED daytime running lights
- Headlight assistant with day/night sensor
- Seats: Driver and passenger seats, 8-way manually adjustable
- Seats: Rear bench seat, sliding, with split-folding backrest
- Seats: Front seats, individually and variably heated
- Start-stop system
- Carpet floor mats front and rear, velour
- Immobiliser



Extra equipment

- Swiveling towbar (incl. ESP trailer stabilization)
- Inductive charging station for mobile devices (The inductive charging station allows you to charge your compatible smartphone while driving without the hassle of connecting it to a cable. The charging station is located in the vehicle's center console and is only activated when it comes into contact with a compatible device. If you place a wallet or other items on the charging station, it remains inactive.)
- Package: Winter II (Heated windscreen - Heated leather steering wheel - Heated outer rear seats)
- Panoramic sliding sunroof, electric, including roof console with glasses storage compartment
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Safety partition net (including attachment points behind the first and second rows of seats)
- Tires: Spare wheel (T165/70 R17 tire - instead of tire repair kit - permissible at max. 80 km/h when used)
- Paint finish: Special metallic paint finish
- Package: Driver Assistance Package (Automatic Transmission) (Intelligent Adaptive Cruise Control with Traffic Sign Recognition System - Traffic Jam Assist with Stop&Go Function and Lane Keeping Assist - Wrong-Way Driver Warning System - Evasive Steering Assist - Driver Drowsiness Detection - Pre-Collision Assist including Forward Collision Warning System with Cross Traffic Alert - Blind Spot Assist with Emergency Braking Function and Trailer Detection - Active Park Assist with Parking Assist and Semi-Autonomous Vehicle Steering - Front Camera with Split View - Door Edge Protectors - Intelligent Speed Limiter with Speed Limit Display)
- Fuel-operated auxiliary heater (including remote control)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - dent(s) - Smooth repair work
2	Mudguard - right side	Mudguard - right side - dent(s) - Smooth repair work
3	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
4	Door - rear right side	Door - Scratch(es) - Smart repair
5	Side panel - rear right side	Sill - Scratch(es) - Smart repair
6	Front bumper	Spoiler (+Blende) - Damaged - Replace
7	Door - rear left side	Door - Unprofessionally repaired - Repair and paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lining - Scratch(es)

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 19 Jan 2026	1.987,59 €



Repainting

No. Repainting

- 1 Roof rail - left side, Side panel - rear left side, Professionally carried out
- 2 Door - rear left side, Unprofessionally carried out

Paint coat thickness measurement

Roof rail - left side	150 µm	Side panel - rear left side	150 µm
Door - rear left side	185 µm		

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

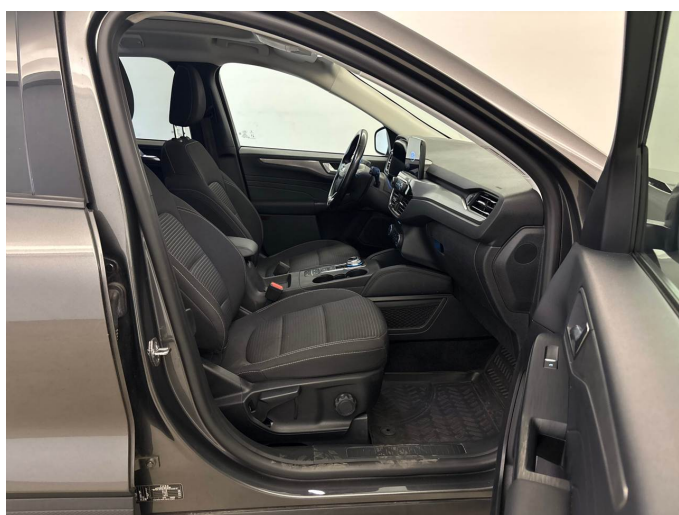


Figure 5: Interior - front

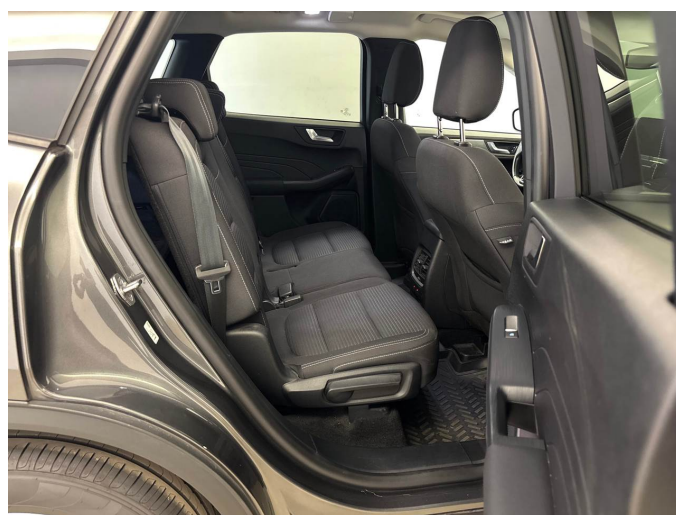


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

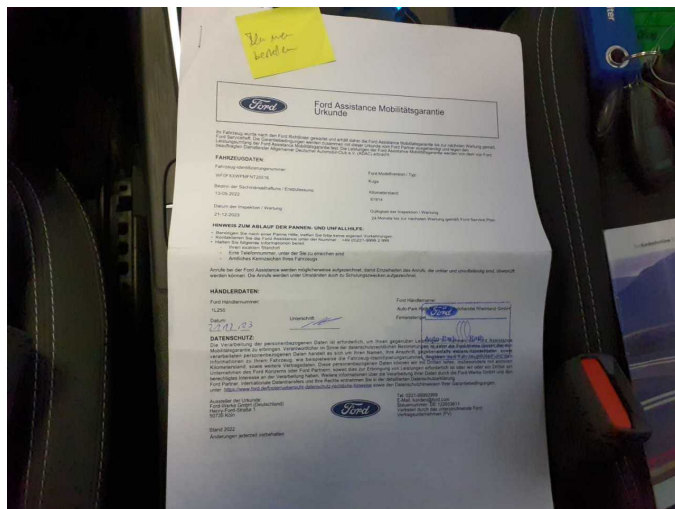


Figure 14: Documents

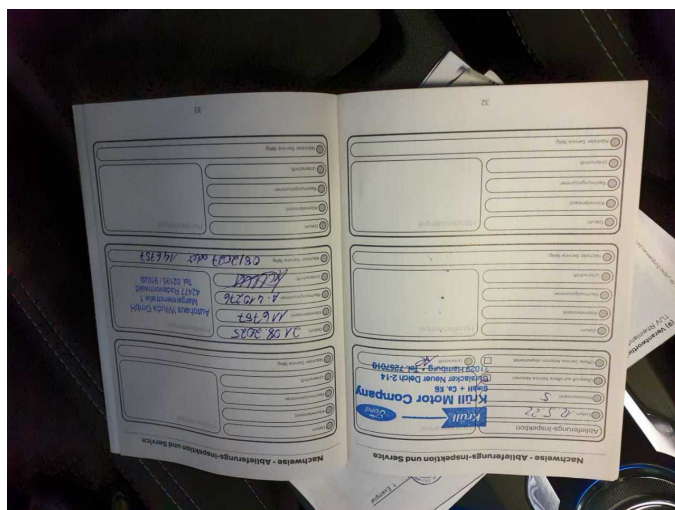


Figure 16: Documents



Figure 18: Additional tyres



Figure 19: Additional tyres



Figure 20: Additional tyres



Figure 21: Navigation



Figure 22: Misc.



Figure 23: Misc.

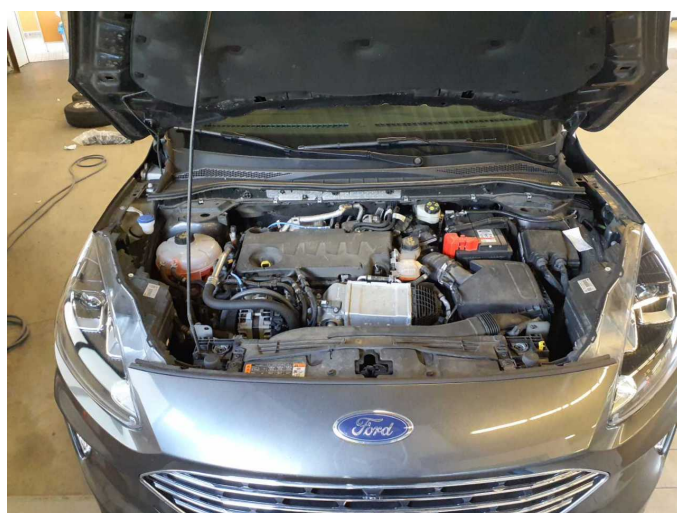


Figure 24: Misc.

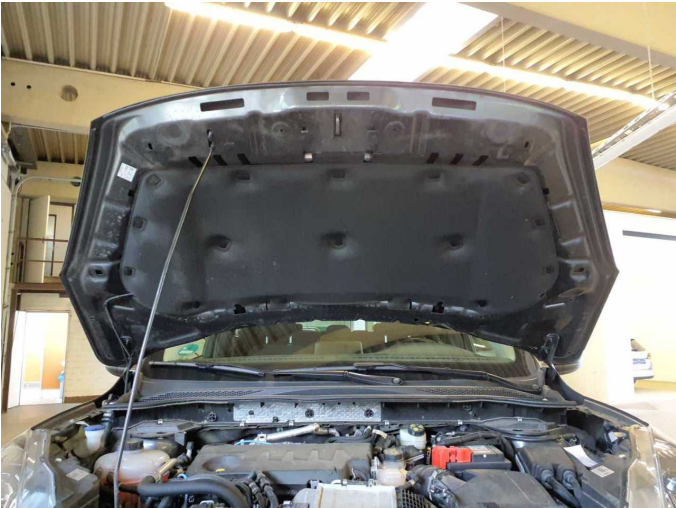


Figure 25: Misc.

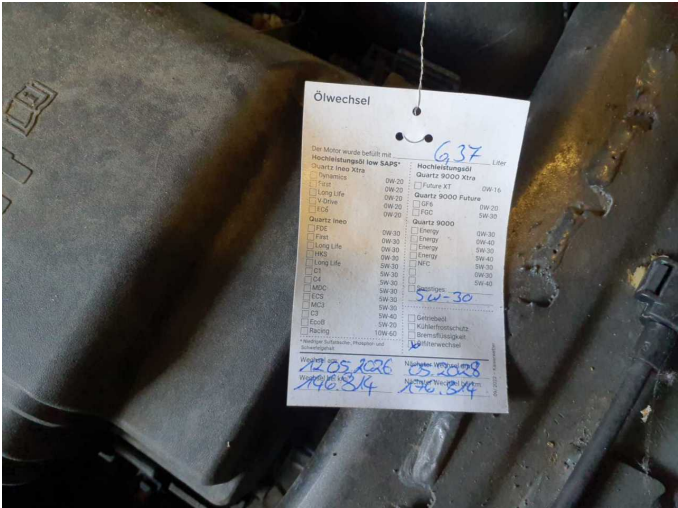


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

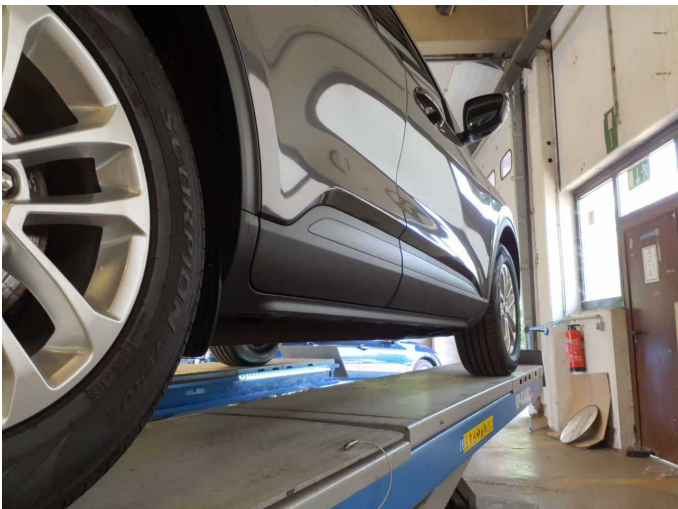


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.

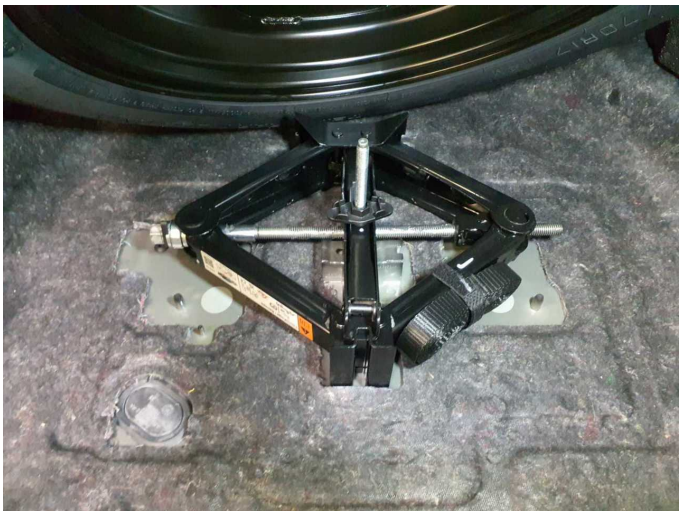


Figure 40: Misc.



Figure 41: Misc.



Figure 42: Misc.



Damage 1: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work




Damage 1: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 1: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work



Damage 1: Boot lid / rear door: Boot lid - dent(s) - Smooth repair work

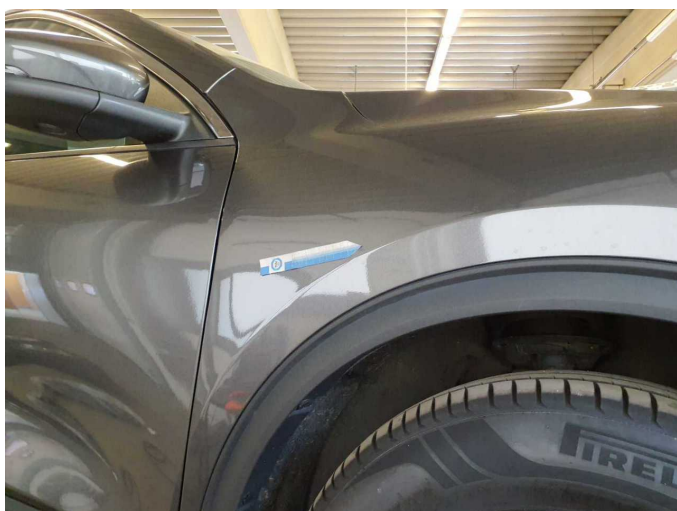


Damage 2: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work



Damage 2: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work



Damage 2: Mudguard - right side: Mudguard - right side - dent(s) - Smooth repair work

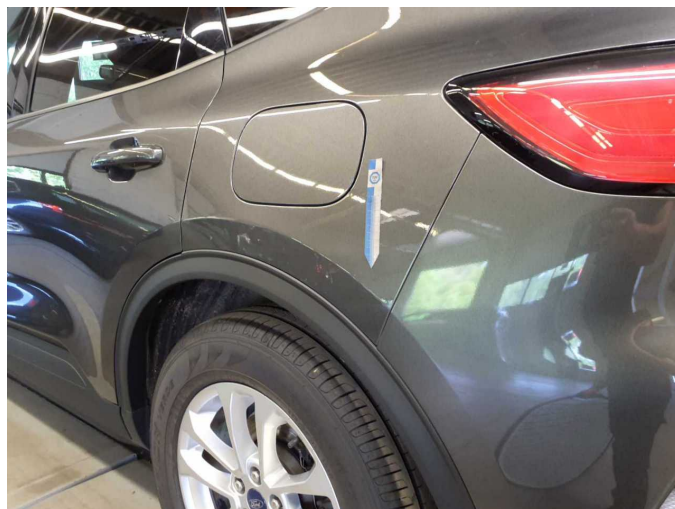

Damage 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work




Damage 3: Side panel - rear left side: Side panel - dent(s) - Smooth repair work



Damage 4: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 4: Door - rear right side: Door - Scratch(es) - Smart repair

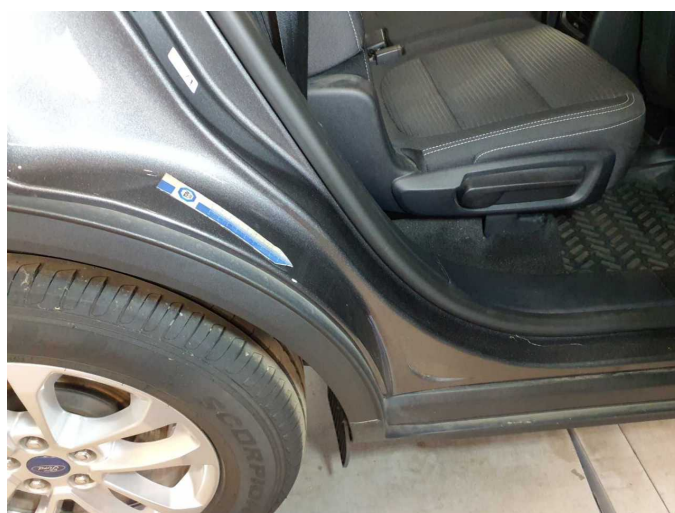

Damage 5: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 5: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 5: Side panel - rear right side: Sill - Scratch(es) - Smart repair



Damage 6: Front bumper: Spoiler (+Blende) - Damaged - Replace




Damage 6: Front bumper: Spoiler (+Blende) - Damaged - Replace



Damage 6: Front bumper: Spoiler (+Blende) - Damaged - Replace




Damage 6: Front bumper: Spoiler (+Blende) - Damaged - Replace

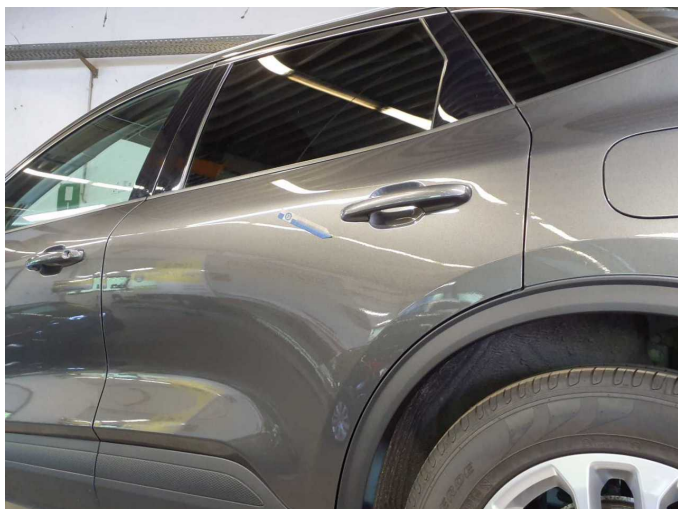


Damage 7: Door - rear left side: Door - Unprofessionally repaired - Repair and paint




Damage 7: Door - rear left side: Door - Unprofessionally repaired - Repair and paint

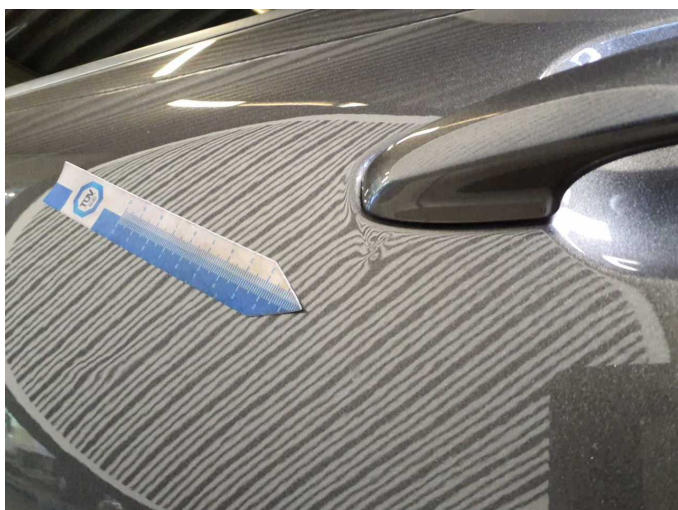

Damage 7: Door - rear left side: Door - Unprofessionally repaired - Repair and paint

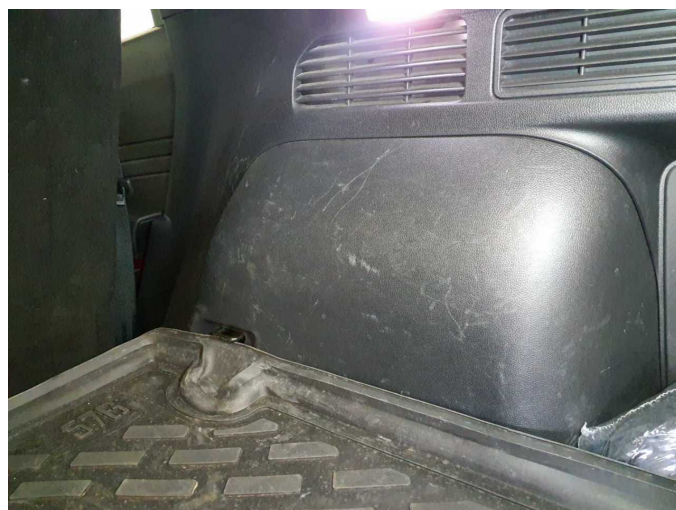

Wear and tear 1: Trim / covers: Boot lining - Scratch(es)

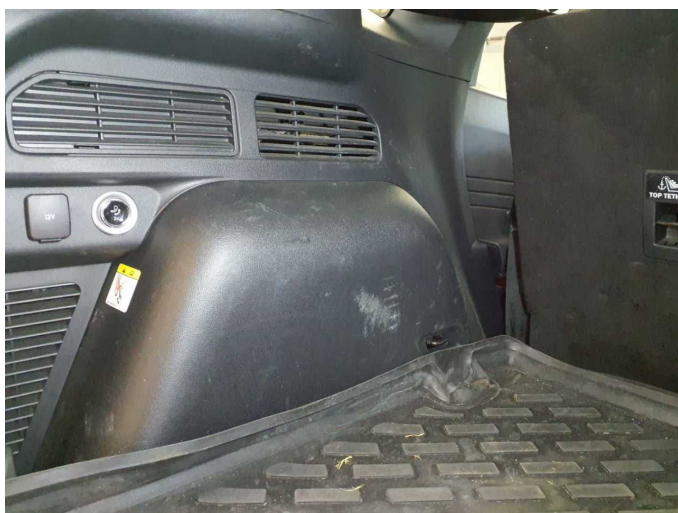

Wear and tear 1: Trim / covers: Boot lining - Scratch(es)



Repainting 1: Roof rail - left side, Side panel - rear left side



Repainting 1: Roof rail - left side, Side panel - rear left side



Repainting 1: Roof rail - left side, Side panel - rear left side



Repainting 1: Roof rail - left side, Side panel - rear left side



Repainting 1: Roof rail - left side, Side panel - rear left side



Repainting 1: Roof rail - left side, Side panel - rear left side



Repainting 1: Roof rail - left side, Side panel - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0FXXWPMFNT25516

Hersteller / Modell: FORD FORD Kuga 2.0 EcoBlue 4x4 Aut. TITANIUM

Datum	KM-Stand	Beschreibung
12.05.2026	146.814	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
16.04.2026	143.226	Bremse Sonstiges; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Getriebeöl ern/prüfen; Systemtest/Eigendiagnose
28.11.2025	126.517	Batterie ern; Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten
25.08.2025	116.763	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
18.08.2025	108.768	AU
27.09.2024	86.237	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze vorne; Bremsscheiben + Klötze v; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
21.12.2023	61.914	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
24.03.2023	30.524	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges