



Expertise

Protocol number: 46737296
Order No. / Reference: 26657476
Inspection date: 9 Jul 2026

Manufacturer: Volvo

Model: XC40 Recharge Single Motor Plus

VIN: YV1XZEFV7P2069653



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC40 Recharge Single Motor Plus	
Vehicle Identification number	YV1XZEFV7P2069653
Mileage (Read)	104,486 km
First registration	12 May 2023
Number of holders	1
Fuel type	Electric
Power	80 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Black Stone
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Non-existent	Next maintenance in	16,060 km
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS759655
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	9101 / BUN 00002		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,480 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 99T	All-season tires (with run-flat capability) on Light alloy	Pirelli	5mm / 5mm
2)	255/45 R19 100T	All-season tires (with run-flat capability) on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbags (driver and front passenger airbags with two-stage deployment system - driver's knee airbag - driver and front passenger side airbags - head/shoulder airbags (IC) for all occupants)
- Aluminum door sill plates with Recharge lettering, front
- Android infotainment system (9" touchscreen (22.9 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - Over-the-air updates (OTA)
- Anthracite headliner
- Automatic tailgate (electric)
- Central locking with two remote controls and integrated emergency key (including automatic locking of the doors while driving (can be deactivated))
- Charging cable Schuko/Type 2 (Mode 2) (7 m length, 1-phase, 10A (for connection to a standard 230-volt household socket))
- Child safety lock for the rear doors (electric)
- Comfort opening/closing of the side windows via radio remote control
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver Assistance (Adaptive Cruise Control - Emergency Stop Assist (automatic emergency stop system if warnings are ignored due to the driver's failure to steer, brake and accelerate, including activation of the hazard warning lights and automatic braking to a standstill) - Pilot Assist (lane guidance assistant with adaptive cruise control up to speeds of 130 km/h))
- Electric auxiliary heater with timer
- Electric parking brake
- Electric windows front and rear (with auto-down and auto-up function)
- Electrically folding exterior mirrors
- Electronic differential lock
- Electronic Stability Control (ESC)
- Enhanced air purification system (with fine dust filtration according to air quality standard PM2.5)
- Fog light
- Fold-out (bag) hook on the glove compartment
- Front and rear parking sensors with automatic braking intervention (rear)
- Front headrests
- Front seat belt height adjustment
- Gearshift lever made of Swedish crystal glass (with center console surround in high-gloss black)
- Glazing: Colored glazing
- Heated exterior mirrors and rear window
- Hill start assist
- Illuminated makeup mirror for driver and front passenger
- 12-volt socket at the front
- Acoustic Vehicle Alerting System (AVAS) (Acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Active safety belts with belt tensioners
- Alarm system with motion/tilt sensor and security lock
- Ambient lighting (Extended interior lighting with: - Ambient lighting front and rear - Exit lights front - Illuminated door pockets front - Illuminated decorative inserts (in dashboard and front doors) - Work light on the tailgate)
- Anti-lock braking system (ABS) with electronic brake force distribution
- Automatic climate control with 2-zone temperature control (including separate temperature control for driver and front passenger, automatic blower control and air distribution including CleanZone air quality system with activated carbon filter)
- Automatic emergency braking (locking the vehicle after the airbags or seatbelt pretensioners have been deployed to prevent secondary accidents.)
- Charge control display (set current limit (from 6A) and charge level in steps of 10 % b to 100 %)
- Convenient Entry and Start (vehicle start by pressing the brake pedal and engaging the forward (D) or reverse (R) gear)
- Digital Services including Google Maps navigation system (Google Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data) - Volvo On Call (includes, among other things, contacting the Volvo On Call service center at the touch of a button and additional convenience services via the Volvo CarsApp) - Usage is time-limited and will be subject to charges thereafter. Further information on renewal is available from a Volvo dealer partner.)
- Driver Awareness (Blind Spot Information System (BLIS) - Blind Spot Assist including Lane Change Warning for rapidly approaching vehicles - Cross Traffic Alert (CTA) - Cross Traffic Warning with braking intervention - Warning of vehicles, cyclists and pedestrians approaching from the side when reversing out of a parking space, including braking to a standstill if warning signals are ignored - Rear Impact Mitigation - Preventive protection in case of impending rear-end collisions)
- Electrically adjustable exterior mirrors
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated below 10 km/h)
- First aid kit and warning triangle
- Foldable cargo floor with fastening system for carrier bags in the luggage compartment
- Front center armrest with integrated storage compartment
- Front luggage compartment (31 liters)
- Hill descent control



- Interior lighting (ambient lighting (white) front, illuminated make-up mirrors on driver and passenger side, welcome lighting front, headliner, front footwell, luggage compartment lighting on both sides, glove compartment, reading lights front and rear)
- One Pedal Drive (acceleration and deceleration to a standstill via the accelerator pedal - activation/deactivation via the menu - recuperation (brake energy recovery) as soon as the foot is taken off the accelerator pedal, to optimize the range)
- Paint finish: Contrasting roof in Black Stone
- Pass-through hatch behind the center armrest in the rear
- Passenger side airbag can be deactivated
- Phone: Inductive smartphone charging system (Wirelessly charges smartphones that support the Qi standard on a charging pad)
- Preparation for Trailer Stability Assist (TSA)
- Radio: Audio system High Performance Sound (250 Watt power - 8 speakers - Air Woofer Technology)
- Rear headrests fixed
- Rear seats can be folded down in a 60/40 split or completely.
- Rear view camera
- rear window wiper
- Recharge emblem on the rear of the vehicle
- Recharge Pure Electric front grille and grille surround in body color
- Roadside Assistance (free mobility promise, 3 years and almost throughout Europe. Covers, for example, mechanical or electrical defects, tire problems, traffic accidents in which the vehicle is so badly damaged that it is unroadworthy, etc. Also applies in the event of premature change of ownership.)
- Roof edge spoiler
- Roof rails in high-gloss black (integrated)
- Seats: Driver's seat height and length adjustable including tilt adjustment
- Service, maintenance and wear and tear (includes vehicle maintenance according to manufacturer specifications as well as the replacement of wear parts. Covers a maximum of 100,000 km or 3 years, remains linked to the vehicle even if ownership changes. Billing is done via QW90.)
- Side window surround in high-gloss black (bottom)
- Sport exterior mirrors in high-gloss black
- Sport front and rear apron
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- third brake light
- Upholstery: Textile (Rivel Chine) (incl. rear center armrest - insert: Origin - headliner: Anthracite)
- Warning tone/indicator when seat belts are not fastened (for all seats)
- Warranty (includes a 3-year manufacturer's warranty on the vehicle and an 8-year manufacturer's warranty on the vehicle battery. Also valid in the event of premature change of ownership.)
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)
- Hooks for carrier bags in the luggage compartment (two on each side)
- Immobiliser
- Interior and exterior mirrors automatically dimming
- ISOFIX mounting points (for the front passenger seat and the outer rear seats)
- Keyless Drive (electronic access system) with sensor-controlled tailgate, illuminated door handles and puddle lights
- Lashing eyes (four) in the luggage compartment
- LED headlights "Thor's Hammer" (with high beam assist and integrated LED daytime running lights)
- LED turn signals integrated into the exterior mirrors
- Luggage compartment partition net
- Optical override protection front and rear in high-gloss black
- Package: Winter Package (front seat heating - steering wheel heating - heat pump, support for air conditioning as well as heating or cooling of the high-voltage battery for range optimization)
- Paint finish: Solid
- Pre-conditioning of the vehicle interior (electrically, to 22°C (max. 30 minutes) - controlled via the menu)
- Radio accessories: Two USB-C ports in the center tunnel (front and rear)
- Rain sensor
- Recharge emblem on the C-pillar
- Run-off Road Protection (preventive protection system in case of unintentional leaving the road or impending rollovers including emergency call via Volvo On Call and door unlocking)
- Safety Assistance (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals including intersection braking assistant and emergency braking assistant for oncoming traffic - Connected Safety - Driver Alert - Attention warning - Variable speed limiter - Cruise control - Lane Keeping Aid (LKA) - Active lane keeping assistant - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI) - Traffic sign recognition)
- Seats: Adjustable (manual) leg rest for driver and front passenger seats
- Seats: Lumbar support (4-way adjustable) for driver and front passenger seats
- Seats: Passenger seat adjustable in height and length
- Speed-sensitive power steering
- Sport pedals
- Steering wheel: Sports steering wheel
- Textile floor mats front and rear
- Textile floor mats: Sport textile floor mats front and rear
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Transmission: 1-speed direct drive
- Waste bin integrated into center console (removable)



- Whiplash Protection System (WHIPS) (including immersion protection on all seats and energy-absorbing front seat cushions)

- Wheels: 19" 5-twin-spoke sport design alloy wheels (diamond cut/ high-gloss black with Recharge all-season tires 235/50 R19 (front) and 255/45 R19 (rear) 7.5 x 19" (front), 8.5 x 19" (rear) Volvo tire category A)

Extra equipment

- Towbar (semi-electric)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (Keine Servicehistorie vorhanden) - Missing - No deduction
2	Trim / covers	Boot lid - interior trim - Scratch(es) - Replace
3	Side panel - rear left side	Sill - Scratch(es) - Smart repair
4	Door - rear right side	Door - Scratch(es) - Smart repair
5	Instrument panel	Centre console - front - Scratch(es) - Smart repair
6	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
7	Rear bumper	Spoiler - Scratch(es) - Replace
8	Rear bumper	Bumper - rear right side - Scratch(es) - Paint
9	Rear bumper	Bumper - rear left side - Scratch(es) - Paint
10	Door - front left side	Door - Dent / paintcoat damage - Repair and paint
11	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Replace
12	Bonnet	Bonnet (Anätzung) - Paint defect - Repair and paint
13	Vehicle glazing	Windscreen - Stone chips - Replace

Wear and tear

No.	Component group	Description
1	Side panel - rear right side	Sill - Scratch(es) - No deduction
2	Seat - front	Seat cover - right side - Scratch(es) - No deduction
3	Side panel - rear right side	Side panel - Scratch(es) - No deduction
4	Mudguard - left side	Mudguard - left side - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Service book



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Die Wartungshistorie ist nicht vorhanden und kann somit nicht auf Vollständigkeit geprüft werden.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

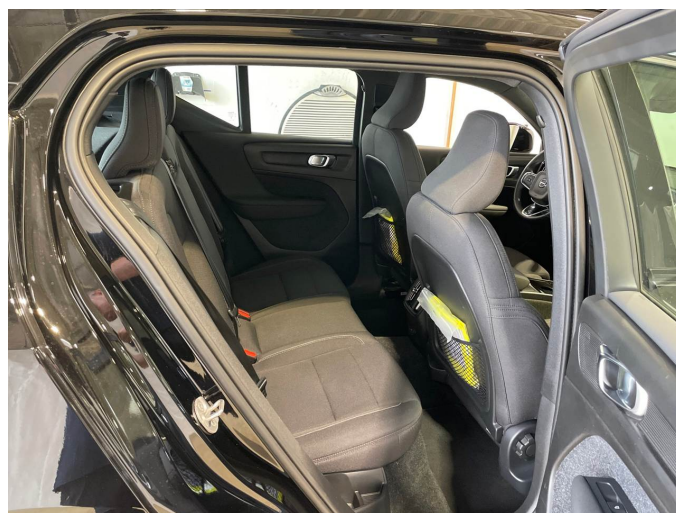


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

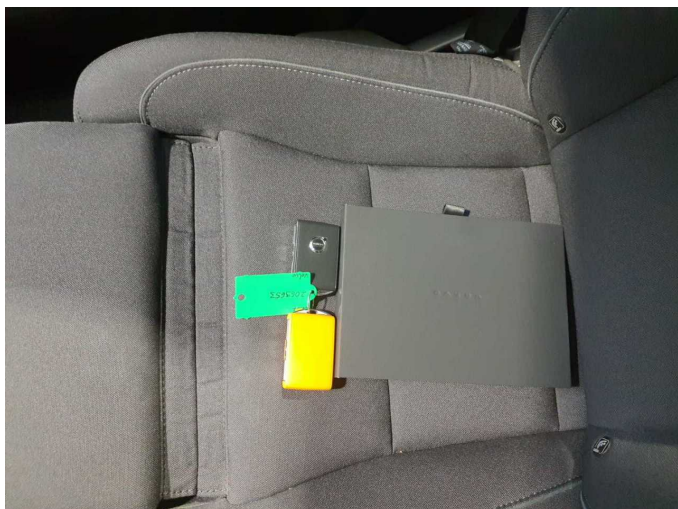


Figure 13: Documents

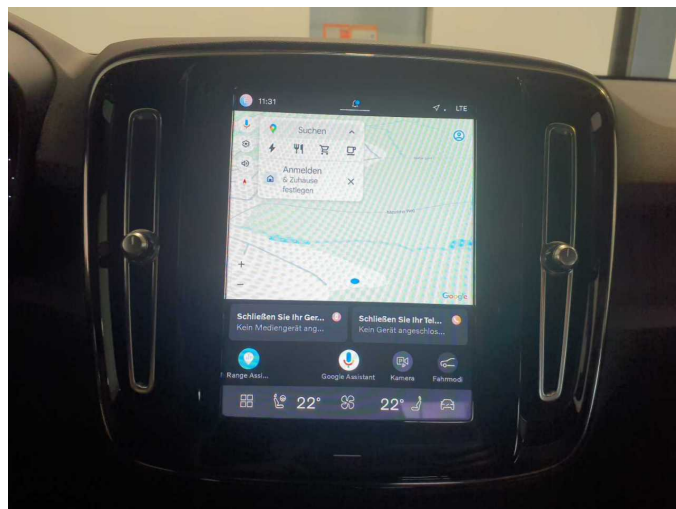


Figure 14: Navigation



Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.

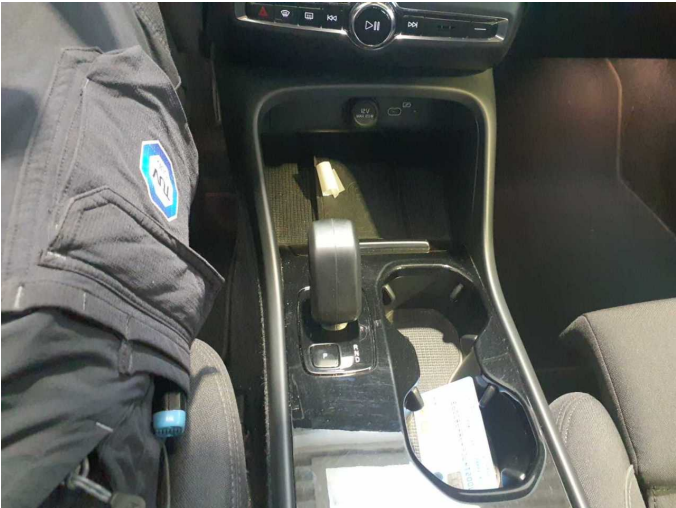


Figure 19: Misc.



Figure 20: Misc.

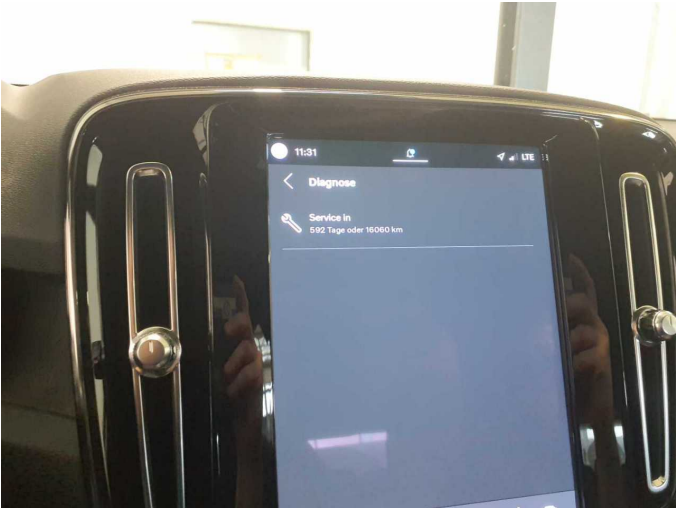


Figure 21: Misc.



Figure 22: Misc.

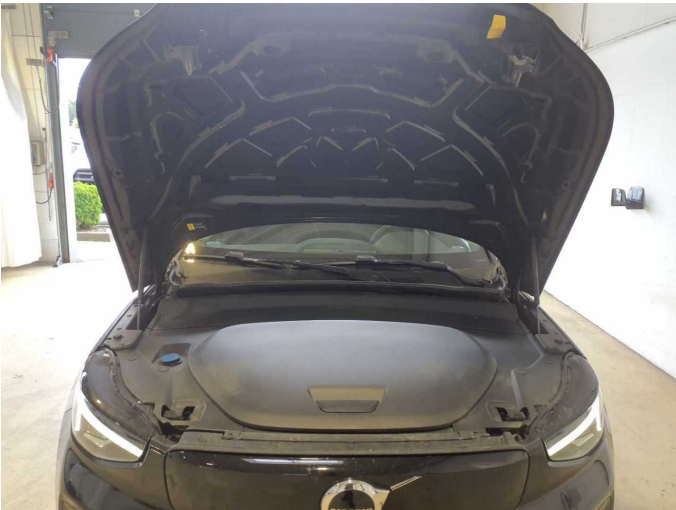


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.


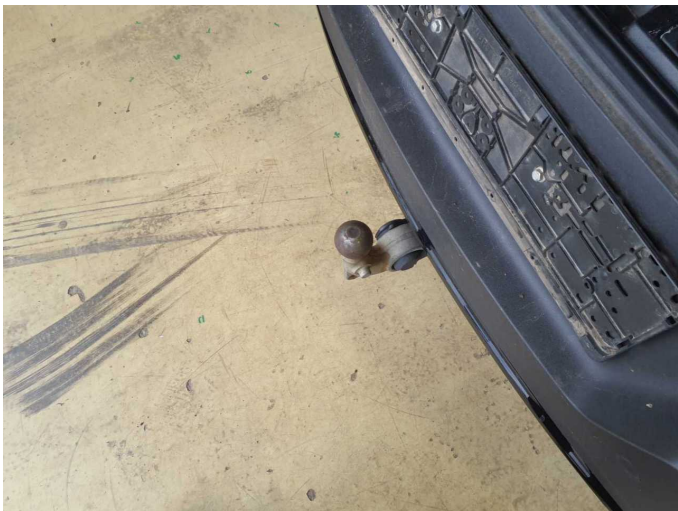



Figure 27: Misc.



Figure 28: Misc.

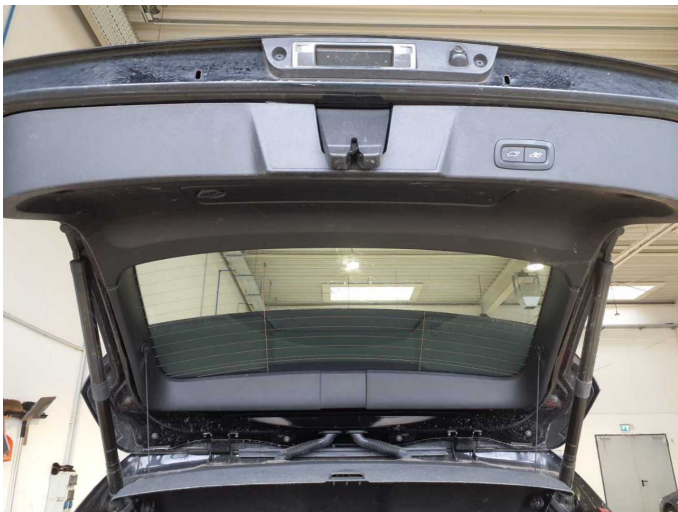

Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace

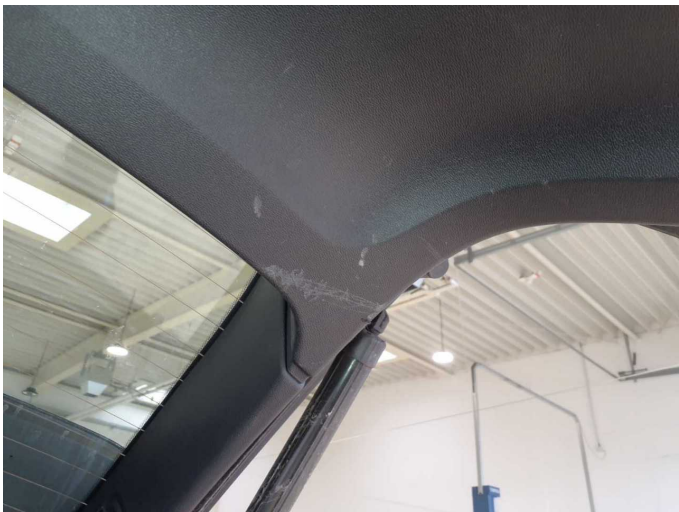


Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace




Damage 2: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace



Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair

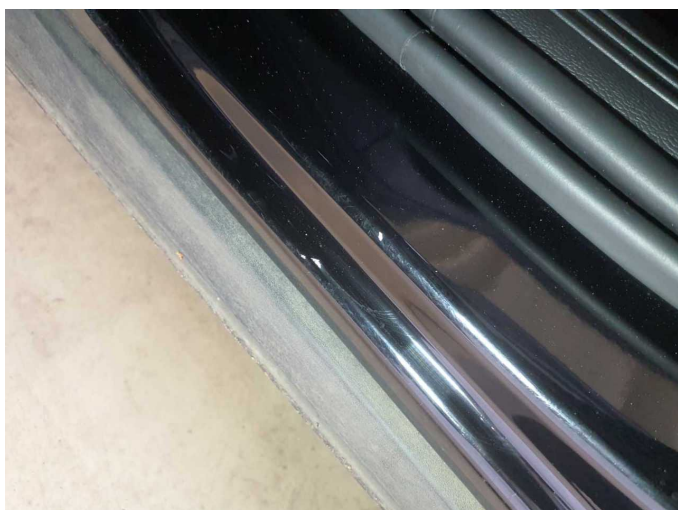


Damage 3: Side panel - rear left side: Sill - Scratch(es) - Smart repair

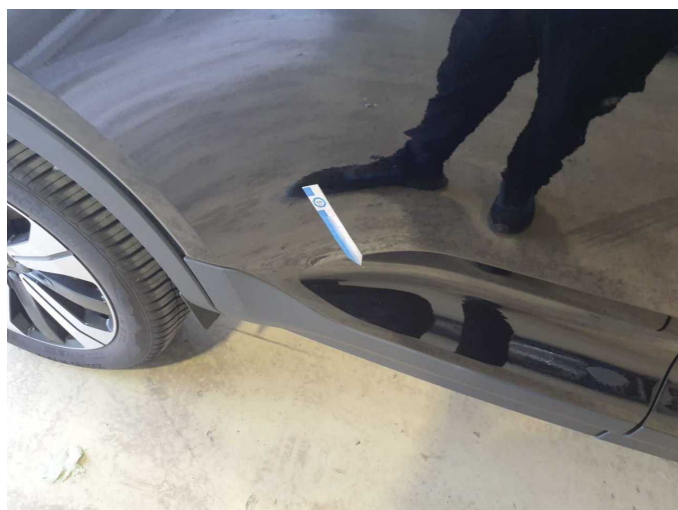

Damage 4: Door - rear right side: Door - Scratch(es) - Smart repair



Damage 4: Door - rear right side: Door - Scratch(es) - Smart repair

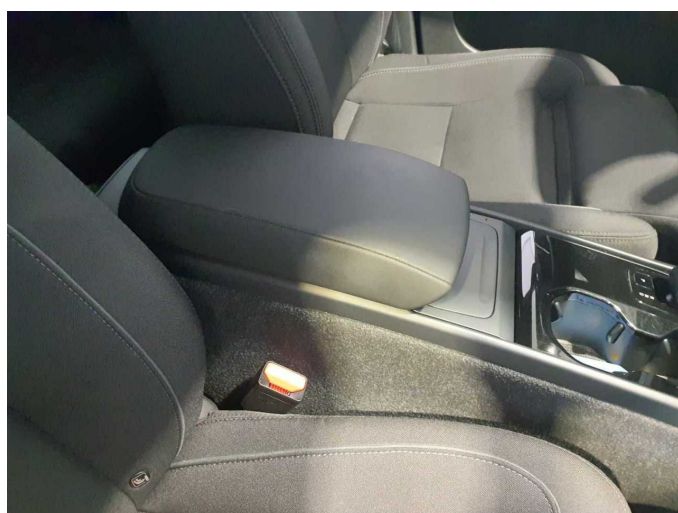

Damage 5: Instrument panel: Centre console - front - Scratch(es) - Smart repair




Damage 5: Instrument panel: Centre console - front - Scratch(es) - Smart repair




Damage 6: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 6: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

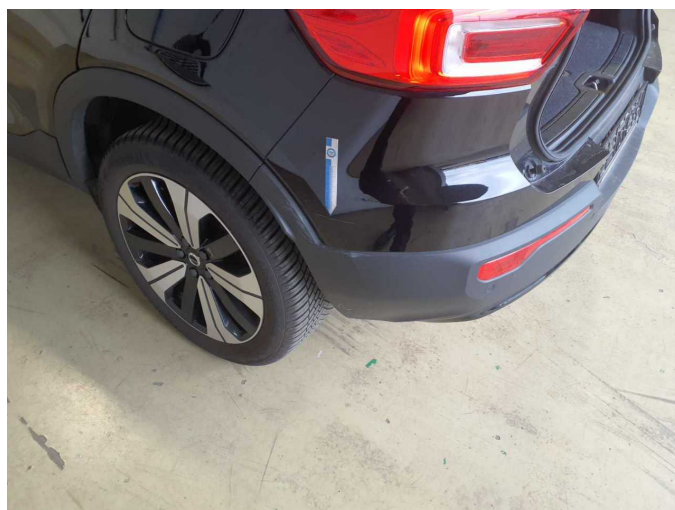

Damage 7: Rear bumper: Spoiler - Scratch(es) - Replace

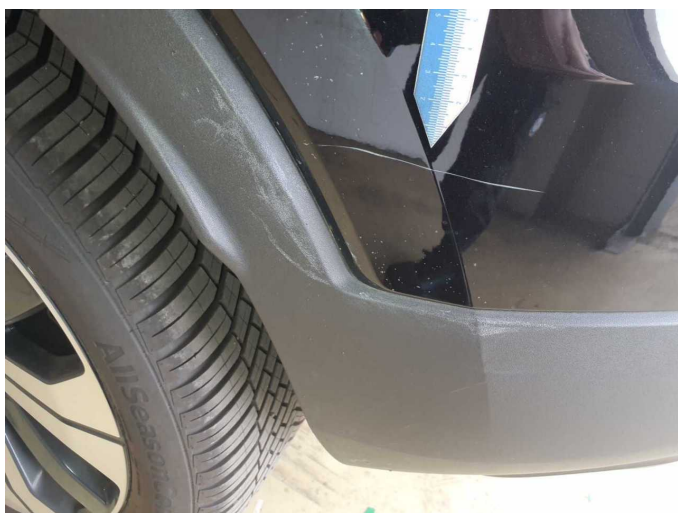

Damage 7: Rear bumper: Spoiler - Scratch(es) - Replace



Damage 8: Rear bumper: Bumper - rear right side - Scratch(es) - Paint



Damage 8: Rear bumper: Bumper - rear right side - Scratch(es) - Paint



Damage 8: Rear bumper: Bumper - rear right side - Scratch(es) - Paint




Damage 9: Rear bumper: Bumper - rear left side - Scratch(es) - Paint



Damage 9: Rear bumper: Bumper - rear left side - Scratch(es) - Paint



Damage 9: Rear bumper: Bumper - rear left side - Scratch(es) - Paint

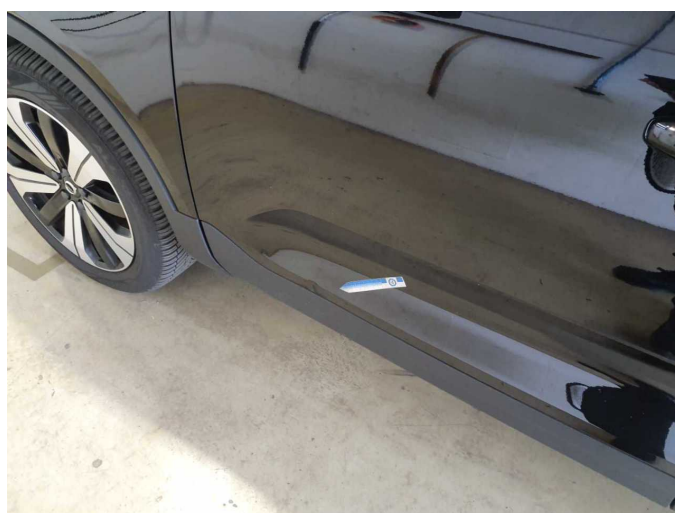

Damage 10: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 10: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 10: Door - front left side: Door - Dent / paintcoat damage - Repair and paint



Damage 10: Door - front left side: Door - Dent / paintcoat damage - Repair and paint




Damage 11: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Replace




Damage 11: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Replace




Damage 11: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Replace

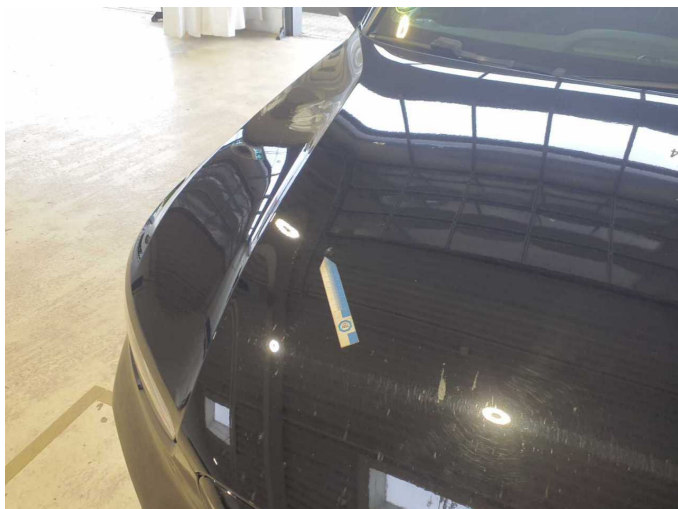

Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint

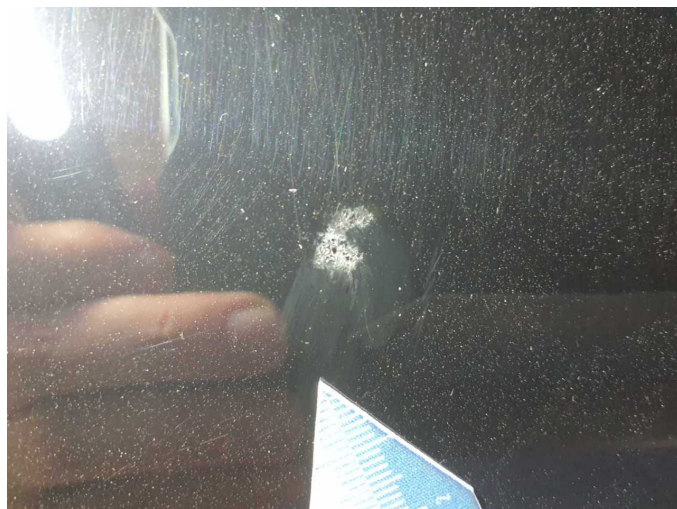


Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint

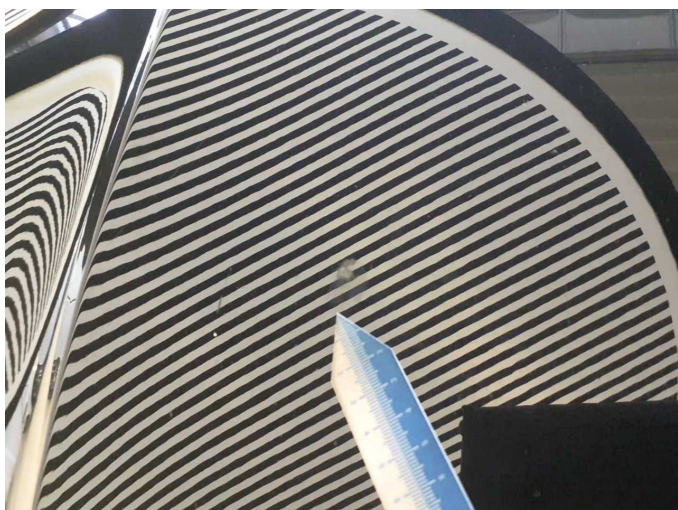

Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint




Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint

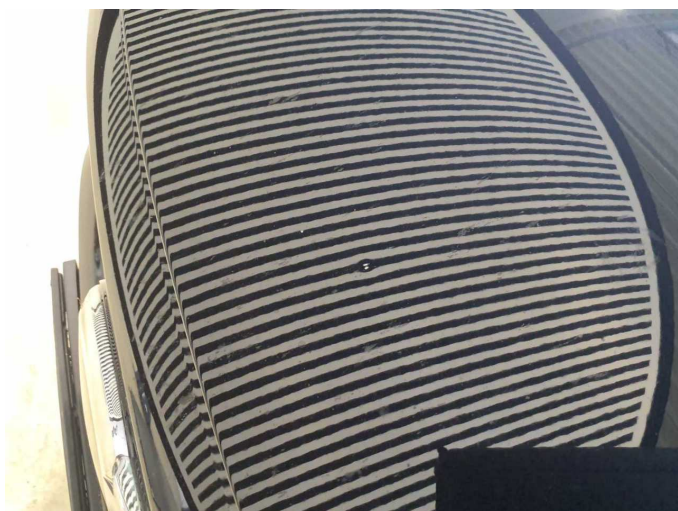

Damage 12: Bonnet: Bonnet (Anätzung) - Paint defect - Repair and paint




Damage 13: Vehicle glazing: Windscreen - Stone chips - Replace

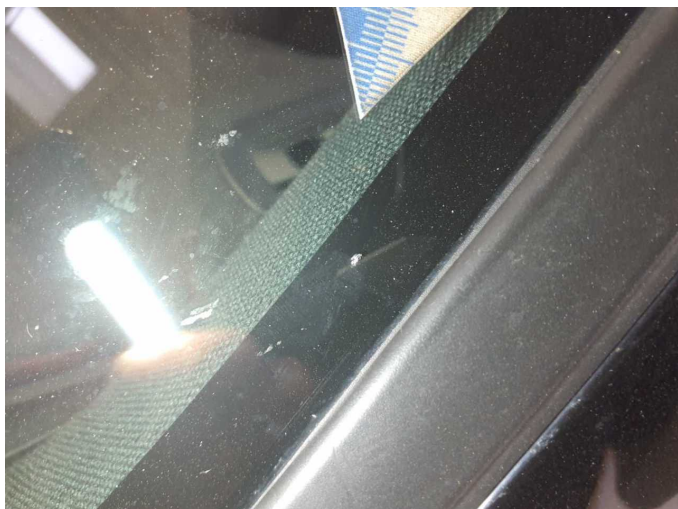

Damage 13: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 13: Vehicle glazing: Windscreen - Stone chips - Replace

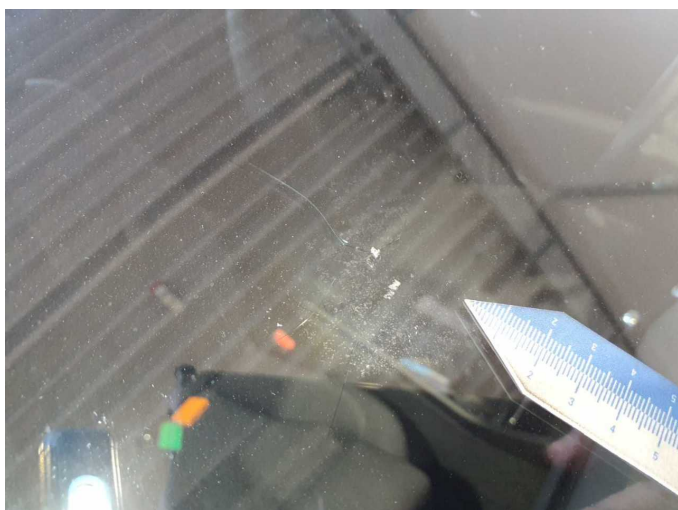

Damage 13: Vehicle glazing: Windscreen - Stone chips - Replace



Wear and tear 4: Mudguard - left side: Mudguard - left side - dent(s) - No deduction



Wear and tear 4: Mudguard - left side: Mudguard - left side - dent(s) - No deduction