



Expertise

Protocol number: 46402449
Order No. / Reference: 26671326
Inspection date: 8 Jul 2026

Manufacturer: Skoda
VIN: TMBJG7NX5MY173339

Model: Octavia Combi 2.0 TDI Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 2.0 TDI Style	
Vehicle Identification number	TMBJG7NX5MY173339
Mileage (Read)	102,892 km
First registration	10 Jun 2021
Number of holders	1
Next periodical technical inspection	06/2026
(Report on hand)	
Power / Engine displacement	85 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Moon-Weiß Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	12,800 km
Last service on / at	11/2025 at 88,964 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GD051716
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWK 00131		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,940 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Dunlop	5mm / 5mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Dunlop	8mm / 8mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 91V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	205/55 R17 91V	Summer tyres on Light alloy	Dunlop	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
Tirefit		Expiration date 04/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartment in the luggage compartment with cargo element
- Airbag for driver and front passenger (passenger airbag can be deactivated)
- Airbag, driver's knee airbag
- Airbag, head airbags
- Airbag, front side airbags
- Ambient lighting (dashboard, front trim strips and footwell with selectable color climate) in the interior as well as logo projector on the outside)
- Automatically dimming exterior mirror (driver's side)
- Exterior mirrors with memory function (boarding spots in the exterior mirrors as well as memory function and mirror lowering)
- Hill start assist including auto-hold function
- Glasses compartment in the headliner
- Roof rails, anodized
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant (Coming Home / Leaving Home function)
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection
- Transmission: 6-speed manual transmission
- Green tec: Start/stop system including brake energy recuperation
- Heated rear window
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Electronic child safety lock
- Removable boot cover
- Headrests (5) front and rear height adjustable
- Paint finish: Solid
- LED fog lights
- LED license plate lights
- Remote release of the rear seat backrests in the trunk
- Steering wheel: Leather steering wheel with multifunction buttons (leather steering wheel and gearshift lever with leather elements - infotainment and driver assistance system operation)
- Front and rear parking sensors
- Radio: Bolero music system with capacitive 10" color display
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Tire mobility kit (tire repair spray incl. compressor)
- Electromechanical power steering
- Seat belts (Three three-point seat belts in the rear)
- Seats: Heated front seats
- Seats: Height-adjustable driver and passenger seats (including lumbar support)
- Storage compartments (Four roof grab handles, rear with coat hooks; holder for the warning vest under the driver's seat; storage compartments in the front door panels with 1.5l bottle holders; storage compartments in the rear door panels with 0.5l bottle holders; ticket holder on the windshield; coat hooks on the B-pillars; storage compartments in the doors with felt lining)
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Center section of the dashboard with fabric covering
- Electrically adjustable and heated exterior mirrors
- Electrically folding exterior mirrors
- Heated windshield washer nozzles including 5l washer fluid reservoir
- Hydraulic brake assist (HBA)
- Grey headliner
- Diesel particulate filter
- Tachometer
- Electronic parking brake
- Electronic Stability Control (ESC)
- Driving profile selection
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Cruise control system
- Tinted windows
- Rear lights with crystal glass look and animated turn signals
- Rear window wiper including windshield washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (2-zone) (fully automatic, separately adjustable for driver and front passenger and anti-allergen filter & activated carbon filter - air-conditioned and illuminated glove compartment)
- LED taillights
- LED headlights with LED daytime running lights
- Steering wheel: height and reach adjustable
- Manual headlight range adjustment
- Rear center armrest with pass-through option
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Upholstery: Cloth
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: 8 speakers
- Radio accessories: Voice control
- Tire pressure monitoring
- Wheels: 17" alloy wheels Rotare AERO (7J x 17, ET 46 with tires 205/55 R17)
- Safety lights in the front side doors
- Seats: Electrically adjustable front seats with memory function
- Seats: Rear seat backrest split 60:40, foldable
- Speed limiter



- SKODA Care Connect (SOS emergency call function (Emergency Call incl. automatic activation in the event of an accident with airbag deployment), Mobility service (connection for rapid assistance in case of breakdown), Information service (connection to the hotline for all questions relating to vehicle functions), Free remote vehicle access for 1 year (Remote Access) with access to vehicle data and functions via smartphone, e.g. parking position, activating hazard warning lights, current fuel level)
- Lashing eyes in the trunk
- Central locking including remote control integrated into the key and EASY Start

- Lane keeping assistant (Lane Assist)
- Lane change and parking assist
- 12V socket in the trunk
- Telephone: Phonebox with inductive charging function (connection via external antenna)
- Phone: SmartLink (MirrorLink, Apple CarPlay, Android Auto)
- Phone: Wireless SmartLink for Apple CarPlay
- Bluetooth hands-free phone system
- Immobiliser

Extra equipment

- Package: Comfort (3-zone Climatronic - Sunset (dark tinted rear window and rear side windows) - Acoustic glazing in the front side windows - Heated front and outer rear seats - Heated steering wheel)
- Package: Travel (Traveller assistance system: - Traffic sign recognition - Predictive and adaptive cruise control (pACC) - Adaptive lane keeping assist - Capacitive steering wheel with hands-off detection - Adaptive cruise control (ACC) (control range 210 km/h) - Driver fatigue detection - Driving profile selection - Automatically dimming exterior mirror (driver's side))

- Heated windscreen
- Package: Infotainment Columbus Plus (Combi) (Columbus navigation system - Infotainment Online (3-year term) - Head-Up Display - Luggage net partition)
- Package: Lights (cornering lights in the fog lights - headlight cleaning system - high beam assist - LED ambient lighting)
- Paint finish: Pearl effect
- Swiveling trailer hitch including trailer stabilization and adapter

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (Verspätet Durchgeführt) - No deduction
2	Mudguard - left side	Mudguard - left side - Soiled - Conditioning
3	Equipment	Tirefit filler - Due - Replace
4	Sill - right side	Sill - dent(s) - Smooth repair work
5	Door - rear right side	Door - dent(s) - Smooth repair work
6	2nd wheel set	1 tyre - Broken / torn - Replace
7	Misc.	Main inspection - Due - Perform
8	Front bumper	Front bumper - Scratch(es) - Smart repair
9	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
10	Rear bumper	Rear bumper - Scratch(es) - Paint
11	Bonnet	Bonnet (Rostunterwandert) - Stone chips - Paint
12	Vehicle glazing	Windscreen - Stone chips - Replace



Wear and tear

No.	Component group	Description
1	Trim / covers	Floor mats - Broken / torn - No deduction
2	Body	Underbody panelling - Scratch(es) - No deduction
3	Side panel - rear left side	Side panel - dent(s) - No deduction
4	Door - front right side	Door - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Umbrella

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

-Der montierte Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

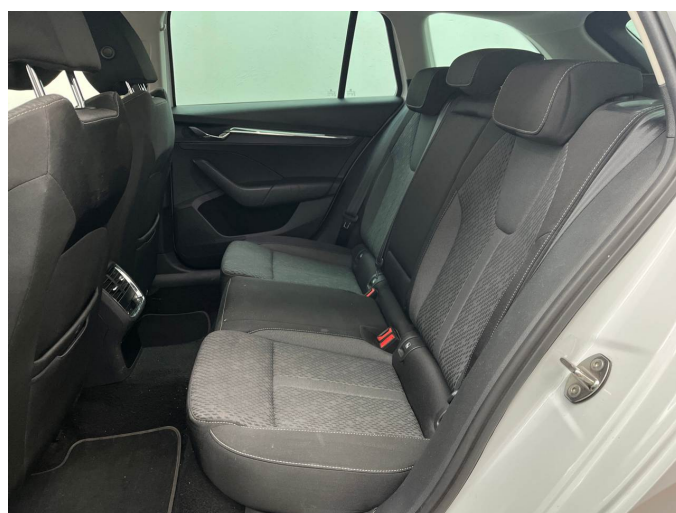


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

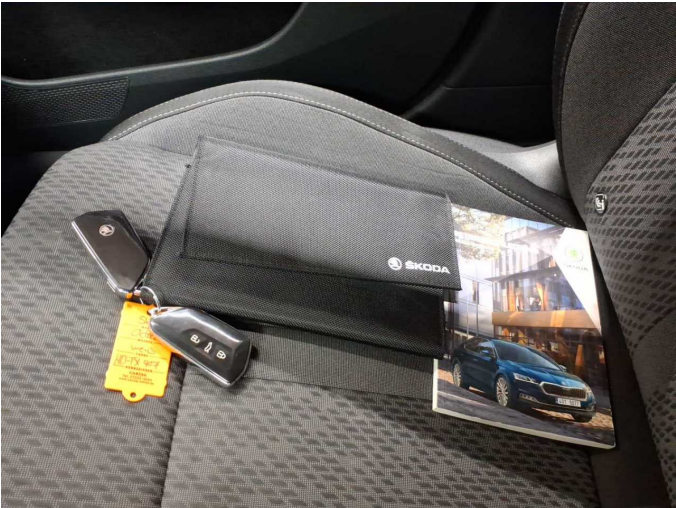


Figure 13: Documents

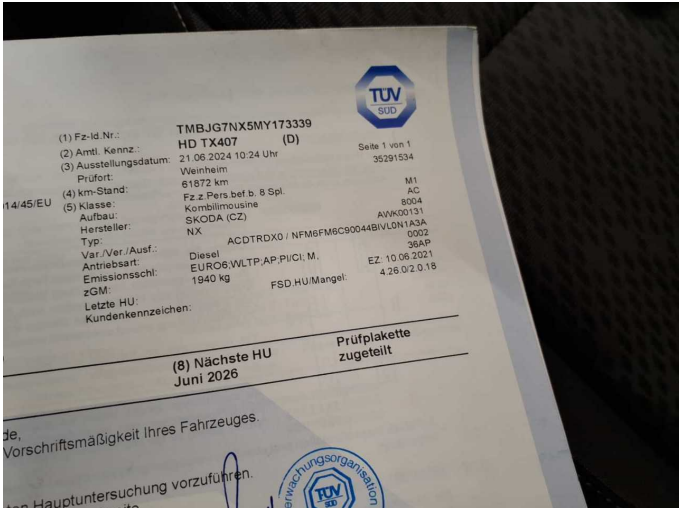


Figure 14: Documents

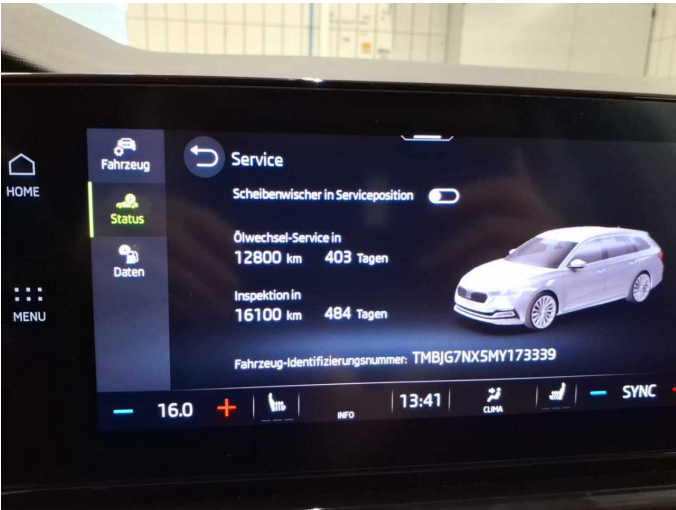


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.

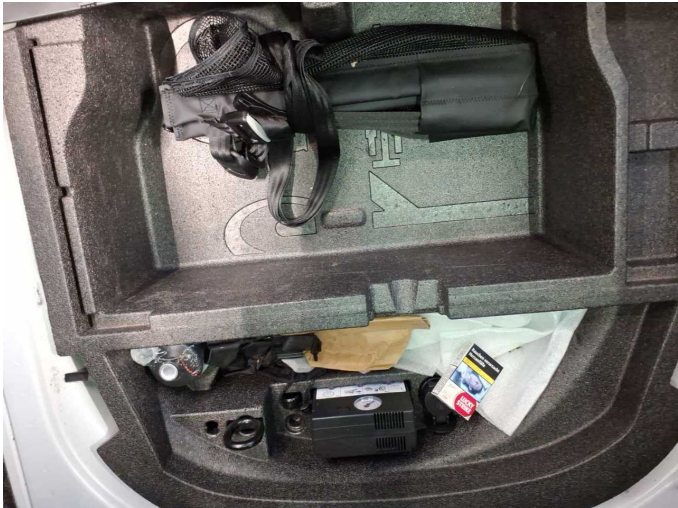


Figure 20: Misc.

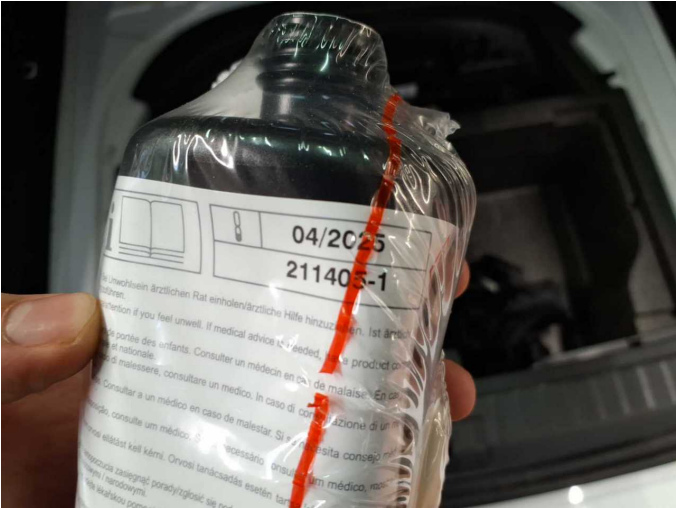


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.

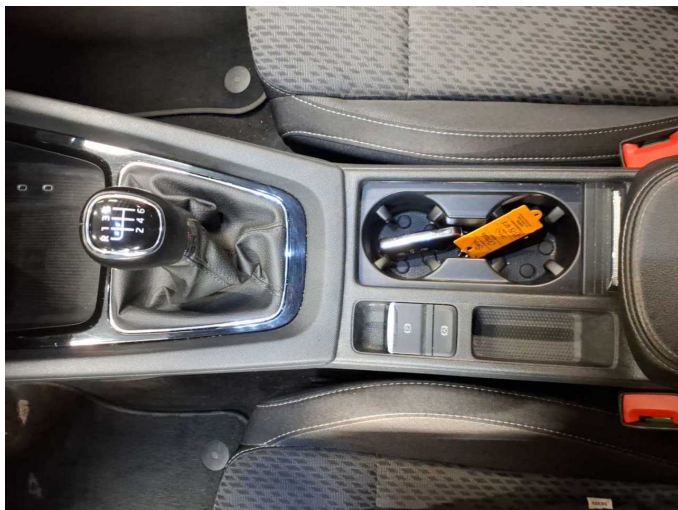


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

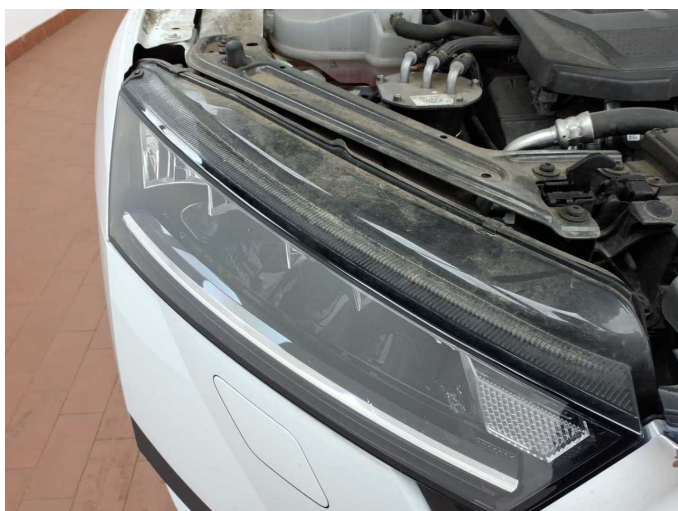


Figure 29: Misc.




Figure 30: Misc.



Figure 31: Misc.




Figure 32: Misc.

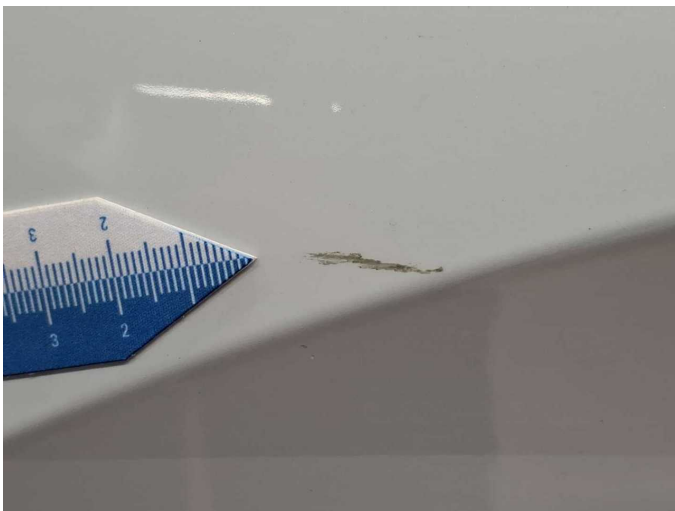

Damage 2: Mudguard - left side: Mudguard - left side - Soiled - Conditioning



Damage 2: Mudguard - left side: Mudguard - left side - Soiled - Conditioning

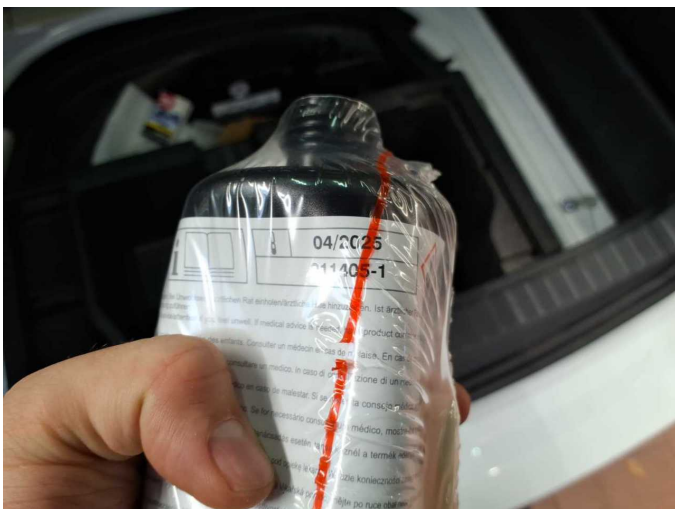

Damage 3: Equipment: Tirefit filler - Due - Replace



Damage 4: Sill - right side: Sill - dent(s) - Smooth repair work



Damage 4: Sill - right side: Sill - dent(s) - Smooth repair work



Damage 5: Door - rear right side: Door - dent(s) - Smooth repair work




Damage 5: Door - rear right side: Door - dent(s) - Smooth repair work



Damage 6: 2nd wheel set: 1 tyre - Broken / torn - Replace



Damage 6: 2nd wheel set: 1 tyre - Broken / torn - Replace

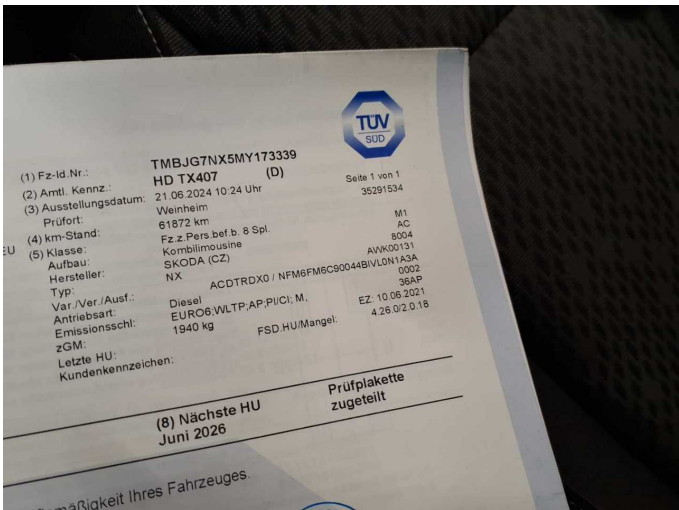

Damage 7: Misc.: Main inspection - Due - Perform



Damage 8: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 8: Front bumper: Front bumper - Scratch(es) - Smart repair



Damage 9: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 9: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 10: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 11: Bonnet: Bonnet (Rostunterwandert) - Stone chips - Paint




Damage 11: Bonnet: Bonnet (Rostunterwandert) - Stone chips - Paint



Damage 11: Bonnet: Bonnet (Rostunterwandert) - Stone chips - Paint



Damage 11: Bonnet: Bonnet (Rostunterwandert) - Stone chips - Paint

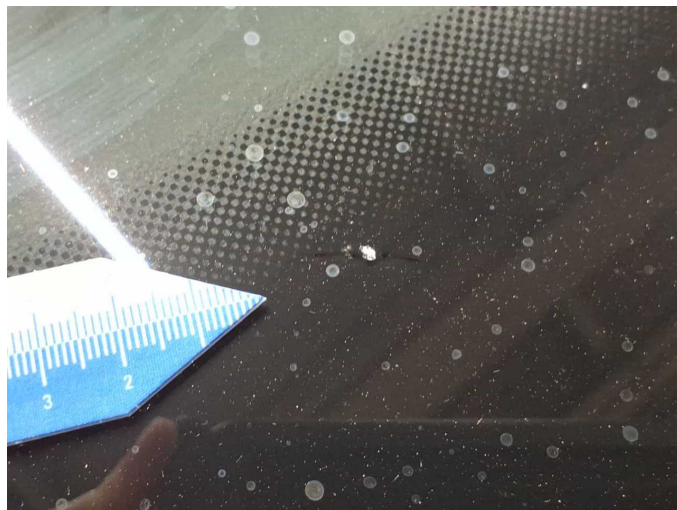

Damage 12: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 12: Vehicle glazing: Windscreen - Stone chips - Replace



Wear and tear 4: Door - front right side: Door - dent(s) - No deduction



Wear and tear 4: Door - front right side: Door - dent(s) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJG7NX5MY173339

Hersteller / Modell: SKODA SKODA Octavia Combi 2.0 TDI Style

Datum	KM-Stand	Beschreibung
24.01.2026	88.967	Systemtest/Eigendiagnose
05.11.2025	88.964	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
24.06.2024	61.875	AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Wartung Sonstiges
31.01.2023	31.213	Motoröl b. Wartung; Regelwartungsdienst