



Expertise

Protocol number: 46506214
Order No. / Reference: 26664323
Inspection date: 14 Jul 2026

Manufacturer: Opel

Model: Crossland 1.5 Diesel Ultimate

VIN: W0V7H9EN9N4164580



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Crossland 1.5 Diesel Ultimate	
Vehicle Identification number	W0V7H9EN9N4164580
Mileage (Read)	165,939 km
First registration	12 Apr 2022
Number of holders	1
Power / Engine displacement	81 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Mondstein Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Anthracite



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	5 Monat(e)
Last service on / at	12/2025 at 151,708 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ650701
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AMH 00104		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,835 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/65 R15 91H	Winter tyres on Light alloy	Goodyear	5mm / 5mm
2)	195/65 R15 91H	Winter tyres on Light alloy	Goodyear	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/50 R17 95W	Summer tyres on Light alloy	Michelin	7mm / 7mm
2)	215/50 R17 95W	Summer tyres on Light alloy	Michelin	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments
- Airbag: Front and rear outer head airbags
- Anti-lock braking system (ABS)
- Electrically adjustable, heated and foldable exterior mirrors for driver and passenger side
- third brake light
- Roof rails, silver
- Diesel particulate filter (DPF) maintenance-free
- Electronic brake force distribution (EBD)
- Electric rear windows
- Functional equipment
- Transmission: 6-speed manual transmission
- Back window, heater
- Interior lighting
- Rear headrests (3)
- LED ambient lighting
- LED headlights
- Steering wheel: Heated leather steering wheel and seat heating, multi-stage, driver and passenger
- Headlight range adjustment, manual
- Navigation system: Multimedia Navi Pro with 8" color touchscreen display, voice control for audio, telephone, navigation
- Proactive driver assistance system
- Radio: Digital radio reception DAB/DAB+/DMB-R
- Tire pressure warning
- Power steering
- Visibility equipment
- Solar Protect thermal insulation glazing
- Start/Stop System
- Traction control (TC Plus)
- Traffic sign assistant
- Immobiliser
- Heat-insulating glazing, tinted
- Airbag for driver and passenger side
- Airbag: Side airbag for driver and front passenger side
- Armrest, driver
- Hill Start Assist
- On-board computer
- Roof design line, above, in chrome
- Roof spoiler
- Tachometer
- Electronic Stability Program (ESP Plus)
- Electric front windows
- Speed controller with limiter
- Head-Up Display
- rear window wiper
- Automatic climate control, two zones
- Front headrests
- LED taillights
- LED daytime running lights
- Steering wheel: Leather steering wheel with chrome elements and steering wheel remote control
- Center armrest, front
- Fog light
- Opel Connect
- Upholstery: Alcantara trim
- Quickheat rapid heating system
- Tire repair kit
- Keyless locking and starting system Keyless Open & Start
- Seat belts: Three-point seat belts in all seats
- Seats: Seat backrest split 60:40, foldable
- Lane Assist
- 12V power outlet in the center console
- Underride protection look, front and rear, in silver
- Pre-installation for child seat mounting system "ISOFIX"
- Heated windscreen, ThermoTec
- Central locking with remote control

Extra equipment

- IntelliGrip (Adaptive traction system with 5 selectable modes: - ESP off - ESP standard - Snow mode - Mud mode - Sand mode)
- Wheels: Alloy wheels 6.5 J x 17 with tires 215/50 R17, in black (5 double spokes)
- Paint finish: Metallic
- Radio accessories: Premium Sound System (6 speakers, 1 subwoofer box in the luggage compartment)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Interior	Interior (Schimmelgeruch) - Odour - Ozone treatment

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Interior	Interior - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Interior - Rear shelf

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Side - left, Side right, Professionally repaired, Invoice of repair done	Non-existent

Repainting

No. Repainting

1	Bonnet, Door - rear right side, Door - front left side, Door - front right side, Professionally carried out, Invoice of repair done	Non-existent
---	---	--------------

Paint coat thickness measurement

Bonnet	333 µm	Door - rear right side	199 µm
Door - front left side	216 µm	Door - front right side	226 µm



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

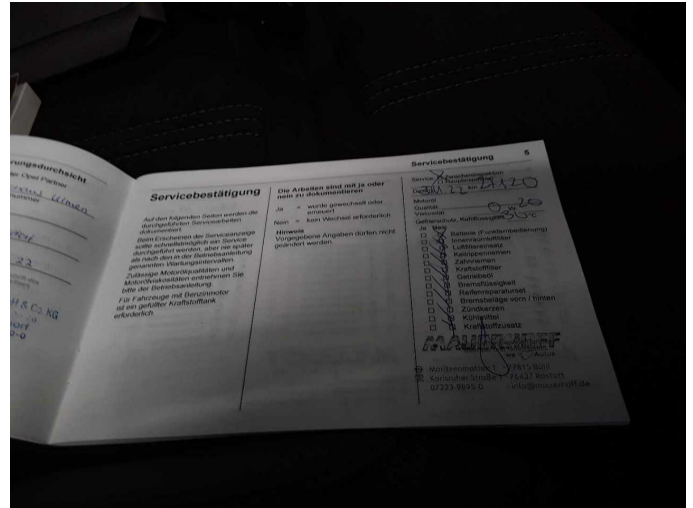


Figure 14: Documents

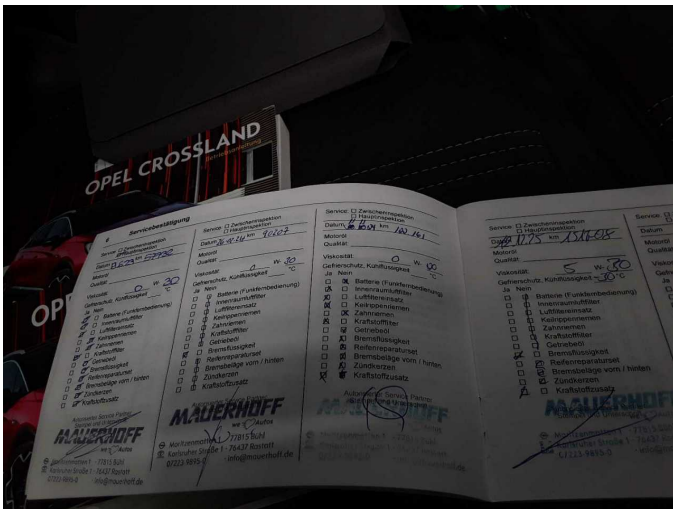


Figure 15: Documents

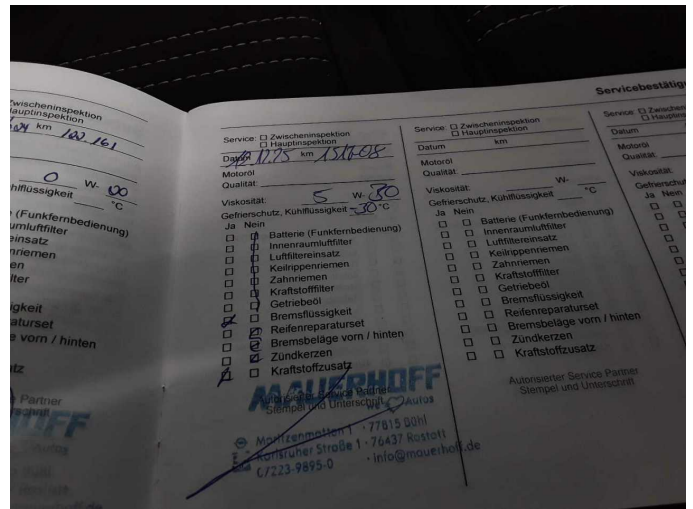


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Repainting 1: Bonnet, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Bonnet, Door - rear right side, Door - front left side, Door - front right side




Repainting 1: Bonnet, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Bonnet, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Bonnet, Door - rear right side, Door - front left side, Door - front right side

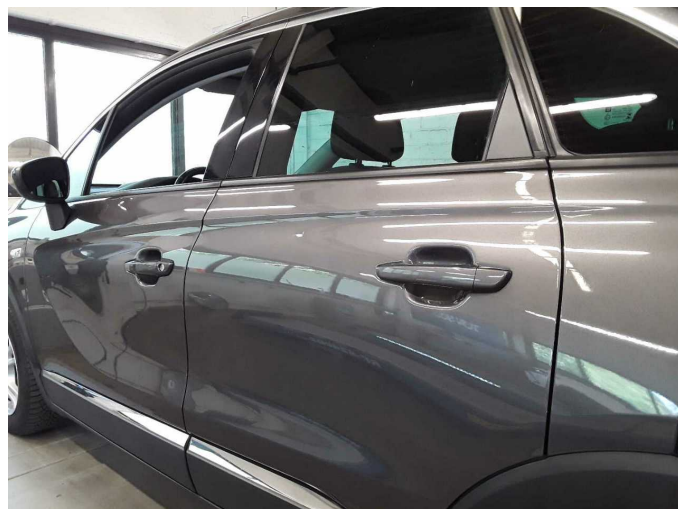

Repainting 1: Bonnet, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Bonnet, Door - rear right side, Door - front left side, Door - front right side



Repainting 1: Bonnet, Door - rear right side, Door - front left side, Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0V7H9EN9N4164580
Hersteller / Modell: OPEL OPEL Crossland 1.5 Diesel Ultimate

Datum	KM-Stand	Beschreibung
05.02.2026	153.299	Reparatur Sonstiges; Systemtest/Eigendiagnose; Turbolader ern
12.12.2025	151.708	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.09.2025	129.087	Systemtest/Eigendiagnose
07.04.2025	129.087	HU + AU
30.01.2025	122.161	Systemtest/Eigendiagnose
30.12.2024	122.161	Systemtest/Eigendiagnose
28.11.2024	122.161	Keilrippenriemen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
26.02.2024	90.207	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.06.2023	57.732	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Regelwartungsdienst
14.12.2022	27.120	Motoröl b. Wartung; Regelwartungsdienst