



Expertise

Protocol number: 46177634
Order No. / Reference: 26550478
Inspection date: 26 Jun 2026

Manufacturer: Audi

Model: A6 50 TFSI e quattro S tronic design

VIN: WAUZZZF29PN049699



Vehicle details	
Manufacturer / Type / Model / Equipment	
Audi A6 50 TFSI e quattro S tronic design	
Vehicle Identification number	WAUZZZF29PN049699
Mileage (Read)	89,222 km
First registration	13 Mar 2023
Number of holders	1
Next periodical technical inspection	03/2028
(Report on hand)	
Power / Engine displacement	195 kw / 1,984 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufll / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	All-wheel drive
Type of vehicle	Saloon car
Colour / colour code	Camouflage-Grün Metallic
Doors / Seats	4 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	25,800 km
Last service on / at	03/2026 at 85,439 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS427456
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0588 / BZC 00874		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,610 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Winter tyres on Light alloy	Michelin	5mm / 5mm
2)	225/55 R18 102V	Winter tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102Y	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	225/55 R18 102Y	Summer tyres on Light alloy	Michelin	3mm / 3mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Airbag for driver and front passenger
- Acoustic vehicle warning system
- Anti-lock braking system (ABS)
- Audi connect emergency call & service m.connect Remote & Control (TFSI e)
- Audi virtual cockpit
- Exterior mirror housings in body color
- Fabric headliner
- Tachometer
- Door sills with aluminum inlay front and rear
- Electronic Stability Control (ESC)
- Driver information system with color display
- key fob
- Automatically opening luggage compartment lid/manually opening luggage compartment lid
- Cruise control system including speed limiter
- Transmission: S tronic 7-speed
- Instrument panel and door trim, two-piece, single/multi-color
- 4-zone automatic climate control
- Headrests (4)
- AC Type 2 charging socket
- LED headlights
- Steering wheel: Double-spoke leather steering wheel with multifunction and paddle shifters
- Steering column, manually adjustable in height and axis
- MMI navigation with MMI touch response
- Ambient lighting package
- Non-smoking package
- Wheel: Alloy wheels, multi-spoke design
- Wheel: Tire repair kit
- Radio accessories: Audi sound system
- Seats: Standard front seats
- Sun visor on driver and passenger side
- Stationary air conditioning
- Phone: Audi smartphone interface
- Glazing: Rear window, rear door and side windows in clear glass
- Central locking
- Airbag: Front side airbags and head airbag system
- "quattro" all-wheel drive with ultra technology
- Audi connect navigation & infotainment
- Audi drive select
- Audi pre sense front
- Electrically adjustable and heated exterior mirrors
- third brake light
- Decorative inlays aluminum fragment
- e-tron compact charging system (designed for charging at wall sockets, a so-called Mode 2 charging system. It consists of a control unit including a vehicle connection cable and two different mains connection cables (with household and industrial plugs). - Manual switching between 100% and 50% charging power - LEDs indicate the status of the charging system and the charging process. - Charging power at your vehicle up to 7.4 kW.)
- Interior mirror dimming
- Interior elements in faux leather above
- ISOFIX child seat attachment and Top Tether for the outer rear seats
- Paint finish: Solid
- Mode 3 charging cable (charging cable for charging at public AC charging stations (Type 2). The cable connects the charging station to the vehicle's AC charging port and enables a charging power of up to 7.4 kW at your vehicle.)
- front center armrest
- Otto particulate filter
- Package Gloss
- Progressive steering
- Wheel: Tire pressure monitoring system
- Radio: MMI Radio plus with MMI touch response
- Seat covers in Essenz/mono.pur 550 fabric combination (for standard seats)
- Lane Departure Warning
- Start-stop system
- Glazing: Windscreen in heat-insulating glazing
- Electronic immobilizer
- Thermal insulation glazing on the sides and rear

Extra equipment

- Business Package (Assistance Package Tour: Adaptive Driving Assistant supports the driver with acceleration, braking, maintaining speed and distance, and lane keeping. Adaptive Cruise Control, Speed Limiter. Efficiency Assistant supports the driver with predictive driving. Parking Aid Plus, 4-zone automatic climate control, heated front seats, Audi phone box, automatically dimming interior mirror, automatically dimming exterior mirrors, adaptive windscreen wipers with integrated washer nozzles, high-beam assistant)
- Comfort stationary climate control (cools or heats the interior as needed before driving for a high level of climate comfort right from the moment you get in. Stationary climate control can be programmed or activated via the MMI or smartphone app, regardless of whether the vehicle is charging at the time. A "short climate control" cycle can be started when unlocking the vehicle with the remote key. Additional seat heating and ventilation, steering wheel and glass surface heating can be activated if these optional equipment has been selected.)
- Parking aid plus with surround view (acoustic and visual parking aid front, side and rear to assist with parking and maneuvering by measuring with 12 ultrasonic sensors. A selective visual display shows the distance to detected objects in the upper display, depending on the current steering angle and the direction of travel. Optionally, activation occurs automatically as soon as the vehicle approaches a detected obstacle at a speed of less than 10 km/h).
- Seats: Split-folding rear seat backrest (pronounced outer rear seats, visually adapted to the front seats, and an additional central seat option - 3 L-shaped rear headrests, manually height-adjustable for good rear visibility - three 3-point seat belts - rear seat backrest split 40:20:40 or fully foldable - one-piece, foldable rear center armrest with storage compartment)
- Steering wheel: Leather steering wheel in 3-spoke design with multifunction plus, shift paddles and steering wheel heating (height and distance of the steering wheel are manually adjustable - leather of the steering wheel and gear selector knob is color-matched to the selected color of the dashboard top - 12 multifunction buttons for convenient operation of the available infotainment features - shift paddles for manual changing of the driving modes)
- Swiveling towbar with electric release (with swiveling ball head, trailer stabilization via electronic stability control (ESC), release via button in the luggage compartment, the integrated swiveling system socket allows continuous operation of electrical devices in the trailer or caravan while driving)
- Comfort key with sensor-controlled luggage compartment unlocking (The vehicle can be opened by operating the door handle without actively using the key. To lock the vehicle from the outside, simply touch one of the sensor buttons on the door handles. The drive authorization is also activated without actively using the comfort key. The driver must be inside the vehicle and have the comfort key with them. The engine is started and stopped using the engine start/stop button in the center console.)
- Electrically adjustable, heated and folding exterior mirrors, automatically dimming on both sides (including curb view function for the passenger-side exterior mirror with integrated LED turn signal, including heated windshield washer nozzles, aspherical mirror glass. The curb view function tilts the passenger-side exterior mirror downwards when reverse gear is engaged, providing the driver with a better view of the curb.)
- Front seat heating (heats seat and backrest center panels; with leather upholstery, sport seats and sport seats plus also seat side bolsters - individually adjustable in multiple stages for driver and front passenger side via the climate control unit)
- High beam assist (within the system's limits, it automatically detects oncoming headlights, taillights of other road users, and built-up areas. Depending on the traffic situation, the high beam is automatically switched on or off.)
- Package: Audi phone box opt-out package
- Paint finish: Audi exclusive individual paint finish
- Tour Assistance Package (Adaptive Driving Assistant - Adaptive Cruise Control, Speed Limiter - Efficiency Assistant supports the driver in anticipatory and therefore fuel-saving driving - Evasive Steering Assist helps the driver to steer the vehicle around an obstacle in a critical situation - Turning Assist - Emergency Assist - High Beam Assist - Camera-based Traffic Sign Recognition)
- Wheel: Audi new car tire warranty (36-month term from vehicle handover to the first customer)
- Wheel: Tire pressure monitoring system (Sensors monitor the set tire pressure of the wheels while driving, even with factory-fitted winter tires. Visual and audible warnings are issued in case of pressure loss in one or more wheels; the information is displayed in the driver information system or Audi virtual cockpit (plus) and MMI. The status of the tire pressures and temperatures of the individual wheels is displayed in the MMI system while driving.)
- Wheel: Winter alloy wheels, 5-arm design (8 J x 18 with tires 225/55 R 18)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Front bumper	Front bumper - Scratched - Smart repair
2	Rear bumper	Rear bumper - Scratch(es) - Smart repair
3	Door - front right side	Door - Deformed - Repair and paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

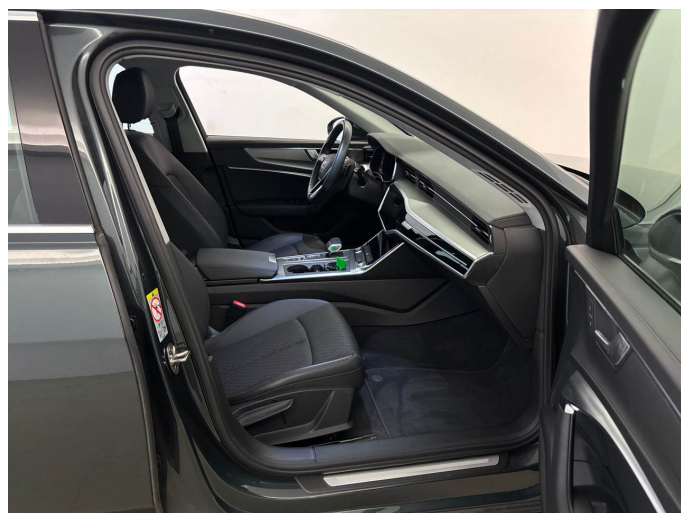


Figure 5: Interior - front

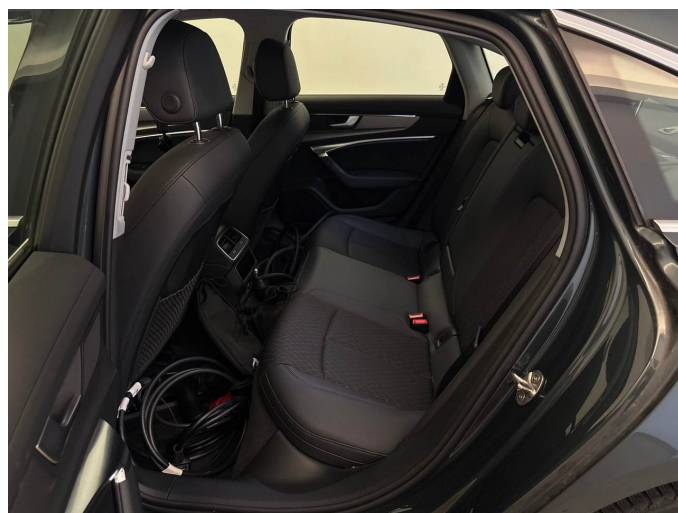


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: Cargo area

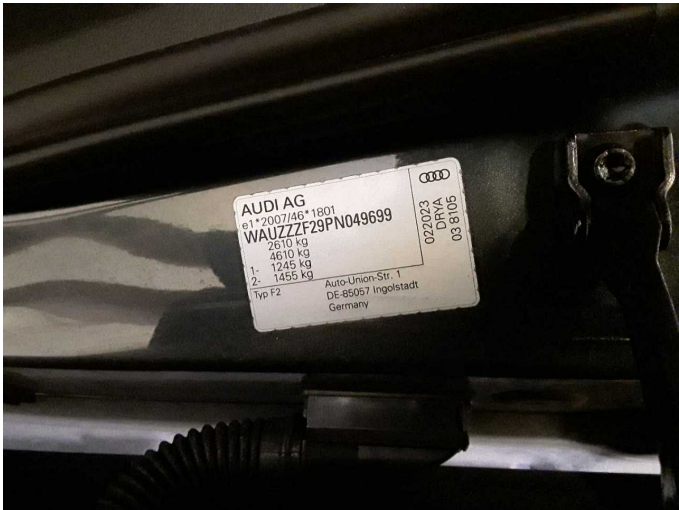


Figure 12: VIN



Figure 13: Mounted tyres



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.


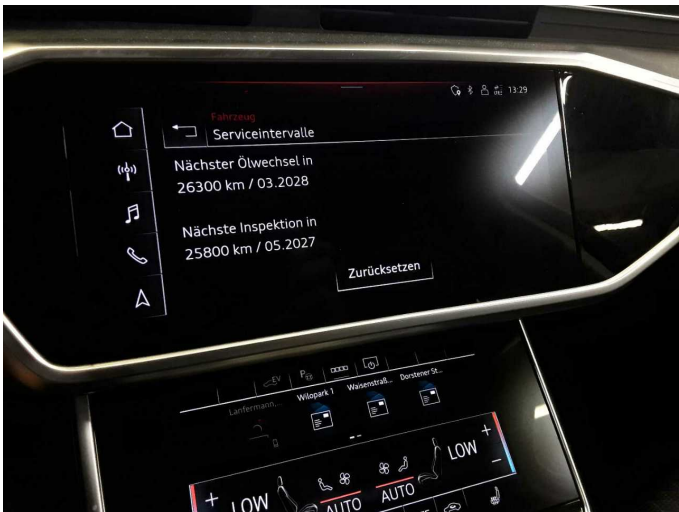


Figure 30: Misc.



Damage 1: Front bumper: Front bumper - Scratched - Smart repair

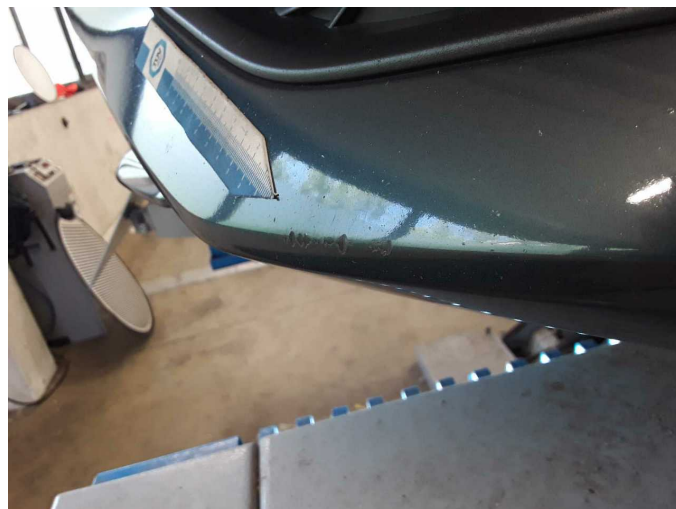

Damage 1: Front bumper: Front bumper - Scratched - Smart repair




Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Door - front right side: Door - Deformed - Repair and paint

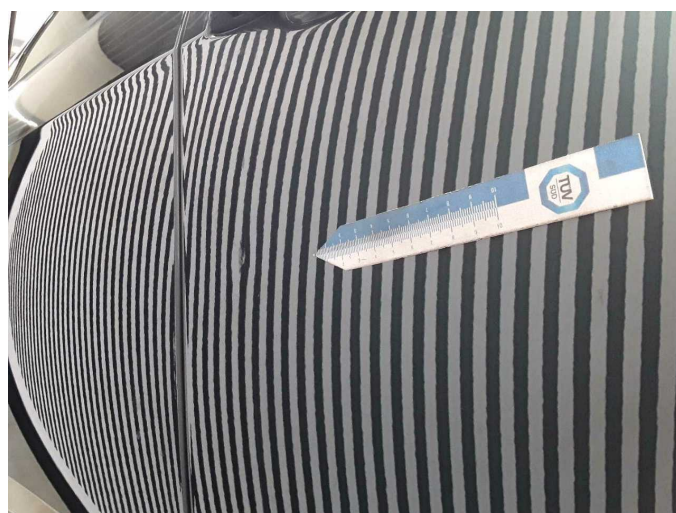

Damage 3: Door - front right side: Door - Deformed - Repair and paint



Damage 3: Door - front right side: Door - Deformed - Repair and paint



Wear and tear 1: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Vehicle glazing: Windscreen - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WAUZZZF29PN049699

Hersteller / Modell: AUDI AUDI A6 50 TFSI e quattro S tronic design

Datum	KM-Stand	Beschreibung
25.03.2026	85.439	HU + AU; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
07.05.2025	58.878	Bremsflüssigkeit; Bremsflüssigkeit ern; Getriebeöl ern/prüfen; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
21.05.2024	29.281	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges