



Expertise

Protocol number: 46273215
Order No. / Reference: 26678538
Inspection date: 2 Jul 2026

Manufacturer: Skoda
VIN: TMBJJ9NXXMY103056

Model: Octavia Combi 2.0 TDI DSG First Edition



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Octavia Combi 2.0 TDI DSG First Edition	
Vehicle Identification number	TMBJJ9NXXMY103056
Mileage (Read)	167,625 km
First registration	8 Feb 2021
Number of holders	1
Next periodical technical inspection	03/2028
(Report on hand)	
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Black-Magic Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	149 Tag(e)
Last service on / at	04/2026 at 162,776 km		
Key is / should be	3 / 3	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GA496118
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AWL 00044		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,990 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 91Y	Summer tyres on Light alloy	Pirelli	5mm / 5mm
2)	225/45 R18 91Y	Summer tyres on Light alloy	Goodyear	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 92H	Winter tyres on Light alloy	Goodyear	3mm / 3mm
2)	205/60 R16 92H	Winter tyres on Light alloy	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
N	125/70 R18 99M	Summer tyres on Steel	Sonstige	4 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag, driver's knee airbag
- Airbag, front side airbags
- Traction control (ASR)
- Automatically dimming exterior mirror (driver's side)
- Exterior mirrors with memory function
- Heated windshield washer nozzles including 5l washer fluid reservoir
- Grey headliner
- Digital instrument cluster (Virtual Cockpit) 10.2"
- Third brake light
- Electronic transverse differential lock (XDS+)
- Driving light assistant
- Electric windows front and rear, including anti-pinch protection and child safety lock
- Transmission: 7-speed dual-clutch transmission (DSG)
- Green tec: Start/stop system including brake energy recuperation
- Heated rear window
- Interior mirror automatically dimming
- Kessy, keyless entry and start-stop system
- Electronic child safety lock
- Removable boot cover
- LED taillights
- Manual headlight range adjustment
- Front center armrest, including storage compartment
- Front and rear parking sensors
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: Voice control
- Tire pressure monitoring
- Seat belts
- Seats: Heated front seats
- Seats: Height-adjustable driver and passenger seats
- Seats: Rear seat backrest split 60:40, foldable
- Speed limiter
- Lane keeping assistant (Lane Assist)
- Lane change and parking assist as well as exit warning
- 12V socket in the trunk
- Telephone: Phonebox with inductive charging function (connection via external antenna)
- Phone: SmartLink (MirrorLink, Apple CarPlay, Android Auto)
- Phone: Wireless SmartLink for Apple CarPlay
- Bluetooth hands-free phone system
- Immobiliser
- Airbag, driver and passenger
- Airbag, head airbags
- Anti-lock braking system (ABS)
- Center section of the dashboard with fabric covering
- Electrically adjustable and heated exterior mirrors
- Electrically folding exterior mirrors
- Hill start assist including auto-hold function
- Hydraulic brake assist (HBA)
- Diesel particulate filter
- Tachometer
- Electronic parking brake
- Electronic Stability Control (ESC)
- Driving profile selection
- Front radar assistant including city emergency braking function and pedestrian and cyclist detection
- Tinted windows
- Rear lights with crystal glass look and animated turn signals
- Rear window wiper including windshield washer system
- ISOFIX preparations on the front passenger seat and the outer rear seats including top tether anchorage
- Climatronic air conditioning (2-zone)
- Headrests (5) front and rear height adjustable
- Steering wheel: height and reach adjustable
- Rear center armrest with pass-through option
- Engine drag torque control (MSR)
- Upholstery: Cloth
- Radio accessories: Digital radio reception DAB+
- Rain sensor
- Electromechanical power steering
- Safety lights in the front side doors
- Seats: Electrically adjustable front seats with memory function
- SKODA Care Connect (SOS emergency call function (eCall including automatic activation in the event of an accident with airbag deployment), mobility service (connection for rapid assistance in case of breakdown), information service (connection to the hotline for all questions regarding vehicle functions), free remote vehicle access for 1 year with access to vehicle data and functions via smartphone, e.g., parking position, hazard warning lights activation, current fuel level)
- Lashing eyes in the trunk
- Central locking including remote control integrated into the key and EASY Start



Extra equipment

- Option to remove the chrome trim strips on the side windows and the anodized roof rails (replaced with black roof rails)
- Decorative trim in piano black
- Paint finish: Pearl effect
- Package: Columbus Plus Infotainment Package (Combi) (Columbus Navigation System - Infotainment Online (3-year subscription) - Head-Up Display - Electric Tailgate Operation - Comfort Opening - Luggage Net Partition)
- Package: Travel (DSG) (Traveller assistance system: - Traffic sign recognition - Predictive and adaptive cruise control (pACC) - Adaptive lane keeping assist - Emergency and traffic jam assist - Capacitive steering wheel with hands-off detection - Adaptive cruise control (ACC) (control range 210 km/h) - Driver fatigue detection - Driving profile selection - Automatically dimming exterior mirror (driver's side))
- Panoramic sunroof, electric (deletion of the glasses compartment in the headliner)
- Radio accessories: CANTON sound system and 18" steel spare wheel (12 speakers (10 speakers, 1 central speaker, 1 subwoofer in the spare wheel well) - 18" steel spare wheel (tire 125/70 R18) including jack and wheel wrench)
- 230V socket and USB charging port (230V socket and 2 x USB charging ports in the rear as well as USB charging port in the rearview mirror)
- Airbag, rear side airbags & proactive occupant protection with rear impact detection
- Swiveling trailer hitch including trailer stabilization and adapter
- Steering wheel: Heated steering wheel in a sporty design with paddle shifters
- Package: Light & Sight (cornering lights in the fog lights - headlight cleaning system - LED ambient lighting - LED main headlights matrix and dynamic high beam assist (AFS) - taillights in crystal glass look and animated turn signals)
- Package: Simply Clever for variable loading floor (media holder - tablet holder - waste bin - 3rd vehicle key)
- Package: Sport (Combi) (Sport seats in front with integrated headrests - Seat upholstery in fabric and Thermoflux - Black headliner - Stainless steel pedals - Leather steering wheel in sport design and multifunction buttons - Front door sill trims - Sunset (Dark tinted rear window and rear side windows) - Black radiator grille frame and exterior mirrors - Sport suspension - 17" Pulsar AERO alloy wheels, black/gloss-turned, 7J x 17, ET 46 with 205/55 R17 tires - AERO roof rails in black)
- Wheels: 18" Vega AERO alloy wheels, black gloss turned (7.5J x 18, ET 48 with 225/45 R18 tires)
- Variable loading floor in the trunk including organizer and aluminum crossbars
- Heated windscreen

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Body	A-pillar - left side (Korrosion) - Stone chips - Smart repair

Wear and tear

No.	Component group	Description
1	2nd wheel set	2 tyres - does not meet manufacturer specifications - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Roof, Provided by user / customer, from 15 Apr 2024	1.478,99 €



Repainting

No. Repainting

1 Boot lid / rear door, Professionally carried out

Paint coat thickness measurement

Boot lid / rear door 216 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

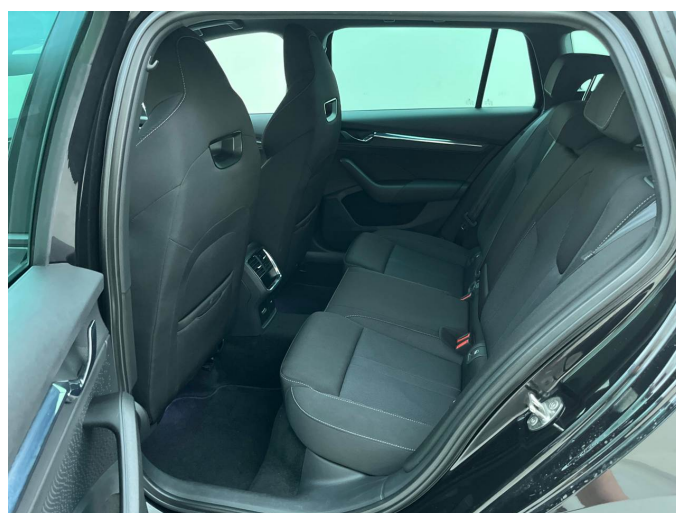


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents

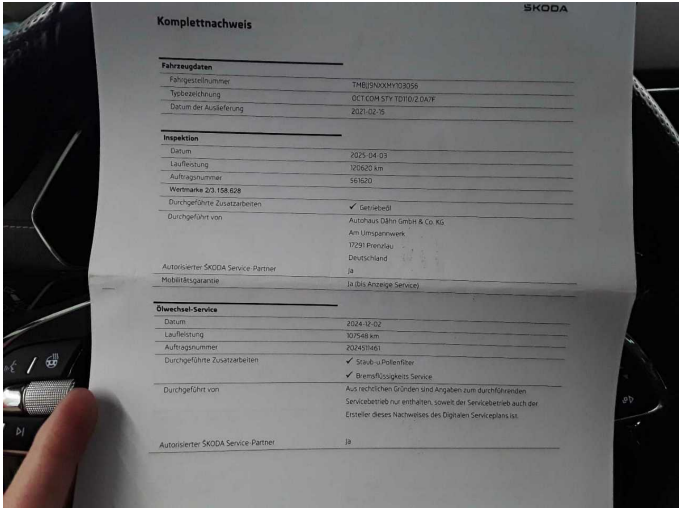


Figure 16: Documents

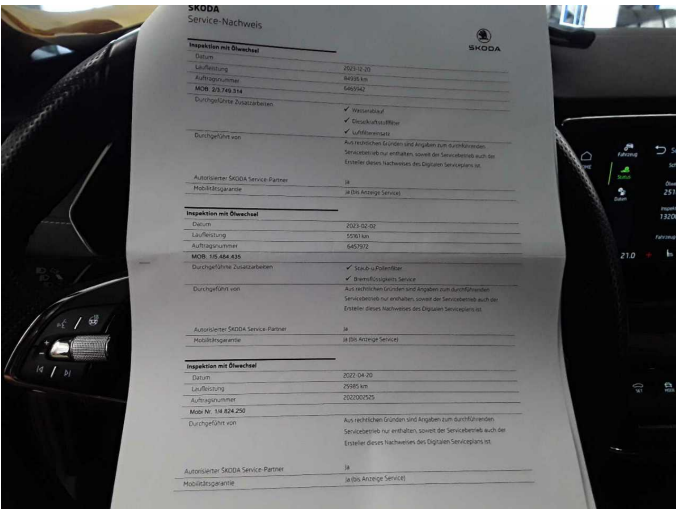


Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

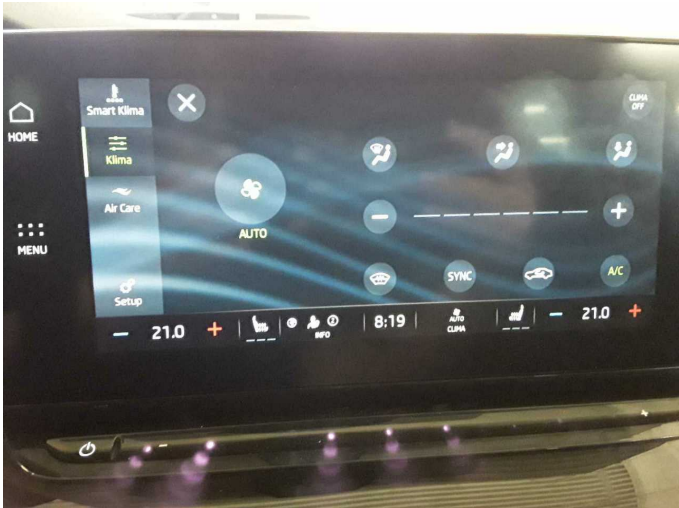


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Damage 1: Body: A-pillar - left side (Korrosion) - Stone chips - Smart repair



Damage 1: Body: A-pillar - left side (Korrosion) - Stone chips - Smart repair



Boot lid / rear door: 216 μm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBJJ9NXXMY103056
Hersteller / Modell: SKODA SKODA Octavia Combi 2.0 TDI DSG First Edition

Datum	KM-Stand	Beschreibung
16.04.2026	162.776	Bremse Sonstiges; Bremsscheiben hinten; Funktionsprüfung; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Reparatur Sonstiges; Systemtest/Eigendiagnose; Wartung Sonstiges
09.03.2026	161.083	HU + AU
28.11.2025	150.796	Regelwartungsdienst; Wartung Sonstiges
04.08.2025	135.633	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
08.04.2025	120.620	Bremse Sonstiges; Getriebeöl ern/prüfen; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
03.12.2024	107.548	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
20.03.2024	90.664	HU + AU
08.01.2024	84.943	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
12.10.2023	81.435	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Systemtest/Eigendiagnose
22.02.2023	55.162	Bremsflüssigkeit ern; Motoröl b. Wartung; Regelwartungsdienst
20.04.2022	25.985	Motoröl b. Wartung; Regelwartungsdienst