



PEUGEOT 3008: FW-769-TS

Vinnumber:	VF3M4DGZULS307770	Versionname:	PEUGEOT 3008 1.6 HYBRID 225 E-EAT8 Allure Pack
First Registrationdate:	27/01/2021	Fiscalpower:	VP [5P] bva 8-225CH-10cv (SUV)
Expertise Mileage:	174766	Power Kw:	165
Bodytype:	SUV	Body colour:	Black
Gearbox:	Automatic	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Plug-in hybrid	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options


Number of keys total	2	Radio	
Number keys remote	2	Central consol F	
GPS big screen color		Luggage cover	
Windows electric F		Headlights Xenon/LED/Laser	
Cruise Control		Front parking sensors	
Steering wheel multifunctional		Rear parking sensors	
Steering wheel leather		Rear view camera	
Type of climate control	Autom climate control	Seat cover lining	Lining Semi-leather

Tyres

	225/55/18/102 V			
Winter tyres:	Fr.L.	Michelin: 55%	Fr.R.	Michelin: 50%
	Re.L.	Michelin: 30%	Re.R.	Michelin: 35%
Tyre profile depth FL				4.5
Tyre profile depth FR				4.9
Tyre profile depth RL				6.1
Tyre profile depth RR				6.0
Tyre size FL				225/55 R 18 102 V
Tyre size FR				225/55 R 18 102 V
Tyre size RL				225/55 R 18 102 V
Tyre size RR				225/55 R 18 102 V
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Outer backrest protection L, Scratch(es), Replace

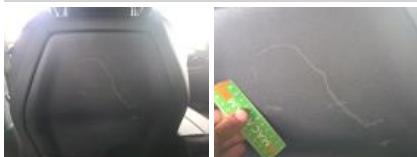

Door panel RL, Scratch(es), Replace



Seat cover FL, Tear, Replace



Tyre FR, Out of tolerance, Replace



Tyre RR, Out of tolerance, Replace



Tyre RL, Out of tolerance, Replace



Tyre FL, Out of tolerance, Replace



Alloy rim RL bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim RR bitone/polychrome, Scratch(es), Repair/replace (lump sum)



Alloy rim FR bitone/polychrome, Scratch(es), Repair/replace (lump sum)





Door FL, Dent(s), Repair and paint (complete)



Door RL, Dent(s), Repair and paint (complete)



Wing trim RL, Unclashed, Dismount/Mount



Bumper moulding F, Deformed / Strained, Replace and paint



Wing trim RR, Unclashed, Dismount/Mount



Door RR, Dent(s), Repair and paint (complete)



Wing trim FR, Scratch(es), Replace



Boot lid covering R, Scratch(es), Replace



Wiper arm rear, Incomplete, Replace



Bumper moulding R, Broken, Replace



Historique Maintenance

Immatriculation: FW-769-TS Date de 1ère immatriculation: 27/01/2021

Modèle: Peugeot 3008 1.6 HYBRID 225 E-EAT8 Allure Pack VP [5P] bva 8-225CH-10cv (SUV)

Date	Kilométrage	Fournisseur	Descriptif
15/12/2025	151.091	GEMY COTE D'AZUR	REVISION
	0		DISQUES PLAQUETTES AV RPLT
17/04/2025	120.134	GEMY COTE D'AZUR	DIVERS CLIM
	0		BOITIER D ALLUMAGE RPLT
	0		FILTRE A AIR RPLT
	0		BATTERIE RPLT
	0		LIQUIDE DE FREIN
	0		FILTRE CLIM RPLT
	0		REVISION
	0		BALAIS ESSUIE GLACE AV
20/02/2025	112.958	CONTROLE TECHNIQUE VELAUXIEN	CONTROLE TECHNIQUE
09/12/2024	103.720	GARAGE DU STADE	ESSAI
	0		JOINT SPI DIFFERENTIEL RPLT
	0		JOINT SPI DIFFERENTIEL RPLT
	0		CARDAN AVG RPLT
	0		CARDAN AVD RPLT
	0		HUILE BV RPLT
12/09/2024	91.226	GARAGE DU STADE	REVISION
	0		PLAQUETTES AR RPLT
	0		PLAQUETTES AV RPLT
	0		COURROIE DE DIRECTION ASSISTEE RPLT
07/02/2024	59.965	GEMY COTE D'AZUR	FILTRE A AIR RPLT
	0		BALAIS ESSUIE GLACE AV
	0		BOITIER D ALLUMAGE RPLT
	0		REVISION
	0		BALAI ESSUIE GLACE AR
08/06/2023	29.330	GEMY COTE D'AZUR	BALAI ESSUIE GLACE AR
	0		REVISION
	0		FILTRE CLIM RPLT
	0		LIQUIDE DE FREIN
	0		BALAIS ESSUIE GLACE AV
05/05/2022	11.778	STELLANTIS &YOU FRANCE SAS	REVISION

Historique Maintenance

Immatriculation: **FW-769-TS**

Date de 1ère immatriculation: **27/01/2021**

Modèle: **Peugeot 3008 1.6 HYBRID 225 E-EAT8 Allure Pack VP [5P] bva 8-225CH-10cv (SUV)**

Date	Kilométrage	Fournisseur	Descriptif
	0		BALAI ESSUIE GLACE AR
	0		BALAIS ESSUIE GLACE AV