



Expertise

Protocol number: 46493624
Order No. / Reference: 26504664
Inspection date: 13 Jul 2026

Manufacturer: Opel

Model: Grandland 1.5 D Automatik Elegance

VIN: W0VZCYHZ0P6027129



ALPHABET



ALPHABET

Vehicle details

Manufacturer / Type / Model / Equipment

Opel Grandland 1.5 D Automatik Elegance

Vehicle Identification number W0VZCYHZ0P6027129
Mileage (Read) 185,853 km
First registration 4 Jul 2023
Number of holders 1
Next periodical technical inspection 07/2026
(Report not on hand)

Power / Engine displacement 96 kw / 1,499 ccm
Fuel type / Cylinder Diesel / 4
Gearbox / Number of gears Automatic / 8
Type of drive Front drive
Type of vehicle SUV

Colour / colour code Quarz Silber Metallic
Doors / Seats 5 / 5
Upholstery type Leather
Colour of upholstery Black



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	800 km
Last service on / at	02/2026 at 168,674 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS858604
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AHG 00256		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,000 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 98V	Summer tyres on Light alloy	Firestone	5mm / 5mm
2)	225/55 R18 98V	Summer tyres on Light alloy	Firestone	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 98H	Winter tyres on Light alloy	Goodyear	9mm / 9mm
2)	215/65 R17 98H	Winter tyres on Light alloy	Goodyear	9mm / 9mm
Replacement				
Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2029		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 ignition keys, both foldable
- Driver and passenger side airbags
- Airbag: Head airbags, front and rear outer
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Exterior mirrors, electrically adjustable and heated, electrically folding
- Roof design line in chrome
- Decorative strips, Erino/Palladium Medium
- Tachometer
- Electronic brake force distribution (EBD)
- Electric windows front and rear
- Luggage compartment cover
- Transmission: 8-speed automatic
- Interior lighting, front and rear
- Child safety lock in the rear doors, manual
- Rear headrests (3), height adjustable
- Front headrests, height adjustable
- LED headlights
- Steering wheel, height and reach adjustable
- Illuminated makeup mirror in sun visor, for driver and front passenger
- Package: Comfort Package
- Front and rear parking sensors
- Radio: Multimedia Radio Pro
- Rain sensor
- Wheels: Light alloy 7.5 J x 18 with 5 double spokes in bicolor/black
- Speed-sensitive power steering
- Seats: Ergonomic active seat with AGR seal of approval, driver
- Lane Assist
- 12-volt power outlet
- Blind spot warning system
- Immobiliser
- Central locking with remote control and interior switches
- Storage compartments
- Airbag: Front and side airbags
- Ambient lighting, center console and in the front door pockets
- Automatic activation of the hazard warning lights
- Hill Start Assist
- On-board computer
- Decor: Opel Vizor with chrome frame
- Diesel particulate filter with SCR and oxidation catalyst
- Electric parking brake
- Electronic Stability Program Plus (ESP Plus)
- Front collision warning
- Cruise control with intelligent speed limiter
- Rear window wiper
- Interior rearview mirror, automatically dimming
- Dual-zone automatic climate control including rear footwell heating
- Paint finish: Metallic Ruby Red
- Leather steering wheel, flat-bottomed, with steering wheel remote control
- Center armrest, sliding, front, including storage compartment and cup holder
- Automatic parking assistant
- Quickheat heating system
- Radio accessories: Digital radio reception DAB+
- Tire pressure warning
- Wheels: Tire repair kit
- Rear view camera
- Seat belts
- Seats: Rear seat backrest split 40:60 and foldable
- Solar Protect thermal insulation glazing
- Start/Stop System
- Bumpers and side panels in high-gloss black
- Pre-wiring for ISOFIX child seat mounting system, including top tether attachment points, rear outer



Extra equipment

- Night Vision including IntelliLux LED Pixel Matrix Light (This camera-based system improves the driver's visibility in the dark. The front-mounted infrared camera detects people and animals up to 100 meters ahead of the vehicle based on their temperature difference with the surroundings. The system warns the driver and displays the position of pedestrians, for example, in the digital driver information display.)
- Seats: Ergonomic active seats with AGR seal of approval, driver and front passenger (length, height and backrest angle manually adjustable - seat tilt electrically adjustable - lumbar support electro-pneumatically adjustable in height and length - extendable thigh support, manually adjustable - pocket on front seat back - all seats in Taxa fabric, black - FlexFold rear seat backrest split and foldable in a 40:60 ratio, rear center armrest with pass-through - winter equipment with seat heating, heated windshield in the wiper area, heated steering wheel)
- Anti-theft alarm system (burglar alarm - deterrent signal - interior monitoring - tilt monitoring - monitoring of luggage compartment, doors and hood)
- Detachable trailer hitch (trailer stability program)
- Package: Technology Package (Keyless locking and starting system "Keyless open & start" - Electric tailgate)
- Park & Go Premium (360-degree camera (degrees displayed in the infotainment system's color screen, with steering guidelines) - Automatic parking assistant (detection of parallel and perpendicular parking spaces at speeds below 20 km/h, exiting parallel parking spaces, automatic steering of the vehicle), including park pilot, front and rear parking aid with audiovisual warning - Electrically folding exterior mirrors - Blind spot warning in both exterior mirrors (active between 12 km/h and 140 km/h))
- safety net
- Wheels: Provision for emergency wheel

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Electrical system	Switch (Sitz Heizung hinten) - Damaged - Replace
2	Interior	Interior - Soiled - Clean
3	Door - front left side	Door - dent(s) - Smooth repair work
4	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
5	Rear of vehicle	Boot floor - Soiled - Clean
6	Instrument panel	Glove box lid (Schließt nicht richtig) - Sub-function - Replace
7	Side panel - rear right side	Side panel - dent(s) - Smooth repair work
8	Rear of vehicle	Boot floor - Soiled - Replace
9	Vehicle glazing	Windscreen - Stone chips - Replace
10	Roof	Roof (Verätzungen) - Paint defect - Paint

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear right side - Scratched - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Missing parts

Description

Interior - Boot cover / roller cover

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

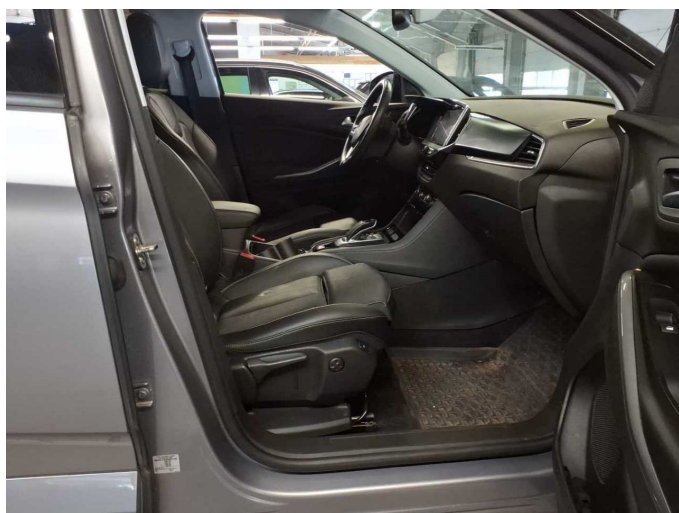


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

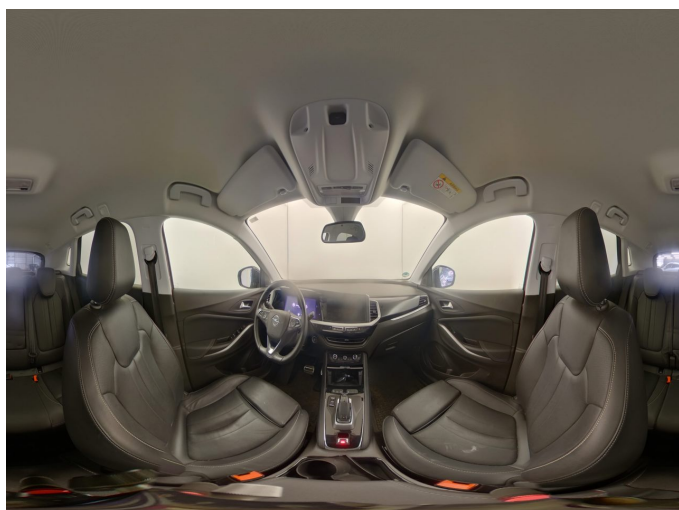


Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation

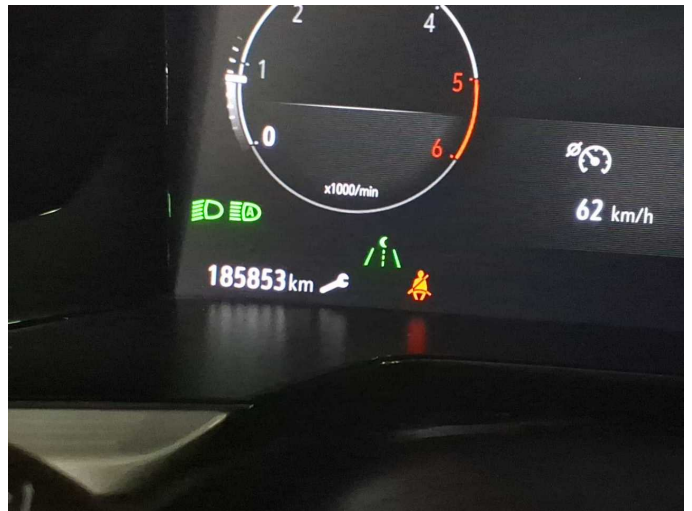


Figure 16: Misc.

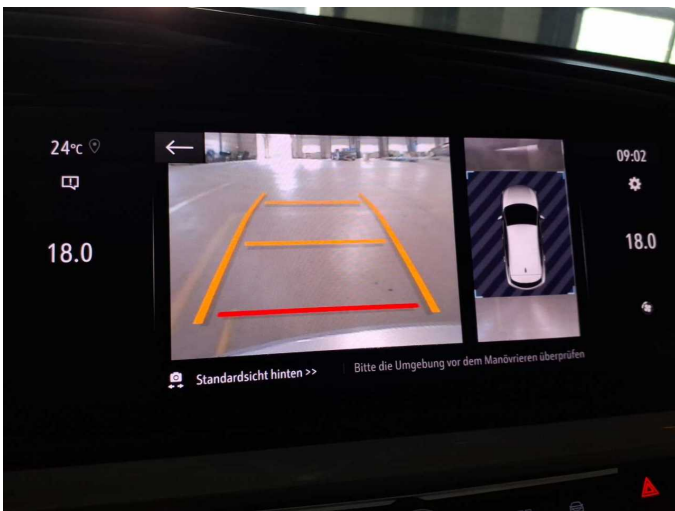


Figure 17: Misc.

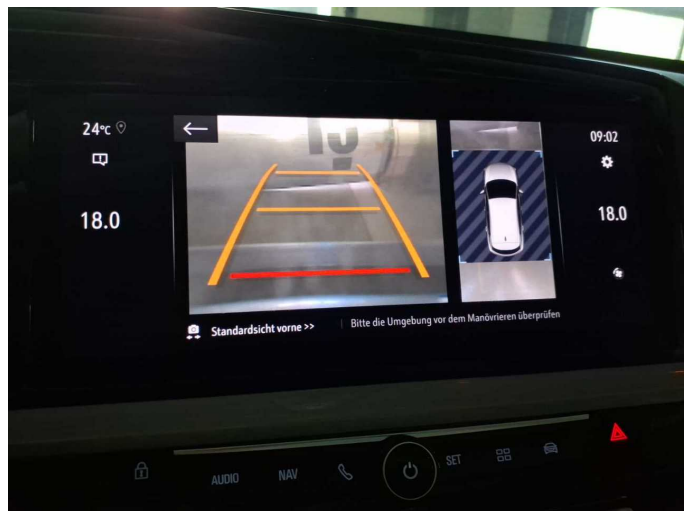


Figure 18: Misc.

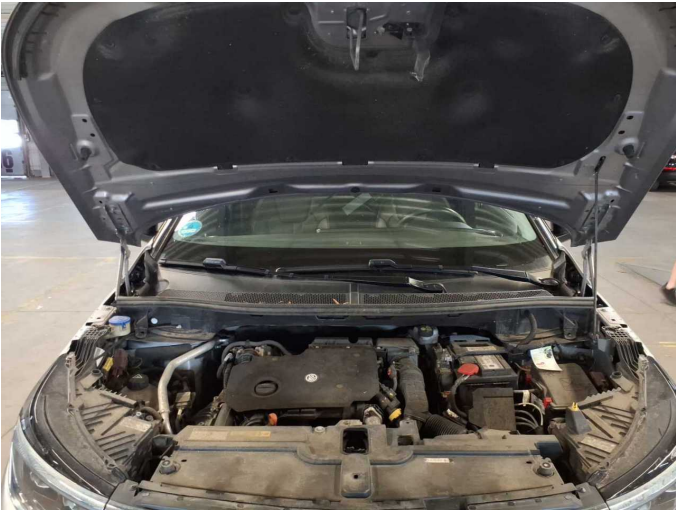


Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.




Figure 25: Misc.



Damage 1: Electrical system: Switch (Sitz Heizung hinten) - Damaged - Replace




Damage 1: Electrical system: Switch (Sitz Heizung hinten) - Damaged - Replace

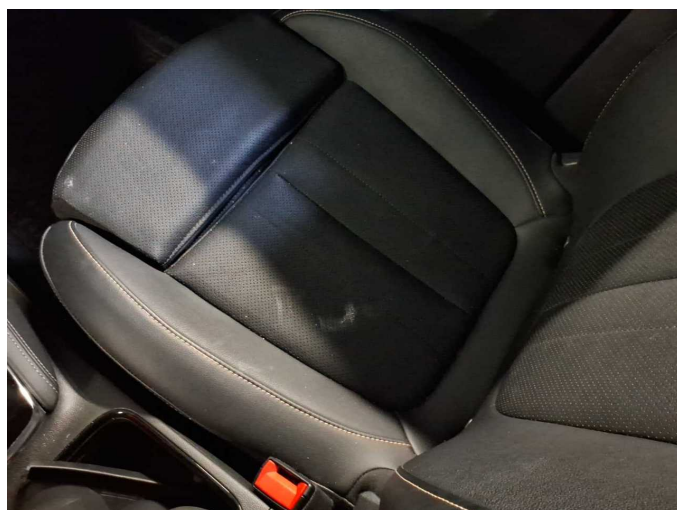

Damage 2: Interior: Interior - Soiled - Clean



Damage 2: Interior: Interior - Soiled - Clean

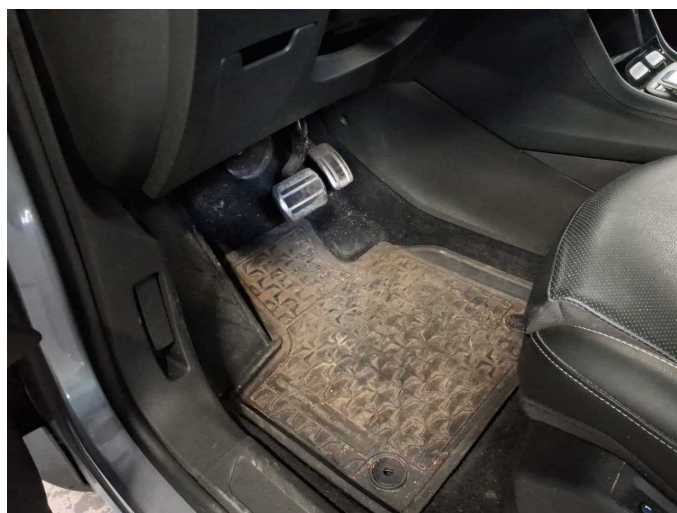


Damage 2: Interior: Interior - Soiled - Clean



Damage 2: Interior: Interior - Soiled - Clean




Damage 3: Door - front left side: Door - dent(s) - Smooth repair work

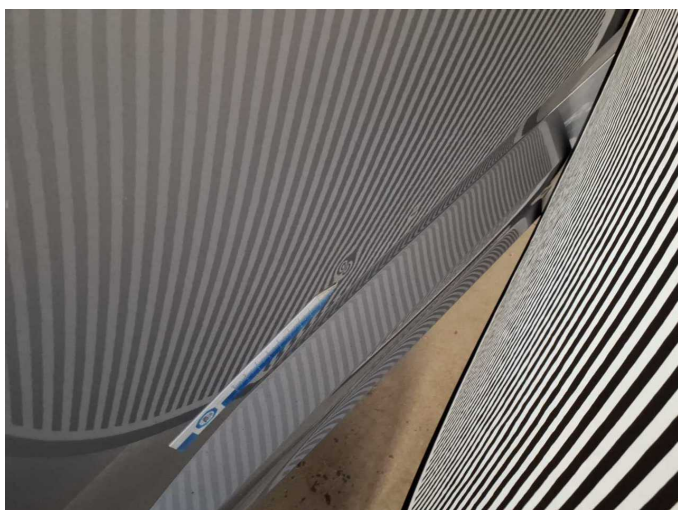


Damage 3: Door - front left side: Door - dent(s) - Smooth repair work



Damage 3: Door - front left side: Door - dent(s) - Smooth repair work

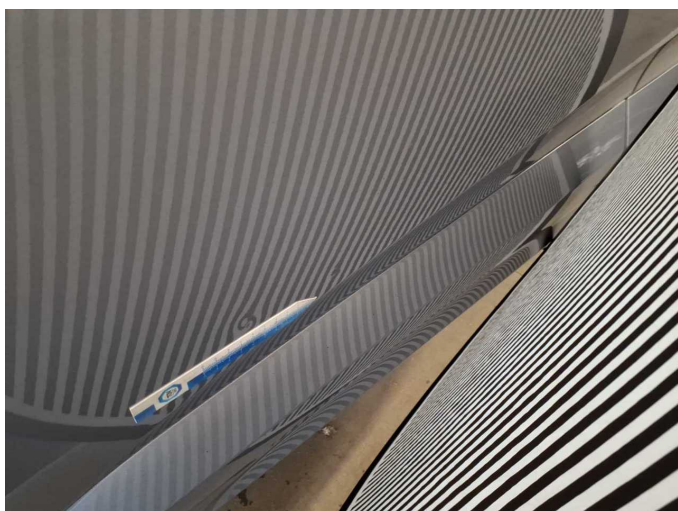

Damage 3: Door - front left side: Door - dent(s) - Smooth repair work

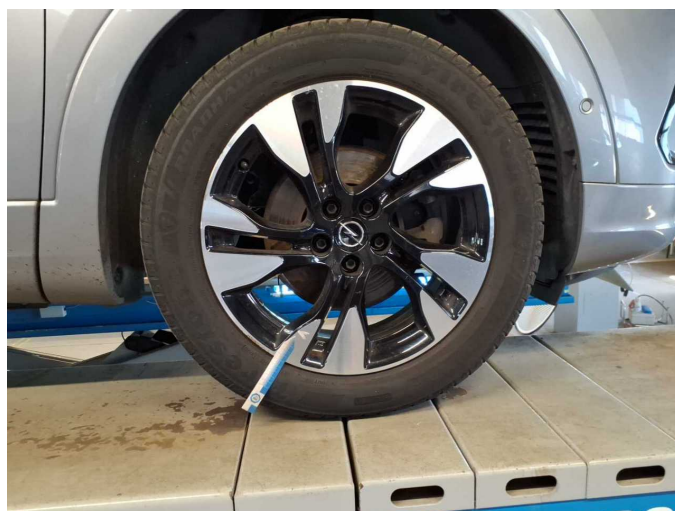


Damage 4: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value




Damage 5: Rear of vehicle: Boot floor - Soiled - Clean

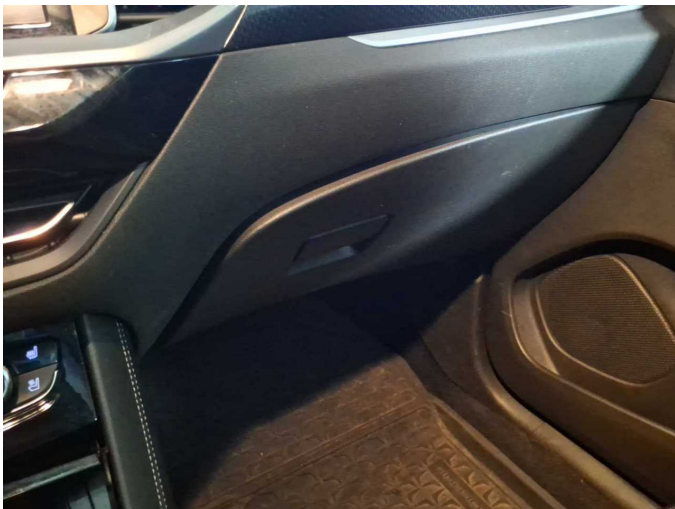


Damage 6: Instrument panel: Glove box lid (Schließt nicht richtig) - Sub-function - Replace




Damage 6: Instrument panel: Glove box lid (Schließt nicht richtig) - Sub-function - Replace

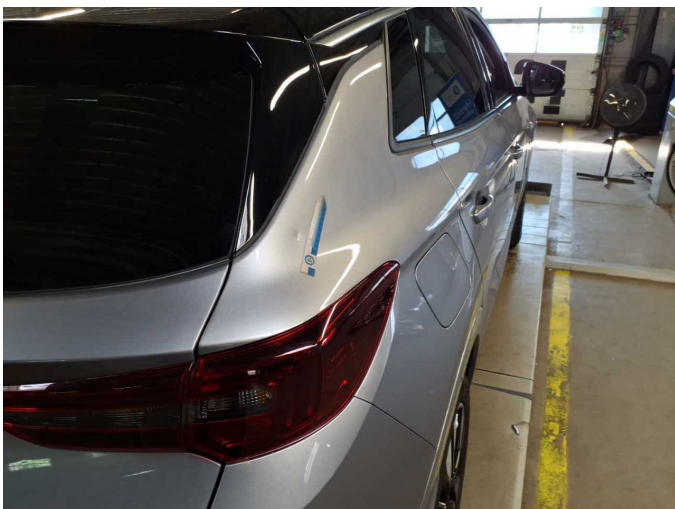


Damage 7: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

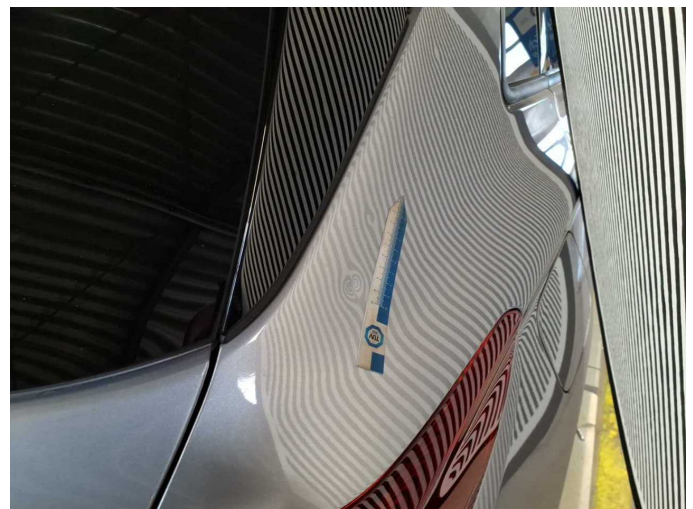

Damage 7: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

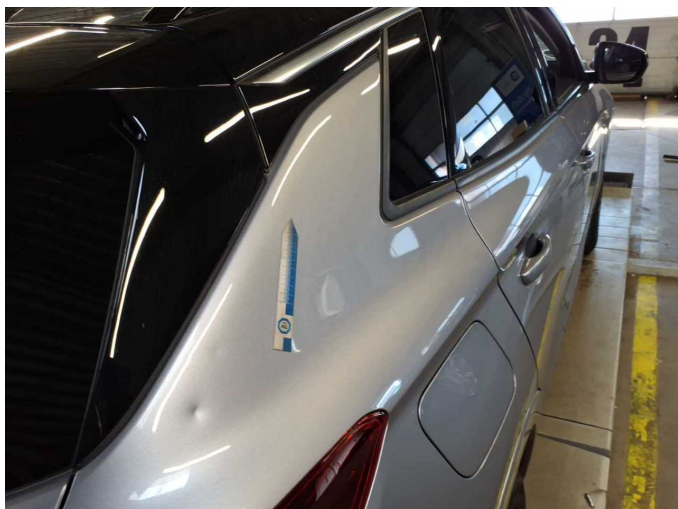

Damage 7: Side panel - rear right side: Side panel - dent(s) - Smooth repair work

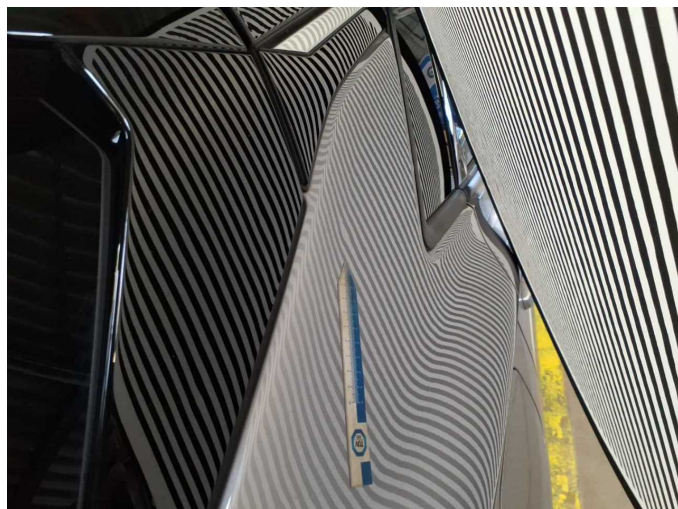


Damage 7: Side panel - rear right side: Side panel - dent(s) - Smooth repair work



Damage 8: Rear of vehicle: Boot floor - Soiled - Replace



Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace

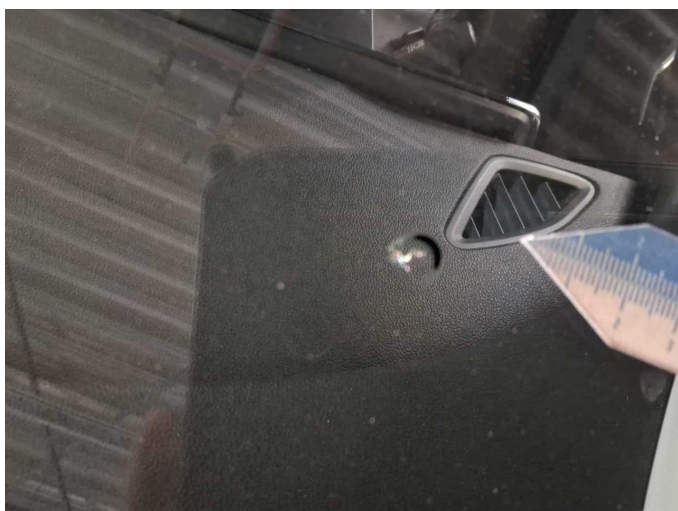

Damage 9: Vehicle glazing: Windscreen - Stone chips - Replace



Damage 10: Roof: Roof (Verätzungen) - Paint defect - Paint



Damage 10: Roof: Roof (Verätzungen) - Paint defect - Paint



Wear and tear 1: Wheel / tyres: Alloy rim - rear right side - Scratched - No deduction



Wear and tear 1: Wheel / tyres: Alloy rim - rear right side - Scratched - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZCYHZ0P6027129

Hersteller / Modell: OPEL OPEL Grandland 1.5 D Automatik Ultimate

Datum	KM-Stand	Beschreibung
16.02.2026	168.674	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
22.01.2026	155.114	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
27.11.2025	147.458	Bremse Sonstiges; Bremsklötze vorne
16.10.2025	133.777	Keilrippenriemen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.06.2025	108.662	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst
26.05.2025	108.662	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Systemtest/Eigendiagnose; Wartung Sonstiges
24.02.2025	79.587	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
10.10.2024	59.925	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
29.04.2024	40.894	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
03.01.2024	21.039	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges