



Expertise

Protocol number: 46122349
Order No. / Reference: 26550458
Inspection date: 24 Jun 2026

Manufacturer: Ford

Model: Transit Custom 320 L1H1 LKW VA Basis

VIN: WF0YXXTTGYNY49804



Vehicle details

Manufacturer / Type / Model / Equipment

Ford Transit Custom 320 L1H1 LKW VA Basis

Vehicle Identification number	WF0YXXTTGYNY49804
Mileage (Read)	104,425 km
First registration	13 May 2022
Number of holders	1
Next periodical technical inspection	04/2028
(Report not on hand)	

Power / Engine displacement	96 kw / 1,995 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Van

Colour / colour code	Frost-Weiß
Doors / Seats	4 / 3
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite

Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	4,000 km
Last service on / at	08/2025 at 78,570 km		
Key is / should be	1 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GK789341
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8566 / BMU 06817		
Emission standard	EURO6;WLTP;AR;PI/CI;N1 III, N2	fine dust sticker	
Permitted total weight	3,200 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 107R	All-season tyres on Steel rim with wheel cover	Uniroyal	5mm / 5mm
2)	215/65 R16 107R	All-season tyres on Steel rim with wheel cover	Uniroyal	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R16 107T	Summer tyres on Steel	Goodyear	6mm / 6mm
2)	215/65 R16 107T	Summer tyres on Steel	Goodyear	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
E	215/65 R16 107T C	Summer tyres on Steel	Goodyear	7 mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 1 battery
- Anti-lock braking system with electronic brake force distribution (EBD)
- Headliner in driver's cab
- Third brake light
- Front electric windows
- Ford Easy Fuel
- Warranty: 2-year Ford new car warranty including Ford Assistance mobility guarantee
- Glove compartment with lid
- Fuel tank 70 l
- Cargo area lighting with activatable switch-off delay
- Emergency brake assist including emergency brake light
- Wheel hub covers
- Wheels: Steel wheels 6.5 J x 16 with 215/65 R 16 R tires
- Mud flaps front and rear
- Power steering
- Start-stop system
- Lashing eyes 8
- Heat-insulating glazing, lightly tinted
- Auxiliary heater, electric
- Driver's side airbag
- On-board computer
- roof, flat
- Tachometer
- Electronic Stability Program (ESP) with Traction Control System (TCS)
- FordPass Connect
- Generator, 240 A
- Transmission: 6-speed transmission
- Interior lighting with delay circuit
- Paint finish: Solid color paint
- Steering column, adjustable in height and reach
- Particulate filter: diesel particulate filter
- Wheels/Tires: Spare wheel, steel wheel
- Sliding door: Sliding door, right
- Side protection strips
- Seat belts
- Power outlet: 12-volt connection
- Immobiliser
- Central locking with remote control

Extra equipment

- Airbag (passenger side)
- Exterior mirrors with blind spot assist HLLAH
- Bi-xenon headlights with LED daytime running lights. JBBAC
- Package: Visibility Package II (electrically adjustable and heated exterior mirrors - heated windshield - washer fluid sensor - electrically folding exterior mirrors - rain-sensing wipers - headlight assistant with day/night sensor)
- Tire Pressure Monitoring System (TPMS)
- Reversing camera with front and rear parking pilot system (reversing camera with image transmission of the rear driving path in the multifunction display and coupling aid)
- Seats: Seat package 15 - partition without window BVFAR,A6A
- SORTIMO:CNRN_151638
- SORTIMO:CNRN_1523 (Basic package)
- Parking heater, programmable, with remote control
- Towing device (fixed, 13-pin socket - incl. trailer stability control (TSC))
- Elimination of vinyl floor covering AG6AE
- Rear swing door without window (without interior mirror)
- Radio: Audio system 25: Ford audio system including Ford SYNC 3 with AppLink, DAB/DAB+, navigation (Radio (FM/AM) 8" touchscreen multifunction display, FordPass Connect integrated control panel and audio remote control, Ford SYNC 3 with touchscreen (hands-free system with voice control, SMS readout/sending function, Bluetooth, Emergency Assistance...), AppLink (advanced voice control, privacy mode, support for Android Auto and Apple CarPlay, capacitive touchscreens...), lane guidance, adaptive cruise control, lane keeping assist, traffic sign recognition, Park Pilot front/rear)
- SORTIMO: CNRN_15291



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Vehicle glazing	Windscreen (Rissbildung) - Stone chips - Replace
2	Trim / covers	Boot lid - interior trim - Damaged - Replace
3	Interior	Cargo space partition (Sortimo Regaleinbauten) - Differs from the original configuration - No deduction
4	Rear bumper	Rear bumper - Scratch(es) - Paint
5	Front bumper	Front bumper - Scratched - Paint
6	Boot lid / rear door	Boot lid - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Interior	Interior - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Equipment - Vehicle key with remote control

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 19 Jan 2026	3.898,59 €
2	Side - left, Provided by user / customer	5.001,65 €

Accident damages

No. Accident

1 Side - left

Repainting

No. Repainting

1 Side panel - rear left side, Professionally carried out, Invoice of repair done Non-existent



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations of light commercial vehicles published by Alphabet Fleet Management GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Non-repaired previous damages were found at the vehicle. The necessary repair costs are listed in the expert report or if necessary, are listed in detail in a separately enclosed repair cost calculation.

Comments

- Für den montierten Radsatz wurde kein Nachweis erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Instrument panel



Figure 10: Interior 360° view

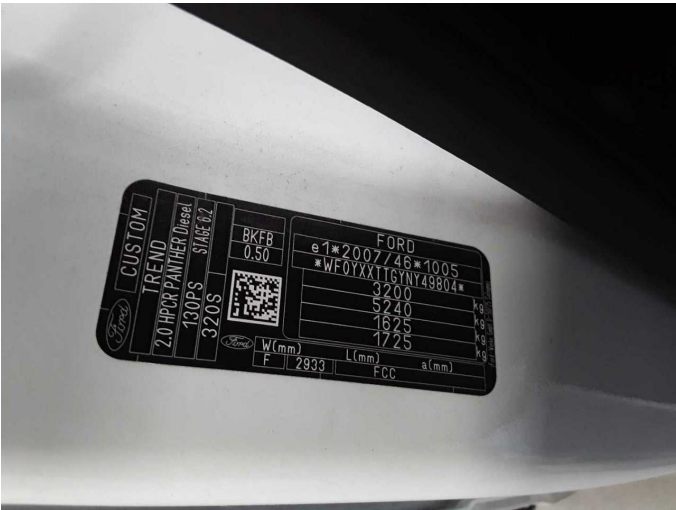


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

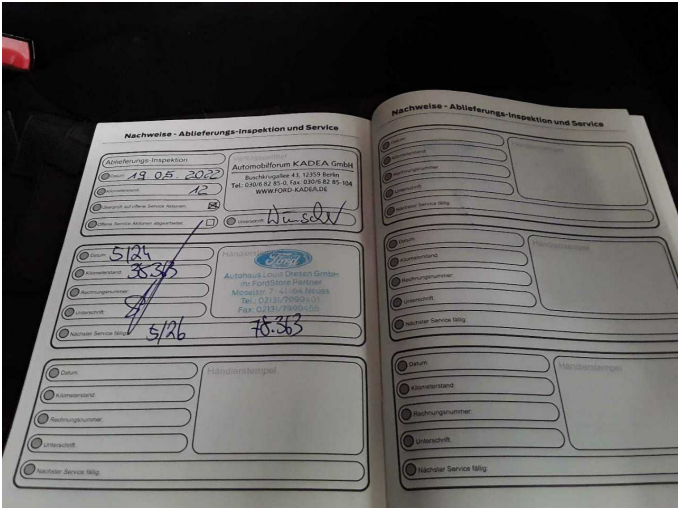


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

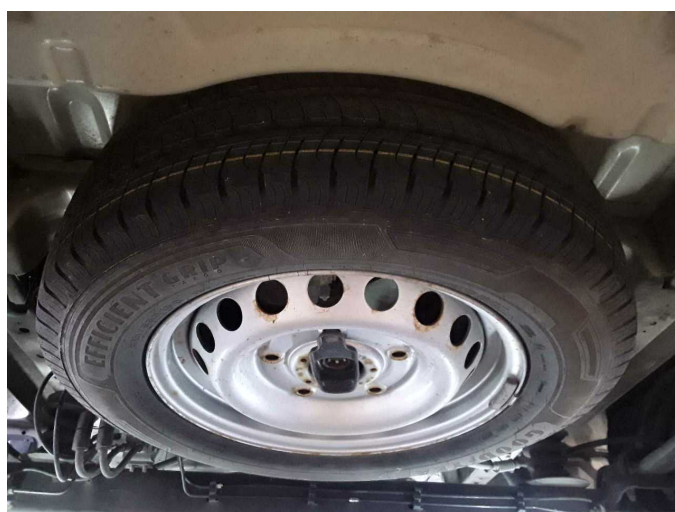


Figure 22: Misc.

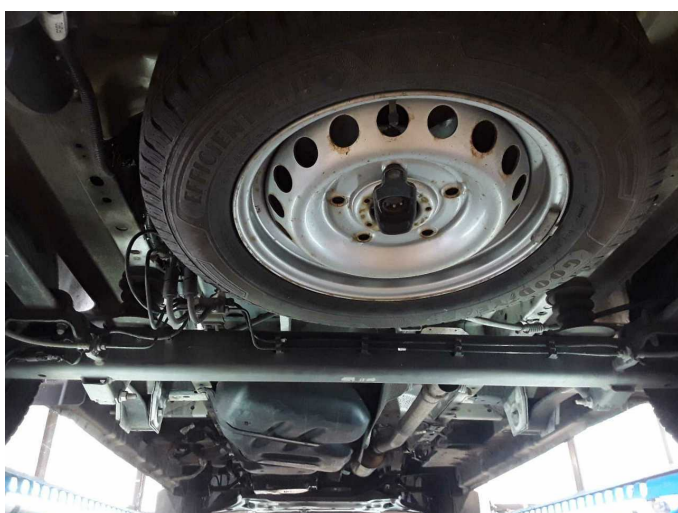


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Damage 1: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage 1: Vehicle glazing: Windscreen (Rissbildung) - Stone chips - Replace



Damage 2: Trim / covers: Boot lid - interior trim - Damaged - Replace



Damage 2: Trim / covers: Boot lid - interior trim - Damaged - Replace



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 4: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint




Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Paint

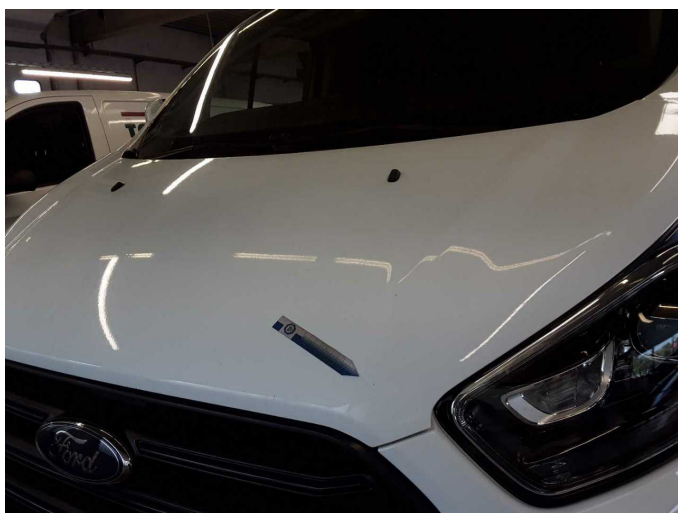

Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction




Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Missing part 1: Equipment: Vehicle key with remote control - Missing - Replace




Accident 1: Side - left

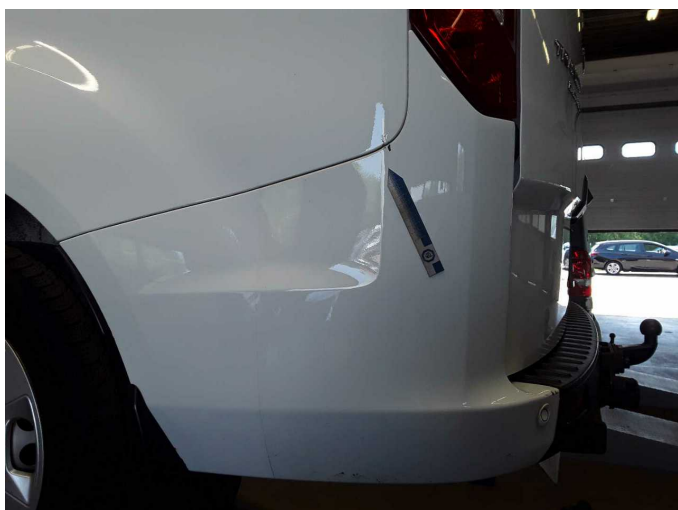

Accident 1: Side - left



Accident 1: Side - left

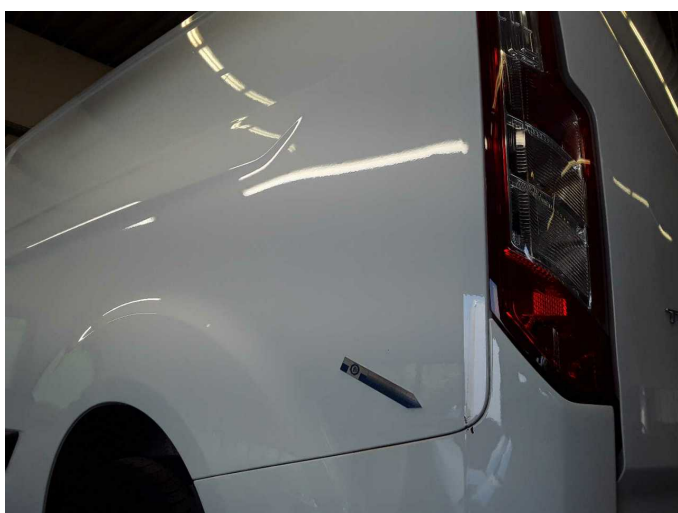

Accident 1: Side - left



Accident 1: Side - left



Repainting 1: Side panel - rear left side



Repainting 1: Side panel - rear left side



Repainting 1: Side panel - rear left side



Repainting 1: Side panel - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WF0YXXTTGYNY49804

Hersteller / Modell: FORD FORD Transit Custom 320 L1H1 LKW VA Trend

Datum	KM-Stand	Beschreibung
27.04.2026	102.316	AU
24.01.2026	94.777	Bremsinspektion vo + hi; Bremsbelagfühler ern; Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne
15.08.2025	78.570	Bremsklötze hinten; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst
22.04.2025	65.763	Bremsklötze vorne; Systemtest/Eigendiagnose
23.05.2024	38.363	AU; Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
20.03.2023	15.552	Systemtest/Eigendiagnose