DEKRA

DEKRA Automotive Solutions

Appraisal Report

Vehicle details

VIN	ZARPAHDX1 P7D74404	Registration date	27/03/2024	Exterior Color	Unknown
Brand	ALFA ROMEO	Licence Plate	UL-JL 6	Odometer	87 973 km
Model	STELVIO 2.2 Diesel 16V 154kW Veloce AT8-				

Inspection Details

Arrival Date	31/08/2026	Inspection ID	7159264	Inspection date	14/09/2026
Assign Date	31/08/2026	Fleet owner	Leasys Privat Leasing	Inspection loc.	Leasys AKB Buch























Generic equipment

Removable element

Spare wheel kit	✓
Load cover	✓
Radio user manual	✓


Technical Document

User manual	✓
Warranty booklet	✓
Log books	✓
Spare key	✓
Key	✓
Remote key	✓
Service	✓

Tyres

Continental 255/45/20 Y Summer 5.0 mm

Continental 255/45/20 Y Summer 5.0 mm

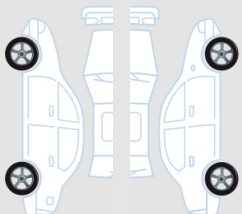

Continental 255/45/20 Y Summer 5.0 mm

Continental 255/45/20 Y Summer 5.0 mm



Exception / Damage

DEKRA

DEKRA Automotive Solutions

Appraisal Report

1



Part	Windscreen	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	-
Damages	Worn out	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	For info	Flat Rate	-	**Net Cost**	**-**

2



Part	Wing	Repair Time	0.45	Part Cost	-
Position	Front left	Repair Cost	63.00€	Gross Cost	258.00€
Damages	Scratched	Paint Time	1.30	Depreciation %	-
Severity	-	Paint cost	195.00€	Depreciation	-
Repair mode	Repair	Flat Rate	-	**Net Cost**	**258.00€**

3



Part	Wing badge	Repair Time	0.15	Part Cost	43.90€
Position	Front left	Repair Cost	21.00€	Gross Cost	64.90€
Damages	Broken	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Replace	Flat Rate	-	**Net Cost**	**64.90€**

4



Part	Upper tailgate / Boot	Repair Time	1.00	Part Cost	-
Position	Back	Repair Cost	140.00€	Gross Cost	350.00€
Damages	Improper repair	Paint Time	1.40	Depreciation %	-
Severity	-	Paint cost	210.00€	Depreciation	-
Repair mode	Repair	Flat Rate	-	**Net Cost**	**350.00€**

5



Part	Tailgate / Boot door badge	Repair Time	0.15	Part Cost	70.45€
Position	Back	Repair Cost	21.00€	Gross Cost	91.45€
Damages	Broken	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Replace	Flat Rate	-	**Net Cost**	**91.45€**

6



Part	Tailgate / Boot door badge	Repair Time	0.15	Part Cost	53.55€
Position	Back left	Repair Cost	21.00€	Gross Cost	74.55€
Damages	Broken	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Replace	Flat Rate	-	**Net Cost**	**74.55€**

7



Part	Tailgate / Boot door badge	Repair Time	0.15	Part Cost	53.55€
Position	Back right	Repair Cost	21.00€	Gross Cost	74.55€
Damages	Broken	Paint Time	-	Depreciation %	-
Severity	-	Paint cost	-	Depreciation	-
Repair mode	Replace	Flat Rate	-	**Net Cost**	**74.55€**

8



Part	Paint preparation	Repair Time	-	Part Cost	-
Position	-	Repair Cost	-	Gross Cost	255.00€
Damages	-	Paint Time	1.70	Depreciation %	-
Severity	-	Paint cost	255.00€	Depreciation	-
Repair mode	Paintworks	Flat Rate	-	**Net Cost**	**255.00€**

DEKRA Automotive Solutions

Summary Inspection

Gross Price	1,168.45€	Depreciation	-	Net Price	1,168.45€

Labor cost summary

	Hourly Rate	Time	Gross Price	Depreciation %	Depreciation	Net Price
Bodywork	140.00€	2.05	287.00€	-	-	287.00€
Paintwork	150.00€	2.70	405.00€	-	-	405.00€
Paint preparation	150.00€	1.70	255.00€	-	-	255.00€

Miscellaneous

	Gross Price	Depreciation %	Depreciation	Net Price
Small parts / disposal charge	0.00€	-	-	0.00€
Part Cost	221.45€	-	-	221.45€
Flat Rate	0.00€	-	-	0.00€