



Expertise

Protocol number: 46077851
Order No. / Reference: 26434587
Inspection date: 20 Jun 2026

Manufacturer: Volvo

Model: XC90 T8 AWD Recharge Plus Bright

VIN: YV1LFH5V9P1975920



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC90 T8 AWD Recharge Plus Bright	
Vehicle Identification number	YV1LFH5V9P1975920
Mileage (Read)	50,811 km
First registration	3 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2028
(Read from ZBI)	
Power / Engine displacement	228 kw / 1,969 ccm
Fuel type / Cylinder	Hybr.B/E ext.aufll / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Onyx Schwarz-Metallic
Doors / Seats	5 / 7
Upholstery type	Leather
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	235 Tag(e)
Last service on / at	02/2026 at 48,228 km		
Key is / should be	2 / 2	FZG documents	ZB#1 (S) was available (copy), ZB#2 (B) was not available.
		Letter No.	GQ220406
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BUL 00009		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,950 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	275/45 R20 110H	All-season tyres on Light alloy	Michelin	4mm / 4mm
2)	275/45 R20 110H	All-season tyres on Light alloy	Michelin	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105V	Winter tyres on Light alloy	Bridgestone	5mm / 4mm
2)	235/55 R19 105V	Winter tyres on Light alloy	Bridgestone	4mm / 0mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 03/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaanlage

|

Standard equipment

- Advanced air purification system with fine dust filtration according to air quality standard PM2.5
- Airbags (airbags for driver and front passenger with two-stage deployment system - knee airbag for driver - side airbags for driver and front passenger - head/shoulder airbags for all occupants)
- Aluminum roof rails (integrated)
- Ambient lighting (Extended interior lighting with: - Ambient lighting front and rear - Illuminated door pockets and door handles front and rear - Ambient lighting on the front and rear doors - Door sills with illuminated Volvo lettering - Exit lights in the rear doors - Ambient lighting on the dashboard - Rear footwell lighting - Work light on the tailgate)
- Attachment system for carrier bags in the luggage compartment
- Automatic climate control with 4-zone temperature control (Individual climate control for driver, front passenger and rear passengers left and right (2nd row of seats) including climate display for the 2nd row of seats)
- Bottle holder in the luggage compartment
- Cargo area roller blind (semi-automatic)
- Central locking with two remote controls and integrated emergency key (including automatic locking of the glove compartment and doors while driving (can be deactivated), panic function (integrated in the remote control), comfort opening/closing of the side windows and, if applicable, sunroof via remote control, luggage compartment lid release via remote control or from the driver's seat)
- Charging box under the cargo floor
- Child safety lock for the rear doors (electric)
- Chrome applications in the front bumper
- Chrome window surround
- Dashboard and door trim in leather look with contrasting stitching
- Digital Services including Google Maps navigation system (Google Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data) - Volvo On Call (includes, among other things, contacting the Volvo On Call service center at the touch of a button and additional convenience services via the Volvo CarsApp) - Usage is time-limited and will be subject to charges thereafter. Further information on renewal is available from a Volvo dealer partner.)
- Driver Awareness (Blind Spot Information System (BLIS) - Blind Spot Assist including Lane Change Warning for rapidly approaching vehicles - Cross Traffic Alert (CTA) - Cross Traffic Warning with braking intervention - Warning of vehicles, cyclists and pedestrians approaching from the side when reversing out of a parking space, including braking to a standstill if warning signals are ignored - Rear Impact Mitigation - Preventive protection in case of impending rear-end collisions)
- Electric auxiliary heater with timer
- Electric parking brake
- Electrically folding exterior mirrors
- ABS - Anti-lock Braking System
- Acoustic Vehicle Alerting System (AVAS) (Acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Active safety belts with belt tensioners (pre-activation of the belt tensioners in dangerous situations and belt force limiter)
- Air conditioning for the 3rd row of seats
- All-wheel drive (AWD) (depending on the driving mode)
- Aluminum door sill plates with Recharge lettering, front and rear
- Aluminum loading sill protector in the luggage compartment
- Android infotainment system (9" touchscreen (22.9 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - 2 USB-C ports (compatible with Apple iPod/iPhone/iPad))
- Armrests with integrated storage compartment and cup holders for the 3rd row of seats (left and right)
- Automatic emergency braking (emergency braking mechanism after the deployment of the airbags or seatbelt pretensioners to prevent secondary accidents)
- Automatic tailgate (electric)
- Brake energy recuperation
- Charging cable Schuko/Type 2 (Mode 2) (7 m length, 1-phase, 10A (for connection to a standard 230-volt household socket))
- Chrome applications on the rear of the vehicle
- Chrome trim strip in the door sill area with Recharge lettering
- Deactivation of the high-voltage battery (in case of a collision)
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver Assistance (Emergency Stop Assist (automatic emergency stopping system in case of failure to heed warnings due to lack of steering, braking and acceleration activity by the driver, including activation of the hazard warning lights and automatic braking to a standstill) - Pilot Assist (lane guidance assistant with adaptive cruise control up to speeds of 130 km/h) - Adaptive cruise control)
- Electric windows front and rear (with auto-down and auto-up function)
- Electrically adjustable exterior mirrors
- Electronic differential lock
- Electronic stability control
- First aid kit and warning triangle
- Front center armrest including cup holder
- Headrests (7)
- Headrests of the 2nd row of seats can be folded down (electrically)
- Heated rear window
- Hill Descent Control (HDC)
- Hill Start Assist (HSA)
- Interior and exterior mirrors automatically dimming
- ISOFIX mounting for the outer rear seats



- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated at speeds below 10 km/h)
- Fog sensor for automatic activation of the defroster function
- Front grille in waterfall design in chrome
- Glazing: Colored glazing
- Heated exterior mirrors and rear window (automatic)
- Illuminated makeup mirror for driver and front passenger
- Immobiliser
- Intelligent driver information system (delays incoming calls or vehicle information in dangerous situations)
- Keyless Start (electronic engine start system)
- Luggage compartment partition net
- On-board computer (with vehicle control functions)
- Parking ticket holder
- Pollen filter
- Power outlet (12-volt connection in the luggage compartment)
- Premium textile floor mats, front and rear
- Preparation for Trailer Stability Assist (TSA)
- Radio: Premium Sound audio system by Harman/Kardon (600 watts of power - 14 speakers - Fresh Air - Subwoofer - Dirac Unison - Sound optimization)
- Rain sensor with automatic light function
- Rear view camera
- rear window wiper
- Roof edge spoiler
- Run-off Road Protection (preventive protection system in case of unintentional road leaving or impending rollovers including pre-activation of the seat belt tensioners, deactivation of the battery (plug-in hybrid only), emergency call via Volvo On Call and door unlocking)
- Safety Assistance (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals including intersection braking assistant and emergency braking assistant for oncoming traffic - Connected Safety - Driver Alert - Attention warning - Variable speed limiter - Cruise control - Lane Keeping Aid (LKA) - Active lane keeping assistant - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI) - Traffic sign recognition)
- Seat belt height adjustment front and rear (2nd row of seats)
- Seats: Child seat integrated in the middle rear seat (2nd row).
- Seats: Heated front seats
- Seats: Heated rear seats (outer seats of the 2nd row)
- Steering wheel adjustable for height and reach
- Steering wheel: Steering wheel heating
- Textile floor mat for the 3rd row of seats
- third brake light
- Upholstery: Leather/leatherette comfort seats (incl. rear center armrest (2nd row of seats) - Aluminum inlay: Metal Mesh - Headliner: Light Beige)
- Keyless Drive (electronic access system) (with sensor-controlled tailgate, illuminated door handles and floor lights)
- Lashing eyes in the luggage compartment (foldable)
- LED turn signals integrated into the exterior mirrors
- Otto particulate filter
- Outdoor temperature display
- Package: Seat Comfort Package (Electrically adjustable front passenger seat (8-way) - Electrically adjustable driver's seat (8-way) with memory function for driver's seat and exterior mirror settings (stored in the remote control) - Lumbar support (4-way electrically adjustable) for driver and front passenger seats - Memory function for front passenger seat - Adjustable leg support for driver and front passenger seats)
- Parking assistance, front and rear (with automatic braking intervention)
- Passenger side airbag can be deactivated
- Phone: Inductive smartphone charging system (Wirelessly charges smartphones that support the Qi standard on a charging pad)
- Radio accessories: Smartphone integration Apple CarPlay
- Radio accessories: Two USB-C ports on the back of the center console
- Safety braking system with disc brakes all around (internally ventilated) (automatic brake system pre-tensioning, brake assist and automatic hold function)
- Seats: Rear bench seat of the 2nd row in a 40/20/40 ratio or completely foldable (incl. individual backrest angle adjustment)
- Seats: Third row of seats (7-seater) (manually adjustable and retractable with longitudinal adjustment (120 mm) for the 2nd row of seats and easy-entry function)
- Speed-sensitive power steering
- Start/Stop technology
- Steering wheel: Multifunction buttons on the steering wheel
- Sun blinds for the rear side windows (integrated)
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Transmission: 8-speed automatic transmission
- Warning tone/indicator when seat belts are not fastened (for all seats)
- Wheels: 20" 5-spoke alloy wheels, diamond cut/high-gloss black (with all-season tires 275/45 R20; rims 9 x 20")
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)
- Whiplash Protection System (WHIPS) (including immersion protection on all seats and energy-absorbing front seat cushions)



Extra equipment

- Towbar (semi-electric)
- Paint finish: Metallic paint
- Parking camera with 360° surround view (including front, side and rear parking aid with automatic braking intervention (rear))
- Windscreen, heater
- Panoramic glass sliding sunroof with lifting function (electric) (with integrated, continuously adjustable sunshade)
- Glazing: Side and rear windows tinted (from the B-pillar back)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (registration document) was available, but the vehicle registration certificate Part 2 (title) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Wheel well extension - Scratch(es) - Smart repair
2	Side panel - rear right side	Sill - dent(s) - Smooth repair work
3	Sill - left side	Sill - Scratch(es) - Smart repair
4	Wheel / tyres	Alloy rim - rear right side - Scratched - Loss in value
5	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
6	Front bumper	Front bumper (+ Blende links lackieren) - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction
2	2nd wheel set	1 tyre (Kein Teil der Ausstattung) - Worn - Replace
3	2nd wheel set	Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction
4	Door - rear right side	Door - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Professionally repaired, Invoice of repair done Non-existent, from 24 May 2025	1.124,20 €

Repainting

No.	Repainting
1	Side panel - rear left side, Door - rear left side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Side panel - rear left side	459 µm	Door - rear left side	154 µm
-----------------------------	--------	-----------------------	--------



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

Professionally repaired previous damages were found at the vehicle.

Comments

Der zusätzliche Winterradsatz ist kein Bestandteil der Ausstattung



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster

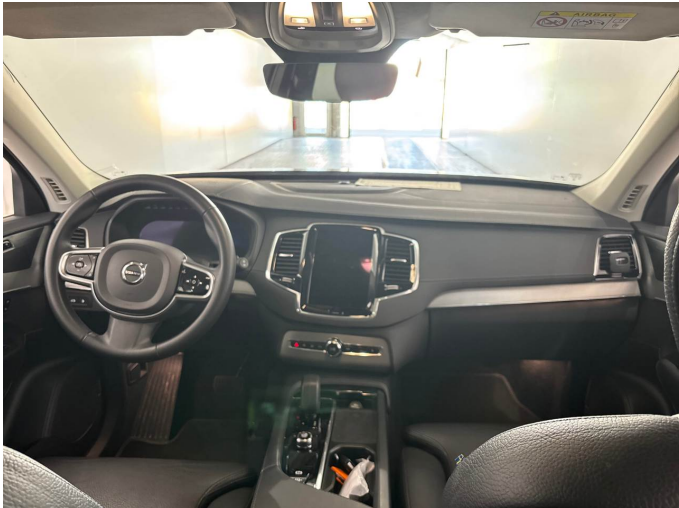


Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

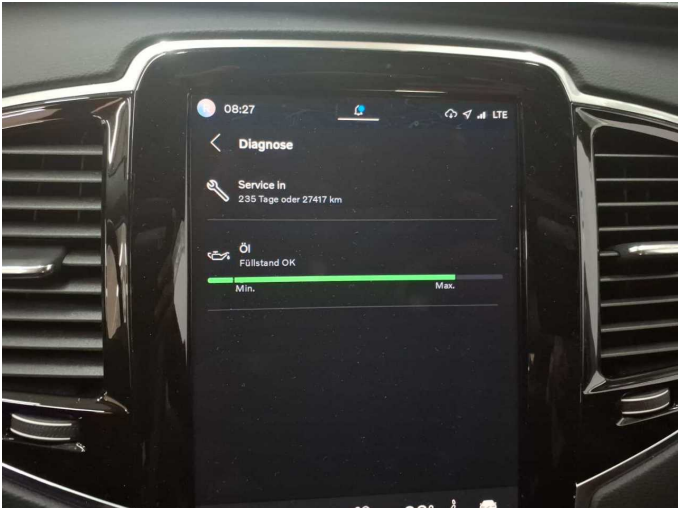


Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

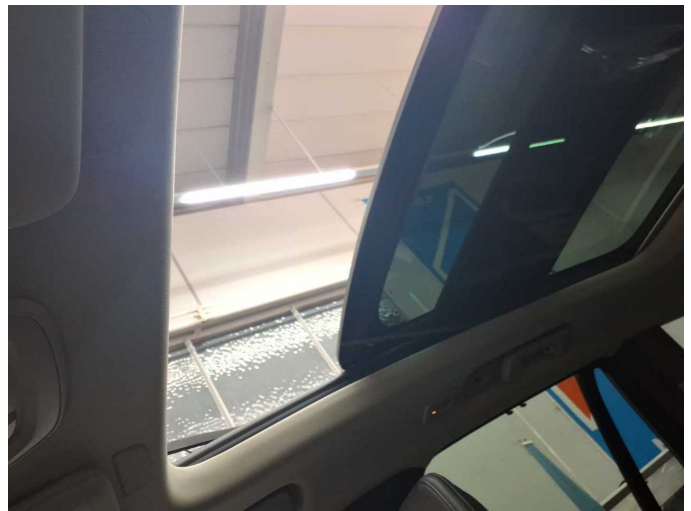


Figure 22: Misc.



Figure 23: Misc.

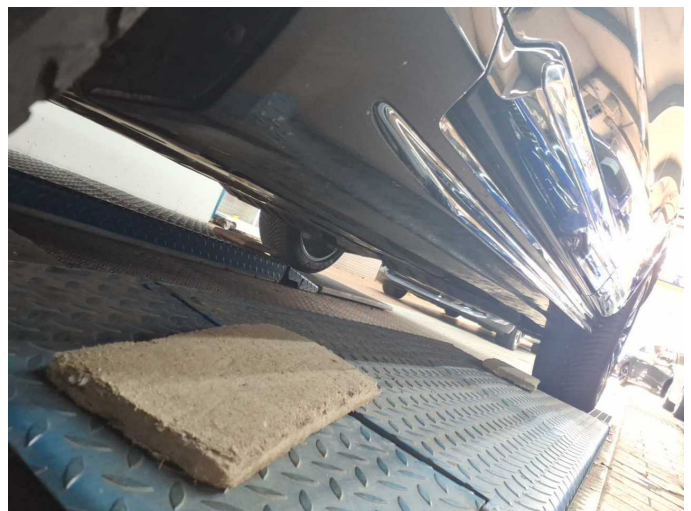


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

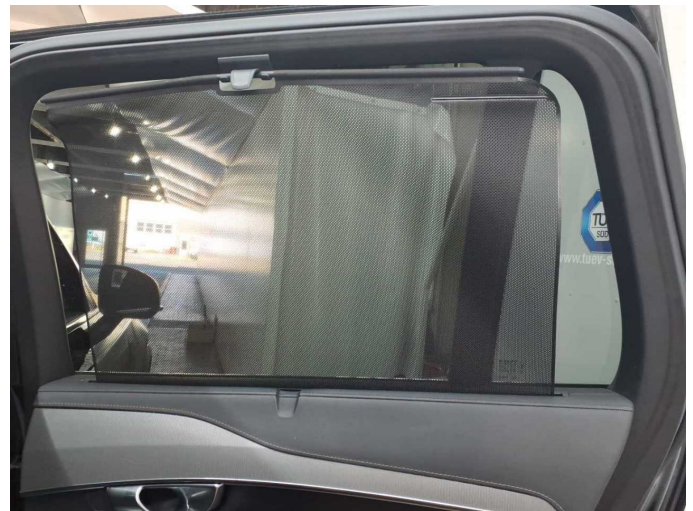


Figure 28: Misc.

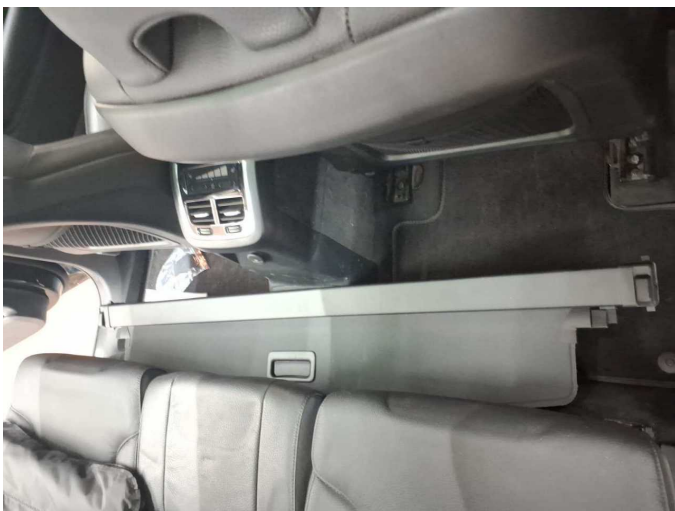


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.

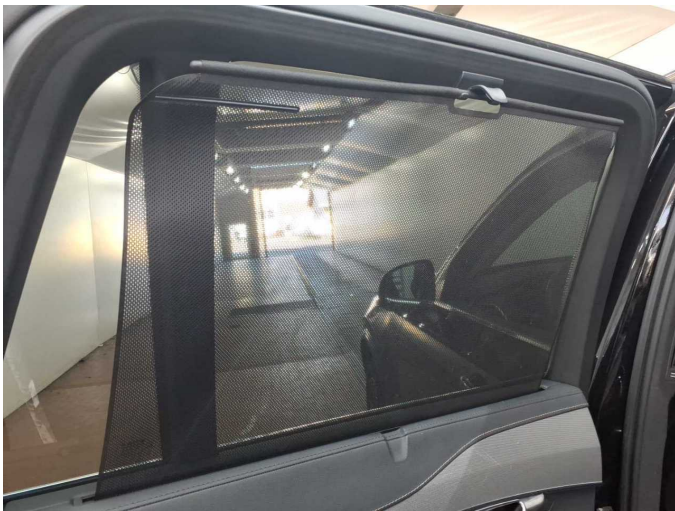


Figure 33: Misc.



Figure 34: Misc.

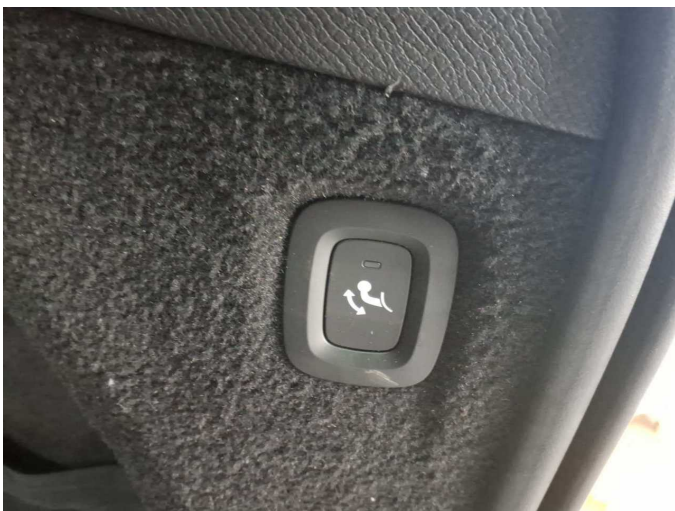


Figure 35: Misc.

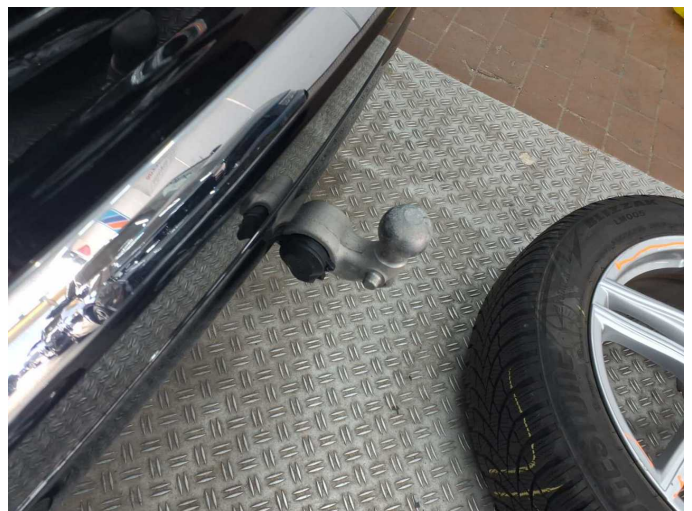



Figure 36: Misc.




Figure 37: Misc.




Damage 1: Side panel - rear left side: Wheel well extension - Scratch(es)
- Smart repair

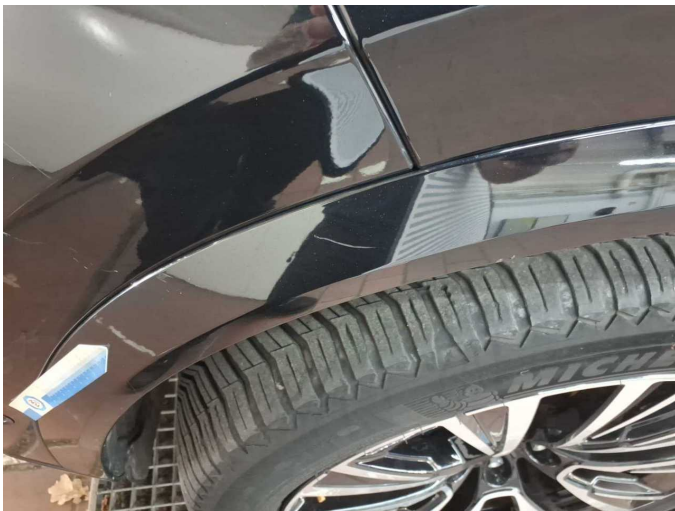


Damage 1: Side panel - rear left side: Wheel well extension - Scratch(es)
- Smart repair

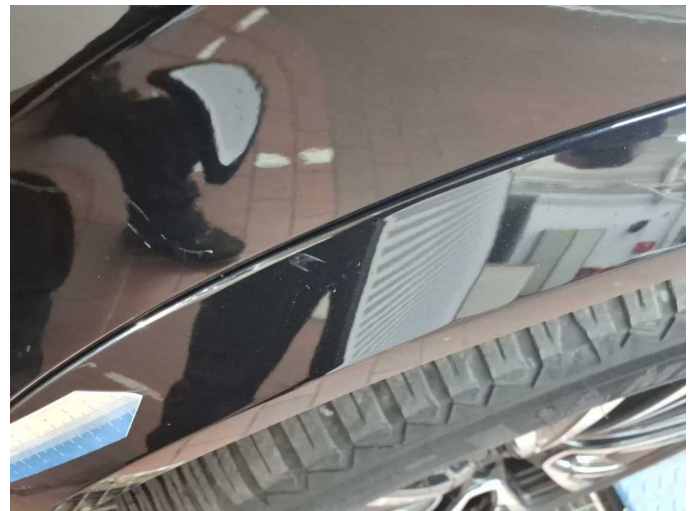

Damage 1: Side panel - rear left side: Wheel well extension - Scratch(es)
- Smart repair

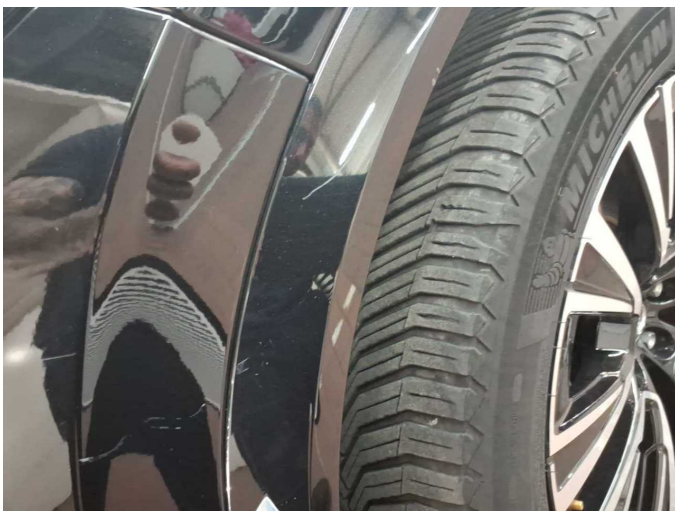

Damage 1: Side panel - rear left side: Wheel well extension - Scratch(es)
- Smart repair

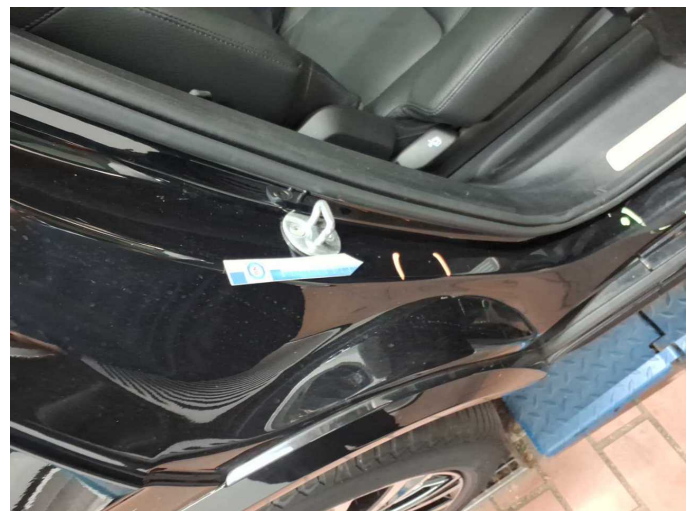

Damage 2: Side panel - rear right side: Sill - dent(s) - Smooth repair work



Damage 2: Side panel - rear right side: Sill - dent(s) - Smooth repair work




Damage 3: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 3: Sill - left side: Sill - Scratch(es) - Smart repair



Damage 3: Sill - left side: Sill - Scratch(es) - Smart repair

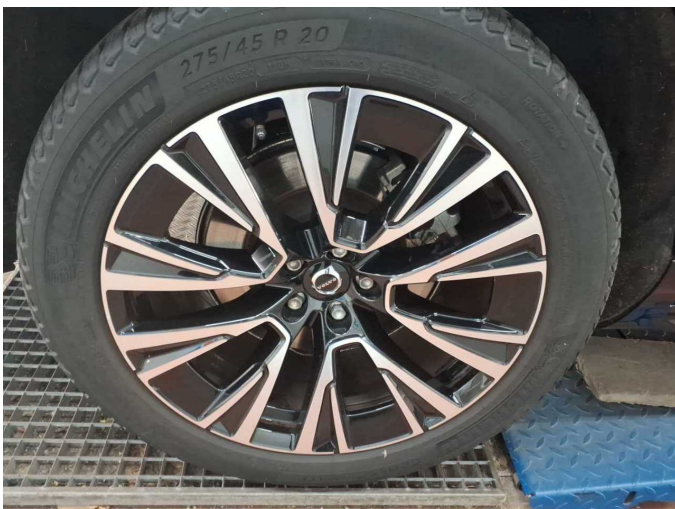

Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratched - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value




Damage 6: Front bumper: Front bumper (+ Blende links lackieren) - Scratch(es) - Paint



Damage 6: Front bumper: Front bumper (+ Blende links lackieren) - Scratch(es) - Paint



Damage 6: Front bumper: Front bumper (+ Blende links lackieren) - Scratch(es) - Paint

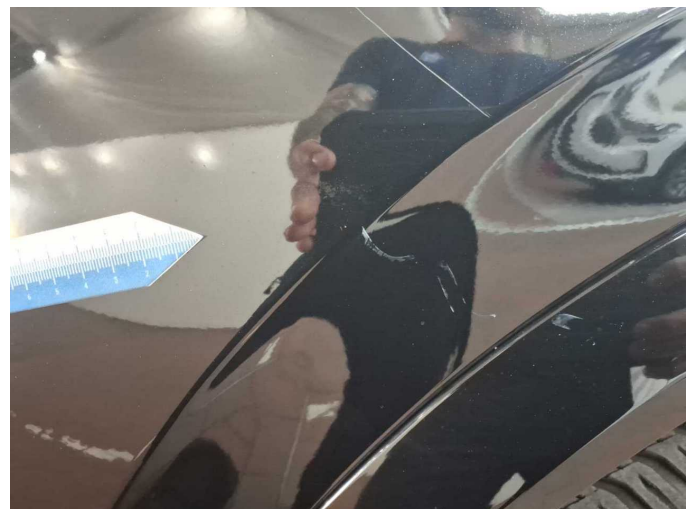

Damage 6: Front bumper: Front bumper (+ Blende links lackieren) - Scratch(es) - Paint




Damage 6: Front bumper: Front bumper (+ Blende links lackieren) - Scratch(es) - Paint



Damage 6: Front bumper: Front bumper (+ Blende links lackieren) - Scratch(es) - Paint



Damage 6: Front bumper: Front bumper (+ Blende links lackieren) - Scratch(es) - Paint

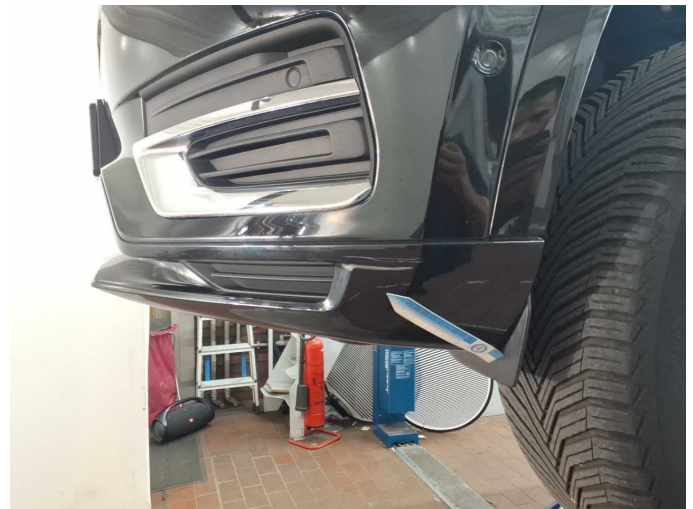

Damage 6: Front bumper: Front bumper (+ Blende links lackieren) - Scratch(es) - Paint



Damage 6: Front bumper: Front bumper (+ Blende links lackieren) - Scratch(es) - Paint



Damage 6: Front bumper: Front bumper (+ Blende links lackieren) - Scratch(es) - Paint




Wear and tear 2: 2nd wheel set: 1 tyre (Kein Teil der Ausstattung) - Worn
- Replace



Wear and tear 2: 2nd wheel set: 1 tyre (Kein Teil der Ausstattung) - Worn
- Replace



Wear and tear 2: 2nd wheel set: 1 tyre (Kein Teil der Ausstattung) - Worn
- Replace

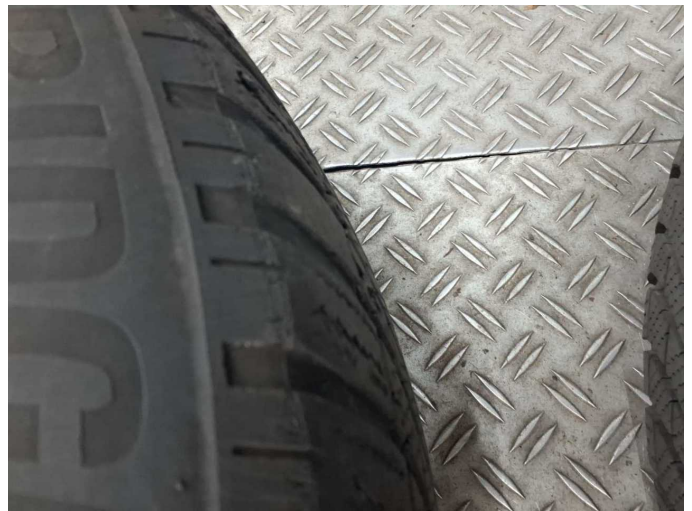

Wear and tear 2: 2nd wheel set: 1 tyre (Kein Teil der Ausstattung) - Worn
- Replace



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction




Wear and tear 3: 2nd wheel set: Alloy rim set - complete (Kein Teil der Ausstattung) - Scratched - No deduction



Wear and tear 4: Door - rear right side: Door - dent(s) - No deduction




Wear and tear 4: Door - rear right side: Door - dent(s) - No deduction

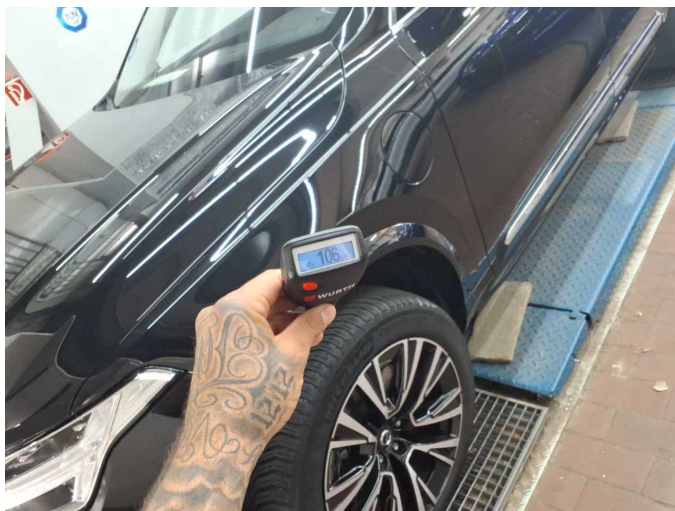

Previous damage 1: Side - left



Previous damage 1: Side - left

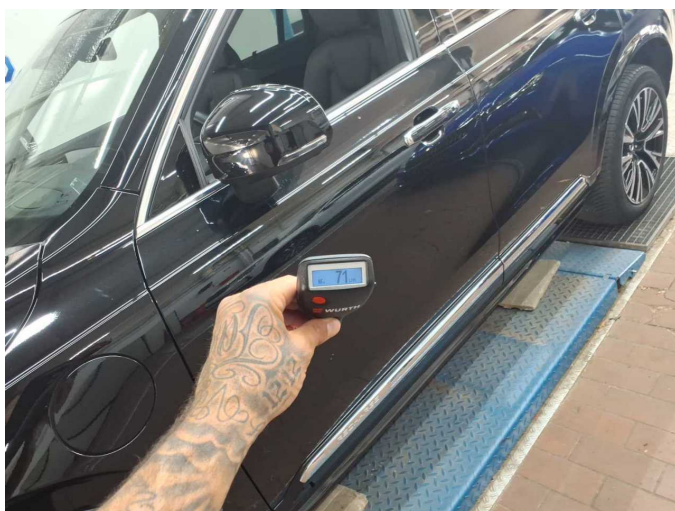

Previous damage 1: Side - left



Previous damage 1: Side - left



Previous damage 1: Side - left



Previous damage 1: Side - left



Previous damage 1: Side - left




Previous damage 1: Side - left



Repainting 1: Side panel - rear left side, Door - rear left side



Repainting 1: Side panel - rear left side, Door - rear left side

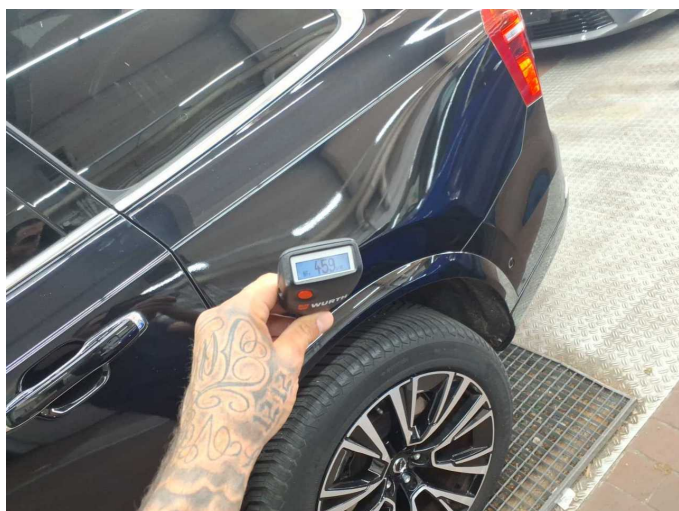

Repainting 1: Side panel - rear left side, Door - rear left side



Repainting 1: Side panel - rear left side, Door - rear left side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1LFH5V9P1975920

Hersteller / Modell: VOLVO VOLVO XC90 T8 AWD Recharge Plus Bright

Datum	KM-Stand	Beschreibung
24.04.2026	49.975	AU
13.02.2026	48.228	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
11.04.2025	32.976	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
26.03.2024	16.493	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges