



Expertise

Protocol number: 46192763  
Order No. / Reference: 26528098  
Inspection date: 23 Jun 2026

|                        |                                                             |
|------------------------|-------------------------------------------------------------|
| Manufacturer: Ford     | Model: Focus 1.5 EcoBlue Start-Stopp-System Aut. TITANIUM X |
| VIN: WF0NXXGCHNPD64093 |                                                             |



| Vehicle details                                           |                   |
|-----------------------------------------------------------|-------------------|
| Manufacturer / Type / Model / Equipment                   |                   |
| Ford Focus 1.5 EcoBlue Start-Stopp-System Aut. TITANIUM X |                   |
| Vehicle Identification number                             | WF0NXXGCHNPD64093 |
| Mileage (Read)                                            | 24,453 km         |
| First registration                                        | 8 May 2023        |
| Number of holders                                         | 1                 |
| Power / Engine displacement                               | 85 kw / 1,499 ccm |
| Fuel type / Cylinder                                      | Diesel / 4        |
| Gearbox / Number of gears                                 | Automatic / 8     |
| Type of drive                                             | Front drive       |
| Type of vehicle                                           | Saloon car        |
| Colour / colour code                                      | Silver Metallic   |
| Doors / Seats                                             | 5 / 5             |
| Upholstery type                                           | Cloth             |
| Colour of upholstery                                      | Black             |



| Vehicle details                              |                              |                         |                                                            |
|----------------------------------------------|------------------------------|-------------------------|------------------------------------------------------------|
| Maintenance booklet / proof                  | Available / complete         | Next maintenance in     | 38 %                                                       |
| Last service on / at                         | 03/2025 at 16,921 km         |                         |                                                            |
| Key is / should be                           | 2 / 2                        | FZG documents           | ZB#2 (B) was available (copy), ZB#1 (S) was not available. |
|                                              |                              | Letter No.              | GT889264                                                   |
| Previous damage / Accident                   | None detectable              | Repainting              | None detectable                                            |
| Inspection conditions                        | sufficient                   | Lifting equipment / pit | No                                                         |
| Test drive                                   | Not performed                | Engine function test    | Performed                                                  |
| Manufacturer key number/<br>type code number | 8566 / BYD 00002             |                         |                                                            |
| Emission standard                            | EURO6;WLTP;AP;PI/CI; M, N1 I | fine dust sticker       |                                                            |
| Permitted total weight                       | 1,910 kg                     | Empty weight            |                                                            |

| Tyres            |                |                             |              |             |
|------------------|----------------|-----------------------------|--------------|-------------|
| Mounted tyres    |                |                             |              |             |
| #                | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
| 1)               | 205/60 R16 92V | Summer tyres on Light alloy | Goodyear     | 5mm / 5mm   |
| 2)               | 205/60 R16 92V | Summer tyres on Light alloy | Goodyear     | 6mm / 6mm   |
| Additional tyres |                |                             |              |             |
| #                | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
| 1)               | 205/60 R16 92H | Winter tyres on Light alloy | Fulda        | 9mm / 9mm   |
| 2)               | 205/60 R16 92H | Winter tyres on Light alloy | Fulda        | 9mm / 9mm   |
| Replacement      |                |                             |              |             |
| Typ              | Tyre size      | Type of tyre                | Manufacturer | Tread depth |
|                  | Tirefit        | Expiration date 03/2027     |              |             |

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



## Equipment



## Standard equipment

- Airbag: Passenger airbag deactivation
- Anti-lock braking system (ABS) with electronic brake force distribution (EBD)
- Tires: 6.5 J x 16 design wheels (4) with 205/60 R16 tires (in 10-spoke design, in black-silver)
- Fabric headliner
- Diesel particulate filter (DPF)
- Tachometer
- Electronic Stability Program (ESP) (with Emergency Brake Assist (EBA) and Traction Control System (TCS))
- Electric parking brake with auto-hold function
- Ford Key Free system including Ford Power Start function (keyless unlocking/locking - keyless starting)
- Luggage compartment cover
- Luggage compartment lighting
- Cruise control
- Transmission: 8-speed automatic transmission
- Back window, heater
- Interior lighting with LED technology (front and rear and map reading lights at the front)
- Isofix mounting (including top tether anchor points on the outer seats of the 2nd row)
- Air conditioning with automatic temperature control (separately adjustable for driver and passenger side (2-zone automatic climate control))
- Knee pads on the center console
- Paint finish: Solid
- LED headlights (LED low beam - LED high beam - LED daytime running lights incl. integrated LED turn signals at the front - LED cornering lights, static, incl. integrated LED fog light function and maneuvering light)
- Make-up mirrors in driver and passenger sun visors
- Front center console "Premium" (sliding armrest - cup holders - storage compartments - 12-volt and USB connection)
- Emergency call assistant
- Front and rear parking pilot system
- Upholstery: Cloth
- Post-Collision Assist (In the event of a severe collision, which would also deploy the airbag and in which the driver might be incapacitated, this system initiates the braking process. This reduces the risk of colliding with further obstacles and road users after the initial collision. The driver can intervene and operate the accelerator or brake pedal manually throughout the entire process.)
- Tire repair kit (for use at a maximum speed of 80 km/h)
- Tire Pressure Monitoring System (TPMS)
- Windscreen wipers with rain sensor (sensitivity adjustable)
- Headlight assistant with day/night sensor
- Selective driving mode switch (including 3 selectable driving modes: Normal, Sport and Eco)
- Ambient lighting, front
- Exterior mirrors painted in body color, electrically adjustable, heated and foldable (with integrated turn signals - ambient lighting)
- Hill start assist
- Roof spoiler painted in car color
- Digital instrument panel 12.3" (31.2 cm screen diagonal)
- Electronic Shifter
- Lane keeping assist including lane keeping assist
- Electric front and rear windows (with all-around closing function)
- FordPass Connect including live traffic information (Additionally for PowerShift automatic transmission: Ford Mobile Remote remote start function)
- Speed limiter (Intelligent speed limiter with speed limit display)
- Illuminated glove compartment
- rear window wiper
- Interior mirror, automatically dimming
- Intelligent safety system (front airbag for driver and front passenger - front and rear head and shoulder airbags - side airbag for driver and front passenger - seat belt tensioners and force limiters in the front and on the outer seats of the 2nd row - 3-point seat belts on all seats, height-adjustable in the front - safety pedal assembly)
- Headrests: 2 front and 3 rear, height adjustable
- LED taillights
- Steering wheel: 3-spoke design steering wheel (in Sensico leather look)
- Steering column, adjustable (adjustable in height and reach)
- Rear center armrest (with 2 cup holders)
- MyKey key system (individually programmable second key)
- Navigation: Ford SYNC 4 including Ford navigation system with AppLink, 13.2" touchscreen and DAB/DAB+ (6 speakers - Amazon Alexa built-in voice assistant - Android Auto and Apple CarPlay - Steering wheel controls - Digital user manual - Bluetooth hands-free calling and audio streaming - USB ports - Voice control for audio and phone - Ford Power-Up software updates - Intelligent route suggestions - Customizable user profiles - Radio player - Audible and visual route guidance, dynamic and cloud-based navigation with advanced traffic information system, lane guidance and road map for Europe)
- Pre-Collision Assist (Forward Alert system with pedestrian and bicycle detection)
- Rear view camera
- Headlight dipped beam (with switch-off delay)
- Side windows from the 2nd row of seats and rear window, dark tinted.
- Electro-mechanical speed-dependent power steering (EPAS - Electric Power Assisted Steering)
- Seats: Driver's seat height adjustable (with manually adjustable lumbar support)
- Seats: Front sports seats with enhanced lateral support



- Seats: Passenger seat height-adjustable, manually (with adjustable lumbar support)
- Seats: Rear seat backrest (foldable, 60:40 split with ski pass-through)
- Start-stop system
- Carpet floor mats front and rear, velour
- 2 USB ports in the center console, rear
- Variable radiator air intake
- Electronic immobilizer
- Central locking with remote control and remote luggage compartment release

- Phone accessories: Inductive charging station for mobile devices (according to Qi standard, compatibility depends on the device)
- Warning system for unfastened seat belts for the 1st and 2nd rows of seats

### Extra equipment

- Fire extinguisher
- Paint finish: Metallic
- Package: Driver Assistance Package II (Drive Assist Intelligent adaptive cruise control Lane keeping assist Traffic jam assist with Stop&Go Traffic sign recognition Wrong-way driver warning radio Evasive steering assist Distance display and distance warning Driver drowsiness detection High beam assist (in conjunction with adaptive LED matrix headlights with glare-free high beam assist) Blind spot assist with cross traffic alert including emergency braking function (when reversing out of parking spaces) and trailer recognition Rear view camera with split view Electrically folding exterior mirrors with surround view)
- Rubber mats
- Package: Easy Parking (Active Parking Assist with parking and exiting function (in conjunction with 8-speed automatic transmission including semi-automated vehicle guidance) - Door edge protection - Rearview camera with "Split View" technology)
- Package: Winter (heated windscreen - heated steering wheel - individually and variably heated front seats)
- Seats: Ford ergonomic seat (driver and front passenger seat, 18-way adjustable: - position, height and tilt of the backrest and seat cushion manually adjustable (in conjunction with EcoBoost Hybrid - front passenger seat, 2-way adjustable) - thigh support, manually extendable - lumbar support, 4-way electrically adjustable)

### Brief expert findings

|                      |                                                                                                                                                                                                                                               |
|----------------------|-----------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------------|
| Documents submitted  | At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)                                                                  |
| VIN comparison       | The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.                                                                     |
| Inspection           | The inspection conditions were sufficient for the assessment of the vehicle.<br>No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent. |
| Test drive           | No test drive/shunting maneuver was carried out during the inspection of the vehicle.                                                                                                                                                         |
| Engine function test | An engine test run was performed.                                                                                                                                                                                                             |

### Value reducing factors

| No. | Component group        | Description                        |
|-----|------------------------|------------------------------------|
| 1   | Door - front left side | Door - Scratch(es) - Smart repair  |
| 2   | Vehicle glazing        | Windscreen - Stone chips - Replace |

### Wear and tear

| No. | Component group | Description                               |
|-----|-----------------|-------------------------------------------|
| 1   | Bonnet          | Bonnet - Stone chips - No deduction       |
| 2   | Front bumper    | Front bumper - Stone chips - No deduction |
| 3   | Rear bumper     | Rear bumper - Scratch(es) - No deduction  |

The vehicle shows signs of wear and tear commensurate with its age and use.



## Missing parts

### Description

Trim / covers - Floor mats (Gummimatten vorne)  
Equipment - Fire extinguisher  
Interior - Boot cover / roller cover

## Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features  
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.  
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

## Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

## Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.





Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear





Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



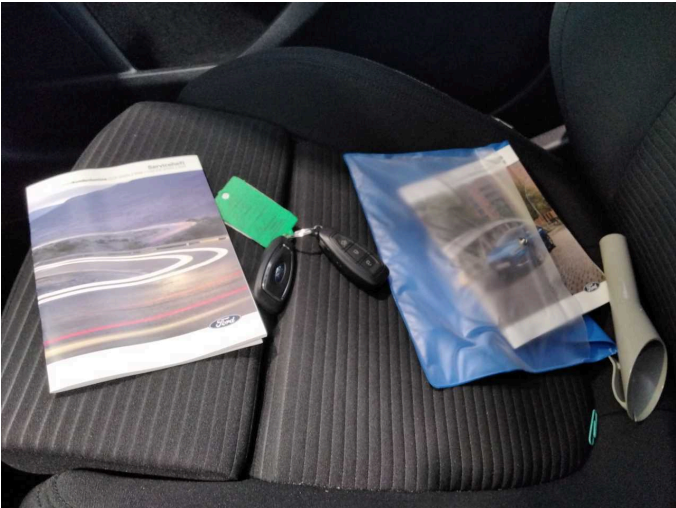


Figure 13: Documents

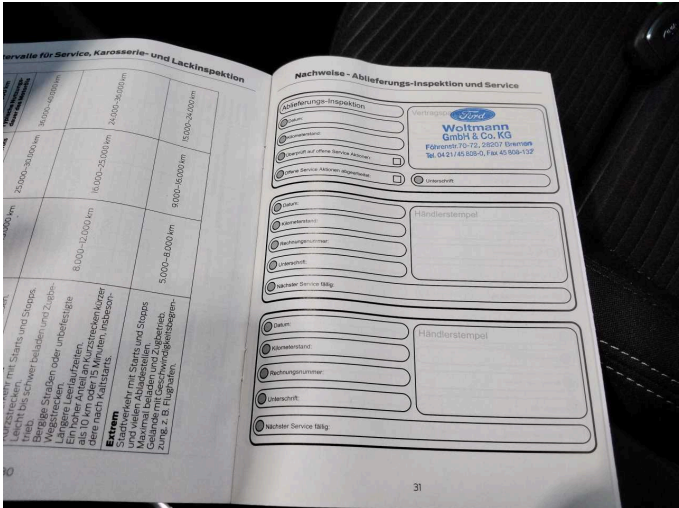


Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres

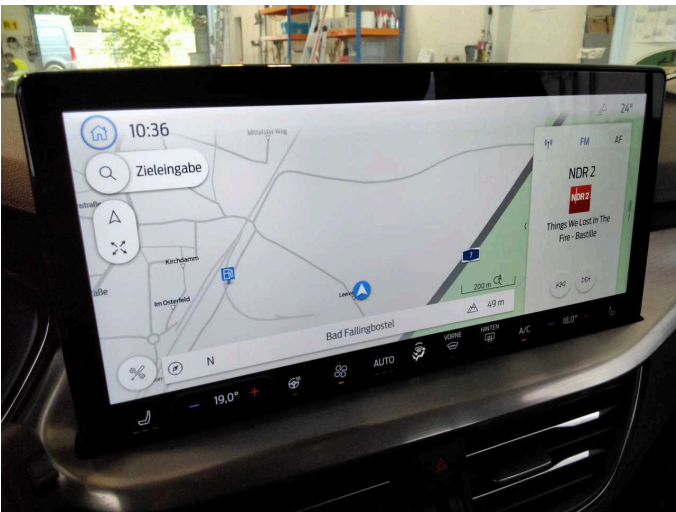


Figure 17: Navigation

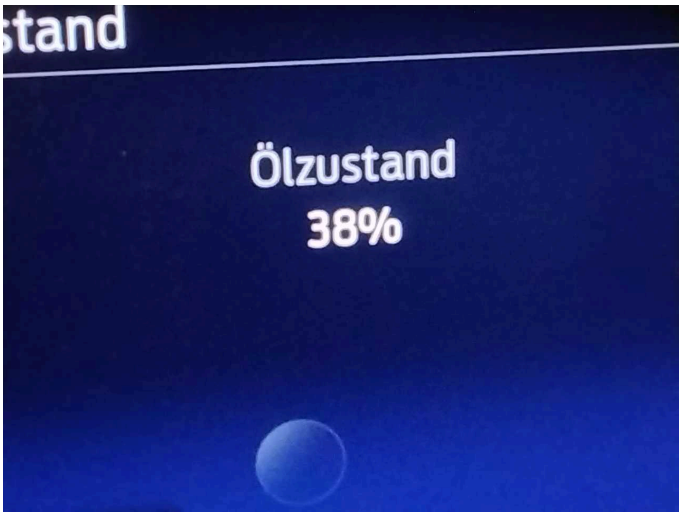


Figure 18: Misc.





Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

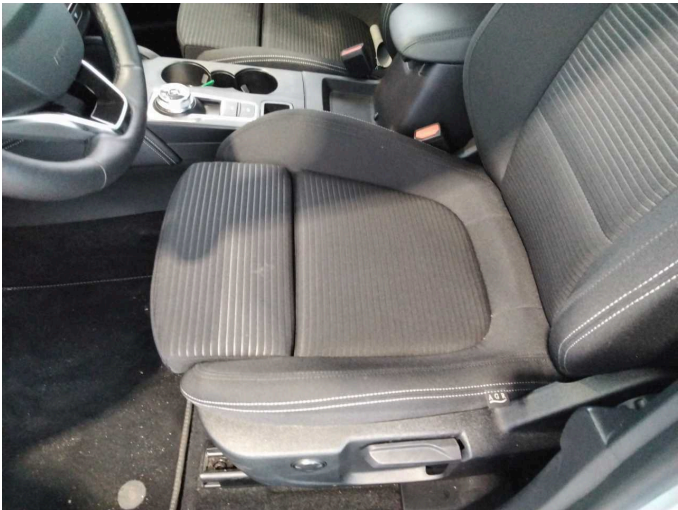


Figure 24: Misc.





**Figure 25:** Misc.



**Figure 26:** Misc.



**Figure 27:** Misc.



**Figure 28:** Misc.



**Figure 29:** Misc.



**Damage 1:** Door - front left side: Door - Scratch(es) - Smart repair






**Damage 1:** Door - front left side: Door - Scratch(es) - Smart repair



**Damage 2:** Vehicle glazing: Windscreen - Stone chips - Replace

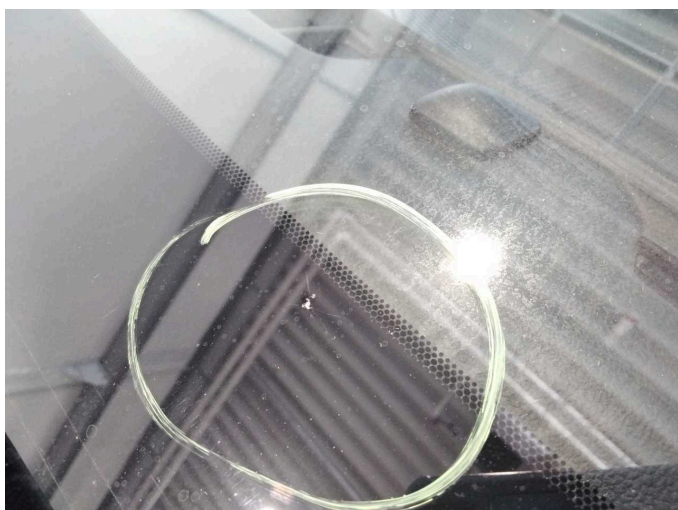

**Damage 2:** Vehicle glazing: Windscreen - Stone chips - Replace



**Damage 2:** Vehicle glazing: Windscreen - Stone chips - Replace



**Missing part 3:** Interior: Boot cover / roller cover - Missing - Replace