



Expertise

Protocol number: 46688055
Order No. / Reference: 26620243
Inspection date: 17 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLA 220 d 4Matic 8G-DCT AMG Line

VIN: W1N2477151J413335



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLA 220 d 4Matic 8G-DCT AMG Line	
Vehicle Identification number	W1N2477151J413335
Mileage (Read)	39,754 km
First registration	30 Jun 2022
Number of holders	1
Next periodical technical inspection	07/2027
(Report not on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,950 ccm / 4
Power	140 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Manufaktor Mountaingrau magno
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Red
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	-14 Tag(e)
Last service on / at	07/2025 at 33,218 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ484804
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	2222 / APU 00053		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,190 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm
2)	235/50 R19 99H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R19 99W	Summer tyres on Light alloy	Pirelli	6mm / 6mm
2)	235/50 R19 99W	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- ADAPTIVE BRAKE with HOLD function, hill start assist, pre-filling and drying brakes in wet conditions
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Lane Keeping Assist
- AMG front apron with chrome front splitter
- AMG floor mats
- Anti-lock braking system (ABS)
- Center console armrest for driver and front passenger with integrated storage compartment
- Outdoor temperature display
- Roof rails in polished aluminum
- Double cup holder
- Third brake light in LED technology
- ECO start/stop function
- Electronic Stability Program (ESP)
- Electric windows (4-way)
- electric parking brake
- Windscreen laminated glass
- Luggage net on driver and passenger seatbacks
- Speed Limit Assistant
- Transmission: 8G-DCT dual-clutch automatic transmission, 8-speed
- Rear window wiper with intermittent function
- Interior headliner fabric crystal grey
- KEYLESS-GO start function
- Climate: THERMATIC automatic climate control
- Rear headrests (3)
- Fuel tank with a capacity of 51 liters
- Steering wheel: Multifunction sports steering wheel in Nappa leather
- Mercedes-Benz emergency call system
- Package: Light and Visibility Package
- Package: Off-road Technology Package
- Upholstery: ARTICO leatherette/DINAMICA microfiber
- Radio accessories: Digital radio
- Rain and light sensor
- Remote Services Plus
- Service interval indicator ASSYST
- GLA-Class seat belts
- Seats: Sports seats
- 12V power outlet in center console
- Cruise control
- Electronic immobilizer
- Central locking
- Adaptive brake light flashing
- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- 4MATIC all-wheel drive with off-road functions and presentation in the CENTRAL MEDIA DISPLAY
- AMG rear apron with diffuser look and chrome trim element
- Traction control (ASR)
- Automatic passenger airbag deactivation
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT
- Door sills with "Mercedes-Benz" lettering
- Suspension with adaptive damping (The suspension with adaptive damping offers a fascinating range of driving pleasure in corners and high comfort on long journeys. Adjust the firmness of the suspension from "Comfort" to "Sport". The lower suspension level and the sport direct steering provide you with the best conditions for a particularly dynamic driving style.)
- Illuminated glove box
- Heated rear window with timer
- ISOFIX child seat anchorages with Top Tether in the rear
- Mechanical child safety lock
- Communication module (LTE) for the use of Mercedes me connect services
- Cargo area cover
- Steering column mechanically adjustable in height and length
- Navigation accessories: Extended MBUX functions
- Package: Non-smoking
- Package: Seating comfort
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Tire pressure monitoring system
- Wheels: 48.3 cm (19") AMG light-alloy wheels, 4 in 5-twin-spoke design
- Seats: Rear seat backrests foldable
- Sport pedal assembly made of brushed stainless steel with rubber studs
- High-visibility vest for drivers
- Heat-insulating glass, green all around
- Decorative elements carbon structure

Extra equipment

- Ambient lighting in 64 colors (Stage the interior according to your personal preference or current mood. The 64 colors of the ambient lighting create fascinating color worlds, for example in the illuminated air vents, doors or the instrument panel.)
- Auxiliary heater (Get in, feel comfortable and drive off safely)
- Climate control: THERMOTRONIC automatic climate control (two zones with individually adjustable temperature for driver and front passenger - automatic control of temperature, air volume and air distribution (Auto button) - sensors maintain the desired climate - fine dust activated carbon filter - dew point sensor prevents window fogging and enables energy-efficient climate control - rear center vents for improved climate comfort in the rear - residual heat button for heating/ventilation when the vehicle is switched off (country-dependent))
- Package: Business (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Seat heating for driver and front passenger - Parking assistant with PARKTRONIC - Preparation for live traffic information)
- Package: Driving Assistance Package (Active Distance Assist DISTRONIC - Active Steering Assist - Active Speed Limit Assist - Active Brake Assist with Cross-Traffic Function - Evasive Steering Assist - Active Blind Spot Assist - Active Lane Keeping Assist - Active Emergency Stop Assist - Route-Based Speed Adaptation - Extended Automatic Restart on Motorways)
- Package: Mirror package (Exterior mirrors electrically fold in and out via a button in the driver's door control panel - the menu allows you to set the exterior mirrors to fold in automatically when locking the vehicle and unfold again when unlocking - the exterior mirror on the driver's side and the interior mirror dim automatically and continuously depending on the incident glare and ambient light)
- Package: Parking package with 360° camera (Including Active Parking Assist and 360° camera)
- Phone accessories: Wireless charging system for mobile devices (in the off-the-shelf section)
- Pre-installation for digital key handover (Share your vehicle with friends and family members more easily than ever before – no matter where you are. You retain full control and decide conveniently via app whether you consent to its use. You can also unlock your vehicle remotely via the mobile application. Only then will a stored key be activated. Service is free of charge for 3 years from activation.)
- 1 set WKR 19" 5 double spokes
- Cargo net (This feature protects you from loose items in the luggage compartment. The cargo net is very easy to use. You can attach or remove it in just a few steps.)
- Heated seats for driver and front passenger
- LED High Performance headlights (low beam in LED projection technology - high beam with LED reflector technology - daytime running lights, position lights and direction indicators in LED technology - automatic adjustment of the light intensity of the rear lights to the surroundings)
- Package: Cargo area (chrome-look loading sill protector - 12V socket - reversible mat - nets on left and right sides - storage compartment under left net - net on boot floor (not for plug-in hybrid) - tension straps on left and right sides)
- Package: MBUX High-End Package (Hard drive navigation - Smartphone integration - Wireless charging system for mobile devices - Preparation for digital key handover - Connectivity package navigation - Central Media Display 10.25" - Fully digital instrument display with high-resolution 10.25" display - MBUX Augmented Reality for navigation - Traffic sign assistant - Preparation for live traffic information)
- Paintwork: MANUFAKTUR magno
- Radio accessories: Advanced sound system (with 10 speakers and 225 watts system power)
- Sport brake system (drilled brake discs, brake calipers at the front and badges at the rear with Mercedes-Benz lettering)
- Steering wheel: Multifunction sports steering wheel in Nappa leather/ DINAMICA microfiber (The multifunction sports steering wheel in Nappa leather with chrome controls and a DINAMICA microfiber grip area fits perfectly in the hand. It is the ideal partner for dynamic driving during rapid changes of direction. The shape and material combination create pure racing flair. The fine Nappa leather also signals the highest quality.)
- Storage compartment in center console with roller blind (The roller blind for the storage compartment in the center console offers you an elegant privacy screen made of high-quality material. This looks good, the interior appears even tidier, and everything important is within easy reach. Typical everyday items such as a smartphone, wallet, or various keys fit into the practical storage compartment.)
- Towbar with ESP trailer stabilization
- Type designation removed from luggage compartment lid



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance (Service B1 um 14 Tage überzogen) - Due - Perform
2	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Interior	Interior - Soiled - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction
4	Door - front left side	Door edge - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Die Unterbodenbesichtigung war nur ebenerdig & eingeschränkt möglich - Mehrkosten sind möglich.
- Für den montierten Radsatz wurde kein Nachweis erbracht.
- Winterradsatz ist kein Bestandteil des Auslieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

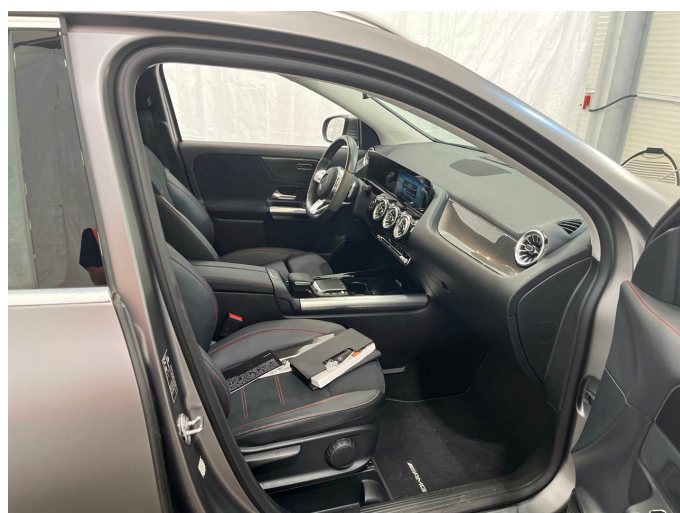


Figure 5: Interior - front

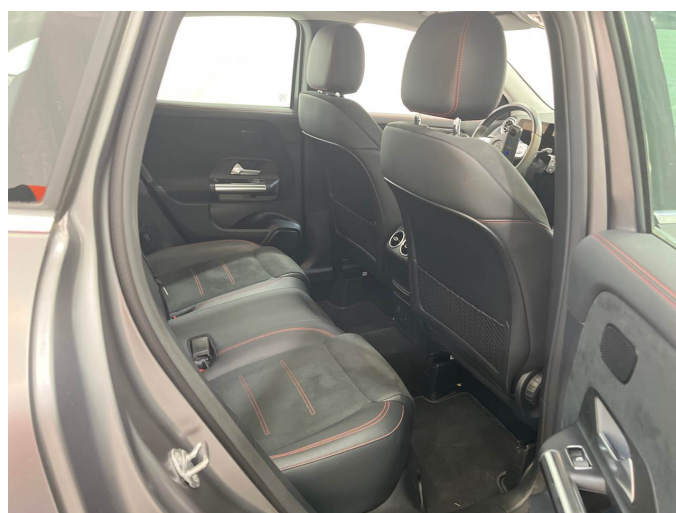


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

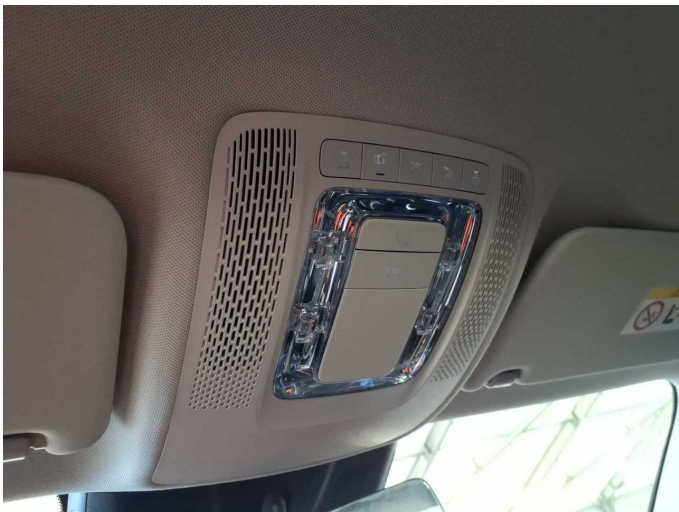


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.

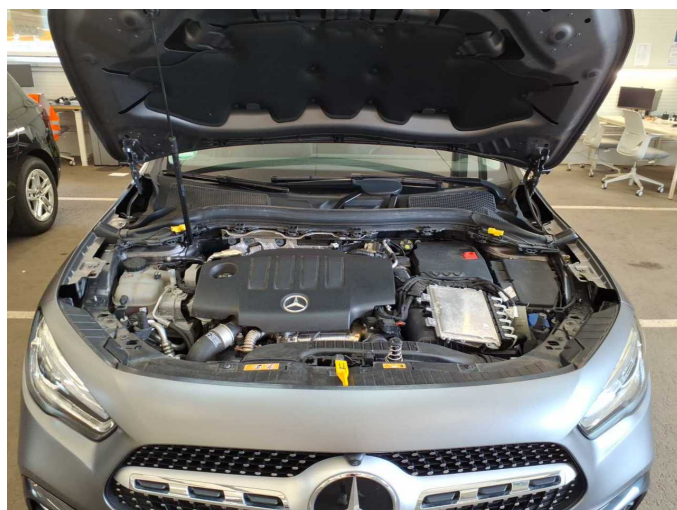


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

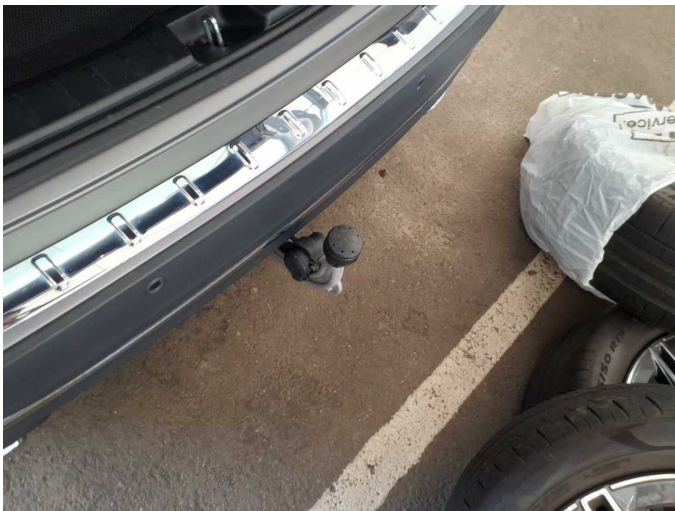


Figure 27: Misc.



Figure 28: Misc.



Damage 1: Misc.: Inspection / maintenance (Service B1 um 14 Tage überzogen) - Due - Perform



Damage 2: Front bumper: Front bumper - Scratched - Paint



Damage 2: Front bumper: Front bumper - Scratched - Paint



Wear and tear 4: Door - front left side: Door edge - Scratch(es) - No deduction



Wear and tear 4: Door - front left side: Door edge - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2477151J413335

Hersteller / Modell: MERCEDES-BENZ MB GLA 220 d 4Matic 8G-DCT AMG Line

Datum	KM-Stand	Beschreibung
03.07.2025	33.218	HU + AU
01.07.2025	33.218	Regelwartungsdienst
03.07.2024	18.453	Regelwartungsdienst
29.06.2023	6.863	Regelwartungsdienst