



Expertise

Protocol number: 46844838
Order No. / Reference: 26737796
Inspection date: 3 Aug 2026

Manufacturer: Skoda
VIN: TMBJH9NY3SF022798

Model: ENYAQ 85



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda ENYAQ 85	
Vehicle Identification number	TMBJH9NY3SF022798
Mileage (Read)	8,100 km
First registration	30 Sept 2024
Number of holders	1
Next periodical technical inspection	09/2027
(Report not on hand)	
Fuel type	Electric
Power	89 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	SUV
Colour / colour code	Arctic-Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Dark grey-Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	65 Tag(e)
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HG799137
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AXP 00013		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,650 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/50 R20 100T	Summer tyres on Light alloy	Bridgestone	5mm / 5mm
2)	255/45 R20 101T	Summer tyres on Light alloy	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101H	Winter tyres on Light alloy	Pirelli	7mm / 7mm
2)	255/50 R19 103H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 07/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaanlage

Standard equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Turning assistant including evasive steering support • front aero windshield wipers • Airbag, driver and passenger • Airbag, front side airbags • Anti-lock braking system (ABS) • Electrically adjustable, heated and folding exterior mirrors • Hill start assist • Design Selection Loft • Third brake light • Electronic parking brake including auto-hold function • Electric windows front and rear • Cruise control • Transmission: 1-speed (EV) • Illuminated glove compartment • Rear window wiper including windshield washer system • Isofix anchorage on the front passenger seat • Child safety locks on the rear doors • Climatronic air conditioning (2-zone) • Front and rear headrests are height-adjustable. • LED license plate lights • LED headlights with daytime running lights • Steering wheel adjustable for height and reach • Manual headlight range adjustment • Multi-collision brake • Navigation: Navigation system • Front and rear parking sensors • Rain sensor and driving light assistant with coming and leaving home function • Tire pressure monitoring • Rear seat backrest split 60:40, foldable • Power steering • Safety lights in the front side doors • Skoda Care Connect • Sun visors with illuminated make-up mirror on driver and passenger side • 12V socket - in the trunk • Traffic sign recognition • heat pump | <ul style="list-style-type: none"> • Storage compartments • Airbag, center airbag front • Airbag, front and rear head airbags • acoustic windscreen • Traction control (ASR) • Outdoor temperature display • Grey headliner • Digital Cockpit • E-Sound • ESC Electronic Stability Control • Front radar assistant with pedestrian and cyclist detection and city emergency braking function • Tinted windows • Heated rear window • Automatic interior mirror dimming • Isofix anchorage on the outer rear seats including top tether • Removable boot cover • Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A) • LED taillights • Steering wheel: Leather steering wheel with multifunction buttons • Fatigue detection • Package: Chrome • Radio: Infotainment system with capacitive 13" color display • Tire Mobility Kit • Rear view camera • Side skirts painted in body color • Seat belts • Seats: Front seats height-adjustable including manually adjustable lumbar support • Speed limiter • Lane keeping assistant (Lane Assist) • Front and rear bumpers in sporty design • Immobiliser • Central locking including remote control integrated into the key |
|--|--|

Extra equipment

- | | |
|---|---|
| <ul style="list-style-type: none"> • Luggage net partition • Package: ADVANCED (Package Plus - Heated outer rear seats - Heated windscreen - Illuminated front grille "Crystal Face" - Augmented reality head-up display - CANTON sound system) • Panoramic sunroof, electric (deletion of the glasses compartment in the headliner) | <ul style="list-style-type: none"> • Paint finish: Metallic • Package: Transport (Net program in the trunk incl. charging cable bag - Variable loading floor in the trunk - Remote release of the rear seat backrests in the trunk - Cargo elements in the trunk) • Wheels: 20" Neptune AERO alloy wheels, anthracite polished (front: 8Jx20 tires 235/50 R20 100T - rear: 9x20 tires 255/45 R20 101T) |
|---|---|



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - No evidence - No deduction
2	Rear bumper	Rear bumper - Scratch(es) - Smart repair

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 21 Sept 2025	4.743,66 €

Repainting

No.	Repainting
1	Side panel - rear right side, Door - front right side, Professionally carried out

Paint coat thickness measurement

Side panel - rear right side	231 µm	Door - front right side	240 µm
------------------------------	--------	-------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

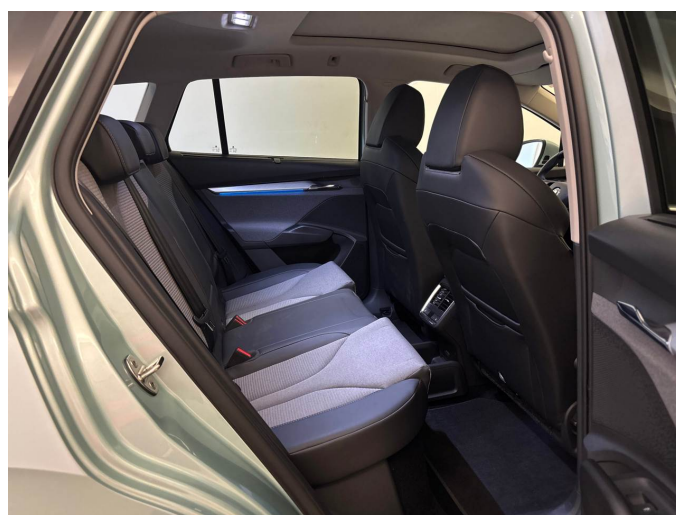


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

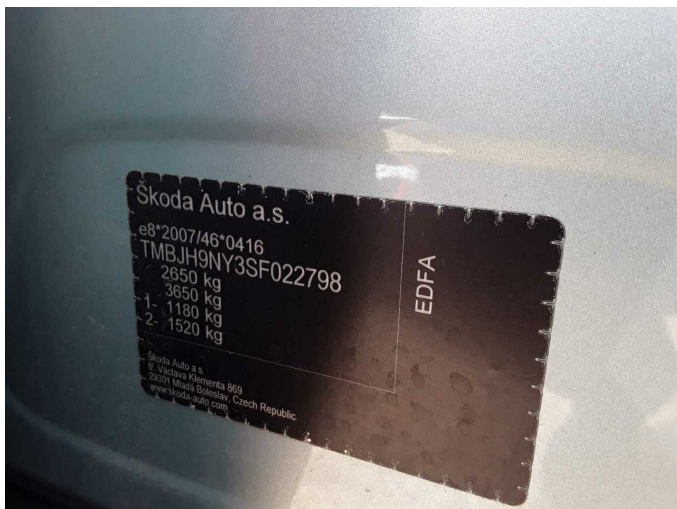


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Navigation



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

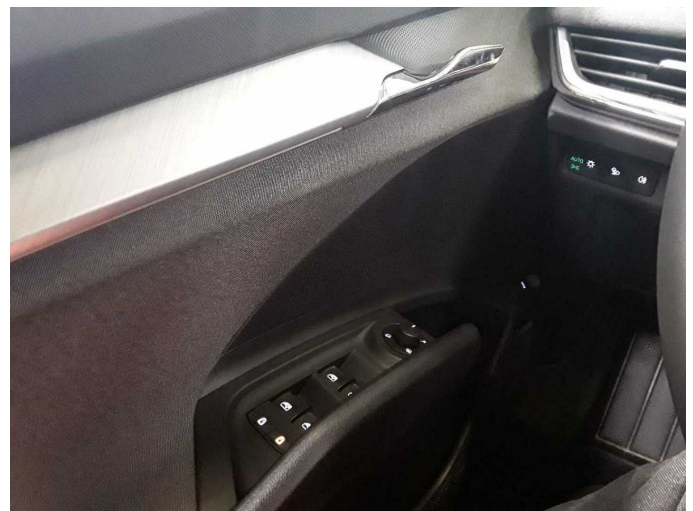


Figure 24: Misc.



Figure 25: Misc.

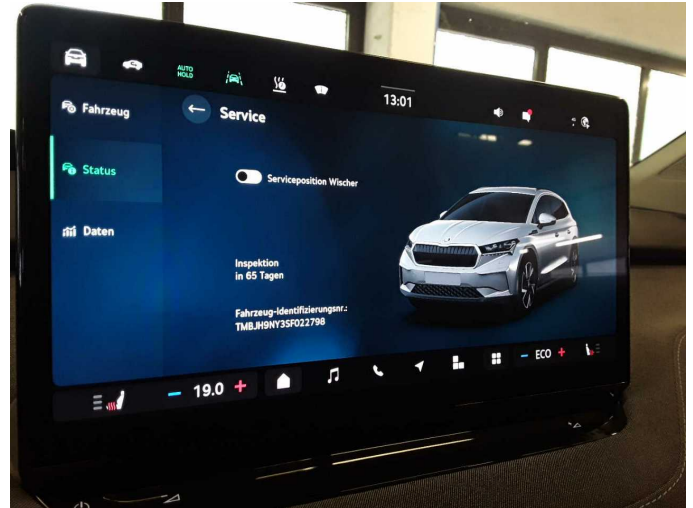


Figure 26: Misc.

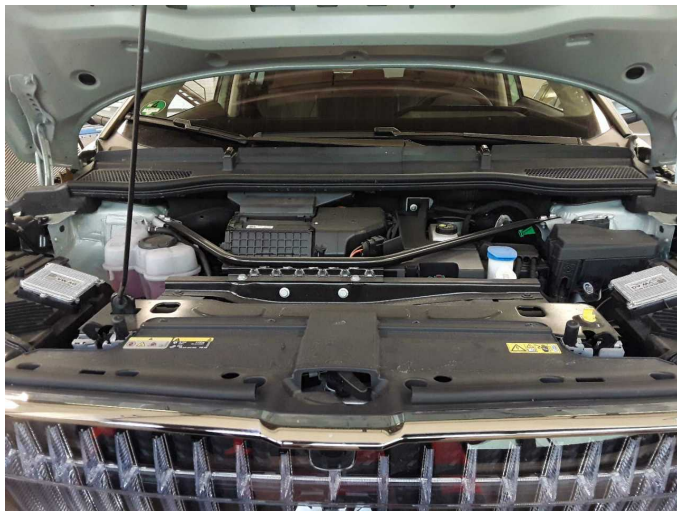


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.




Figure 38: Misc.




Figure 39: Misc.



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair

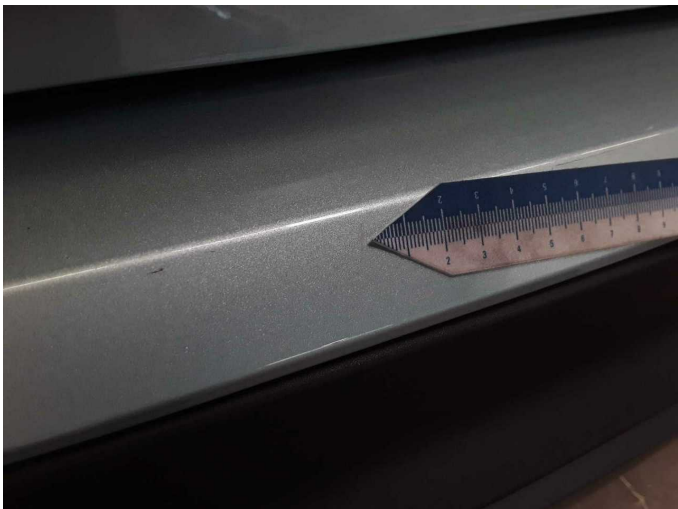

Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair

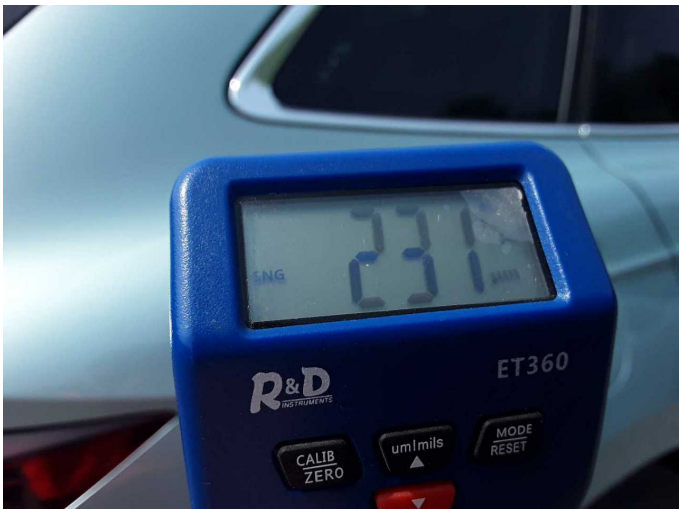

Side panel - rear right side: 231 μm



Door - front right side: 240 µm