

Volkswagen Golf:

Vinnumber:	WVWZZZAUZKP085293	Versionname:	
First Registrationdate:	4/06/2019	Fiscalpower:	
Expertise Mileage:	114512	Power Kw:	110
Bodytype:		Body colour:	Black
Gearbox:	Automatic	Type of rims (mounted):	Aluminium
Transmission:		Parking lot:	2816
Fueltype:	Diesel		
Maintenance:	NOT OK		
Type of rims (mounted):	Aluminium		
Certificate of Conformity:	Yes		
Category:	Passenger Car		
Registration Certificate Car (BE):	Yes		

Options

Number of keys total:	2	Luggage cover:	
Cruise Control:		Front parking sensors:	
Steering wheel multifunctional:		Rear parking sensors:	
Radio multimedia:		Type of Tow bar:	No Tow bar
Type of headlighting:	Headlighting Halogen		
Type of GPS:	GPS big screen color		
Type of Lining:	Lining semi-Alcantara		
Type of climate control:	Autom climate control		

Limited Technical Inspection

Tyres

	205/55/16/92 H			
Summer tyres:	Fr.L.	Semperit: 5 mm	Fr.R.	Semperit: 5 mm
	Re.L.	Dunlop: 5 mm	Re.R.	Dunlop: 5 mm
Tyre profile depth FL:				5.0
Tyre profile depth FR:				5.0
Tyre profile depth RL:				5.0
Tyre profile depth RR:				5.0
Tyre size FL:				205/55 R 16 92 H
Tyre size FR:				205/55 R 16 92 H
Tyre size RL:				205/55 R 16 92 H
Tyre size RR:				205/55 R 16 92 H
Tyre type FL:				Summer
Tyre type FR:				Summer
Tyre type RL:				Summer
Tyre type RR:				Summer
Tyre make FL:				2477
Tyre make FR:				2477
Tyre make RL:				257
Tyre make RR:				257

Assistance equipment

Number of charging cables (normal):	0
Number of charging cables (rapid charge):	0

Total cost ex VAT:	2208,04
Interior, Stain, Cleaning:	175,04



Door panel RL, Scratch(es), Acceptable 0,00



Service, Maintenance, Check 0,00



Bumper F, Scratch(es), Repair and paint (complete) 296,58




Bonnet, Chemical polution, Repair and paint (complete) 465,70



Roof pillar L, Dent(s), Acceptable 0,00



Alloy rim RL, Scratch(es), Acceptable 0,00

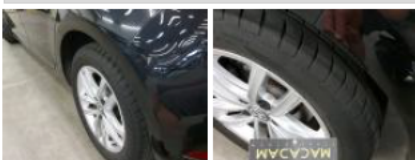

Door RL, Dent(s), Acceptable 0,00



Door FL, Scratch(es), Spot repair 148,33



Step L, Scratch(es), Repair and paint (complete) 161,81



Wing FL, Dent(s), Paintless dent repair 95,47



Wing FL, Scratch(es), Acceptable 0,00



Roof pillar L, Scratch(es), Repair and paint (complete) 308,32




Boot cover, Broken, Replace 143,52



Boot carpet, Damaged, Smart repair 116,69



Tailgate / Boot, Dent(s), Acceptable 0,00

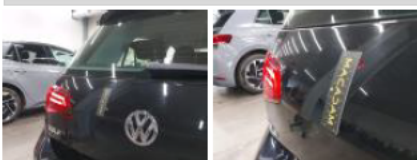

Rear window, Scratch(es), Acceptable 0,00



Bumper R, Dent(s) and scratch(es), Repair and paint (complete) 296,58



Wing FR, Dent(s), Acceptable 0,00



Door RR, Scratch(es), Repair and paint (complete) 0,00



Wing RR, Dent(s) and scratch(es), Repair and paint (complete) 0,00



Roof, Hail damage, Repair and paint (complete) 0,00

