



Expertise

Protocol number: 46920934
Order No. / Reference: 26765664
Inspection date: 6 Aug 2026

Manufacturer: Volkswagen

Model: Polo 1.0 TSI DSG OPF Highline

VIN: WVGZZAWZMU029373



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Polo 1.0 TSI DSG OPF Highline	
Vehicle Identification number	WVGZZAWZMU029373
Mileage (Read)	45,650 km
First registration	2 Jul 2021
Number of holders	1
Next periodical technical inspection	07/2026
(Report not on hand)	
Fuel type	Petrol
Engine displacement / Cylinder	999 ccm / 3
Power	70 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Pure White
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Re-import	no
Vehicle with smoke odor	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	6,100 km
Last service on / at	08/2025 at 28,451 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GC195074
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	0603 / CDS 00686		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,650 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 91V	Summer tyres on Light alloy	Goodyear	5mm / 5mm
2)	195/55 R16 91V	Summer tyres on Light alloy	Goodyear	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2030		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Equipment

- Klimaautomatik

Standard equipment

- | | |
|---|--|
| <ul style="list-style-type: none"> • Storage pockets on the backs of the front seats • Airbag, head airbag system for front and rear passengers • Outdoor temperature display • third brake light • Ceramique headliner • Parking assistance • Automatic headlight control with daytime running lights • Windscreen made of laminated safety glass, heat-insulating • Luggage compartment lighting • Transmission: 7-speed DSG • Rear window wiper with intermittent function • ISOFIX mounting points • LED license plate lighting • Rear headrests (3) • Front headrests • Steering column adjustable in height and length • Front center armrest, longitudinally adjustable, with storage box • Fog lights and cornering lights • Emergency braking assistant "Front Assist" • Otto particulate filter • Package: Winter • Radio "Composition" • Radio accessories: Digital radio reception DAB+ • Wheels: Tire Mobility Set • Rear seat bench is undivided, backrest is asymmetrically split and foldable • Seat belts: • Seats: Front seats are height-adjustable • Storage compartment under the front seats • Telephone interface • First aid kit, warning triangle and high-visibility vest • Warning tone and light for unfastened seat belts front and rear • Central locking without safe locking, with remote control and 2 remote folding keys | <ul style="list-style-type: none"> • Airbag for driver and front passenger • Ambient lighting • Hill start assist • Chrome applications • Decorative inlays in Deep Iron Metallic • Electronic Stability Program (ESP) • Fresh air intake with activated carbon filter • Pedestrian detection • luggage compartment cover • Speed limiter • Rear window heated • Interior lights with delayed shut-off and dimming function, 2 reading lights in the front and 2 in the rear • Instrument cluster with electronic speedometer, odometer and trip odometer, tachometer • Radiator grille with chrome strip • Illuminated makeup mirrors in the sun visors • Multifunction display "Plus" • Fatigue detection • Non-smoking version • Emergency call service • Package: Comfort Package (Electrical) • Upholstery: Fabric "Tracks 2" • Radio accessories: 4 speakers • Tire pressure monitoring system (passive) • Rear light dark red • Gearshift knob in leather • Power steering • Seats: Sport comfort seats • Start-stop system • Bumpers in body color • Textile floor mats • Prepared for "We Connect" and "We Connect Plus" • Electronic immobilizer • Green thermal insulation glazing, sides and rear |
|---|--|



Extra equipment

- Extended warranty, 3 years following the manufacturer's warranty, maximum total mileage 100,000 km
- Adaptive Cruise Control (ACC) stop & go up to 210 km/h and emergency braking assistant "Front Assist" (Adaptive Cruise Control ACC "stop&go" incl. speed limiter - "Front Assist" area monitoring system, city emergency braking function (for ACC cruise control up to 210 km/h))
- "Climatronic" air conditioning system (Air Care Climatronic air conditioning system with active combination filter and 2-zone temperature control)
- Navigation system "Discover Media" incl. "Streaming & Internet" (6 speakers - screen diagonal 20.3 cm - touchscreen - FM radio reception - dual tuner with phase diversity - RDS - radio station logos - MP3 - USB-C with Apple compatibility - output power 4x20 watts - 2D map display - traffic sign display - telephone interface - 3-way tone control - DAB+ digital radio reception)
- Rear side windows and rear window tinted
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto (selected apps for Android smartphones and Apple iPhones can be displayed and operated on the touchscreen of the radio or navigation system)
- Electrically adjustable, folding, and heated exterior mirrors, passenger-side mirror lowering function
- Pure White paint finish
- LED headlights (LED headlights for low and high beam - dynamic headlight range control)
- Package: Light and Sight (automatic headlight control with LED daytime running lights, "Leaving home" function and manual "Coming home" function - automatically dimming interior mirror - rain sensor)
- Wheels: 4 light alloy wheels 6.5 J x 16 "Las Minas" (wheel locks with enhanced theft protection - tires 195/55 R 16, rolling resistance class A)
- Seats: Lumbar support in the front

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - Due - Perform
2	Side panel - rear right side	Sill - Dent / paintcoat damage - Smart repair
3	Wheel / tyres	Alloy rim - front left side - Scratched - Replace
4	Sill - right side	Sill - Dent / paintcoat damage - Repair and paint
5	Rear bumper	Rear bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres

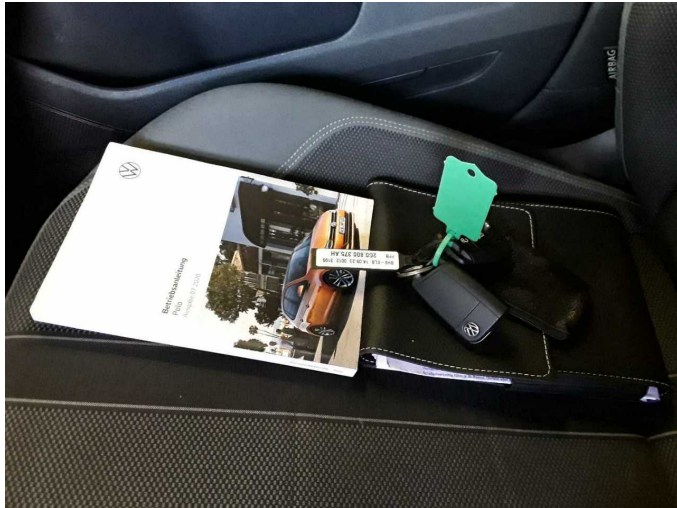


Figure 13: Documents



Figure 14: Navigation



Figure 15: Misc.

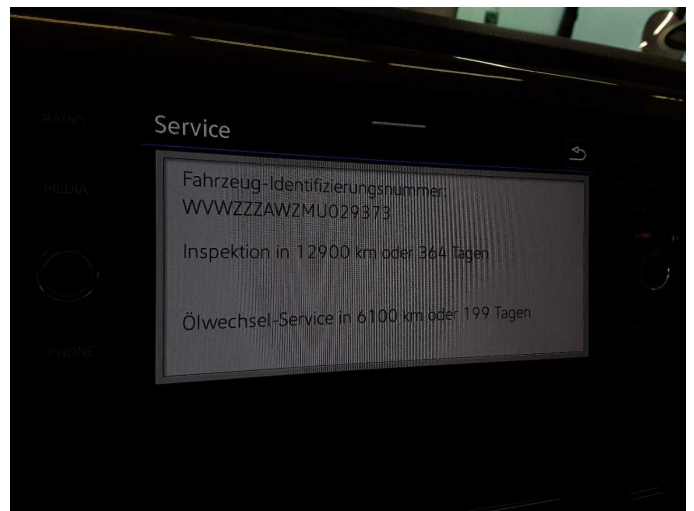


Figure 16: Misc.

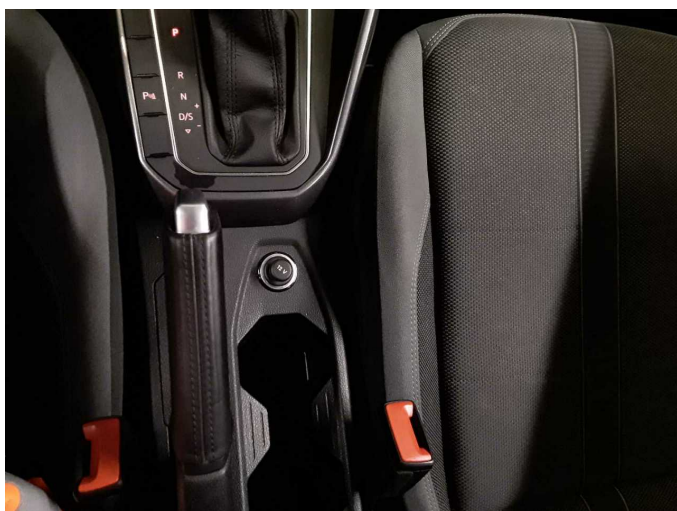


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

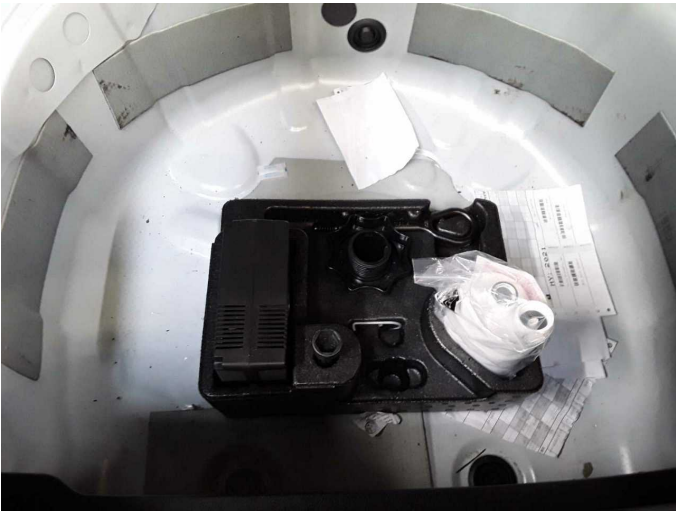


Figure 29: Misc.

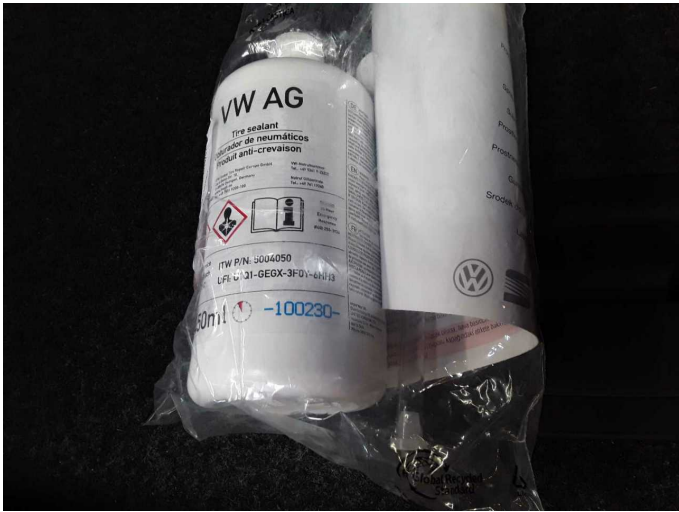



Figure 30: Misc.




Figure 31: Misc.



Figure 32: Misc.

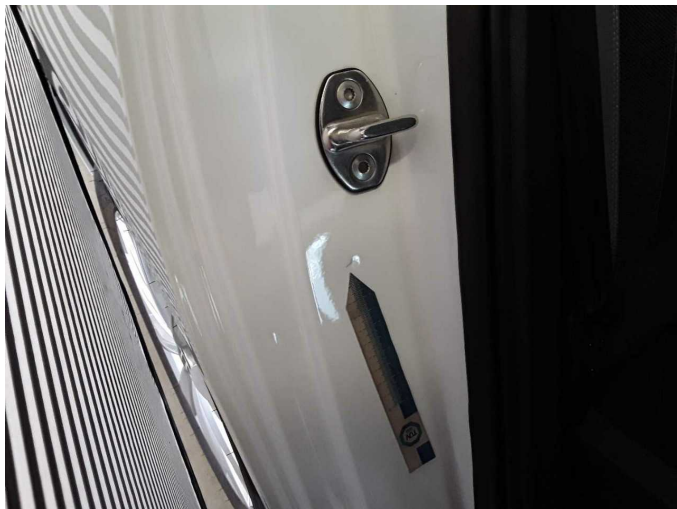

Damage 2: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair

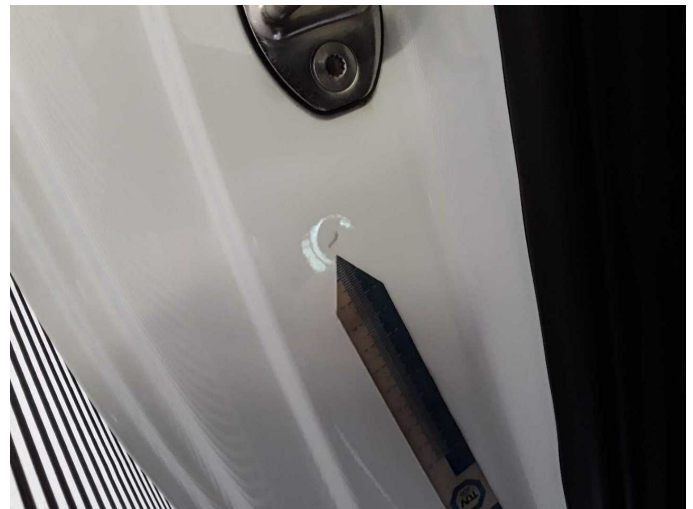

Damage 2: Side panel - rear right side: Sill - Dent / paintcoat damage - Smart repair



Damage 3: Wheel / tyres: Alloy rim - front left side - Scratched - Replace




Damage 3: Wheel / tyres: Alloy rim - front left side - Scratched - Replace



Damage 4: Sill - right side: Sill - Dent / paintcoat damage - Repair and paint



Damage 4: Sill - right side: Sill - Dent / paintcoat damage - Repair and paint

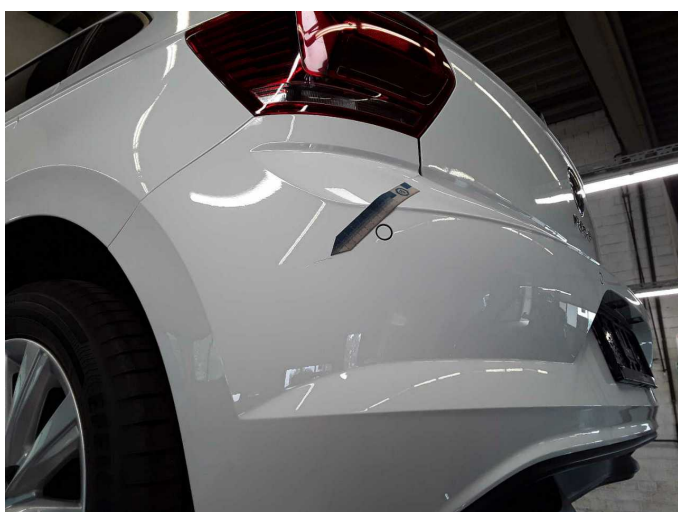

Damage 5: Rear bumper: Rear bumper - Scratched - Paint



Damage 5: Rear bumper: Rear bumper - Scratched - Paint



Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 1: Front bumper: Front bumper - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wear and tear 2: Bonnet: Bonnet - Stone chips - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZAWZMU029373

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Polo 1.0 TSI DSG OPF Highline

Datum	KM-Stand	Beschreibung
06.08.2025	28.451	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
23.07.2024	13.894	AU; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
13.07.2023	9.423	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst; Wartung Sonstiges
28.12.2022	8.148	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges