



Audi A4:			
Vinnumber:	WAUZZZF40PA022660	Versionname:	
First Registrationdate:	24/10/2022	Fiscalpower:	
Expertise Mileage:	86601	Power Kw:	110
Bodytype:		Body colour	Black
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	4433
Fueltype:	Hybrid Petrol		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options			
Number of keys total	2	Seats electric F L	
Cruise Control		Sun Roof electric	
Steering wheel multifunctional		Luggage cover	
Seats F heated		Front parking sensors	
Radio multimedia		Rear parking sensors	
Type of headlighting	Headlighting LED	Type of Tow bar	No Tow bar
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		
Type of GPS storage	HD		

Limited Technical Inspection

Tyres

		245/40/18/93 H		
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R.	Michelin: 4 mm
	Re.L.	Bridgestone: 5 mm	Re.R.	Bridgestone: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				5.0
Tyre profile depth RR				4.0
Tyre size FL				245/40 R 18 93 H
Tyre size FR				245/40 R 18 93 H
Tyre size RL				245/40 R 18 93 H
Tyre size RR				245/40 R 18 93 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				261
Tyre make FR				261
Tyre make RL				255
Tyre make RR				255

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		
Total cost ex VAT			3580,15
Seat cover R, Damaged, Acceptable			0,00




Bonnet, Dent(s), Acceptable	0,00
-----------------------------	------



Bumper F, Scratch(es), Repair and paint (complete)	296,58
--	--------




Roof pillar L, Bad repair, Repair and paint (complete)	308,32
--	--------

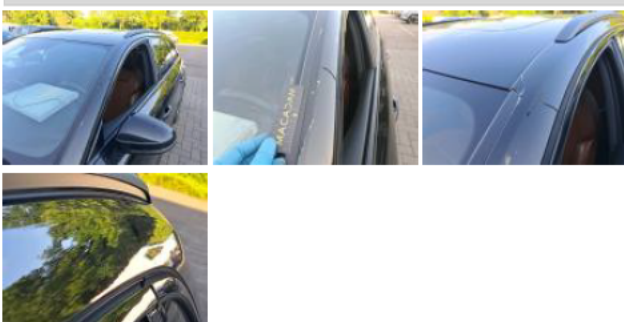


Alloy rim FL polished, Scratch(es), Repair and paint (complete)	204,21
---	--------



Alloy rim RL polished, Scratch(es), Repair and paint (complete)	204,21
---	--------

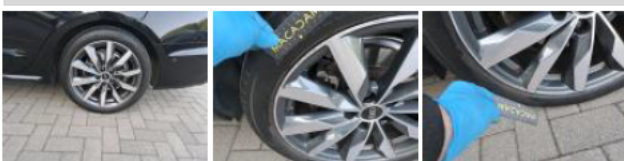

Wing RL, Bad repair, Repair and paint (complete)	431,58
--	--------

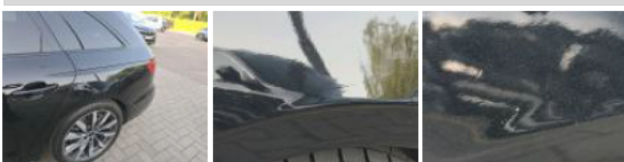

Door FL, Dent(s) and scratch(es), Repair and paint (complete)	475,54
---	--------



Door RL, Dent(s) and scratch(es), Acceptable	0,00
--	------



Step L, Scratch(es), Acceptable	0,00
---------------------------------	------



Bumper R, Dent(s) and scratch(es), Repair and paint (complete)	356,09
--	--------



Alloy rim FR polished, Scratch(es), Repair and paint (complete)	204,21
---	--------



Tyre FR, Tear, Replace	180,98
------------------------	--------



Wing FR, Dent(s) and scratch(es), Repair and paint (complete)	427,34
---	--------



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)	491,09
---	--------



Alloy rim RR polished, Scratch(es), Acceptable	0,00
--	------



Outside rear-view mirror housing R, Scratch(es), Acceptable	0,00
---	------

