



Expertise

Protocol number: 46572781
Order No. / Reference: 26657642
Inspection date: 17 Jul 2026

Manufacturer: Skoda
VIN: TMBLE9NY1PF056599

Model: Enyaq iV 80x



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Enyaq iV 80x	
Vehicle Identification number	TMBLE9NY1PF056599
Mileage (Read)	86,496 km
First registration	19 Jun 2023
Number of holders	1
Next periodical technical inspection	06/2026
(Report not on hand)	
Power / Engine displacement	77 kw / 0 ccm
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Brillant-Silber Metallic
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	323 Tag(e)
Last service on / at	07/2025 at 54,893 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT108212
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	8004 / AWT 00036		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,750 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101T	Summer tyres on Light alloy	Hankook	5mm / 5mm
2)	255/50 R19 103T	Summer tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105V	Winter tyres on Light alloy	Fulda	5mm / 5mm
2)	255/50 R19 107V	Winter tyres on Light alloy	Fulda	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Storage compartments
- Airbag, driver and passenger
- Airbag, front side airbags
- Permanent all-wheel drive
- Traction control (ASR)
- Electrically adjustable, heated and folding exterior mirrors, including automatic dimming.
- Grey headliner
- Third brake light
- Electronic parking brake including auto-hold function
- ESC Electronic Stability Control
- Electric windows front and rear
- Cruise control
- Transmission: 1-speed (EV)
- Heated rear window
- Automatic interior mirror dimming
- Isofix anchorage on the outer rear seats including top tether
- Front and rear headrests are height-adjustable.
- LED headlights with daytime running lights
- LED taillights
- Manual headlight range adjustment
- Package: Drive BASIC
- Radio: Infotainment system with capacitive 13" color display
- Rain sensor and driving light assistant with coming and leaving home function
- Wheels: 19" Proteus Silver alloy wheels
- Power steering
- Safety lights in the front side doors
- Skoda Care Connect
- Speed limiter
- 12V socket - in the trunk
- Immobiliser
- Airbag, center airbag front
- Airbag, front and rear head airbags
- acoustic windscreen
- Anti-lock braking system (ABS)
- Evasive steering assist including turn assist
- Outdoor temperature display
- Hill start assist
- Digital instrument cluster (Virtual Cockpit)
- E-Sound
- Increased battery charging power max. 125 kW incl. 1 year free monthly basic fee at Ionity
- Front radar assistant with pedestrian and cyclist detection and city emergency braking function
- Tinted windows
- Rear window wiper including windshield washer system
- Isofix anchorage on the front passenger seat
- Child safety locks on the rear doors
- Removable boot cover
- Charging cable for AC charging stations (Mode 3 charging cable, Type 2, 16A)
- Steering wheel adjustable for height and reach
- Package: Chrome
- Package: Parking BASIC
- Radio accessories: SmartLink
- Radio accessories: Wireless SmartLink
- Tire Mobility Kit
- Tire pressure monitoring
- Rear seat backrest split 60:40, foldable
- Seat belts
- Seats: Front seats height-adjustable including manually adjustable lumbar support
- Lane keeping assistant (Lane Assist)
- Traffic sign recognition
- Central locking including remote control integrated into the key



Extra equipment

- Airbag, rear side airbags
- Design Selection Suite (leather seat covers - "Piano black" trim strips - grey headliner - front center armrest including storage compartment - rear center armrest with cup holders and pass-through - floor mats - multi-coloured ambient lighting for instrument panel and front door trim - footwell lighting and illuminated door handle recesses - umbrella)
- Package: Driving Assistance PLUS (Predictive Adaptive Cruise Control (pACC) incl. Traffic Jam Assist - Lane Change and Parking Assist - Proactive Occupant Protection - Traveller Assistance System incl. Emergency Assist (Traffic Sign Recognition, Adaptive Lane Keeping Assist))
- Package: Infotainment PLUS (Navigation system - Infotainment Online 3 years (Online map updates for navigation; display of weather data, news, headlines; charging station and parking space search; Online POI search; Online destination import) - Augmented reality head-up display)
- Package: Light & Sight BASIC (LED matrix headlights incl. AFS and dynamic high beam assist; in rain and bad weather conditions, the cornering and curve lights illuminate the area directly in front of the car better - headlight cleaning system - full LED taillights with animated turn signals)
- Panoramic sunroof, electric (deletion of the glasses compartment in the headliner)
- Swiveling trailer hitch (including trailer stabilization)
- Luggage net partition
- Paint finish: Metallic
- Package: Convenience PLUS (KESSY (Keyless Entry and Start System) - Phonebox with inductive charging function (connection via external antenna) - Sunset tinted windows including acoustic side glazing at the front - Enhanced acoustic measures - Driver fatigue detection - Electric tailgate operation including comfort opening - Removable glasses compartment - Free remote vehicle access for 3 years)
- Package: Family PLUS (Sun protection roller blind for rear side windows - 230V socket and 2 x USB-C charging ports in the rear - Storage box for rear seat row - Folding tables on the front seat backrests - Sleeping package (Sleeping headrests for the outer rear seats and blanket))
- Package: Climate Control PLUS (Heated front and outer rear seats - Heated windshield washer nozzles - Climatronic air conditioning (3-zone), fully automatic, separately adjustable for driver, front passenger and rear passengers including odor and particle filter - Heated windshield)
- Package: Parking PLUS
- Package: Transport (Net program in the trunk incl. charging cable bag - Variable loading floor in the trunk - Remote release of the rear seat backrests in the trunk - Cargo elements in the trunk)
- heat pump

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Boot lid / rear door	Boot lid - Glued / labelled - De-glue / neutralise
2	Body	B-pillar - right side - dent(s) - Smooth repair work
3	Misc.	Main inspection - Due - Perform
4	Front bumper	Front bumper (+ Kratzer) - Stone chips - Paint
5	Mudguard - right side	Mudguard - right side - Deformed - Repair and paint



Wear and tear

No.	Component group	Description
1	Door - rear right side	Door - Scratch(es) - No deduction
2	Door - front left side	Door - dent(s) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Roof, Provided by user / customer, from 31 Oct 2023	1.881,95 €

Repainting

No.	Repainting
1	Roof, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Roof	329 µm
------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

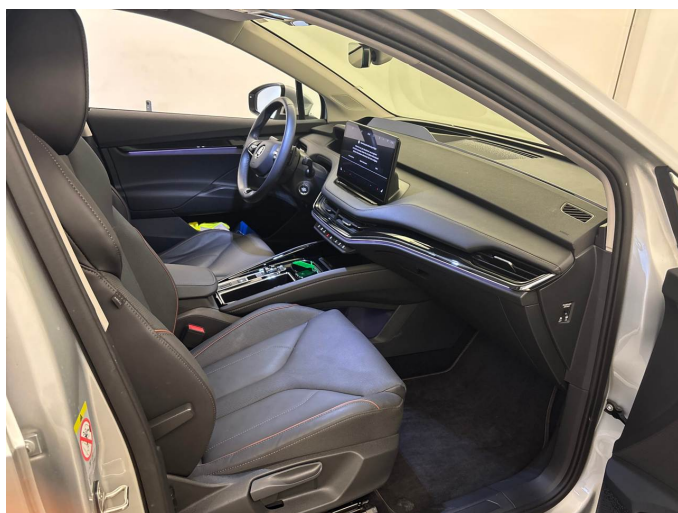


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

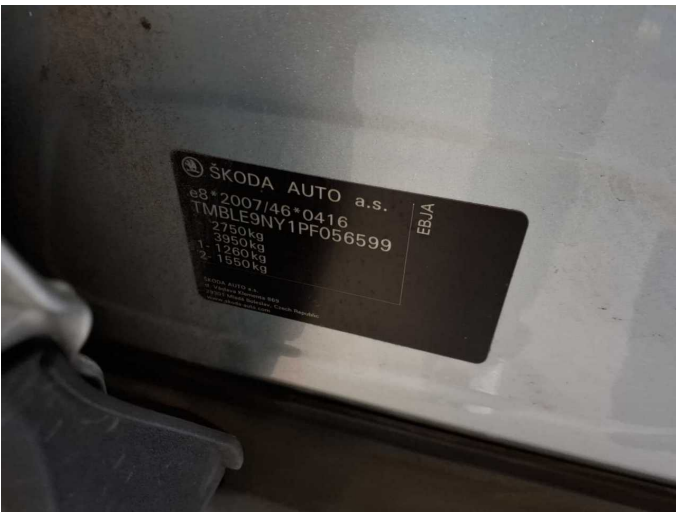


Figure 11: VIN



Figure 12: Mounted tyres

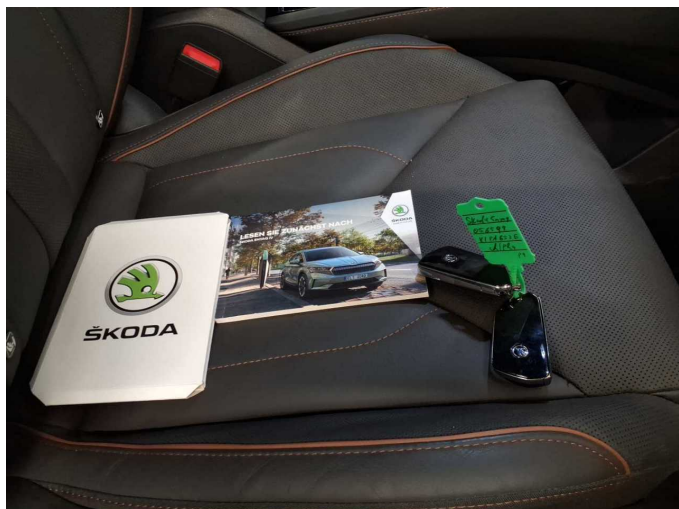


Figure 13: Documents

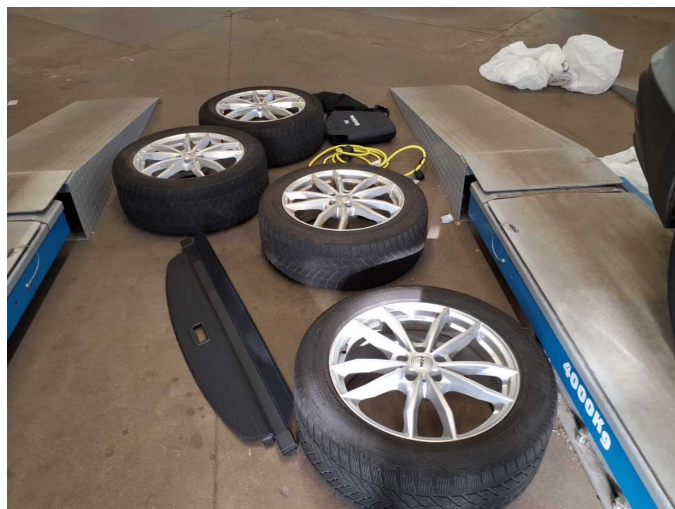


Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

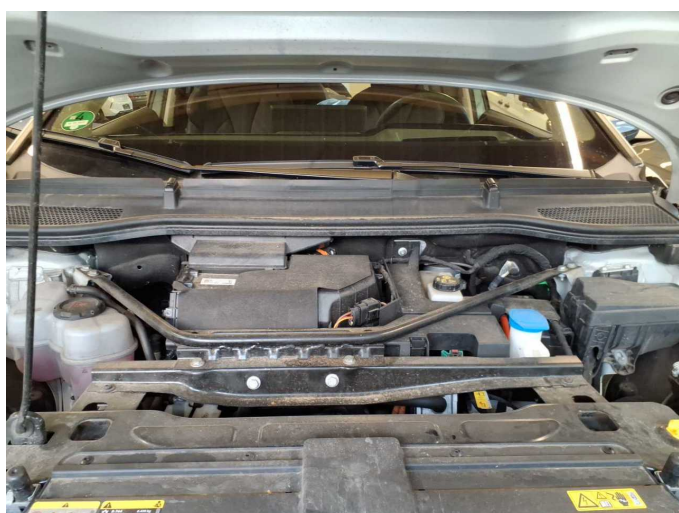


Figure 17: Misc.

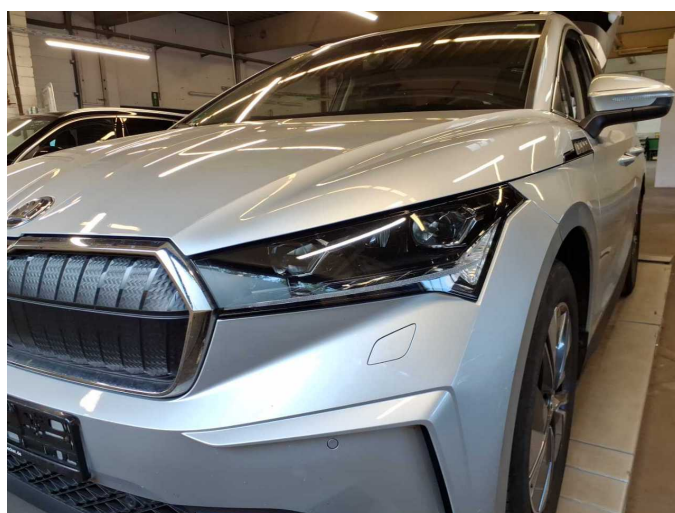


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.

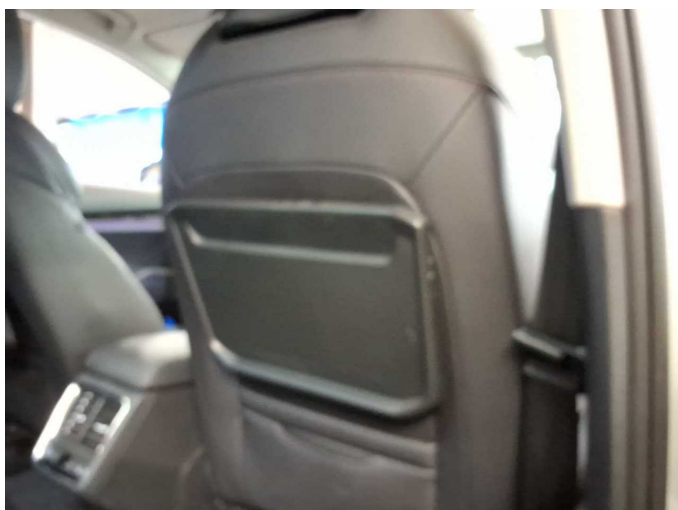


Figure 21: Misc.



Figure 22: Misc.

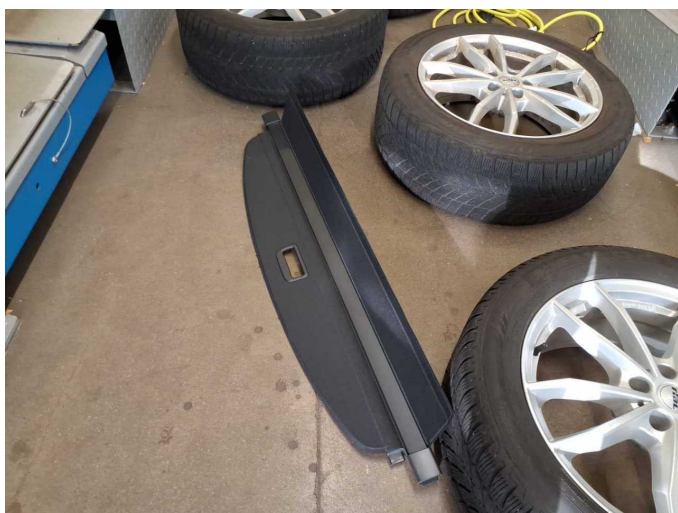


Figure 23: Misc.



Figure 24: Misc.

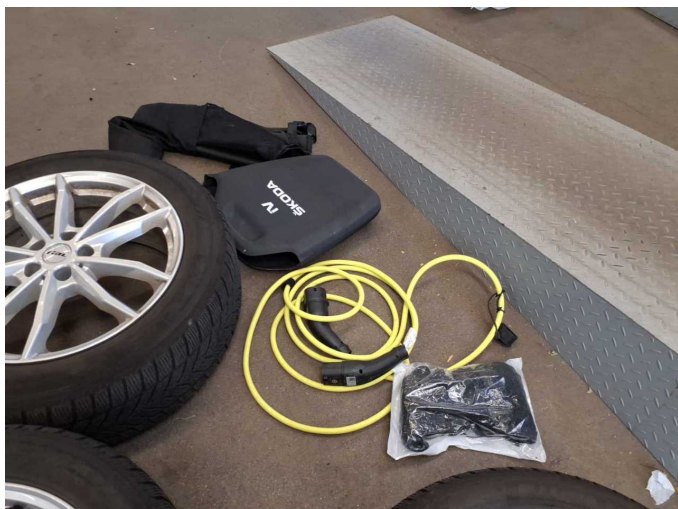


Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.

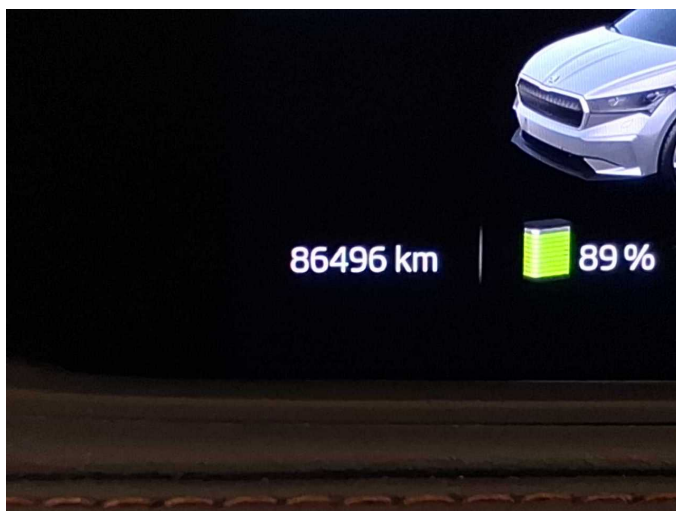


Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.



Figure 38: Misc.



Figure 39: Misc.



Figure 40: Misc.



Figure 41: Misc.




Damage 1: Boot lid / rear door: Boot lid - Glued / labelled - De-glue / neutralise



Damage 2: Body: B-pillar - right side - dent(s) - Smooth repair work



Damage 2: Body: B-pillar - right side - dent(s) - Smooth repair work

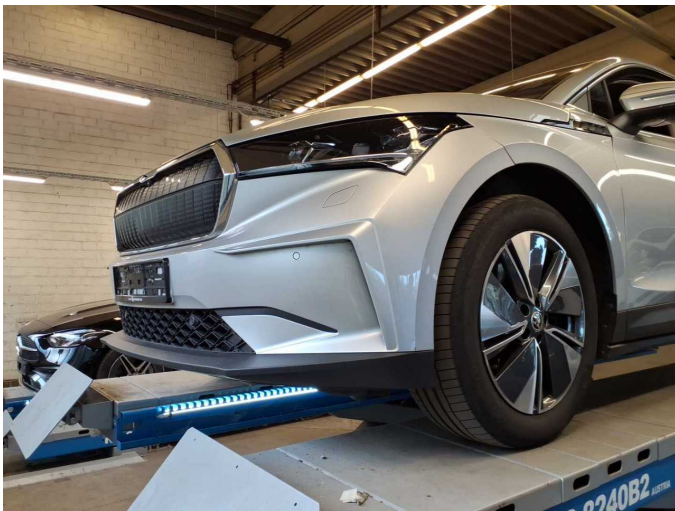

Damage 4: Front bumper: Front bumper (+ Kratzer) - Stone chips - Paint



Damage 4: Front bumper: Front bumper (+ Kratzer) - Stone chips - Paint



Damage 4: Front bumper: Front bumper (+ Kratzer) - Stone chips - Paint



Damage 4: Front bumper: Front bumper (+ Kratzer) - Stone chips - Paint



Damage 4: Front bumper: Front bumper (+ Kratzer) - Stone chips - Paint



Damage 4: Front bumper: Front bumper (+ Kratzer) - Stone chips - Paint



Damage 5: Mudguard - right side: Mudguard - right side - Deformed - Repair and paint



Damage 5: Mudguard - right side: Mudguard - right side - Deformed - Repair and paint



Damage 5: Mudguard - right side: Mudguard - right side - Deformed - Repair and paint



Repainting 1: Roof



Repainting 1: Roof



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBLE9NY1PF056599
Hersteller / Modell: SKODA SKODA Enyaq iV 80x

Datum	KM-Stand	Beschreibung
25.07.2025	54.893	Bremsflüssigkeit; Bremsflüssigkeit ern; Regelwartungsdienst