



Expertise

Protocol number: 46902160
Order No. / Reference: 26809510
Inspection date: 3 Aug 2026

Manufacturer: Mercedes-Benz
VIN: W1K5M1CB8PN346037

Model: CLA 200 d Shooting Brake AMG Line



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz CLA 200 d Shooting Brake AMG Line	
Vehicle Identification number	W1K5M1CB8PN346037
Mileage (Read)	161,147 km
First registration	7 Oct 2022
Number of holders	1
Fuel type	Diesel
Engine displacement / Cylinder	1,950 ccm / 4
Power	110 kW
Gearbox / Number of gears	Manual / 6
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	NACHTSCHWARZ UNILACK
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Anthracite-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	20,940 km
Last service on / at	11/2025 at 132,807 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GM504398
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Not possible
Manufacturer key number/ type code number	2222 / AGV 00079		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,090 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/45 R18 91W	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	225/45 R18 95Y	Summer tyres on Light alloy	Pirelli	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R17 91H	Winter tyres on Light alloy	Hankook	4mm / 4mm
2)	205/55 R17 91H	Winter tyres on Light alloy	Hankook	4mm / 4mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- ADAPTIVE BRAKE with HOLD function, hill start assist, pre-filling and drying brakes in wet conditions
- Airbag: Kneebag for driver
- Airbag: Windowbag for driver and front passenger
- AMG floor mats
- AMG Styling (AMG front apron with chrome front splitter and radiator grille with diamond grille and chrome pins - AMG side sill panels - AMG rear apron with chrome trim and visible tailpipe trims)
- ATTENTION ASSIST
- Basic services (breakdown management, maintenance management, accident management, telediagnosis, remote vehicle diagnostics)
- Diesel particulate filter
- Double cup holder at the front
- Tachometer
- Third brake light in LED technology
- DYNAMIC SELECT (DYNAMIC SELECT offers various driving programs at the touch of a button, which predefine, for example, the engine, transmission, suspension, or steering. With the "Sport" mode, you drive with a decidedly dynamic feel, while the basic "Comfort" program offers a very balanced driving experience. "ECO," on the other hand, focuses on maximum efficiency, saving fuel and money.)
- Electronic Stability Program (ESP) (with Curve Dynamic Assist)
- Electric windows (4-way)
- electric parking brake
- Speed Limit Assistant (The Speed Limit Assistant detects and displays speed limits.)
- Halogen headlights with integrated LED daytime running lights
- KEYLESS-GO start function
- Rear headrests (3)
- Front headrests, integrated
- Paint finish: Solid
- Steering wheel: Multifunction sports steering wheel in Nappa leather (with chrome control panels, flattened at the bottom and perforated in the grip area - an excellent qualification for sporty driving)
- Net in the passenger footwell
- Package: Light and Sight Package (Overhead control unit with 4 light elements (including glasses compartment), interior/reading light in rear mounting plate (rear/left/right), touchpad lighting (front), reading lights (front/left/right), console ambient lighting, vanity lights (front/left/right), signal and ambient lighting, exit signal light (front/left/right), door handle/pull-out handle lighting (front/rear/left/right), footwell lighting (front/left/right), cupholder/storage compartment lighting, occasional storage compartment lighting)
- Radio: Extended MBUX functions (personalization (profiles) and prediction functions - LINGUATRONIC with natural language understanding - activation via Hey Mercedes - Wi-Fi hotspot - internet radio)
- Radio accessories: Digital radio (DAB)
- Airbag for driver and front passenger
- Airbag: Automatic passenger airbag deactivation
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- AMG sports pedal assembly made of brushed stainless steel with rubber studs
- Anti-lock braking system (ABS)
- Traction control (ASR)
- Foldable armrest for driver and front passenger
- Exterior mirrors, left and right, heated and electrically adjustable, painted in car color (with aspherical curved mirror glass and integrated LED turn signal)
- Active Brake Assist (If you don't react, the Active Brake Assist takes over and attempts to dissipate as much energy as possible through autonomous braking. This can prevent accidents or at least reduce their severity. The system can also brake for stationary vehicles and pedestrians crossing the road at speeds up to approximately 60 km/h. Depending on the situation, this can even prevent collisions at speeds up to 50 km/h.)
- ECO start/stop function (Automatic engine shutdown when stationary, for example in traffic jams or at traffic lights, reduces fuel consumption, lowers emissions and saves fuel costs. The ECO start/stop function works particularly effectively, quickly and quietly.)
- Chassis: Comfort chassis with lowering including direct steering (The chassis, lowered by 15 millimeters, uses specially tuned springs and dampers: designed to be sportier than the standard chassis.)
- Transmission: 6-speed manual transmission
- Lockable glove compartment
- Black fabric headliner
- THERMATIC automatic climate control (1-zone air conditioning, automatically controlled air distribution, recirculation function, tunnel mode in conjunction with navigation system, fine dust filter)
- Steering: Direct steering (with variable steering ratio)
- Light and rain sensor
- Mercedes-Benz Emergency Call System (can provide a crucial time advantage in an emergency. A communication module with its own SIM card automatically triggers an emergency call upon detection of an accident, which can shorten the time until emergency services arrive. The emergency call can also be triggered manually to organize assistance.)
- Package: Seating comfort (height adjustment of passenger seat, seat cushion tilt adjustment for driver and passenger seats, seat cushion depth adjustment for improved seating comfort through a 60 mm wider thigh support area, specific seat design)
- Upholstery: ARTICO leatherette/DINAMICA microfiber



- Radio accessory: Communication module (LTE) for using Mercedes me connect services (The communication module (LTE) offers you a clear increase in comfort and safety. It constantly connects the vehicle to the internet – so that you can use helpful services such as the Live Traffic Information from Mercedes me connect. Two mobile antennas and an LTE-enabled SIM card ensure a fast connection.)
- Gearshift lever in perforated Nappa leather and additional chrome elements (red or black decorative stitching depending on the upholstery)
- Windscreen wipers with rain sensor
- Seats: iSize child seat anchorages with top tether on the outer seats
- Seats: Rear seat backrests are split 40:20:40 and foldable
- Seats: Front sports seats (with integrated headrests and optimized lateral support)
- Bumpers in body color (including door handles painted in body color)
- High-visibility vest for drivers
- Central locking (with interior switch, automatic locking (can be deactivated) and crash sensor with emergency opening)
- DINAMICA decorative elements

Extra equipment

- Ambient lighting with 64 different colors
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: Business (Hard drive navigation - Smartphone integration - Traffic sign assistant - Preparation for digital key handover - Connectivity package navigation - Seat heating for driver and front passenger - Active parking assistant with PARKTRONIC)
- Package: Night (Exterior mirror housings in high-gloss black - Single louvre in the radiator grille in high-gloss black - Rear apron with trim element in high-gloss black - Beltline trim strip and window line trim strip in high-gloss black - Heat-insulating dark tinted glass from the B-pillar - 45.7 cm (18") AMG light-alloy wheels in 5-spoke design, aerodynamically optimized, painted black and polished, 225/45 R 18 on 7.5 J x 18 ET 49 - AMG front apron with front splitter in high-gloss black.)
- Wheels: Complete summer wheel sets fitted at the factory
- Wheels: Winter complete wheels M+S 4-way 43.2 cm (17") (Light alloy wheels in 10-spoke design, vanadium silver painted with 205/55 R 17 on 6.5 J x 17 ET44)
- Seats: 4-way lumbar support for driver and front passenger
- Partition net for luggage compartment separation and occupant protection

- Radio: MBUX multimedia system (instrument display with 17.78 cm (7") diagonal - media display with 17.78 cm (7") diagonal and touch function - touch control buttons on the steering wheel - radio (FM/AM) - USB interface in the center console under the armrest - Bluetooth telephony with contact transfer and audio streaming of music files - display of vehicle functions (driver assistance systems, driving programs and vehicle settings) - favorites storage - smartphone-related voice control)
- Radio accessories: USB interface in the storage compartment & 2 USB interfaces in the rear center console
- Tire pressure monitoring system (TPMS)
- Wheels: 45.7 cm (18") AMG light-alloy wheels, set of four in a 5-twin-spoke design (aerodynamically optimized, painted in tremolite grey and polished with 225/45 R 18 tires on 7.5 J x 18 ET 49 rims)
- Seat belts CLA-Class (3-point seat belts including mechanical belt height adjustment - pyrotechnic belt force limiter and belt tensioner for driver and front passenger - pyrotechnic belt tensioner in the rear outer seats)
- Lane Keeping Assist, active
- 12V socket (12V socket in the storage compartment)
- Cruise control (with variable speed limiter)
- Touchpad (operates the infotainment system display)
- Electronic immobilizer (including locking system with radio remote control in the electronic key in chrome look, optical locking feedback and emergency opening (approved by AZT and TÜV))

- LED High Performance headlights (The LED High Performance headlights offer greater safety at night and a distinctive, striking look. Thanks to LED technology, they illuminate the road better than conventional headlights – with lower energy consumption.)
- Package: MBUX Advanced Package (Hard drive navigation - Preparation for Live Traffic Information - Traffic Sign Assist - Connectivity Package Navigation: Hard drive navigation, Extended navigation services - Smartphone integration: Mobile phone via Apple CarPlay and Android Auto with the media system - Preparation for digital key handover)
- Package: Parking package with reversing camera (including Active Parking Assist with PARKTRONIC - reversing camera)
- Radio accessories: Advanced sound system (with 10 speakers and 225 watts system power)
- Wheels: 45.7 cm (18") AMG light-alloy wheels, 4 in 5-twin-spoke design (aerodynamically optimized, painted in high-gloss black and polished, 225/45 R 18 on 7.5 J x 18 ET 49)
- Heated windshield washer system
- Heated seats for driver and front passenger
- Type designation removed from tailgate
- Heat-insulating dark tinted glass



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run could not be performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Wing mirror - right side	Cap - Scratch(es) - Smart repair
3	Indicator - front	Mirror - right side - Scratch(es) - Replace
4	Side panel - rear right side	Side panel - Scratch(es) - Smart repair
5	Side panel - rear left side	Side panel - dent(s) - Smart repair
6	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
7	Interior	Interior (Muffig) - Odour - Ozone treatment
8	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
9	Vehicle glazing	Windscreen - Broken / torn - Replace
10	Rear bumper	Rear bumper - Dent / paintcoat damage - Repair and paint

Wear and tear

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Mudguard - right side	Mudguard - right side - dent(s) - No deduction
4	Front bumper	Front bumper - Stone chips - No deduction
5	Door - rear right side	Door - Scratch(es) - No deduction
6	Wing mirror - left side	Cap - Stone chips - No deduction
7	Indicator - front	Mirror - left side - Scratch(es) - No deduction
8	Door - front left side	Door edge - Scratch(es) - No deduction
9	Roof	Roof rail - right side - dent(s) - Smooth repair work
10	2nd wheel set	Tyres - complete set (Reifen über 4mm) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

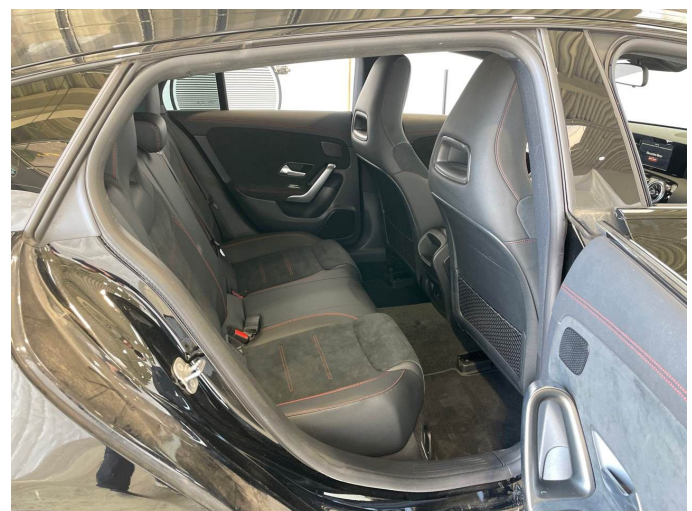


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

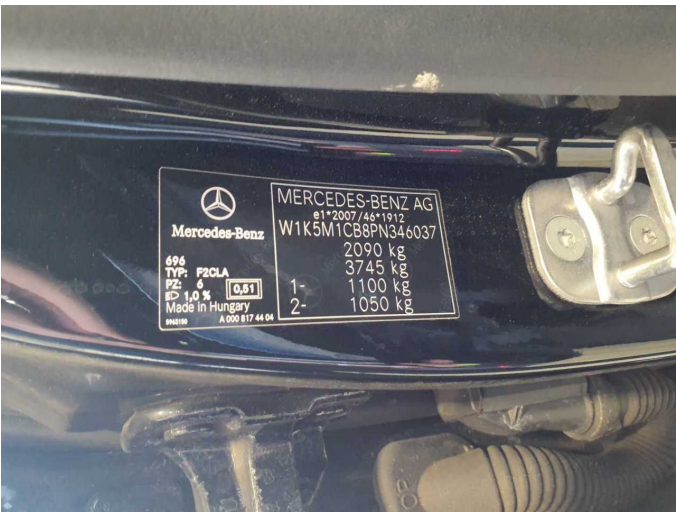


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Navigation



Figure 16: Misc.

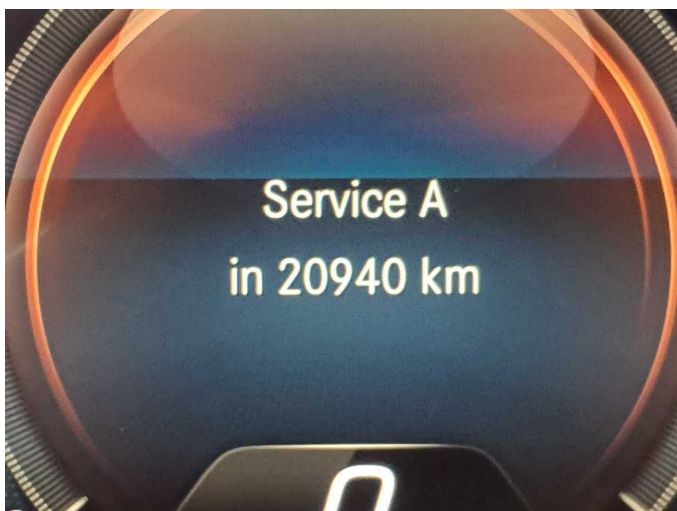


Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.




Figure 26: Misc.



Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair

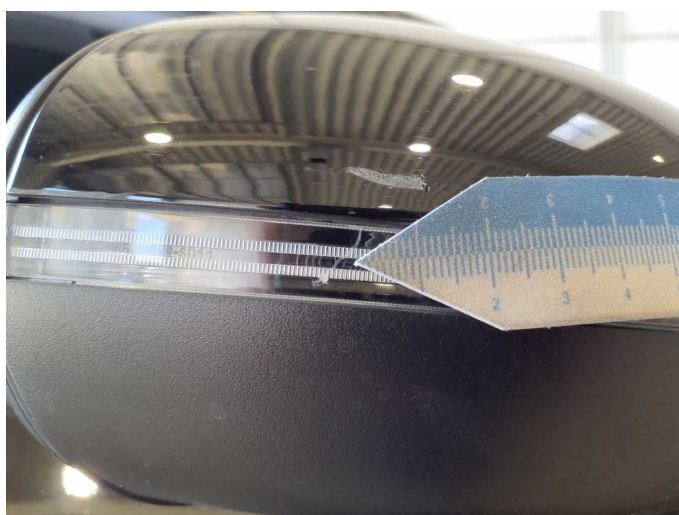

Damage 3: Indicator - front: Mirror - right side - Scratch(es) - Replace



Damage 3: Indicator - front: Mirror - right side - Scratch(es) - Replace



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair



Damage 4: Side panel - rear right side: Side panel - Scratch(es) - Smart repair




Damage 5: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 5: Side panel - rear left side: Side panel - dent(s) - Smart repair



Damage 5: Side panel - rear left side: Side panel - dent(s) - Smart repair

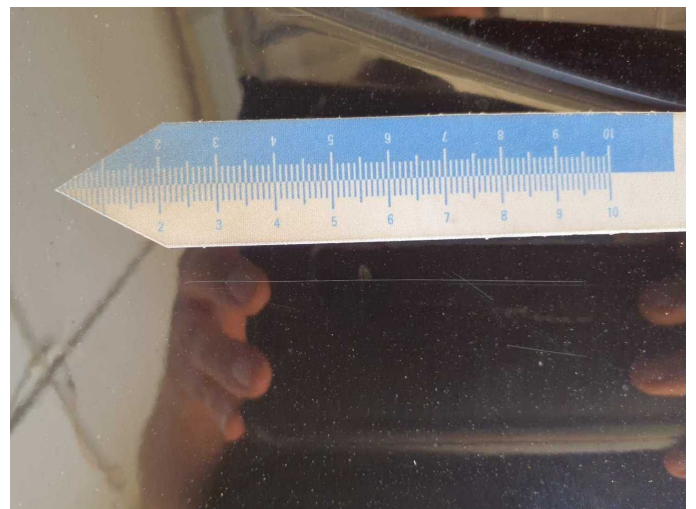

Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair



Damage 6: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair




Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 9: Vehicle glazing: Windscreen - Broken / torn - Replace

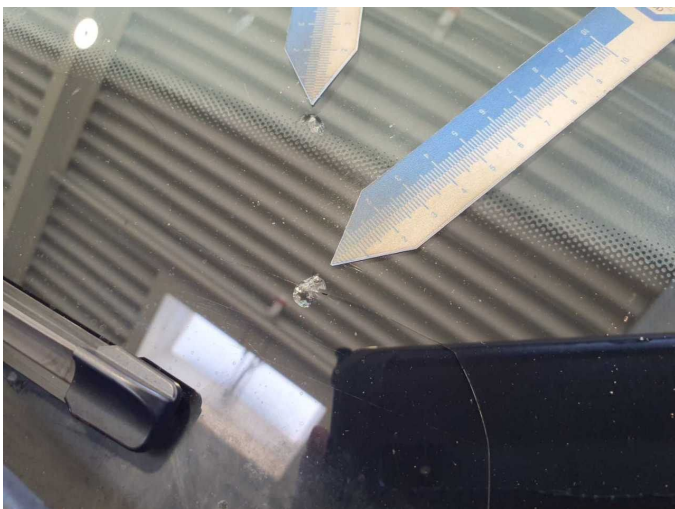

Damage 9: Vehicle glazing: Windscreen - Broken / torn - Replace



Damage 10: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 10: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Damage 10: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint




Damage 10: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint

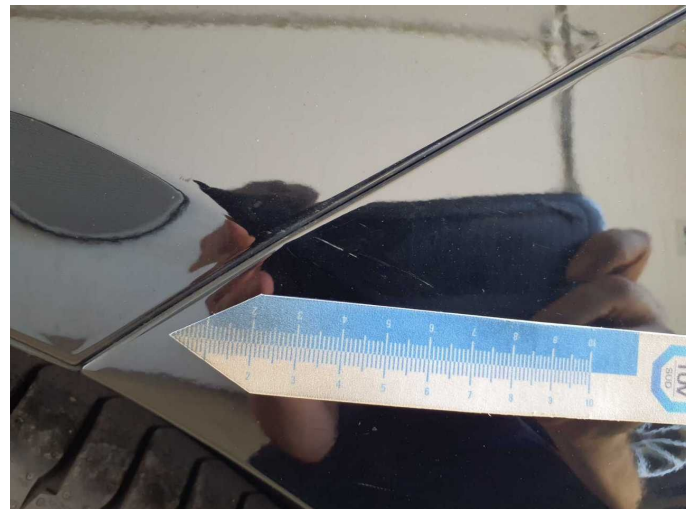

Damage 10: Rear bumper: Rear bumper - Dent / paintcoat damage - Repair and paint



Wear and tear 9: Roof: Roof rail - right side - dent(s) - Smooth repair work

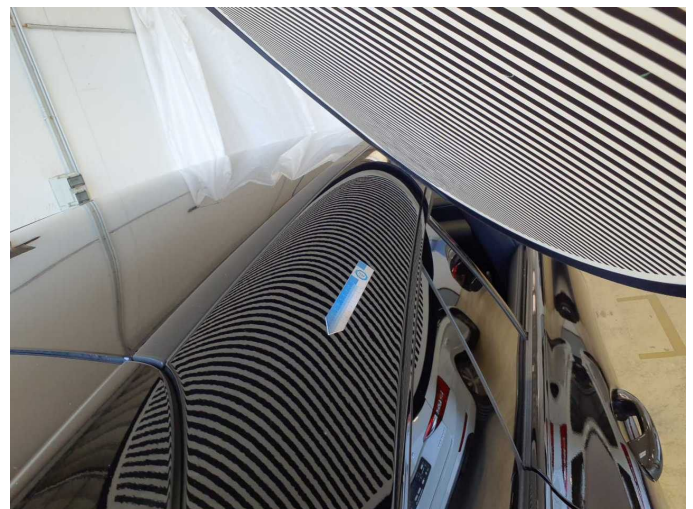

Wear and tear 9: Roof: Roof rail - right side - dent(s) - Smooth repair work



Wear and tear 9: Roof: Roof rail - right side - dent(s) - Smooth repair work