



Expertise

Protocol number: 46821073
Order No. / Reference: 26832798
Inspection date: 31 Jul 2026

Manufacturer: Mercedes-Benz

Model: GLC 300 de 4Matic 9G-TRONIC AMG Line

VIN: W1N2539111V333864



Vehicle details

Manufacturer / Type / Model / Equipment

Mercedes-Benz GLC 300 de 4Matic 9G-TRONIC AMG Line

Vehicle Identification number W1N2539111V333864
Mileage (Read) 126,803 km
First registration 18 Nov 2021
Number of holders 2
Next periodical technical inspection 11/2026
(Report not on hand)

Fuel type Hybr.D/E ext.aufl
Engine displacement / Cylinder 1,950 ccm / 4
Power 143 kW
Gearbox / Number of gears Automatic / 9
Type of drive All-wheel drive
Type of vehicle SUV

Colour / colour code OBSIDIANSCHWARZ - METALLICLACK
Doors / Seats 5 / 5
Upholstery type Alcantara / Leather
Colour of upholstery Anthracite-Black



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	351 Tag(e)
Last service on / at	06/2025 at 106,736 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF750113
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ASV 00049		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,650 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105W	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	235/55 R19 105W	Summer tyres on Light alloy	Michelin	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	235/60 R18 107H	Winter tyres on Light alloy	Continental	6mm / 6mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Airbag for driver and front passenger
- Airbag: Sidebag for driver and front passenger (combined thorax/pelvisbag)
- Acoustic environmental protection (To ensure that your vehicle does not become a danger to pedestrians and cyclists even when driving purely electrically and almost silently, the acoustic environmental protection generates a Mercedes-Benz specific sound outside the vehicle up to a speed of 30 km/h.)
- Anti-lock braking system (ABS)
- Automatic passenger airbag deactivation
- Heated exterior mirrors on the left and right, electrically adjustable from the inside (with aspherically curved mirror glass and integrated turn signal light)
- Roof rails in polished aluminum
- Diesel particulate filter
- Tachometer
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Chassis with higher ground clearance (In this chassis variant, the body is raised by 20 mm)
- electric parking brake
- Transmission: 9G-TRONIC
- rear window wiper
- KEYLESS-GO start function
- Remote trunk lid release
- Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") multifunction display
- Communication module (LTE) for using Mercedes me connect services (The communication module (LTE) offers you a clear increase in comfort and safety. It constantly connects the vehicle to the internet – so that you can use helpful services such as the Live Traffic Information from Mercedes me connect. Two mobile antennas and an LTE-enabled SIM card ensure a fast connection.)
- Charging system: AC on-board charger (AC charging)
- LED High Performance headlights (with integrated daytime running lights, LED taillights)
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black Nappa leather (with black decorative stitching, flattened at the bottom, deeply embossed in the grip area, touch control buttons and steering wheel trim in silver chrome galvanized)
- Package: Storage (map pockets on the back of the front seats - net on the load floor - folding box under the load floor - 12V socket in the load compartment on the left - cargo bars - two USB-C ports in the rear)
- Package: Interior lighting (More light, more atmosphere, better orientation: The interior lighting package provides more comprehensive direct and indirect lighting. The additional light elements create a pleasant atmosphere and make operation easier.)
- Upholstery: ARTICO leatherette/DINAMICA microfiber
- Radio: MBUX multimedia system
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Active Brake Assist (can help avoid rear-end collisions with vehicles ahead, whether moving or stationary, as well as collisions with moving pedestrians and cyclists. In addition to distance and collision warnings, it primarily offers brake boosting – up to and including autonomous emergency braking.)
- 4MATIC all-wheel drive
- ATTENTION ASSIST (can detect typical signs of fatigue through driver behavior and warn the driver of increasing fatigue or inattentiveness)
- On-board computer
- Brake system with larger brake discs on the front axle (drilled front brake discs and front brake calipers with Mercedes-Benz lettering).
- Third brake light in LED technology
- EASY-Pack cargo cover (removable)
- Driving light assistant
- Electric window regulator, 4-way (with comfort operation and anti-pinch protection)
- Black floor mats with AMG lettering
- Heated rear window (with timer)
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control with 2 climate zones (The THERMATIC automatic climate control with 2 climate zones offers individual climate comfort in the front seats: driver and front passenger can set the temperature separately for their side. Thanks to the automatic climate control and the sensitive sensor system, this is kept constant without any manual adjustments.)
- Headrests adjustable in 5 ways (4-way for driver and front passenger, and 2-way in the rear)
- Charging cable for household socket, 5m, smooth (This charging cable, also called Mode 2 cable, allows you to charge the vehicle battery at the household socket with up to 2.3 kW (230 V, 1-phase, 10 A) and fits sockets of type E/F CEE 7/7.)
- Steering column mechanically adjustable in height and length
- Steering: Sport direct steering
- Mercedes-Benz emergency call system
- Navigation accessories: Extended MBUX functions (personalization (profiles) and prediction functions - LINGUATRONIC with natural language understanding - activation via "Hey Mercedes" - Wi-Fi hotspot - internet radio)
- Package: OFF-ROAD Exterior (lower part of the front bumper silver-chromed, radiator grille with chrome trim strips, 45.7 cm (18") 5-spoke alloy wheels painted tremolite grey and polished with 235/60 R 18 tires on 8 J x 18 ET 38 rims, suspension with increased ground clearance, front bumper with increased approach angle)
- Radio accessories: Digital radio
- Tire pressure monitoring system (TPMS)



- Radio accessories: Touchpad (integrated into the center console, including a hand rest - single and multi-finger gestures, swiping movements and zoom gestures by spreading and pinching the fingers - recognizes handwritten characters: letters, special characters and numbers - clear haptic feedback)
- Windscreen wipers with rain sensor
- Power steering
- Seat: Front sports seats
- Seats: i-Size child restraint system on the outer rear seats
- Seats: Front seats electrically adjustable (with electric adjustment for seat height and backrest angle, as well as mechanical adjustment for longitudinal adjustment and headrests)
- High-visibility vest for drivers
- Immobiliser
- Central locking (with interior switch, automatic locking (can be deactivated) and crash sensor with emergency opening)

Extra equipment

- Ambient lighting
- EASY-Pack tailgate with electric operation for opening and closing
- Paint finish: Metallic
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Package: Advanced Assistance
- Package: Advanced Light
- Package: AMG Line Exterior (Plug-in Hybrid)
- Package: High-End Infotainment
- Panoramic sunroof
- Remote and Charging Services Plus
- Heated windshield washer system
- TIREFIT with tire inflation compressor
- Running boards in aluminum look with rubber studs
- Heat-insulating dark tinted glass all around from the B-pillar back

Retrofitted equipment

- Equipment as per offer printout

- Remote Services Plus (The Remote Services Plus package transforms mobility into a new experience, offering greater comfort and safety. Status queries provide information about the remaining range. You can remotely control certain functions and locate your vehicle. Services such as maintenance management coordinate service appointments, saving you valuable time.)
- Seats: Folding rear seat backrests (40/20/40 split including Easy Pack Quickfold and center armrest with double cupholder and storage compartment)
- Cruise control (Drive relaxed and fuel-efficiently, especially on longer journeys. Simply select your desired speed and your vehicle will regulate it. In addition to the cruising speed, the speed limiter helps you maintain a maximum speed. This increases road safety and protects you from expensive speeding tickets.)
- Decorative elements: black piano lacquer finish/light longitudinally brushed aluminum

- Towbar with ESP trailer stabilization
- Black fabric headliner
- Instrument panel and door sills in ARTICO man-made leather
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: Advanced Comfort
- Package: Advanced Park
- Package: Business (for plug-in hybrid vehicles)
- Package: Mirror
- PRE-SAFE system
- Wheels: 48.3 cm (19") AMG light-alloy wheels, 4 in 5-twin-spoke design
- Partition net for luggage compartment separation
- Heat and sound insulating acoustic glass
- Decorative elements: open-pored black ash wood

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Front bumper	Spoiler (Zusätzlich Zierleiste Kratzer) - Scratch(es) - Loss in value
2	Door - rear right side	Door (Einschlüsse und wellig) - Unprofessionally repaired - Repair and paint
3	Boot lid / rear door	Boot lid - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Bonnet	Bonnet - Dent / paintcoat damage - No deduction
3	Vehicle glazing	Rear window - Scratch(es) - No deduction
4	Door - front left side	Door edge - Scratch(es) - No deduction
5	Side panel - rear right side	Wheel well extension - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No. Repainting

- 1 Door - rear right side, Unprofessionally carried out

Paint coat thickness measurement

Door - rear right side 272 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

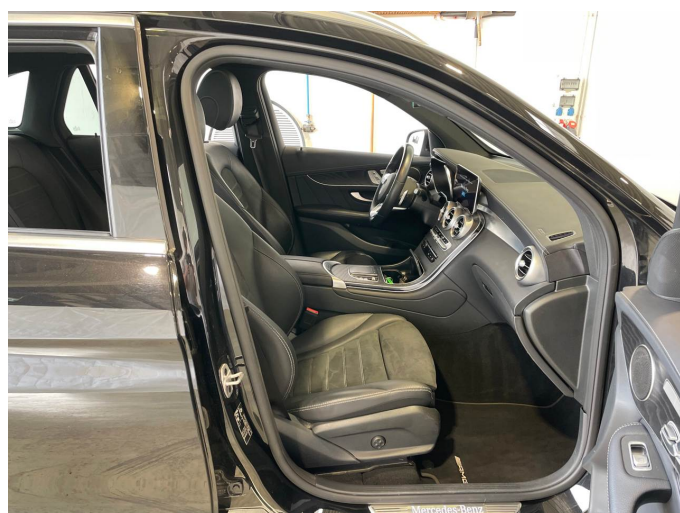


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

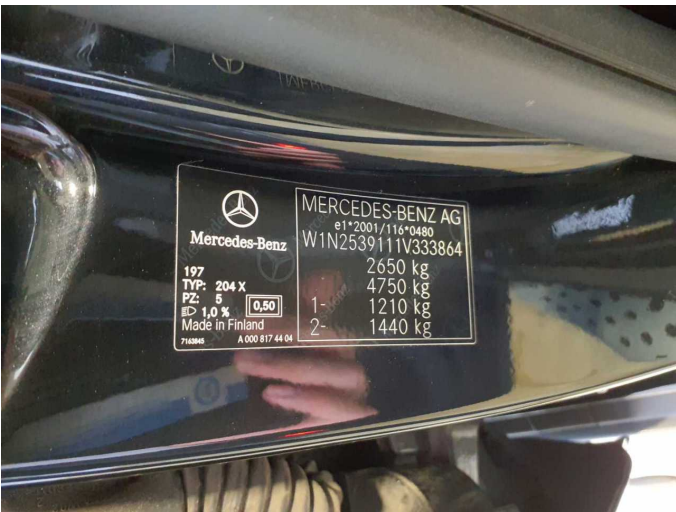


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.

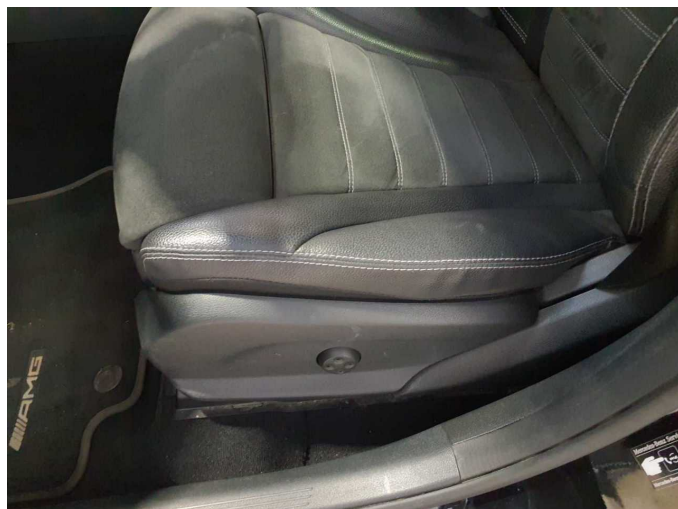


Figure 20: Misc.



Figure 21: Misc.

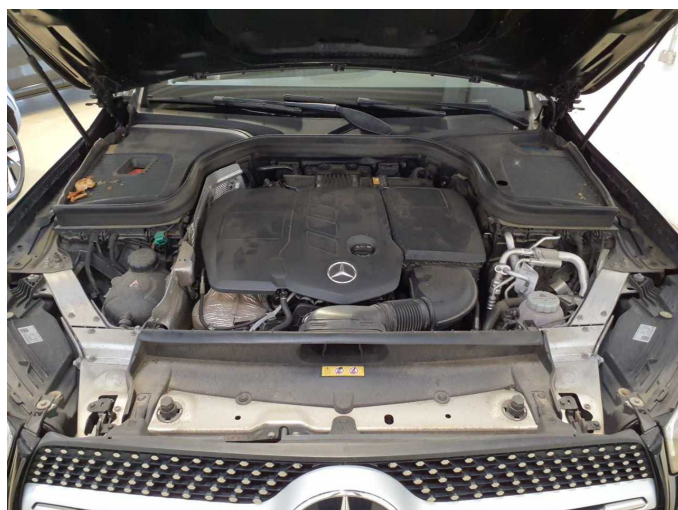


Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

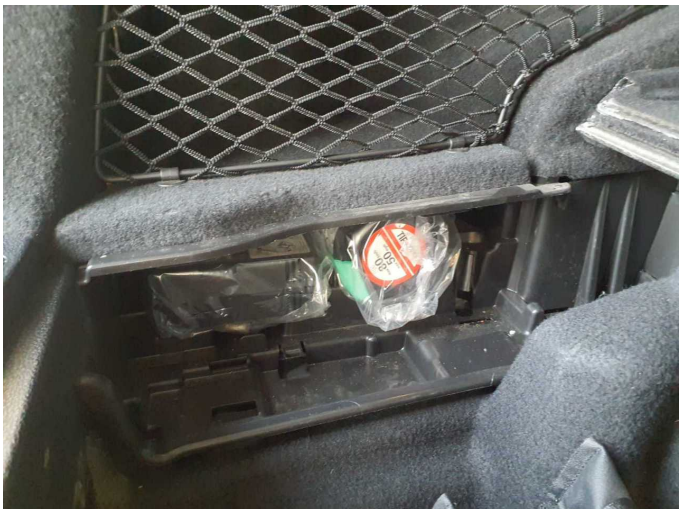



Figure 30: Misc.



Damage 1: Front bumper: Spoiler (Zusätzlich Zierleiste Kratzer) - Scratch(es) - Loss in value



Damage 1: Front bumper: Spoiler (Zusätzlich Zierleiste Kratzer) - Scratch(es) - Loss in value

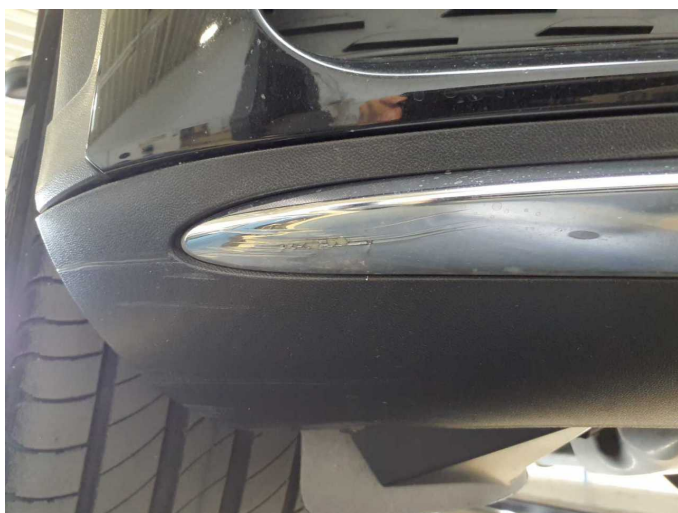

Damage 1: Front bumper: Spoiler (Zusätzlich Zierleiste Kratzer) - Scratch(es) - Loss in value



Damage 2: Door - rear right side: Door (Einschlüsse und wellig) - Unprofessionally repaired - Repair and paint




Damage 2: Door - rear right side: Door (Einschlüsse und wellig) - Unprofessionally repaired - Repair and paint




Damage 2: Door - rear right side: Door (Einschlüsse und wellig) - Unprofessionally repaired - Repair and paint




Damage 2: Door - rear right side: Door (Einschlüsse und wellig) - Unprofessionally repaired - Repair and paint

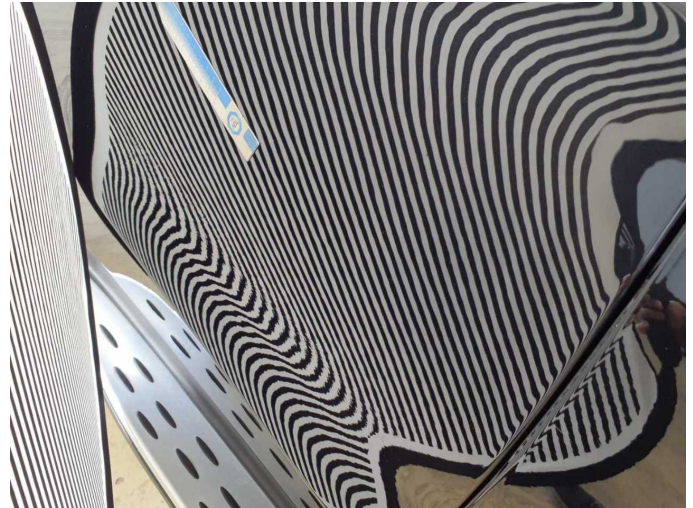


Damage 2: Door - rear right side: Door (Einschlüsse und wellig) - Unprofessionally repaired - Repair and paint

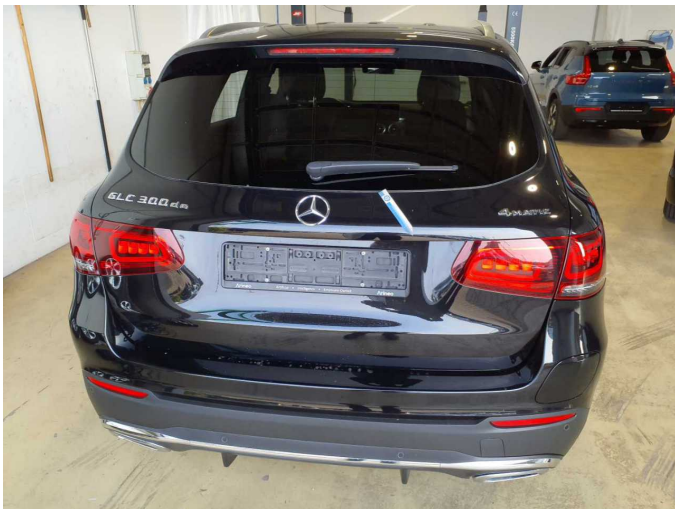

Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Paint

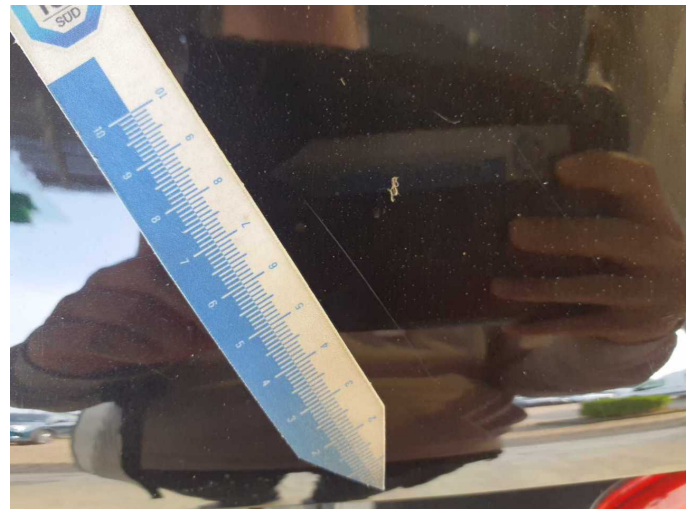

Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Paint

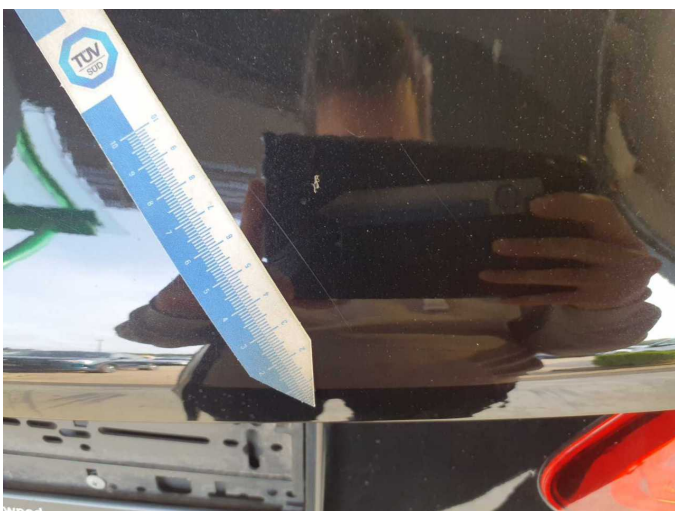

Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Repainting 1: Door - rear right side



Repainting 1: Door - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2539111V333864

Hersteller / Modell: MERCEDES-BENZ MB GLC 300 de 4Matic 9G-TRONIC AMG Line

Datum	KM-Stand	Beschreibung
27.02.2026	120.897	Bremsscheiben hinten
23.06.2025	106.736	Regelwartungsdienst
21.11.2024	92.423	AU
23.04.2024	84.952	Regelwartungsdienst
28.09.2023	60.133	Regelwartungsdienst
25.11.2022	31.191	Regelwartungsdienst