



RENAULT CLIO: GD-692-PE

Vinnumber:	VF1RJA00768305692	Versionname:	RENAULT CLIO Business E-Tech hybride 140 -21N
First Registrationdate:	15/12/2021	Fiscalpower:	VP [5P] bva 6-140CH-5cv (bi-corps)
Expertise Mileage:	130984	Power Kw:	103
Bodytype:	Berline	Body colour:	White
Gearbox:	Automatic	Paint type:	Opaque
Transmission:	Front	Interior colour:	Grey
Fueltype:	Hybrid	Type of rims (mounted):	Steel
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Steel		
Category:	Passenger Car		

Options

Number of keys total	1	Radio	
Number keys remote	1	Central consol F	
GPS big screen color		Luggage cover	
GPS storage		Headlights Xenon/LED/Laser	
GPS storage	HD	Rear parking sensors	
Windows electric F		Seat cover lining	Lining Other
Cruise Control			
Steering wheel multifunctional			
Steering wheel leather			
Type of climate control	Manual climate control		

Tyres

	195/55/16/91 H			
Summer tyres:	Fr.L.	Firestone: 80%	Fr.R.	Firestone: 80%
	Re.L.	Firestone: 60%	Re.R.	Firestone: 65%
Tyre profile depth FL				3.1
Tyre profile depth FR				2.8
Tyre profile depth RL				4.2
Tyre profile depth RR				3.9
Tyre size FL				195/55 R 16 91 H
Tyre size FR				195/55 R 16 91 H
Tyre size RL				195/55 R 16 91 H
Tyre size RR				195/55 R 16 91 H
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				258
Tyre make FR				258
Tyre make RL				258
Tyre make RR				258

Assistance equipment

Interior trim, Missing, Replace



Interior trim, Missing, Replace



Remote ignition key, Missing, Repair/replace (lump sum)



Interior, Dirty, Cleaning



Tyre FR, Out of tolerance, Replace



Tyre RR, Out of tolerance, Replace



Tyre FL, Out of tolerance, Replace



Bumper F, Scratch(es), Paint




Bumper grille, Unclassped, Dismount/Mount



Grille, Unclassped, Dismount/Mount



Windscreen, Stone chip(s), Windscreen repair

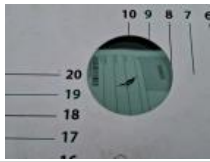

Bumper R, Scratch(es), Paint



Aerial, Missing, Replace



Historique Maintenance

Immatriculation: **GD-692-PE** Date de 1ère immatriculation: **15/12/2021**

Modèle: **Renault CLIO Business E-Tech hybride 140 -21N VP [5P] bva 6-140CH-5cv (bi-corps)**

Date	Kilométrage	Fournisseur	Descriptif
22/12/2025	122.172	SVA LACROIX	LIQUIDE DE FREIN
	0		REVISION ET CLIM ET AIR ET BOUGIES
17/01/2025	90.866	SVA LACROIX	GEOMETRIE CTRL
06/01/2025	90.693	PROFIL PLUS	REPLACEMENT PNEUS 4 SAISONS
18/12/2024	89.680	SVA LACROIX	RECYCLAGE
	0		REVISION ET CLIM
	0		BALAIS ESSUIE GLACE AV
	0		BALAI ESSUIE GLACE AR
27/08/2024	79.392	SVA LACROIX	TELECHARGEMENT CALCULATEUR
	0		DIVERS ECHAPPEMENT
	0		DIAG
	0		DIVERS ELEC
14/02/2024	59.164	SVA LACROIX	BALAIS ESSUIE GLACE AV
	0		RECYCLAGE
	0		REVISION
05/12/2023	50.500	PROFIL PLUS	REPLACEMENT PNEUS 4 SAISONS
16/08/2023	39.470	SVA LACROIX	REPARATION DE ROUE
15/05/2023	29.602	PROFIL PLUS	REPLACEMENT PNEUS ETE
12/05/2023	29.570	SVA LACROIX	REVISION
	0		RECYCLAGE