



Expertise

Protocol number: 46661553
Order No. / Reference: 26611608
Inspection date: 22 Jul 2026

Manufacturer: Mercedes-Benz
VIN: W1KEG1BB4PF030508

Model: EQE 300 Electric Art



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz EQE 300 Electric Art	
Vehicle Identification number	W1KEG1BB4PF030508
Mileage (Read)	68,592 km
First registration	6 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Fuel type	Electric
Power	180 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	SUV
Colour / colour code	Schwarz uni
Doors / Seats	4 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	577 Tag(e)
Last service on / at	12/2025 at 59,186 km		
Key is / should be	2 / 2	FZG documents	Registration and title documents unavailable
		Letter No.	GS703267
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2222 / BIN 00897		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,880 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R19 104V	Winter tyres on Light alloy	Pirelli	5mm / 5mm
2)	255/45 R19 104V	Winter tyres on Light alloy	Pirelli	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	255/45 R19 104Y	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	255/45 R19 104Y	Summer tyres on Light alloy	Bridgestone	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 05/2028		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Equipment

- Klimaautomatik

Standard equipment

- | | |
|--|---|
| <ul style="list-style-type: none"> • ABS - Anti-lock Braking System • Airbag: Automatic passenger airbag deactivation • Airbag: Windowbag all around • Ambient lighting • Brake assist, active • Door sills with "Mercedes-Benz" lettering • Driver display with 25.4 cm (10.25") screen diagonal • Flex Bottle Holder • Velour floor mats • Transmission: Direct drive • Climate: Pre-conditioning • THERMATIC automatic climate control with 2 climate zones • Front headrests are height-adjustable • Charging cable for household socket, 5m, smooth • Charging system: Direct current charging system (DC charging) • LED High Performance Headlights • Steering wheel: Multifunction sports steering wheel in ARTICO man-made leather • Navigation accessories: Pre-installation for Live Traffic Information • Navigation: Hard disk navigation • Package: Interior lighting package • Upholstery: ARTICO leatherette/fabric • Radio: Extended MBUX functions • Radio accessories: Digital radio • Tire pressure monitoring system • Remote Services Plus • Remote and Charging Services Premium • Wheels: 48.3 cm (19") light alloy wheels in a 10-spoke design • Seats: i-Size child seat attachment • Seats: Heated seats for driver and front passenger • TIREFIT • URBAN GUARD Vehicle Protection Plus • Pre-installation for digital key handover • High-visibility vest for drivers | <ul style="list-style-type: none"> • Airbag for driver and front passenger • Airbag: Kneebag for driver • Acoustic environmental protection • Traction control (ASR) • DYNAMIC SELECT • Electronic Stability Program (ESP) • Chassis: Comfort chassis • Rear seat belt status indicator in the instrument cluster • Speed Limit Assistant • Instrument panel and door sills in ARTICO man-made leather, space grey • Rear headrests (3) • Paint finish: Solid • Charging cable for wallbox and public charging station, 5m, smooth, 11kW • Charging system: AC charging system 11kW • LED taillights in 3D helix design • Mercedes-Benz emergency call system • Center console in high-gloss black • Navigation accessories: Pre-installation for navigation services • Navigation: MBUX Navigation Premium • Package: Parking package with reversing camera • PRE-SAFE system • Radio: MBUX multimedia system • Radio accessories: Communication module (LTE Advanced) for using Mercedes me connect • Remote Services Premium • Remote and extended Charging Services Premium • Heated windshield washer system • Seats: Rear seat backrests foldable 40/20/40 split • Seats: Comfort seats • Cruise control • Door center panels and transition from the center console to the instrument panel in ARTICO man-made leather • Pre-installation for remote and navigation services • Decorative elements with fine textured black finish |
|--|---|



Extra equipment

- ENERGIZING AIR CONTROL Plus (Air quality sensor with one fine dust sensor each for inside and outside - Filter system in the front of the vehicle consisting of a coarse pre-filter and a HEPA fine dust filter - Broadband cabin filter in the air conditioning unit based on activated carbon with filter layers against fine dust (PM2.5) and nitrogen oxides (NOx) or sulfur dioxides (SO2), certain viruses are reduced directly at the filter - antibacterial effect - automatic recirculation or fresh air switching depending on the measured air quality - Air quality menu in the MBUX multimedia system)
- Interior headliner fabric nevagrau
- Charging system: AC charging system 22kW (Even faster ready for your next journey: With the AC charging system, you can charge at up to 22 kW (3-phase) at suitable public charging stations or wallboxes. This significantly reduces your charging times when no fast charging station such as those from IONITY is available.)
- Package: Advanced Package (Display Package including driver display with 12.3-inch (31.2 cm) OLED screen diagonal, central display with 12.8-inch (32.5 cm) screen diagonal, fingerprint scanner, wireless charging system for mobile devices in the front storage compartment, adaptive high-beam assist, mirror package with brand logo projection, flush door handles, and smartphone integration with Android Auto and Apple CarPlay)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (registration document) and the vehicle registration certificate Part 2 (title) were not available.
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door handle - outside - Scratch(es) - Smart repair
2	2nd wheel set	1 alloy rim - Scratched - Loss in value
3	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
4	Body	Underbody panelling - Broken / torn - Replace
5	Bonnet	Bonnet bowden cable - Non-operational - Diagnosed and repair if necessary
6	Front bumper	Spoiler (Zierleiste) - Scratched - Replace
7	2nd wheel set	1 alloy rim (Materialabtrag) - Scratched - Replace
8	Boot lid / rear door	Boot lid - Scratch(es) - Paint
9	Bonnet	Bonnet - Stone chips - Paint
10	Door - front right side	Door - dent(s) - Repair and paint

Wear and tear

No.	Component group	Description
1	Door - rear left side	Door - Stone chips - No deduction
2	Mudguard - right side	Mudguard - right side - Stone chips - No deduction
3	Mudguard - right side	Brightware, grille - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Rear, Provided by user / customer, from 31 Jan 2024	1.448,15 €
2	Rear, Underbody, Provided by user / customer, from 19 May 2024	1.927,15 €
3	Side - left, Provided by user / customer, from 18 Jun 2025	2.001,22 €
4	Rear, Provided by user / customer, from 24 Apr 2026	2.337,87 €

Repainting

No. Repainting

- | | |
|---|--|
| 1 | Boot lid / rear door, Professionally carried out |
|---|--|

Paint coat thickness measurement

Boot lid / rear door	185 µm
----------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 14: Documents

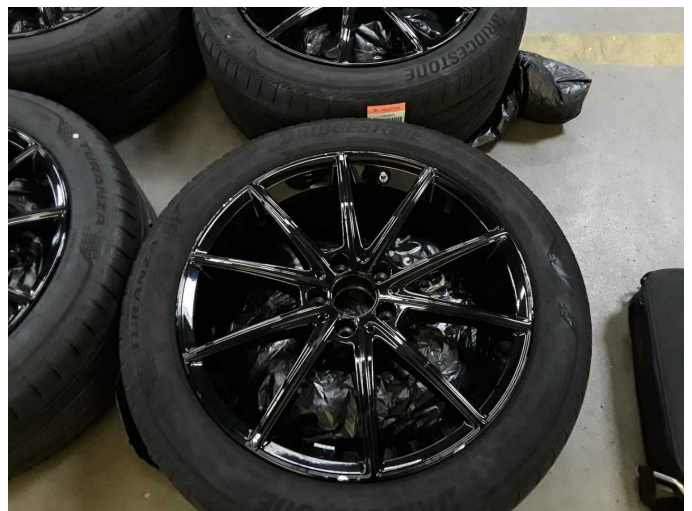


Figure 16: Additional tyres

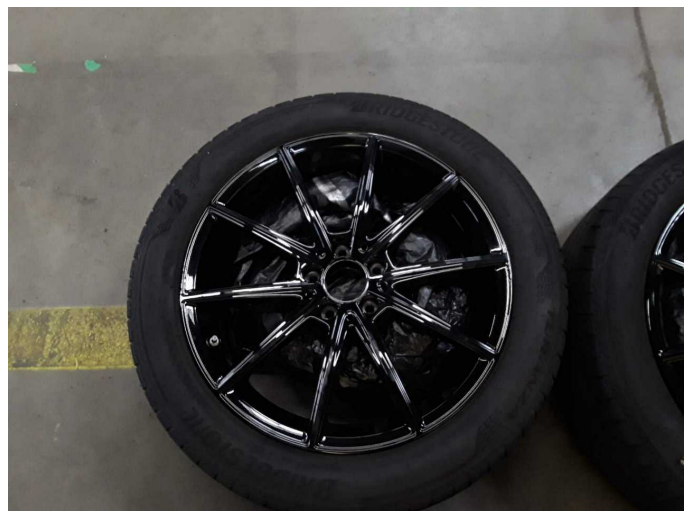


Figure 18: Additional tyres



Figure 19: Additional tyres



Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.

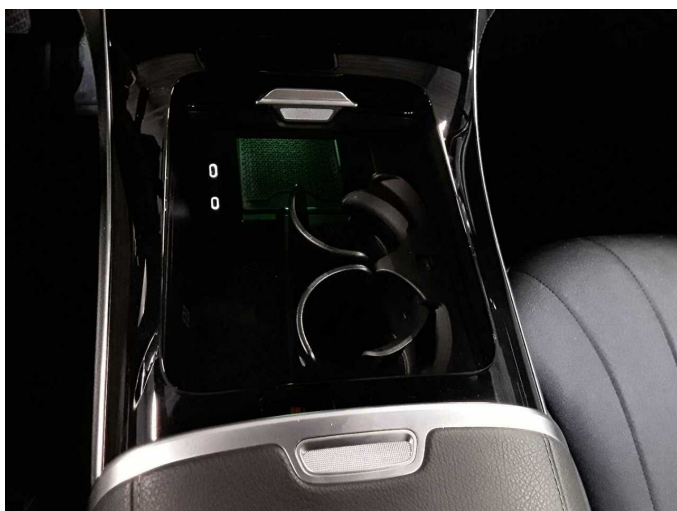


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

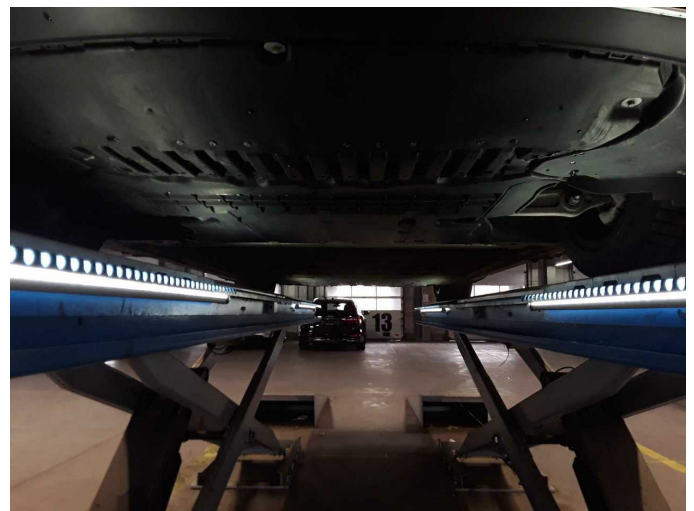


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.


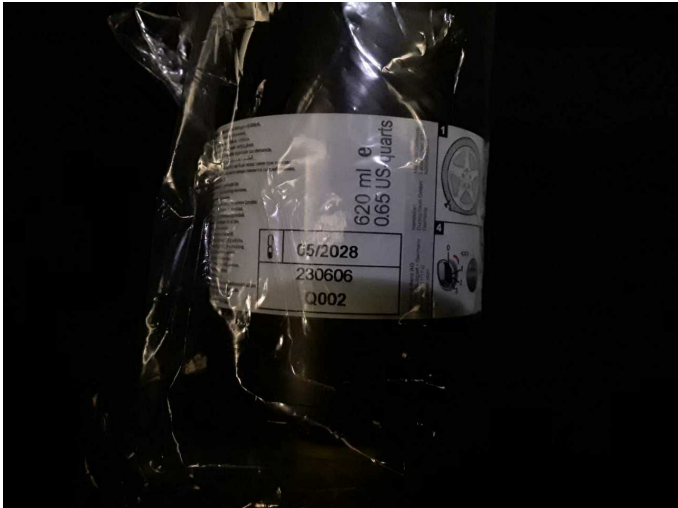


Figure 34: Misc.



Figure 35: Misc.

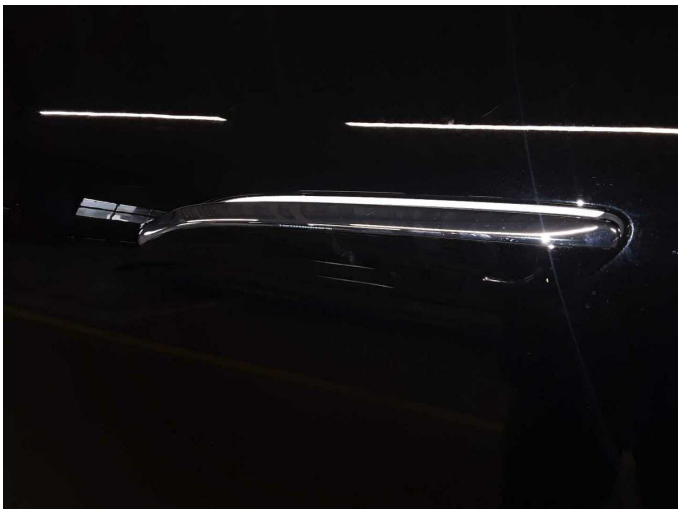


Damage 1: Door - front left side: Door handle - outside - Scratch(es) - Smart repair



Damage 1: Door - front left side: Door handle - outside - Scratch(es) - Smart repair



Damage 2: 2nd wheel set: 1 alloy rim - Scratched - Loss in value

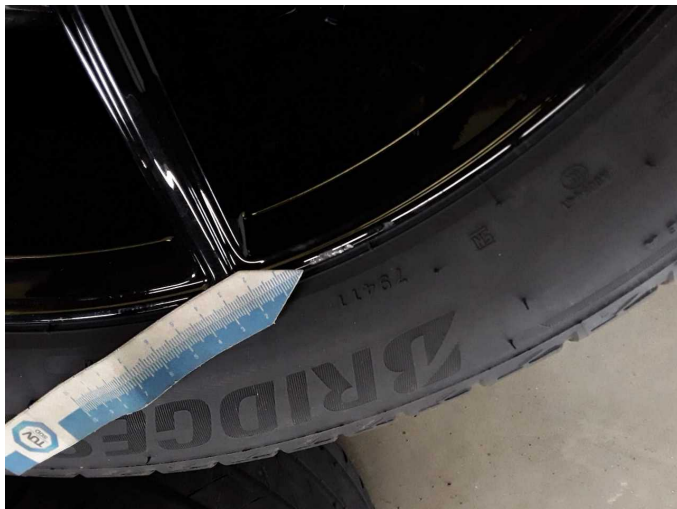

Damage 2: 2nd wheel set: 1 alloy rim - Scratched - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value




Damage 3: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 3: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value

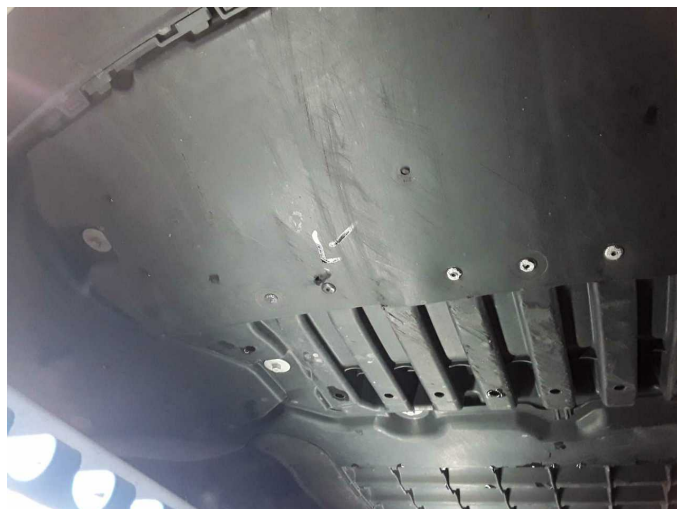

Damage 4: Body: Underbody panelling - Broken / torn - Replace




Damage 4: Body: Underbody panelling - Broken / torn - Replace



Damage 6: Front bumper: Spoiler (Zierleiste) - Scratched - Replace



Damage 6: Front bumper: Spoiler (Zierleiste) - Scratched - Replace

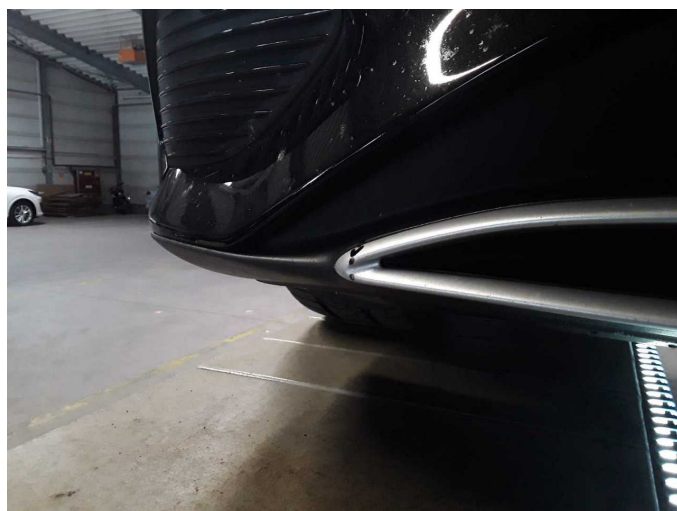

Damage 6: Front bumper: Spoiler (Zierleiste) - Scratched - Replace




Damage 6: Front bumper: Spoiler (Zierleiste) - Scratched - Replace



Damage 7: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 7: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace

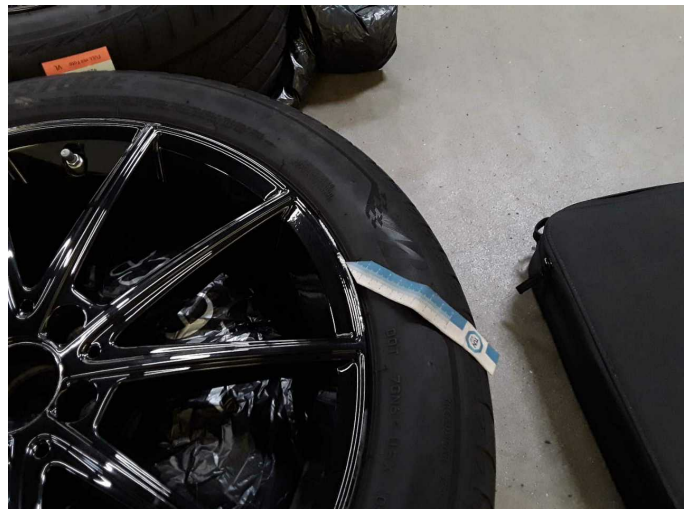

Damage 7: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 7: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 7: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 7: 2nd wheel set: 1 alloy rim (Materialabtrag) - Scratched - Replace



Damage 8: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 8: Boot lid / rear door: Boot lid - Scratch(es) - Paint



Damage 9: Bonnet: Bonnet - Stone chips - Paint



Damage 9: Bonnet: Bonnet - Stone chips - Paint



Damage 9: Bonnet: Bonnet - Stone chips - Paint



Damage 9: Bonnet: Bonnet - Stone chips - Paint



Damage 9: Bonnet: Bonnet - Stone chips - Paint



Damage 9: Bonnet: Bonnet - Stone chips - Paint



Damage 9: Bonnet: Bonnet - Stone chips - Paint



Damage 9: Bonnet: Bonnet - Stone chips - Paint



Damage 9: Bonnet: Bonnet - Stone chips - Paint



Damage 9: Bonnet: Bonnet - Stone chips - Paint



Damage 10: Door - front right side: Door - dent(s) - Repair and paint



Damage 10: Door - front right side: Door - dent(s) - Repair and paint



Damage 10: Door - front right side: Door - dent(s) - Repair and paint



Damage 10: Door - front right side: Door - dent(s) - Repair and paint



Repainting 1: Boot lid / rear door



Boot lid / rear door: 185 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1KEG1BB4PF030508

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ EQE 300 Electric Art

Datum	KM-Stand	Beschreibung
11.12.2025	59.186	Regelwartungsdienst
27.08.2024	31.726	Regelwartungsdienst