



Expertise

Protocol number: 46460399
Order No. / Reference: 26603467
Inspection date: 13 Jul 2026

Manufacturer: Opel

Model: Grandland X Plug-in-Hybrid 1.6 DI Start/Stop Aut Business
Edition

VIN: W0VZ4DGZ6MS029185



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Grandland X Plug-in-Hybrid 1.6 DI Start/Stop Aut Business Edition	
Vehicle Identification number	W0VZ4DGZ6MS029185
Mileage (Read)	69,581 km
First registration	7 May 2021
Number of holders	1
Power / Engine displacement	133 kw / 1,598 ccm
Fuel type / Cylinder	Hybr.B/E ext.auf1 / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Jade Weiß
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital evidence / incomplete	Next maintenance in	0 km
Last service on / at	06/2025 at 57,304 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	FW984032
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / ALW 00015		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,290 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R18 102V	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	225/55 R18 102V	Summer tyres on Light alloy	Continental	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/65 R17 103H	Winter tyres on Light alloy	Continental	5mm / 5mm
2)	215/65 R17 103H	Winter tyres on Light alloy	Continental	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2025		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 folding ignition keys
- Storage compartments
- Airbag: Chest-pelvis-side airbags, driver and front passenger
- Electrically folding exterior mirrors
- Hill Start Assist
- Braking system: Regenerative
- Decorative trim, Frosted Silver
- Electric parking brake
- Electronic Stability Program Plus (ESP Plus)
- Front collision warning system with automatic emergency braking and pedestrian detection
- Transmission: 8-speed automatic
- Interior features
- Instrument panels in black, with rings in high-gloss black, 3.5" color driver information display
- Rear headrests (3), height adjustable
- LED headlights
- Steering wheel, height and reach adjustable
- Illuminated makeup mirrors in both sun visors
- Mode 2 charging cable
- Fog light
- Otto particulate filter
- Upholstery: Fabric/Premium leather look
- Radio accessories: Digital radio reception DAB+
- Wheels: Light alloy 7.5 J x 18 with 5 spokes
- Reversing camera and front and rear parking sensors
- Service interval indicator
- Speed-sensitive power steering
- Visibility equipment
- Seats: Ergonomic active seat with AGR seal of approval, driver
- 12-volt power outlet
- Traffic sign recognition
- Pre-wiring for ISOFIX child seat mounting system, including top tether attachment points, rear outer
- Central locking with remote control and interior switches
- Low beam automatically
- Driver and passenger side airbags
- Airbag: Head airbags, front and rear outer
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- On-board computer
- Roof design line in black
- Tachometer
- Electronic brake force distribution (EBD)
- Electric windows front and rear
- Luggage compartment cover
- Cruise control with intelligent speed limiter
- Rear window wiper
- Interior lighting, front and rear, with reading light at the front.
- Child safety lock in the rear doors, manual
- Dual-zone automatic climate control
- Front headrests, height adjustable
- Leather steering wheel including remote control
- Steering wheel: flattened, with paddle shifters
- Center armrest, sliding, front, including storage compartment and cup holder
- Onboard charger
- Parkpilot, front and rear parking aid
- Radio: Navi 5.0 IntelliLink with 8" color touchscreen display
- Tire pressure warning
- Wheels: Tire repair kit
- Keyless locking and starting system "Keyless Open & Start"
- Seat belts
- Seats: 5 seats
- Lane Assist
- Start/Stop System
- Phone: Wireless Charging
- Lashing eyes in the luggage compartment (4)
- Immobiliser
- Tinted heat-insulating glazing

Extra equipment

- Detachable trailer hitch (trailer stability program)
- Onboard charger (vehicle-integrated charging unit, single-phase (max. 7.4 kW/32 A))
- Paint finish: Uni Jade White
- safety net
- Seats: Heated seats, multi-stage, driver and front passenger



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Tirefit filler - Expired - Replace
2	Wheel / tyres	Pressure sensor (Reifendruck) - on - Perform diagnosis
3	Mudguard - right side	Mudguard - right side - Scratch(es) - Smart repair
4	Seat - front	Seat cover - left side - Porous / cracked - Smart repair
5	Front bumper	Front bumper - Malposition - Set / adjust
6	Misc.	Inspection / maintenance - Due - Perform

Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

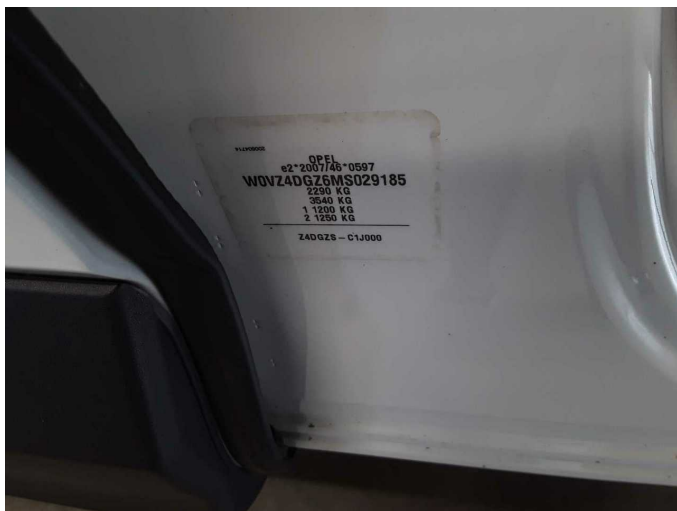


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

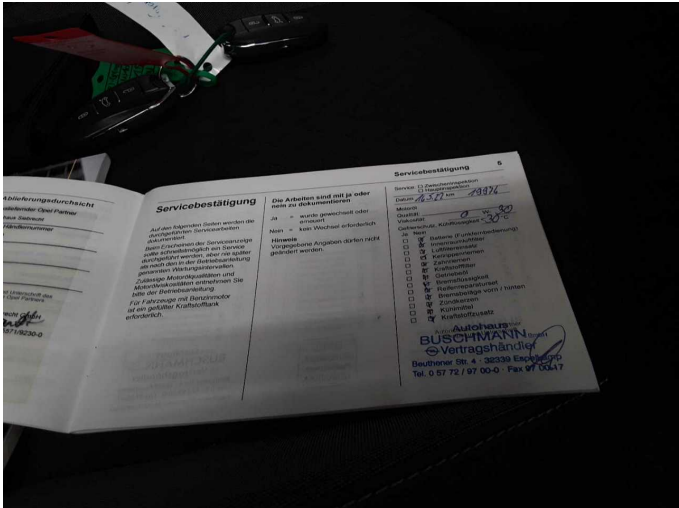


Figure 14: Documents

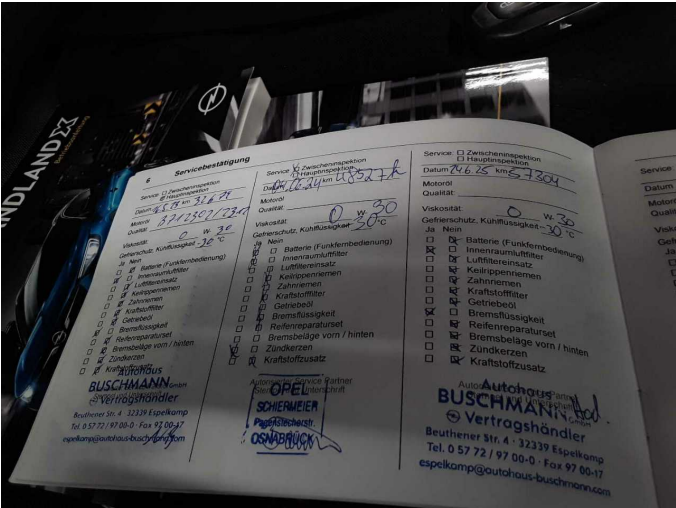


Figure 15: Documents



Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres

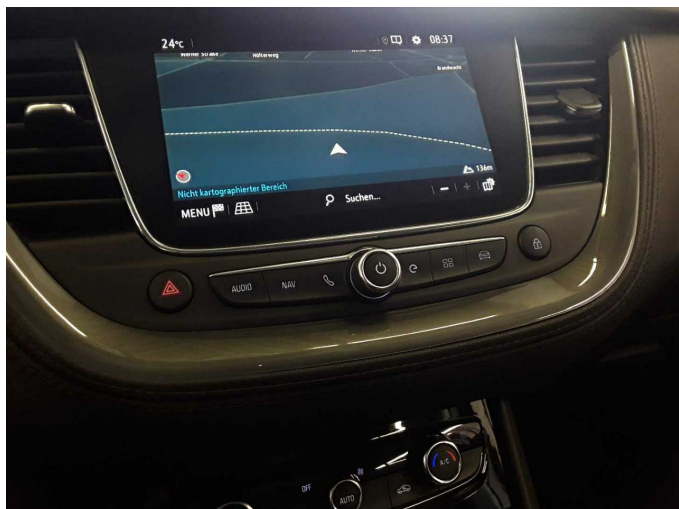


Figure 19: Navigation



Figure 20: Misc.

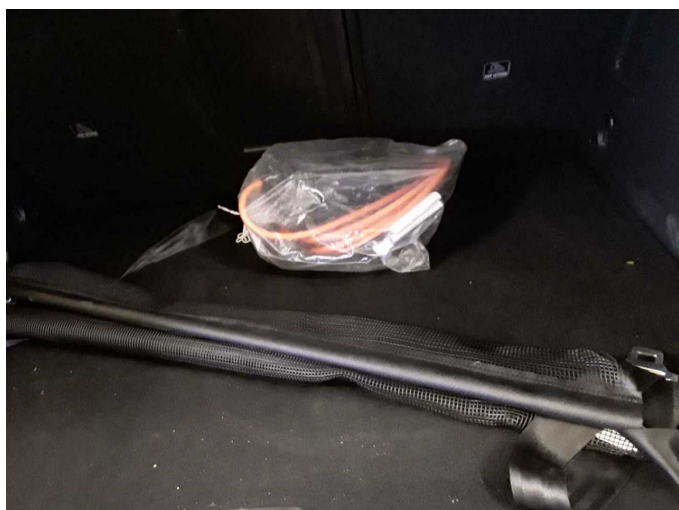


Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.

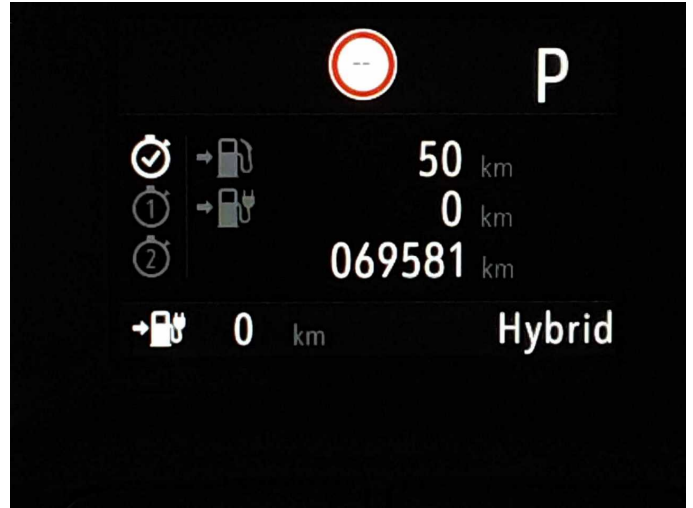


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Damage 1: Equipment: Tirefit filler - Expired - Replace




Damage 2: Wheel / tyres: Pressure sensor (Reifendruck) - on - Perform diagnosis



Damage 3: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair




Damage 3: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair

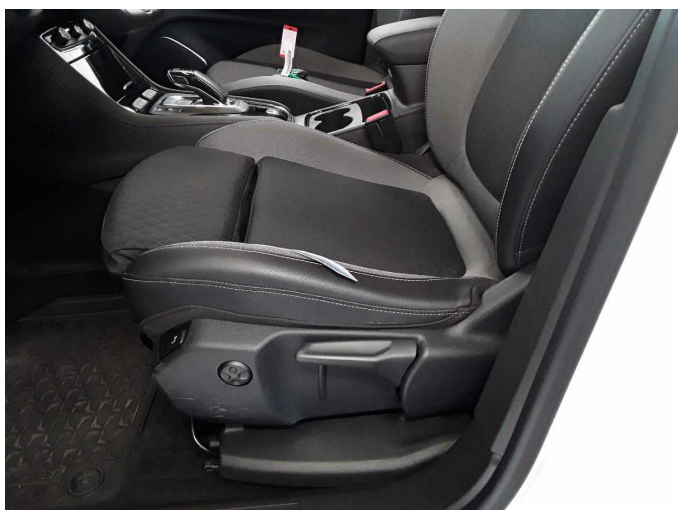

Damage 4: Seat - front: Seat cover - left side - Porous / cracked - Smart repair



Damage 4: Seat - front: Seat cover - left side - Porous / cracked - Smart repair

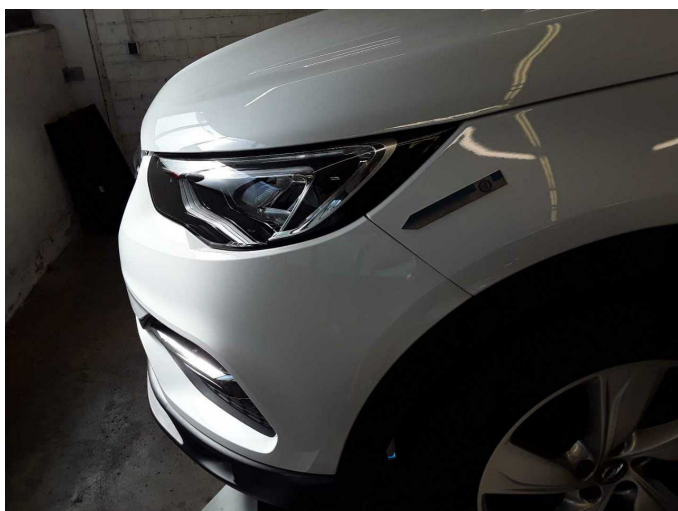

Damage 5: Front bumper: Front bumper - Malposition - Set / adjust



Damage 5: Front bumper: Front bumper - Malposition - Set / adjust



Damage 5: Front bumper: Front bumper - Malposition - Set / adjust



Damage 6: Misc.: Inspection / maintenance - Due - Perform



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZ4DGZ6MS029185

Hersteller / Modell: OPEL OPEL Grandland X Plug-in-Hybrid 1.6 DI Start/Stop Aut
Business Edition

Datum	KM-Stand	Beschreibung
03.02.2026	65.460	Systemtest/Eigendiagnose
28.06.2025	57.304	Batterie ern; Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfiler ern; Regelwartungsdienst; Wartung Sonstiges
29.08.2024	49.725	Klimaanlage inst.; Systemtest/Eigendiagnose
06.06.2024	48.527	HU + AU
05.06.2024	48.527	Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfiler ern; Regelwartungsdienst; Wartung Sonstiges; Zündkerzen ern
12.06.2023	32.679	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfiler ern; Regelwartungsdienst; Wartung Sonstiges
17.05.2022	19.974	Motoröl b. Wartung; Ölfiler ern; Regelwartungsdienst; Wartung Sonstiges