



Expertise

Protocol number: 46516716
Order No. / Reference: 26431389
Inspection date: 7 Jul 2026

Manufacturer: Volkswagen

Model: ID.4 Performance Upgrade Pro

VIN: WVGZZZE2ZPE018525



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen ID.4 Performance Upgrade Pro	
Vehicle Identification number	WVGZZZE2ZPE018525
Mileage (Read)	95,694 km
First registration	20 Dec 2022
Number of holders	1
Next periodical technical inspection	12/2027
(Report on hand)	
Power / Engine displacement	70 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	Saloon car
Colour / colour code	Mondsteingrau
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	191 Tag(e)
Last service on / at	02/2026 at 88,231 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GP917018
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CLQ 00105		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,540 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 105T	Winter tyres on Light alloy	Continental	6mm / 6mm
2)	255/50 R19 107T	Winter tyres on Light alloy	Continental	4mm / 4mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101H	Summer tyres on Steel rim with wheel cover	Hankook	4mm / 4mm
2)	255/50 R19 103T	Summer tyres on Steel rim with wheel cover	Hankook	3mm / 3mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 10/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 USB-C ports on the front
- Airbag for driver and front passenger, with front passenger airbag deactivation
- Ambient lighting, 10 colors
- Electrically adjustable, folding and heated exterior mirrors
- Car2X
- e-Sound (artificially generated engine noise to inform other road users about the approach of the e-vehicle)
- ESP Electronic Stability Program (incl. ABS Anti-lock Braking System)
- Speed limiter (in conjunction with online services)
- Transmission: 1-speed automatic
- Back window, heater
- rear window wiper
- Interior mirror automatically dimming
- ISOFIX mounting points for child seats (mounting points for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Paint finish: Solid
- Charging: 11 kW AC charging power (alternating current)
- LED headlights with automatic headlight control
- Makeup mirrors in the sun visors
- Fatigue detection
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection
- Emergency call service (no registration required, service is activated upon delivery)
- Upholstery: Seat center panels of the front seats and the outer rear seats in "Matrix" fabric
- Radio "Ready 2 Discover" (Digital radio reception DAB+ - Diversity antenna for FM reception)
- Radio accessories: 6 + 1 speakers
- Tire pressure monitoring system
- LED taillights
- Keyless Start system (without safe locking)
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner (3 three-point automatic seat belts at the rear - warning tone and light for unfastened seat belts at the front and rear)
- Voice control
- Lane keeping assistant "Lane Assist"
- Ambient lighting with logo projection
- Traffic sign recognition
- Green thermal insulation glazing, sides and rear
- Turning brake function and evasive steering support
- Airbags: Front and rear head airbags, front side airbags, center airbag
- App-Connect Wireless for Apple CarPlay and Android Auto
- third brake light
- black roof rails
- Parking aid (warning signals for obstacles in the front and rear area)
- Driving profile selection (possibility to set different vehicle settings: Comfort (only in conjunction with Adaptive Chassis Control DCC), Normal, Sport, Eco, Individual - adjustable vehicle systems are: engine, Adaptive Chassis Control DCC, DSG, steering, start-stop system, cornering lights and "Dynamic Light Assist", Adaptive Cruise Control ACC, air conditioning)
- "Climatronic" air conditioning system (active combination filter - stationary air conditioning)
- Front and rear headrests (5)
- Mode 3 Type 2 charging cable, 16 A
- Charging: 125 kW DC charging power (direct current)
- Steering wheel: Multifunction steering wheel with touch controls
- Navigation system "Discover Pro" (23.4 cm touchscreen - map with 2D display - traffic sign display - points of interest - App-Connect Wireless - voice control)
- Package: Infotainment package (Navigation system "Discover Pro": 23.4 cm touchscreen, map with 2D display, traffic sign display, points of interest, App-Connect Wireless, voice control - "Comfort" telephone interface with inductive charging function including hands-free system, Bluetooth audio, external antenna connection with LTE support)
- Wheels: Steel wheels (4) 8 J x 19 (tires 235/55 R 19 front, tires 255/50 R 19 rear - wheel covers)
- Electromechanical power steering (speed-dependent control)
- Seats: Armrest for front seats
- Seats: Driver's seat height adjustable
- Seats: Rear bench seat undivided, backrest asymmetrically split and foldable
- Telephone interface
- First aid kit, warning triangle and high-visibility vest
- Electronic immobilizer
- Central locking including remote control



Extra equipment

- Package: Assistance package "Plus" incl. "IQ.DRIVE" with "Travel Assist" (Easy Open & Close - tailgate with sensor-controlled opening and closing, with remote control, Adaptive Cruise Control (ACC) stop&go, speed limiter, anti-theft alarm with interior monitoring and towing, Travel Assist, Lane Assist and Emergency Assist, illuminated strip between headlights and door handle recesses, memory radio for Park Assist, multifunction steering wheel with LED lighting, Park Assist, Active Parking Assist, occupant protection, keyless entry and start system, Keyless Access with Safe-Side, Lane Change Assist, Side Assist, Area View including Rear View camera)
- Package: Comfort Package "Plus" (2 USB-C ports in the front, 2 USB-C charging ports on the rear center console - Windscreen in laminated safety glass, wirelessly heated and infrared-reflecting, noise-reducing - Luggage net - Luggage compartment floor - "Air Care Climatronic" air conditioning with active combination filter, stationary climate control and 3-zone temperature control - Variable center console with interchangeable inserts for cup holders and storage compartments - Cargo net partition - Rain sensor - Automatically heated front windscreen washers - Heated front seats)
- Charging cable: Mains charging cable for household socket
- Foldable towbar (electric release)
- Package: Design package (3D LED taillights with dynamic turn signals - Dynamic Light Assist high beam control for LED matrix headlights - IQ.LIGHT - LED matrix headlights with automatic headlight control, bad weather light, welcome function - illuminated strip between the headlights - tinted rear side windows and rear window)
- Package: Infotainment Package "Plus" (Head-up display - Navigation system "Discover Pro": 23.4 cm touchscreen, map with 2D display, traffic sign recognition, points of interest, App-Connect Wireless, voice control - Radio "Ready 2 Discover Max": DAB+ digital radio reception, diversity antenna for FM reception - Telephone interface "Comfort" with inductive charging function including hands-free system, Bluetooth audio, external antenna connection with LTE support - Sound system, 6 loudspeakers, digital channel amplifier, subwoofer, 450 W)
- Textile floor mats front and rear

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Trim / covers	Boot lid - interior trim - Scratch(es) - Loss in value
2	Interior	Interior (Tierhaare) - Soiled - Clean
3	Door - rear right side	Door (Mit Kratzer) - dent(s) - Repair and paint

Wear and tear

No.	Component group	Description
1	Bonnet	Bonnet - Stone chips - No deduction
2	Seat - rear	Back seat - Soiled - No deduction
3	Interior	Interior - Scratch(es) - No deduction
4	Body	Body - Scratch(es) - No deduction
5	Wheel / tyres	Alloy rim - rear right side - Scratched - No deduction
6	Wheel / tyres	Tyre - right - Does not meet the leasing specifications - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Rear, Provided by user / customer	9.743,89 €

Paint coat thickness measurement

Boot lid / rear door	55 µm	Bonnet	68 µm
----------------------	-------	--------	-------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Winter - Radsatz ist kein Bestandteil des Lieferumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)

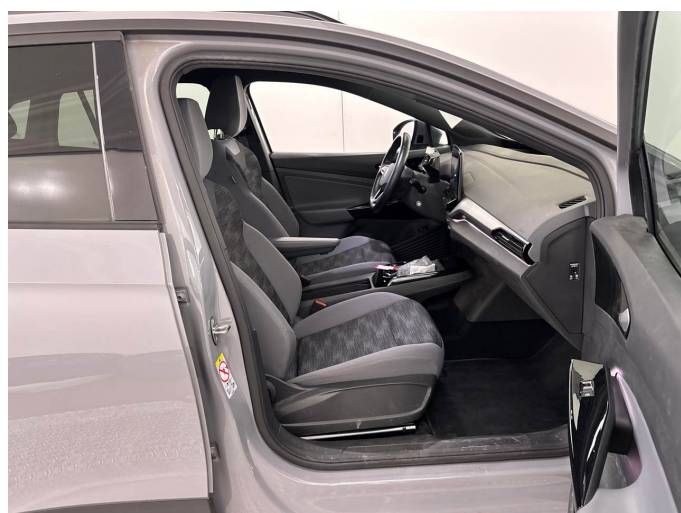


Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument cluster



Figure 9: Instrument panel



Figure 10: Interior 360° view

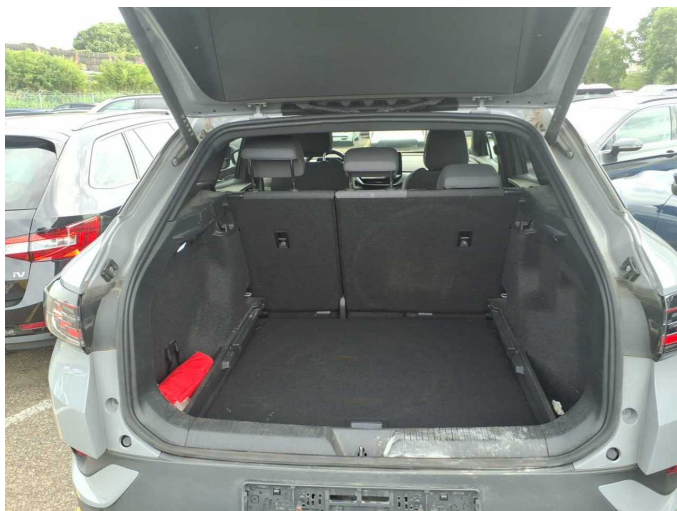


Figure 11: Cargo area



Figure 12: VIN



Figure 13: Mounted tyres

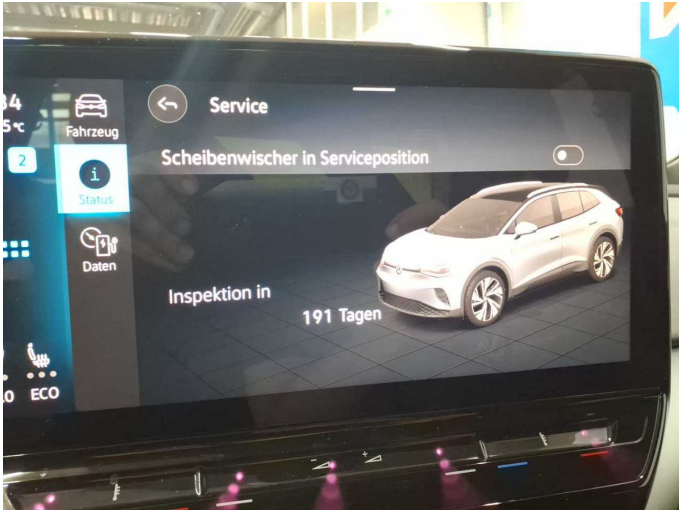


Figure 14: Documents



Figure 15: Documents



Figure 16: Documents



Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Navigation



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

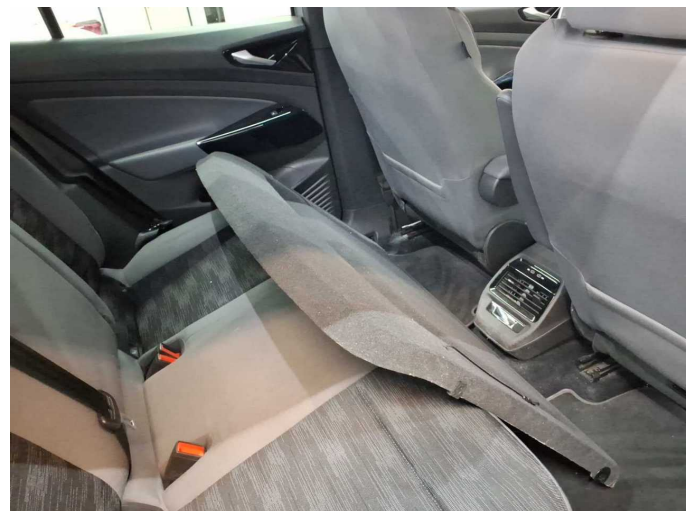


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.


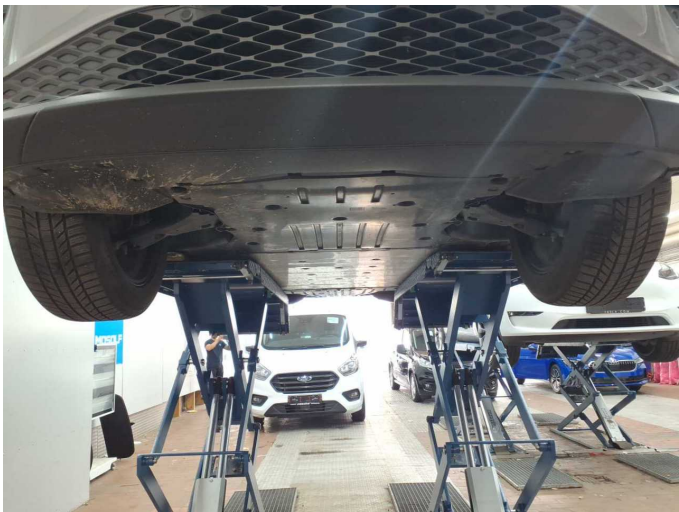


Figure 36: Misc.



Damage 1: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value

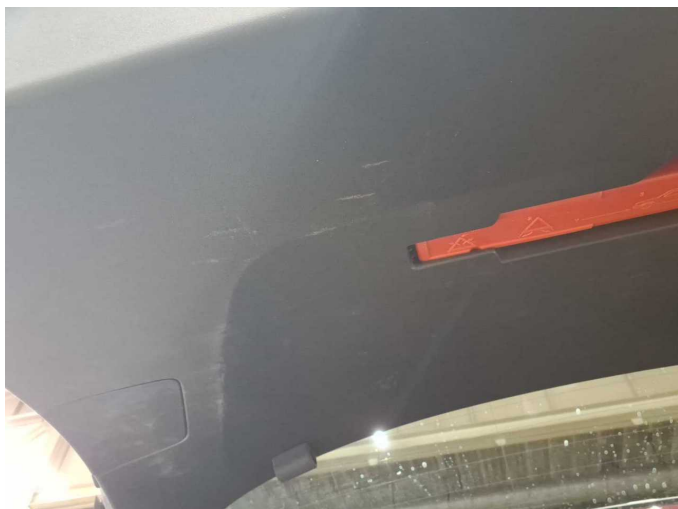


Damage 1: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 1: Trim / covers: Boot lid - interior trim - Scratch(es) - Loss in value



Damage 2: Interior: Interior (Tierhaare) - Soiled - Clean

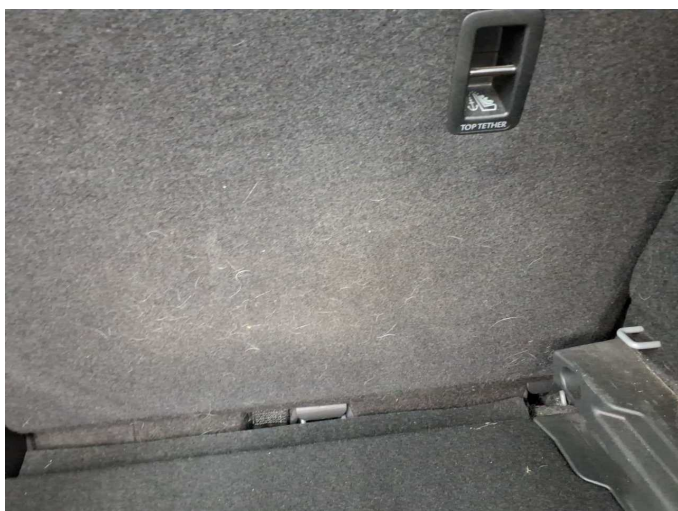

Damage 2: Interior: Interior (Tierhaare) - Soiled - Clean




Damage 2: Interior: Interior (Tierhaare) - Soiled - Clean



Damage 2: Interior: Interior (Tierhaare) - Soiled - Clean



Damage 3: Door - rear right side: Door (Mit Kratzer) - dent(s) - Repair and paint

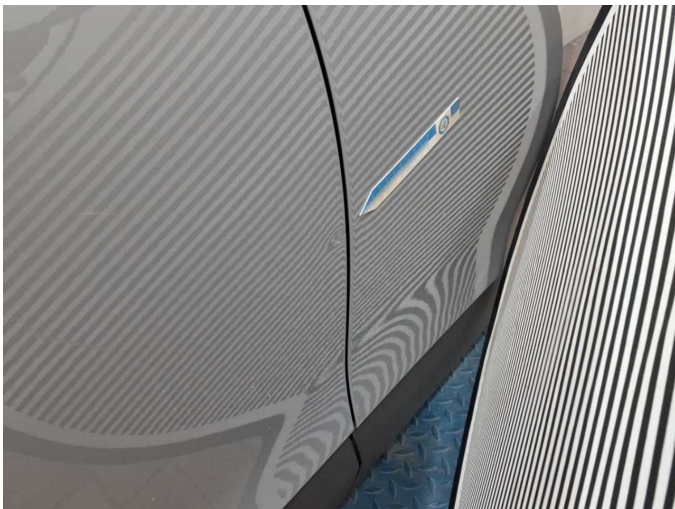


Damage 3: Door - rear right side: Door (Mit Kratzer) - dent(s) - Repair and paint



Damage 3: Door - rear right side: Door (Mit Kratzer) - dent(s) - Repair and paint



Previous damage 1: Front, Rear

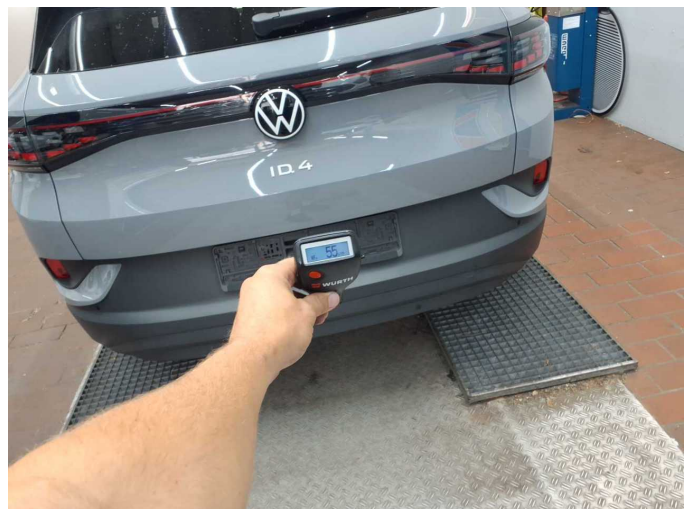

Previous damage 1: Front, Rear