



U5YH5F15GML080246

Angaben zum Fahrzeug

Halter		Besichtigungszustand	bedingt: Licht/Nässe/Schmutz
Kennzeichen		Laufleistung (abgelesen)	54.761 km
Hersteller	Kia	Restlauf bis Service	3 Monat(e)
Typ/Modell	XCeed	HU (Bericht lag vor)	11/2026
Fahrgestellnummer	U5YH5F15GML080246	Leistung / Hubraum	118 kW / 1.482 ccm
Erstzulassung	08.11.2021	Polster/Farbe	Stoff/Leder Kombination / Anthrazit
Letzte Wartung	09/2025, 49.301 km	Lackierung	Gelb
Kraftstoffart	Benzin	Getriebe	Automatik

Zustandsbericht

Wertmindernde Faktoren

Nr.	Bauteilgruppe	Beschreibung	Kosten (netto)	Minderwert
1	Rad/Reifen	Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern	855,00 €	430,00 €

Gebrauchsspuren

Nr.	Bauteilgruppe	Beschreibung	Kosten (netto)	Minderwert
Das Fahrzeug weist dem Alter und Einsatzzweck entsprechende Gebrauchsspuren auf.				

Fehlteile

Fehlteil	Kosten (netto)	Minderwert
----------	----------------	------------

Festgestellte Nachlackierungen

Nr.	Ort	Wertminderung
1	Motorhaube, fachgerecht ausgeführt, Reparaturrechnung nicht vorhanden	

Hauptbereifung

Achse	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Verktgl.	Zul.
1	235/45 R18 98Y	Vredestein	Ganzjahresreifen	4mm - 4mm	i.O.	i.O.
2	235/45 R18 98Y	Vredestein	Ganzjahresreifen	6mm - 6mm	i.O.	i.O.

Ersatz

Typ	Reifengröße	Hersteller	Reifentyp	Profiltiefe	Ablaufdatum
Tirefit					07/2026

Der Verschleißzustand sowie evtl. Schäden an der Bereifung sind wertmäßig berücksichtigt.



Angaben zum Fahrzeug

Hersteller	Kia	Besichtigungszustand	bedingt: Licht/Nässe/Schmutz
Typ/Modell	XCeed	Laufleistung (abgelesen)	54.761 km
Fahrgestellnummer	U5YH5F15GML080246	Erstzulassung	08.11.2021

Schadenzusammenfassung

Schadenklasse	Rep.Kosten	Minderwert
Beschädigungen	855,00 €	430,00 €
Gebrauchsspuren	0,00 €	0,00 €
Fehlteile	0,00 €	0,00 €
Gesamtsumme (ohne Mwst.)	855,00 €	430,00 €
Mwst. (19%)	162,45 €	81,70 €
Gesamtsumme (inkl. Mwst.)	1.017,45 €	511,70 €

Angaben zum Auftrag:

Auftragsgemäß erfolgte die Fahrzeugzustandsbewertung in demontagefreien Zustand.

Grundlage dieses Produktes stellt der Leitfaden für Fahrzeugrücknahmen und Bewertungen gemäß des Schadengrenzmusterkatalog des Auftraggebers dar. Die expliziten Feststellungen im Einzelfall trifft der Sachverständige objektiv im Rahmen der vorgegebenen Standards aufgrund eigener Sachkunde.

Fahrzeug-Identifizierung:

Die Fahrzeug-Identifizierungsnummer (FIN) wurde am Fahrzeug abgelesen und die Übereinstimmung im Verlauf der Besichtigung durch den Unterzeichner mit den vorgelegten Unterlagen festgestellt.

Besichtigungsbedingungen:

Eine ordnungsgemäße Sichtprüfung der Lackierung und der Karosserie war wegen unzureichender Lichtverhältnisse/ Nässe oder Verschmutzung nur eingeschränkt möglich.

Allgemeinzustand:

Das Fahrzeug weist dem Alter und Einsatzzweck entsprechende Gebrauchsspuren auf.

Unterschrift Sachverständiger (Markus Böttcher)

Vorliegendes Druckexemplar wurde auf elektronischem Wege erzeugt. Der benannte Sachverständige versichert, dass der Inhalt die von ihm getroffenen Feststellungen korrekt wiedergibt. Es ist ohne Originalunterschrift gültig.

Übersichtsfotos



Abbildung 1: FIN



Abbildung 2: Schräg vorne



Abbildung 3: Schräg vorne



Abbildung 4: Schräg hinten



Abbildung 5: Schräg hinten



Abbildung 6: Montierte Bereifung

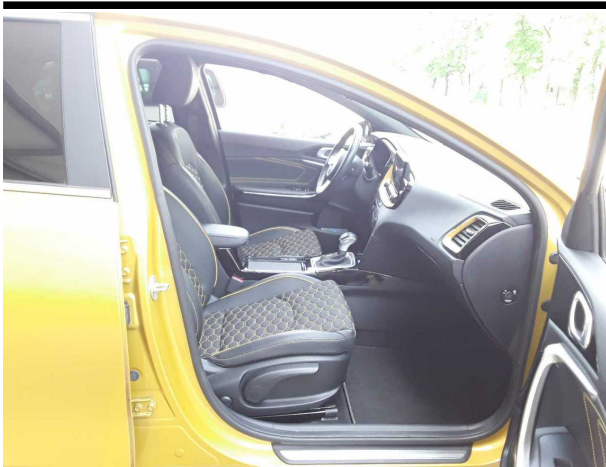


Abbildung 7: Innenraum vorne

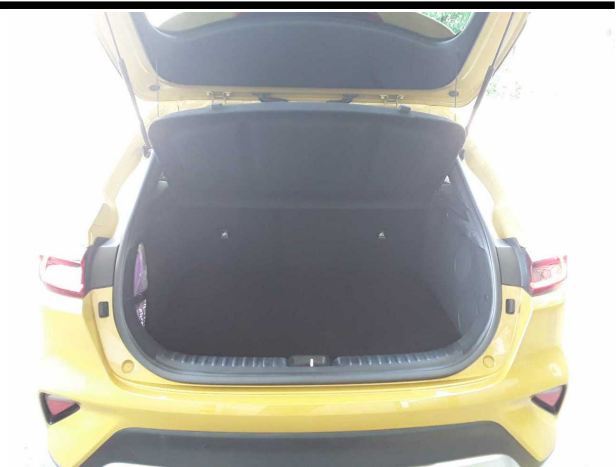


Abbildung 8: Laderaum



Abbildung 9: Laderaum



Abbildung 10: Kombiinstrument



Abbildung 11: Kombiinstrument



Abbildung 12: Instrumententafel

TÜV SÜD Auto Partner GmbH
Wiesenring 2
04159 Leipzig

Besichtigungsort
MVI Oberschleißheim
Mittenheimer Straße 64
85764 Oberschleißheim

Besichtigungsdatum: 08.06.2026
Protokollnummer: 46336134
Erstellt durch: Markus Böttcher
Besichtigt durch: Baumgartner



Abbildung 13: Instrumententafel



Abbildung 14: Dokumente

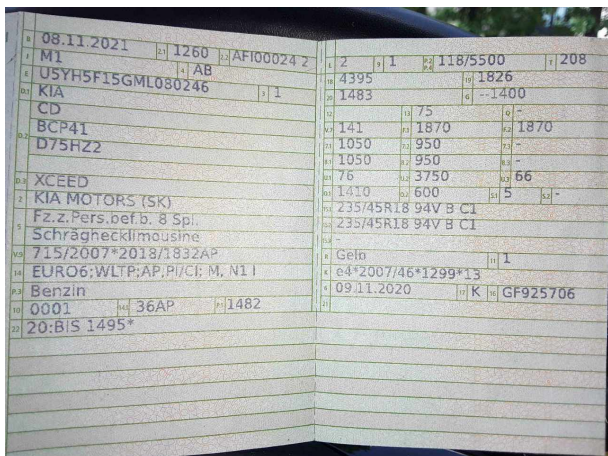


Abbildung 15: Dokumente


Beschädigungsfotos



Beschädigung #1: Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern



Beschädigung #1: Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern

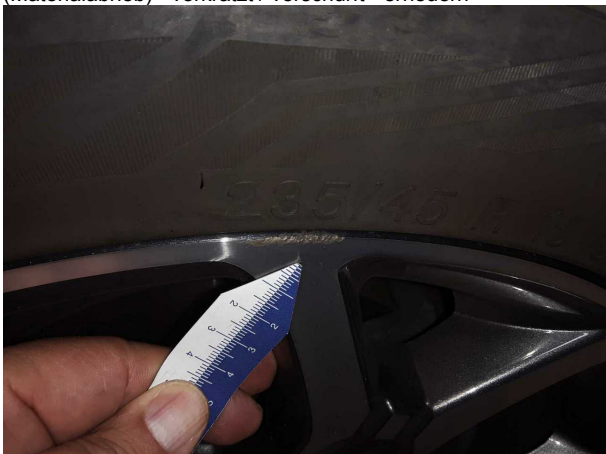

Beschädigung #1: Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern




Beschädigung #1: Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern



Beschädigung #1: Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern

Nachlackierungsfotos

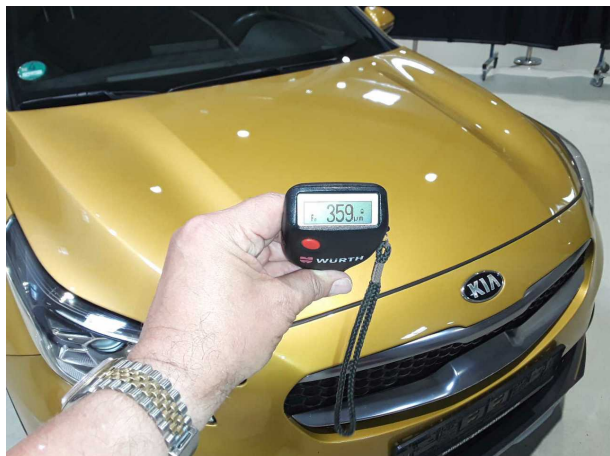

Nachlackierung 1: Motorhaube

Power plant

20. Manufacturer of the engine: Hyundai or Kia

21. Engine code as marked on the engine: G4LH

22. Working principle: Spark ignition / 4-stroke

23. Pure electric: no

23.1. Class of Hybrid (electric) vehicle:

24. Number and arrangement of cylinders: 4; inline

25. Engine capacity: 1482 cm³

26. Fuel: Gasoline

26.1. Mono fuel/Bi fuel/flex fuel/Dual-fuel: Mono fuel

26.2. (Dual fuel only)

27. Maximum power

27.1. Maximum net power: 117.50 kW at 5500 min-1

27.3. Maximum net power (electric motor): kW

27.4. Maximum 30 minutes power (electric motor): kW

28. Gearbox(type): Automatic

28.1. Gearbox ratios(to complete for vehicles with manual shift transmissions)

1.Gear	2.Gear	3.Gear	4.Gear	5.Gear	6.Gear	7.Gear	8.Gear

28.1.1. Final drive ratios(if applicable):

28.1.2. Final drive ratios(to complete if and where applicable)

1.Gear	2.Gear	3.Gear	4.Gear	5.Gear	6.Gear	7.Gear	8.Gear

Maximum Speed

29. Maximum Speed: 208 km/h

Axles and Suspension

30. Axle(s) track

1. 1575 mm

2. 1573 mm

35. Fitted tyre/wheel combination/energy efficiency class of rolling resistance coefficients (RRC) and tyre category used for CO2 determination

Axle 1: 235/45R18 94V 7.5Jx18/ET45 / B/C1

Axle 2: 235/45R18 94V 7.5Jx18/ET45 / B/C1

Brakes

36. Trailer brake connections:

Bodywork

38. Code for bodywork: AB(hatchback)

40. Colour of the vehicle: YELLOW

41. Number and configuration of doors: 5 ; 2 le, 2 ri, 1 re

42. Number of seating positions (including driver): 5

42.1. Seat(s) designated for use only when the vehicle is stationary:

42.3. Number of wheelchair user accessible position:

Environmental performance

46. Sound level

-Stationary: 76.30 dB(A) at engine speed: 3750 min-1

-Drive -by: 66.00 dB(A)

47. Exhaust emission level: EURO6;WLTP;AP;PI/CI; M, N1 I

47.1. Parameters for emission testing V . .

47.1.1. Test mass, kg: 1547

47.1.2. Frontal area, m²: 2.26

47.1.2.1. Projected frontal area of air entrance of the front grille, cm²:

47.1.3. Road load coefficients:

47.1.3.0. F0, N: 100.1607

47.1.3.1. F1, N/ (KM/h): 1.136

47.1.3.2. F2, N/ (KM/h): 0.032259

47.2. Driving cycle

47.2.1. Driving Cycle class: 3b

47.2.2. Downscaling factor (f_{dsc}):

47.2.3. Capped speed: N

48. Exhaust emissions: EC 2018/1832AP

Number of the base regulatory act and latest amending

regulatory act applicable: 715/2007

48.1. Smoke corrected absorption coefficient: (m-1)

48.1.2. Test procedure: type I (NEDC average values, WLTP

highest values) or WHSC (EURO VI)

CO: 472.9 mg/km THC: 38.7 mg/km

NMHC: 30.03 mg/km NOx: 46.5 mg/km

THC + NOx: mg/km NH3: mg/km

Particulates: 0.38 mg/km Particles: 0.77 E+11

(mass) (number)

48.2. Declared maximum RDE values (if applicable)

Complete RDE trip: 60 NOx Particle Number: 6E+10

Urban RDE trip: 60 NOx Particle Number: 6E+10

48.2.2. Test procedure: WHTC (EURO VI)

CO: mg/km NOx: mg/km

NMHC: mg/km THC: mg/km

CH4: mg/km NH3: mg/km

Particulates: mg/km Particles: E+11

(mass) (number)

49. CO2-Emissions / fuel consumption / electric energy consumption

49.1. All powertrains except pure electric vehicles

NEDC values	CO2 emissions	Fuel consumption
Urban conditions	g/km	l/100km
Extra-urban conditions	g/km	l/100km
Combined	g/km	l/100km
Weighted, combined	g/km	l/100km
Deviation factor		
Verification factor		

49.2. Pure electric vehicles and OVC hybrid electric vehicles

Electric energy consumption(weighted, combined) Wh/km

Electric range Km

046CC0118060



www.PS-Team.de

49.3. Vehicle fitted with eco-innovation(s): yes

49.3.1. General code of eco innovation(s): e9 29+ e9 28

49.3.2. Total CO2 emissions savings due to the eco-innovation(s): 2.05

49.3.2.1. NEDC savings: g/km

49.3.2.2. WLTP savings: 2.05 g/km

49.4. All powertrains, except pure electric vehicle under Regulation (EU) 2017/1151

WLTP values	CO2 emissions	Fuel consumptions
Low	173 g/km	7.6 l/100km
Medium	134 g/km	5.9 l/100km
High	121 g/km	5.4 l/100km
Extra High	151 g/km	6.7 l/100km
Combined	141 g/km	6.2 l/100km
Weighted combined	g/km	l/100km

49.5. Pure electric vehicles and OVC hybrid electric vehicles under Regulation (EU) 2017/1151

49.5.1. Pure electric vehicles

Electric energy consumption: Wh/km

Electric range: km

Electric range city: km

49.5.2. OVC hybrid electric vehicles

Electric energy consumption (ECAC, weighted): Wh/km

Electric range (EAER): km

Electric range city (EAER city): km

51. For special purpose vehicles: designation in accordance with point 5 of Part A of annex I to Regulation (EU)2018/858 of the European Parliament and of the Council:

52. Remarks:

7:1495*13:1400*30:A1:1585;A2:1583*35:205/60R16 92H,6.5Jx16/ET40;235/45R18 94V,7.5Jx18/ET45*Vehicle equipped with a 24 GHz short-range radar equipment*

For this vehicle the registration document no. GF 925 706 has already been issued for Germany.



**COMPLETE VEHICLES
CERTIFICATE OF CONFORMITY**

Übereinstimmungsbescheinigung
Πιστοποιητικό Συμμόρφωσης
Certificat de Conformité
Certificate of Conformity
Certificato di Conformità
Conformiteitscertificaat
Świadectwo Zgodności
Certifikat o składności
Certificado de Conformidad

The Undersigned S.U.CHO, GENERAL MANAGER herewith certifies that the vehicle

0.1.	Make (Trade name of manufacture)	KIA
0.2.	Type	CD
	Variant	BCP41
	Version	D75HZ2
0.2.1.	Commercial Name	XCeed
0.2.3.	Identifiers:	
0.2.3.1.	Interpolation family's identifier:	IP-091899-U5Y-1
0.2.3.2.	ATCT family's identifier:	AT-091893-U5Y-1
0.2.3.3.	PEMS family's identifier:	9-KMS-3-0
0.2.3.4.	Roadload family's identifier:	RL-041169-U5Y-1
0.2.3.5.	Roadload Matrix family's identifier:	
0.2.3.6.	Periodic regeneration family's identifier:	
0.2.3.7.	Evaporative test family's identifier:	EV-000003-TMA-1
0.4.	Vehicle Category:	M1
0.5.	Company name and address of Manufacturer:	Kia Motors Slovakia s.r.o., Sv. Jana Nepomuckeho 1282/1, Teplicka nad Vahom, 013 01 Slovak Republic
0.6.	Location and method of attachment of the statutory plates :	On the left hand B-post, bonded
	Location of the vehicle identification number:	Under the right front seat
0.9.	Name and address of the manufacturer's representative (if any)	Hyundai Motor Europe Technical Center GmbH, Hyundai-Platz, 65428 Russelsheim, Germany
0.10.	Vehicle identification number:	U5YH5F15GML080246
0.11.	Date of manufacture of the vehicle:	04.06.2021

General construction characteristics:

1.	Number of axles and wheels:	2 ; 4
3.	Powered axles:	1, Front
3.1	Specify if the vehicle is:	non-automated

Main Dimensions:

4.	Wheelbase:	2650 mm
4.1.	Axle spacing:	2650 mm
5.	Length:	4395 mm
6.	Width:	1826 mm
7.	Height:	1483 mm

Masses

13.	Mass in running order:	1400 kg
13.2.	Actual mass of the vehicle:	1474 kg
16.	Technically permissible maximum masses	
16.1.	Technically permissible maximum laden mass:	1870 kg
16.2.	Technically permissible maximum mass on each axle:	1. 1050 kg 2. 950 kg
16.4.	Technically permissible maximum mass of the combination:	3280 kg
18.	Technically permissible maximum towable mass in case of:	
18.1.	Drawbar trailer:	kg
18.3.	Centre-axle trailer:	1410 kg
18.4.	Unbraked trailer:	600 kg
19.	Technically permissible maximum static vertical mass at the coupling point:	75 kg

conforms in all respects to the type described in approval e4*2007/46*1299*13 granted on 09.11.2020 and can be permanently registered in Member states having right hand traffic and using metric units for the speedometer and metric units for the odometers.

Frankfurt, 24.08.2021

Chorazew 1102228