



Expertise

Protocol number: 46562559
Order No. / Reference: 26699627
Inspection date: 10 Jul 2026

Manufacturer: Volkswagen
VIN: WVVZZZCDXPW148955

Model: Golf 2.0 TDI SCR DSG Life



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Golf 2.0 TDI SCR DSG Life	
Vehicle Identification number	WVVZZZCDXPW148955
Mileage (Read)	112,899 km
First registration	29 Mar 2023
Number of holders	1
Power / Engine displacement	110 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Deep Black Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Grey



Vehicle details			
Maintenance booklet / proof	digital proof / complete	Next maintenance in	7,300 km
Last service on / at	06/2026 at 111,261 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GS386518
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	No
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CNX 01732		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	1,950 kg	Empty weight	

Tyres				
Mounted tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/55 R16 91W	Summer tyres on Light alloy	Barum	6mm / 6mm
2)	205/55 R16 91V	Summer tyres on Light alloy	Nexen	5mm / 5mm
Additional tyres				
#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/50 R17 93H	Winter tyres on Light alloy	Pirelli	4mm / 4mm
2)	205/50 R17 93H	Winter tyres on Light alloy	Pirelli	6mm / 6mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Sunscreen, 3-pack

|



Standard equipment

- 2 USB-C ports on the front
- Turning brake function and evasive steering support (When making left turns, the Golf with the turning assistant automatically brakes to a standstill (with a simultaneous acoustic and visual warning) should a vehicle approach in the lane to be crossed. Depending on the speed of both vehicles, the turning assistant can, within the system limits, prevent the accident or mitigate its consequences.)
- Electrically adjustable and heated exterior mirrors with memory function and passenger-side mirror lowering function.
- Vehicle tool kit
- Car2X (Using the WLANp ITS G5 standard, all Car2X-enabled vehicles and traffic systems such as traffic lights can transmit data at high speed without using the mobile network. This works over a distance of around 800 meters - enough to warn of an invisible traffic jam.)
- Parking aid (acoustic warning signals for obstacles in the front and rear area)
- Electronic parking brake including auto-hold function
- Automatic headlight control, with LED daytime running lights (as well as welcome and farewell lights)
- Electric windows, front and rear
- Windscreen made of laminated safety glass, heat and sound insulating
- Luggage compartment cover
- Rear window heated
- Rear window wiper with intermittent function
- ISOFIX mounting points (for child seats on the outer rear seats and on the front passenger seat, i-Size compatible)
- Rear headrests (3 pieces)
- Paint finish: Solid
- LED taillights
- Steering wheel: Multifunction leather steering wheel with paddle shifters
- Front center armrest adjustable in height and length
- Non-smoking version (storage compartment and 12V socket at the front)
- Emergency braking assistant "Front Assist" with pedestrian and cyclist detection (detects critical distance situations to other vehicles and helps to shorten the stopping distance - warns the driver visually and audibly in dangerous situations as well as with a preventive braking jolt with pedestrian and cyclist detection - also reacts to pedestrians and cyclists)
- Tire pressure monitoring system (passive)
- Wheels: Alloy wheels (4) "Norfolk" 7 J x 16 (tires 205/55 R 16)
- Rear bench seat undivided, backrest asymmetrically split and foldable with center armrest
- Electromechanical power steering (speed-dependent control)
- Seat belts: Three-point automatic seat belts for the outer rear seats
- Seat covers in fabric (seat center panels of the front seats and the outer rear seats in fabric)
- 2 USB charging ports on the rear of the center console
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Airbags: Front and rear head airbags, front side airbags, center airbag
- Ambient lighting, 10 colors
- App-Connect (selected smartphone apps can be displayed and operated on the touchscreen of the radio or navigation system - MirrorLink, Android Auto, Apple CarPlay)
- Exterior mirror housings and door handles in body color
- Third brake light
- Headliner in Storm Grey
- Decorative inlays "Nature Cross Brushed" (for instrument panel and front door trim)
- Diesel particulate filter and SCR catalyst
- Digital Cockpit Pro, multicolor (various info profiles selectable)
- Electronic differential lock XDS
- Electronic stability program and electromechanical brake booster (Anti-lock braking system with brake assist - Electronic brake force distribution - Traction control - Electronic differential lock - Engine drag torque control - Trailer stabilization)
- Pedestrian protection measures expanded
- Transmission: 7-speed DSG (7-speed dual-clutch transmission DSG)
- Rear spoiler
- "Climatronic" air conditioning system (with active combination filter)
- Front headrests (safety-optimized)
- LED reading lights at the front (2) and 2 at the rear
- LED headlights
- Dynamic headlight range control
- Illuminated makeup mirrors in the sun visors
- Fatigue detection (detects signs of possible driver fatigue based on characteristic steering behavior, time of day and driving duration and issues a visual and audible warning)
- Emergency call service (no registration required, service is activated upon delivery)
- Radio "Composition" (touchscreen with 21 cm screen diagonal - 4+1 speakers - output power 4 x 20 watts - FM radio reception - dual tuner with phase diversity for the best possible radio reception - Radio Data System (RDS) - MP3 playback - USB-C interface with Apple compatibility - DAB+ digital radio reception - telephone interface (hands-free system, Bluetooth audio))
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Keyless start system without safe locking
- Seat belts: Three-point automatic seat belt for the middle rear seat
- Seat belts: Three-point automatic seat belts at the front with height adjustment and belt tensioner
- Seats: Comfort seats in the front
- Seats: Lumbar support in the front
- Lane keeping assistant "Lane Assist"
- 12-volt power outlet in the luggage compartment



- Seats: Front seats are height-adjustable
- Start-stop system (with brake energy recuperation)
- Bumpers in body color
- Illuminated door handle recesses
- First aid kit, warning triangle and high-visibility vest
- Warning tone and light for unfastened seat belts front and rear
- Central locking without safe locking, with remote control and 2 remote folding keys

Extra equipment

- Towbar, foldable with electric release
- Head-up display
- Paint finish: Pearl effect
- Package: Light and Sight Package incl. High Beam Control "Light Assist" (High Beam Control "Light Assist" - Automatically Dimming Interior Mirror - Multifunction Camera - Rain Sensor)
- Package: Winter "Premium" (DSG) (Air Care Climatronic air conditioning with active combination filter, rear controls and 3-zone temperature control - leather multifunction steering wheel, heated, with shift paddles - automatically heated front windscreen washer nozzles - auxiliary heating and ventilation with remote control and timer - heated front seats and outer rear seats)
- Proactive occupant protection system in conjunction with "Front Assist" (detects critical traffic situations with increased accident potential - prepares vehicle occupants and the vehicle for a possible accident by tightening the front, fastened seat belts and securing the driver and front passenger, and closing open windows and the sunroof except for a gap)

- Telephone interface with inductive charging function
- Ambient lighting with logo projection
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Green thermal insulation glazing, sides and rear

- Chassis: Adaptive chassis control DCC including driving profile selection (sports chassis)
- Package: "Business Premium" package including "Discover Media" navigation system (DSG) (6+1 speakers, App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto, Adaptive Cruise Control (ACC) stop & go with speed limiter, Travel, Lane Assist and Emergency Assist, Multifunction camera, Heated leather multifunction steering wheel with paddle shifters, Discover Media navigation system including streaming & internet, Heated windshield washer nozzles, Voice control, Comfort telephone interface, Textile floor mats front/rear, Heated front seats)
- Panoramic tilt/slide sunroof (2 LED reading lights at the front and 2 at the rear)
- Wheels: Alloy wheels (4) "San Antonio" 7 J x 16 (tires 205/55 R 16 - wheel locks with enhanced theft protection)
- Wheels: Winter wheels (additional), alloy, "Nottingham" 6.5 J x 17 (4 alloy wheels 6.5 J x 17 - wheel wrench and jack - winter tires 205/50 R 17 H)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. No lifting equipment or pit was available for inspecting the vehicle. Therefore, inspection of the vehicle's underside was only possible to a limited extent.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Wing mirror - left side	Cap - Scratch(es) - Smart repair
2	Electrical system	Power socket - Broken / torn - Replace
3	Boot lid / rear door	Boot lid - Scratch(es) - Smart repair
4	Side panel - rear left side	Side panel - Scratch(es) - Smart repair
5	Mudguard - left side	Mudguard - left side - Scratch(es) - Smart repair
6	Sill - right side	Sill - Scratch(es) - Smart repair
7	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
8	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Loss in value
9	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Loss in value
10	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
11	Trim / covers	Boot lid - interior trim - Scratch(es) - Replace
12	Side panel - rear right side	Side panel - Dent / paintcoat damage - Repair and paint
13	Rear bumper	Rear bumper - Scratch(es) - Paint
14	Bonnet	Bonnet - Dent / paintcoat damage - Repair and paint
15	Roof	Roof rail - right side - Scratch(es) - Paint
16	Front bumper	Front bumper (Inklusive Blende erneuern) - Dent / paintcoat damage - Repair and paint
17	Roof	Roof - Scratch(es) - Paint

Wear and tear

No.	Component group	Description
1	2nd wheel set	2 tyres (Über 4mm) - No deduction
2	Roof	Roof rail - left side - Scratch(es) - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Missing parts

Description

Documents - Service book (Digitaler Ausdruck)

Equipment - Tirefit complete

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear

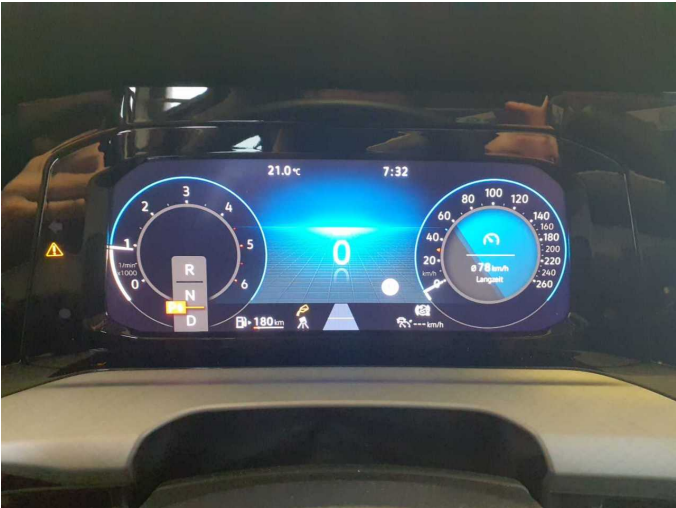


Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

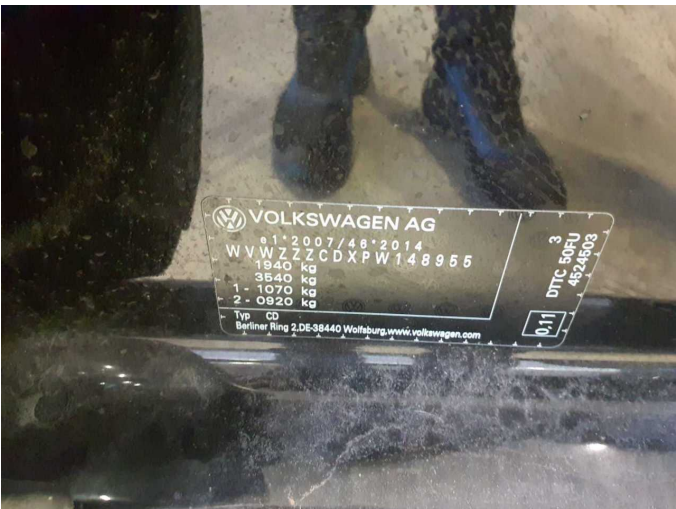


Figure 11: VIN



Figure 12: Mounted tyres

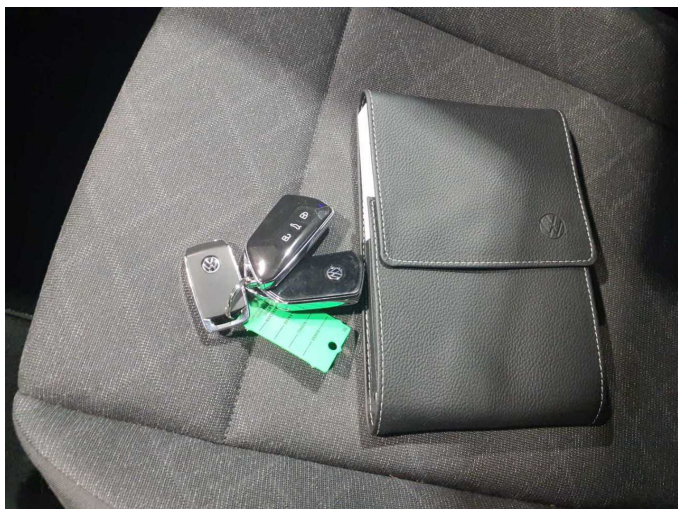


Figure 13: Documents



Figure 14: Additional tyres

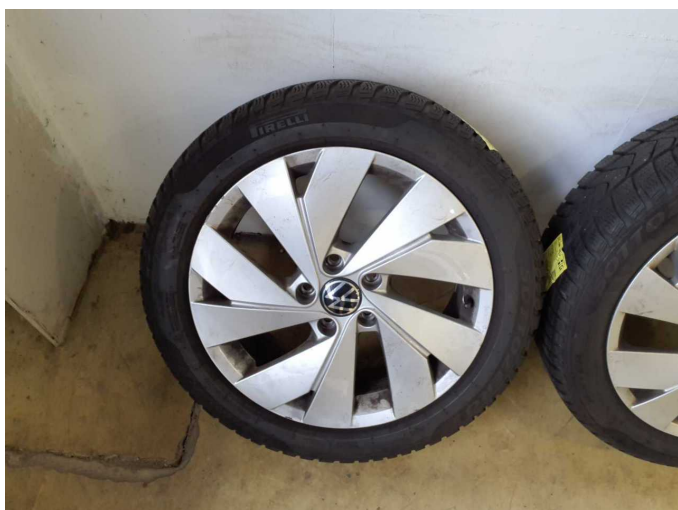


Figure 15: Additional tyres



Figure 16: Navigation



Figure 17: Misc.

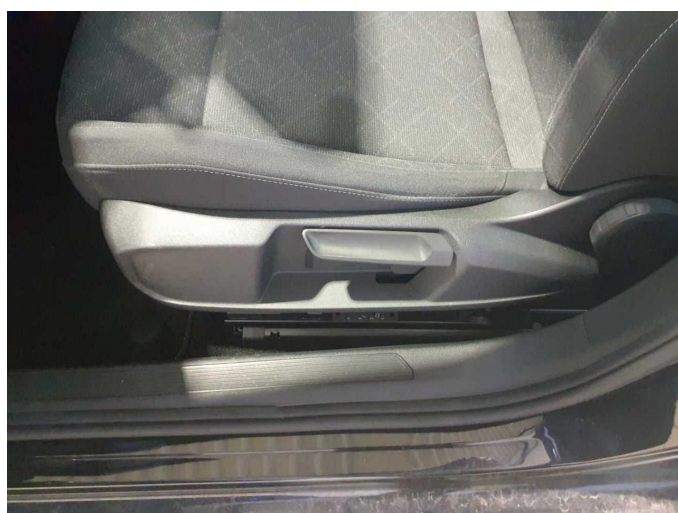


Figure 18: Misc.

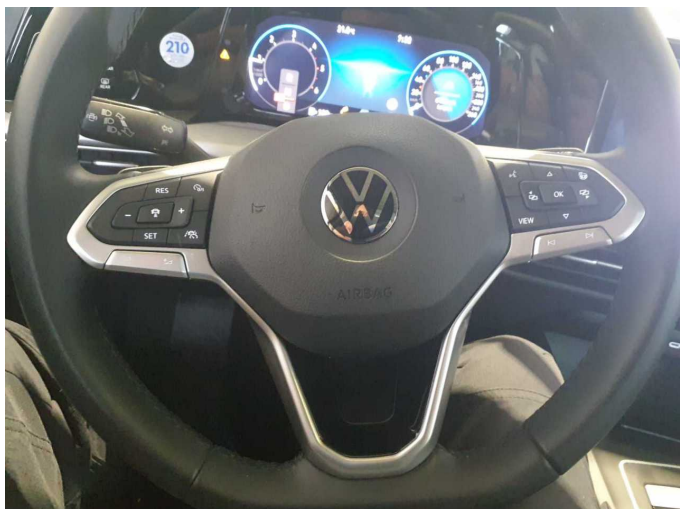


Figure 19: Misc.

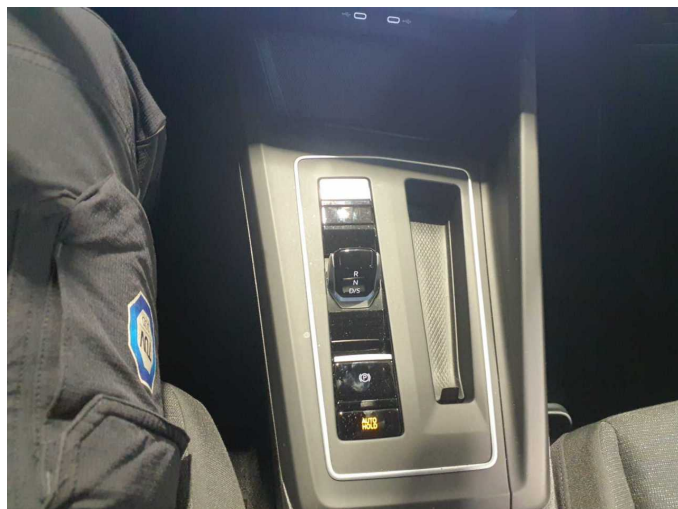


Figure 20: Misc.



Figure 21: Misc.

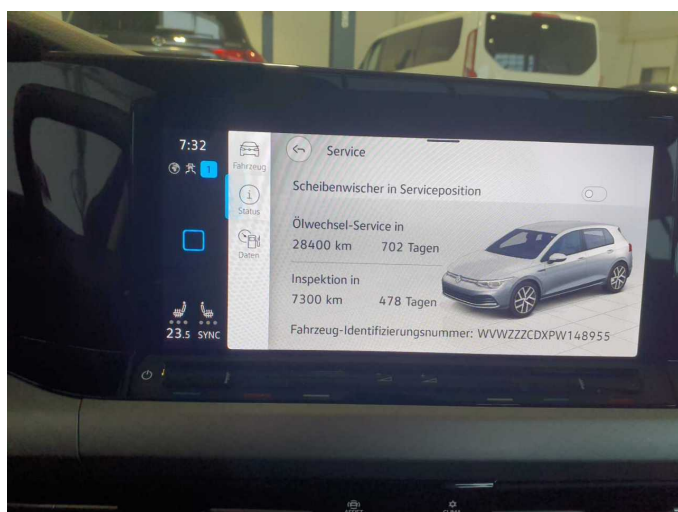


Figure 22: Misc.

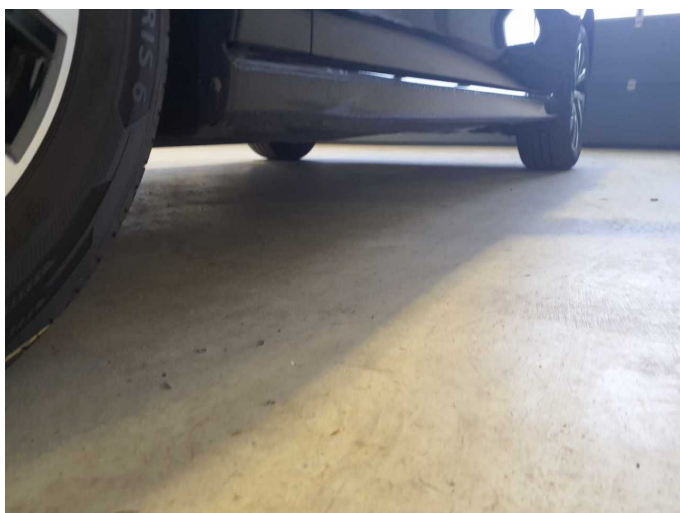


Figure 23: Misc.

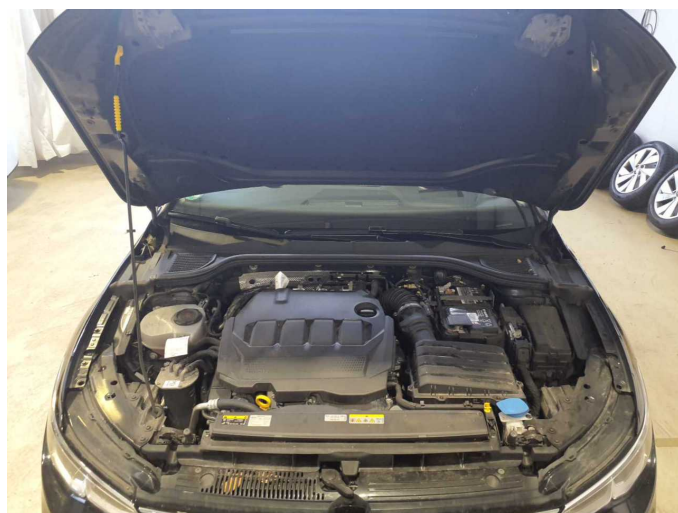


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

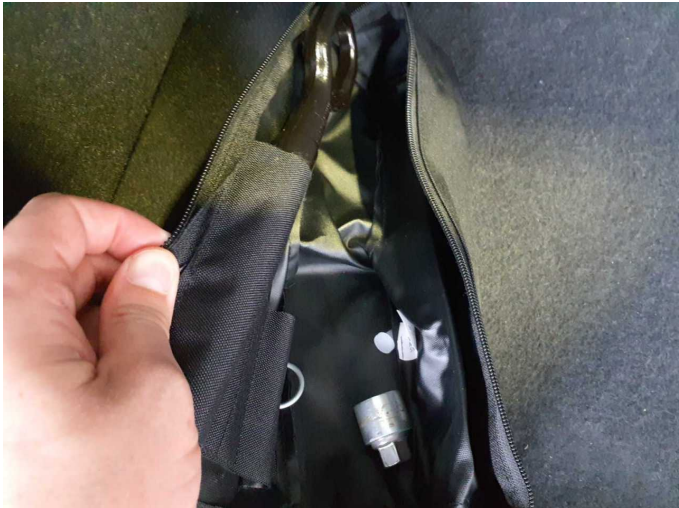


Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



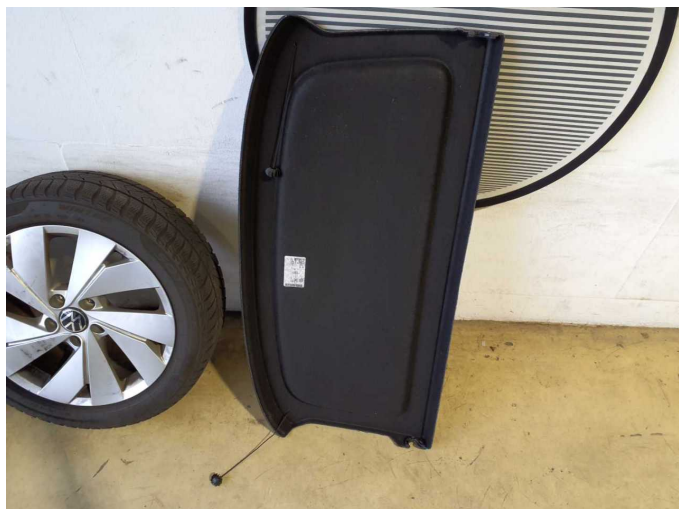


Figure 31: Misc.

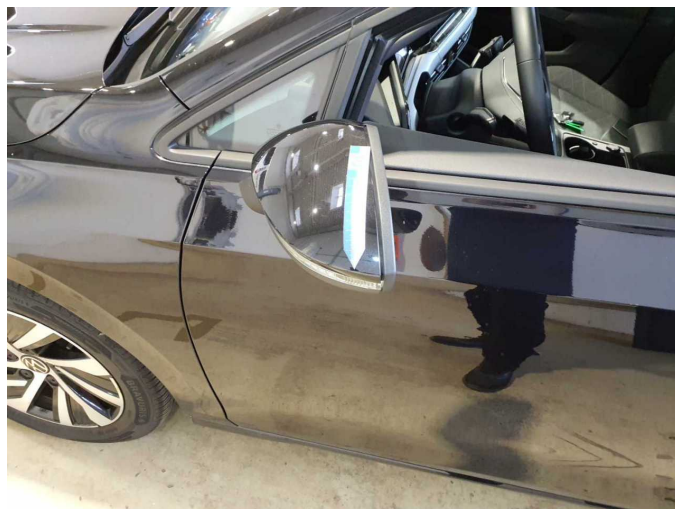

Damage 1: Wing mirror - left side: Cap - Scratch(es) - Smart repair

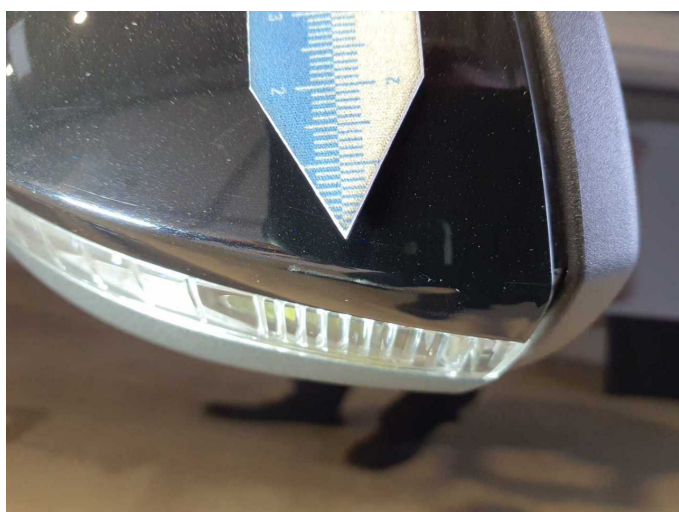

Damage 1: Wing mirror - left side: Cap - Scratch(es) - Smart repair



Damage 2: Electrical system: Power socket - Broken / torn - Replace




Damage 2: Electrical system: Power socket - Broken / torn - Replace




Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair




Damage 3: Boot lid / rear door: Boot lid - Scratch(es) - Smart repair

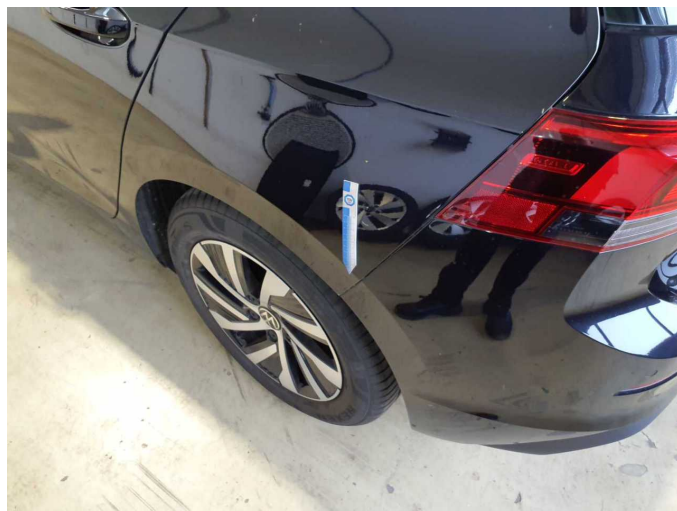

Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

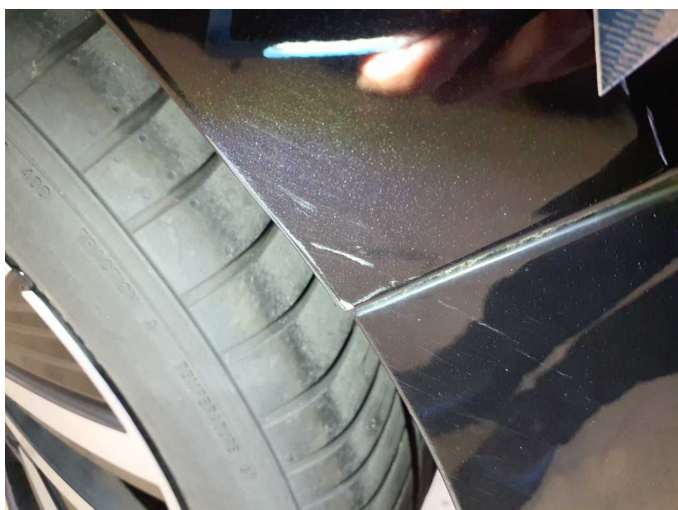

Damage 4: Side panel - rear left side: Side panel - Scratch(es) - Smart repair

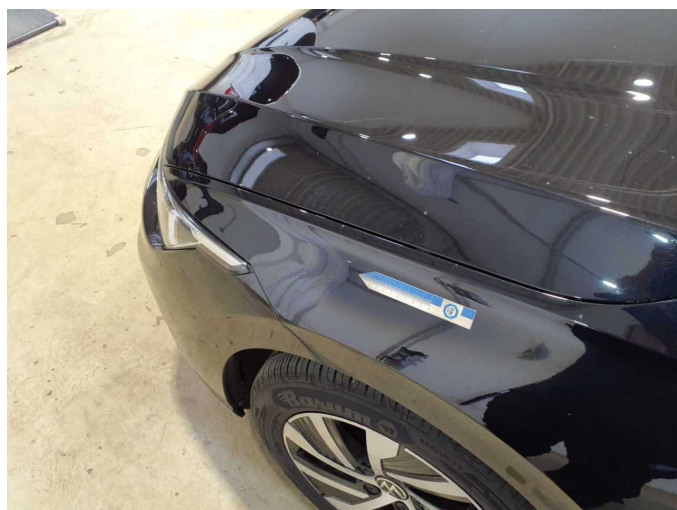

Damage 5: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair




Damage 5: Mudguard - left side: Mudguard - left side - Scratch(es) - Smart repair



Damage 6: Sill - right side: Sill - Scratch(es) - Smart repair



Damage 6: Sill - right side: Sill - Scratch(es) - Smart repair

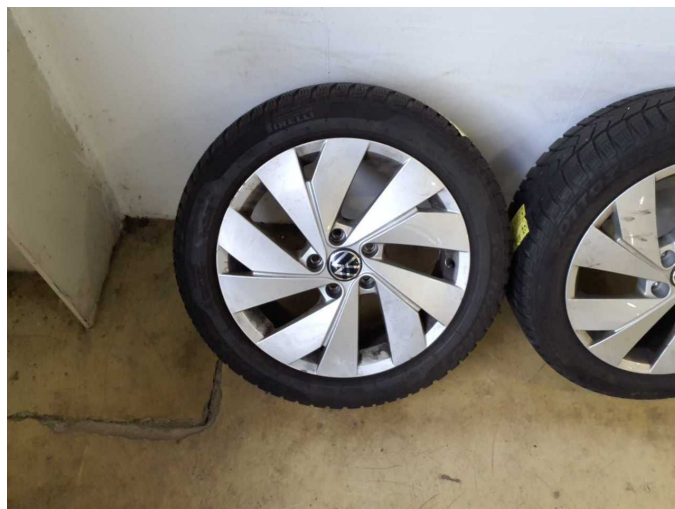

Damage 7: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value




Damage 7: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Loss in value

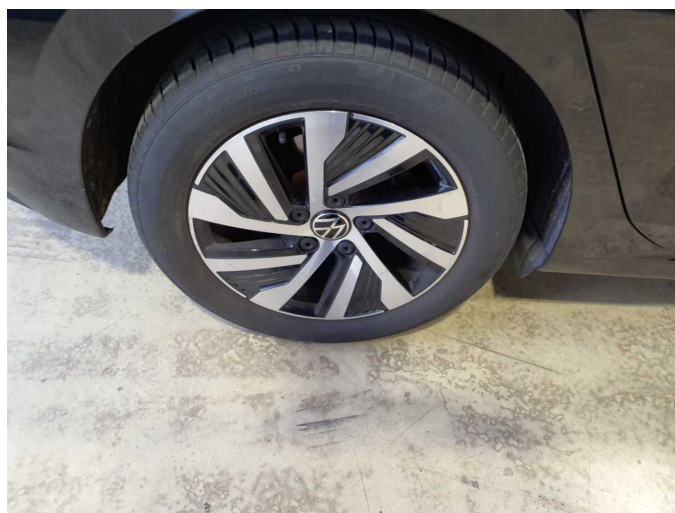

Damage 9: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 9: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Loss in value



Damage 10: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value




Damage 10: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value




Damage 11: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace




Damage 11: Trim / covers: Boot lid - interior trim - Scratch(es) - Replace

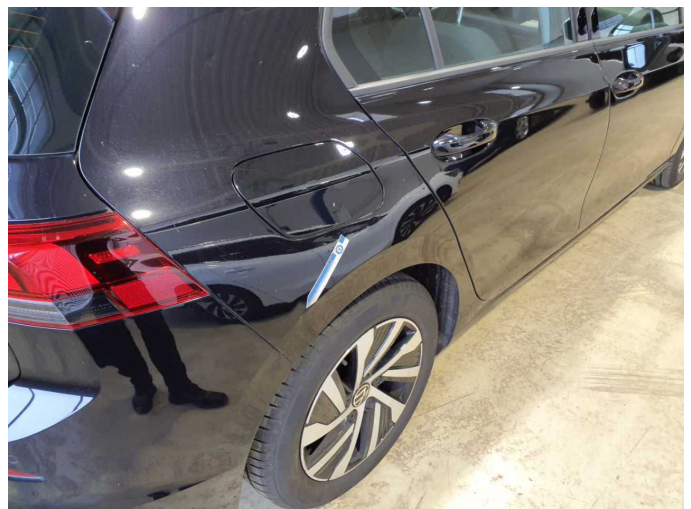


Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

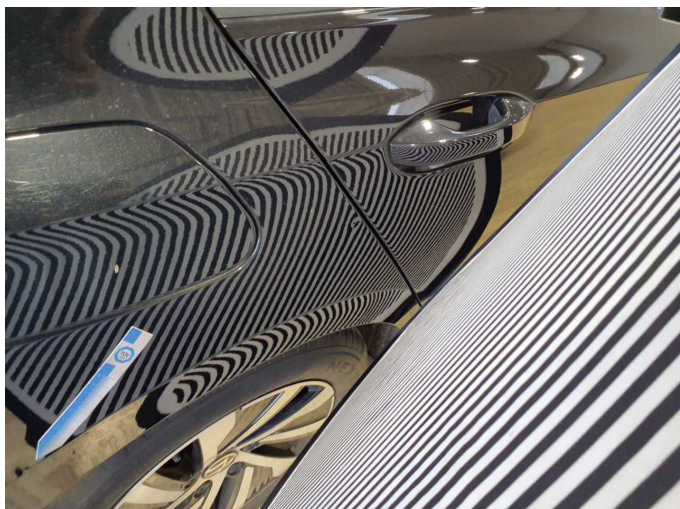

Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

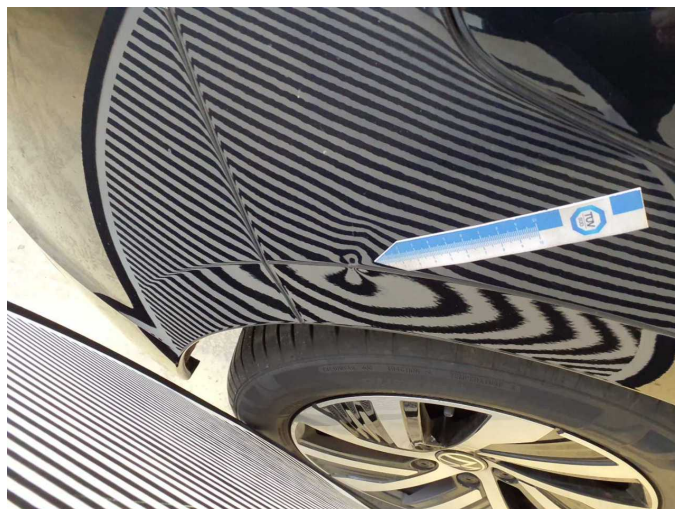


Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint

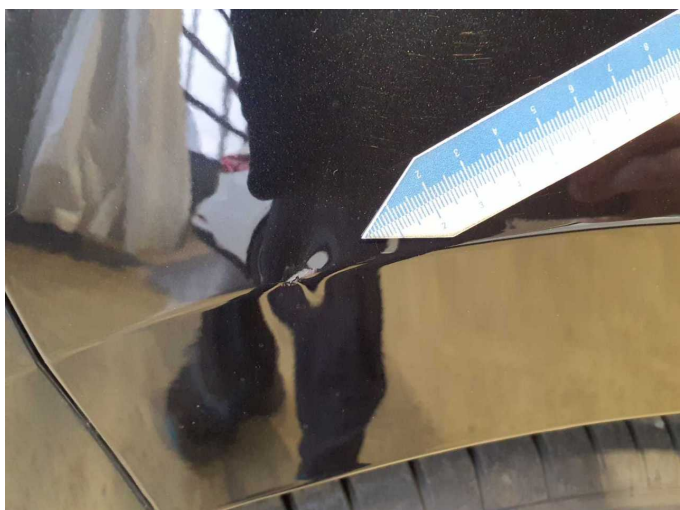

Damage 12: Side panel - rear right side: Side panel - Dent / paintcoat damage - Repair and paint



Damage 13: Rear bumper: Rear bumper - Scratch(es) - Paint

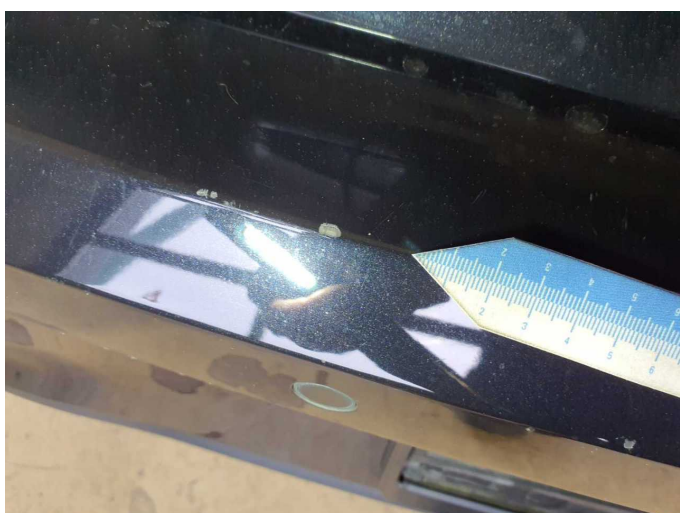

Damage 13: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 13: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 13: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 14: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 14: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 14: Bonnet: Bonnet - Dent / paintcoat damage - Repair and paint



Damage 15: Roof: Roof rail - right side - Scratch(es) - Paint




Damage 15: Roof: Roof rail - right side - Scratch(es) - Paint




Damage 15: Roof: Roof rail - right side - Scratch(es) - Paint




Damage 15: Roof: Roof rail - right side - Scratch(es) - Paint

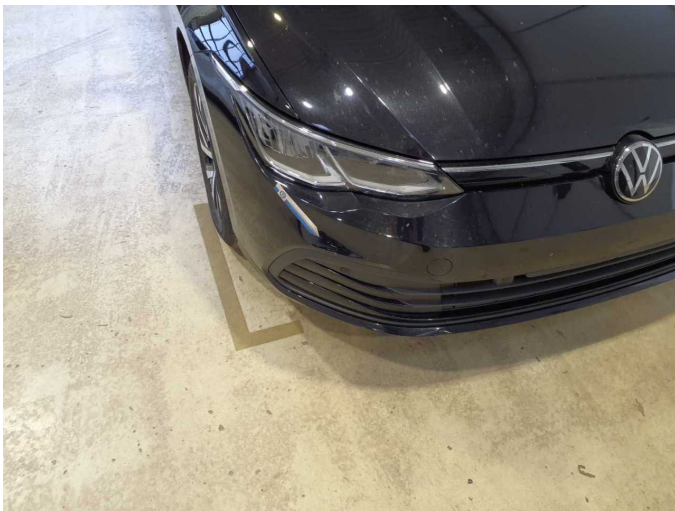


Damage 16: Front bumper: Front bumper (Inklusive Blende erneuern) - Dent / paintcoat damage - Repair and paint

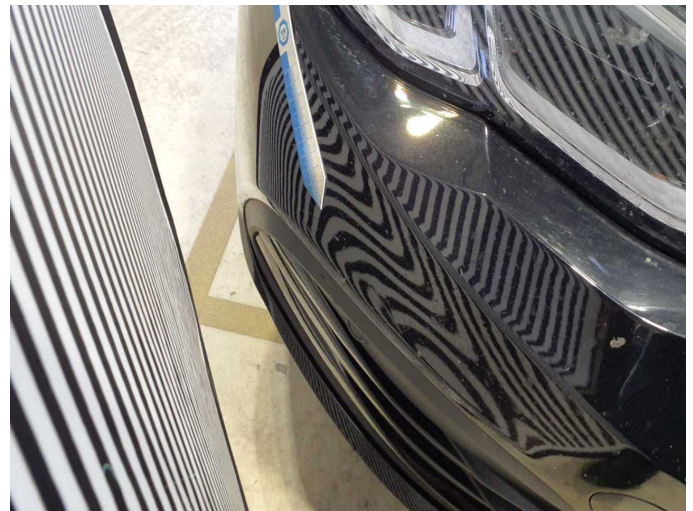


Damage 16: Front bumper: Front bumper (Inklusive Blende erneuern) - Dent / paintcoat damage - Repair and paint

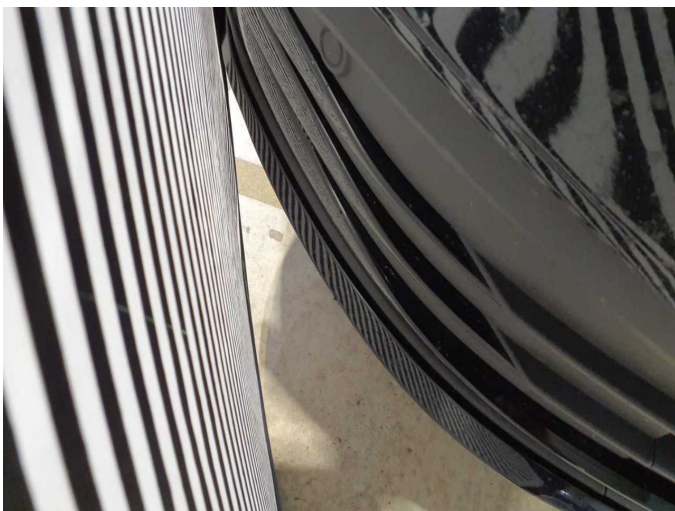

Damage 16: Front bumper: Front bumper (Inklusive Blende erneuern) - Dent / paintcoat damage - Repair and paint

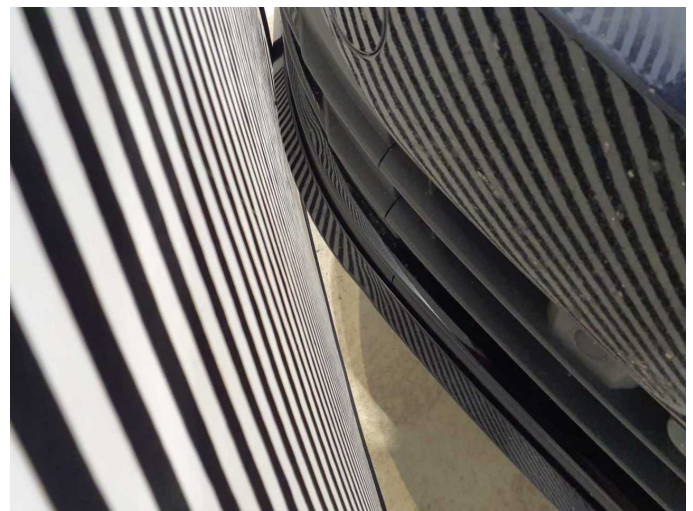

Damage 16: Front bumper: Front bumper (Inklusive Blende erneuern) - Dent / paintcoat damage - Repair and paint

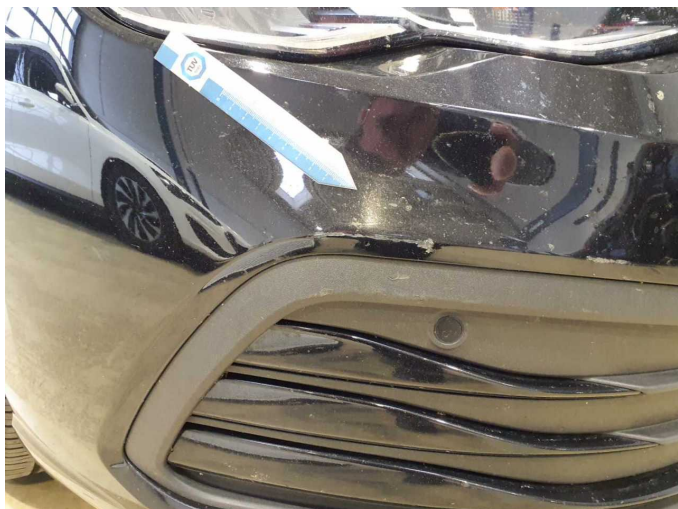

Damage 16: Front bumper: Front bumper (Inklusive Blende erneuern) - Dent / paintcoat damage - Repair and paint



Damage 16: Front bumper: Front bumper (Inklusive Blende erneuern) - Dent / paintcoat damage - Repair and paint



Damage 16: Front bumper: Front bumper (Inklusive Blende erneuern) - Dent / paintcoat damage - Repair and paint



Damage 16: Front bumper: Front bumper (Inklusive Blende erneuern) - Dent / paintcoat damage - Repair and paint



Damage 17: Roof: Roof - Scratch(es) - Paint



Damage 17: Roof: Roof - Scratch(es) - Paint



Damage 17: Roof: Roof - Scratch(es) - Paint



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVVZZZCDXPW148955

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Golf 2.0 TDI SCR DSG Life

Datum	KM-Stand	Beschreibung
12.06.2026	111.261	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
11.05.2026	107.629	HU + AU
03.11.2025	90.151	Bremsflüssigkeit; Bremsflüssigkeit ern; Kraftstofffilter ern; Luftfiltereinsatz ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
15.09.2025	84.908	Bremse Sonstiges; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben + Klötze h; Bremsscheiben + Klötze v; Bremsscheiben hinten; Bremsscheiben vorne; Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
02.12.2024	60.132	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
19.02.2024	30.524	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges