



Expertise

Protocol number: 46718707
Order No. / Reference: 26627524
Inspection date: 23 Jul 2026

Manufacturer: Volvo

Model: XC60 B4 D AWD Geartronic Momentum Pro

VIN: YV1UZZK5V0P1380057



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC60 B4 D AWD Geartronic Momentum Pro	
Vehicle Identification number	YV1UZZK5V0P1380057
Mileage (Read)	138,560 km
First registration	3 May 2023
Number of holders	1
Next periodical technical inspection	05/2028
(Report on hand)	
Fuel type	Hybrid Diesel / E
Engine displacement / Cylinder	1,969 ccm / 4
Power	145 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	Crystal Weiß-Perleffekt
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Anthracite-Grey
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	15,637 km
Last service on / at	03/2026 at 124,197 km		
Key is / should be	2 / 2	FZG documents	Registration and title documents unavailable
		Letter No.	GS764234
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BPQ 00033		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,540 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107V	Summer tyres on Light alloy	Continental	6mm / 6mm
2)	235/60 R18 107V	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 107V	Winter tyres on Light alloy	Nokian	3mm / 3mm
2)	235/60 R18 107V	Winter tyres on Light alloy	Nokian	5mm / 5mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 04/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- ABS - Anti-lock Braking System
- Passenger side airbag can be deactivated
- Airbag, driver's knee airbag
- Airbag, side airbags for driver and front passenger and head/shoulder airbags for all occupants
- All-wheel drive (AWD)
- Electrically folding exterior mirrors
- Electrically adjustable and heated exterior mirrors, left and right
- Hill Descent Control (HDC)
- Fog sensor for automatic activation of the defroster function
- On-board computer
- Chrome trim on the side windows
- Roof edge spoiler
- Diesel particulate filter
- Digital Instrumentation 2nd Gen.
- Aluminum inlay Iron Ore
- Aluminum door sill plates with Volvo lettering at the front
- Electronic Stability Control (ESC)
- Enhanced air quality system with fine dust filtration according to air quality standard PM2.5
- Automatic emergency braking
- Luggage compartment partition net
- Transmission: 8-speed automatic transmission
- Google Services with navigation function
- Automatic tailgate
- IDIS - Intelligent Driver Information System
- Interior lighting
- ISOFIX mounting for the outer rear seats
- Keyless Drive (electronic access system)
- Child safety lock (rear doors)
- Automatic climate control with separate temperature control for driver and front passenger
- Rear headrests foldable
- Paint finish: Solid
- Stainless steel loading sill protector in the luggage compartment
- LED headlights "Thor's Hammer" with high beam assist and integrated LED daytime running lights
- Illuminated makeup mirror for driver and front passenger
- Front center armrest with integrated storage compartment and cup holders
- Emergency brake lights
- Electric parking brake
- Upholstery: Premium textile comfort seats
- Radio: High Performance Sound audio system
- Radio accessories: Two USB-C ports on the back of the center console
- Run-off Road Protection
- Wheels: Tire sealant
- Safety Assistance
- Whiplash protection system WHIPS
- Driver and passenger side airbags with two-stage deployment system
- Airbag, side airbags for driver and front passenger and head/shoulder airbags (iC) for all occupants
- Active safety belts with belt tensioners
- Android infotainment system
- Electrically adjustable exterior mirrors
- Heated exterior mirrors and rear window (automatic)
- Outdoor temperature display
- Hill Start Assist (HSA)
- LED turn signals integrated into the exterior mirrors
- third brake light
- CleanZone air quality system with activated carbon filter
- Black roof rails (integrated)
- Digital services including Google Maps navigation system
- Drive Mode
- Rear parking assist with automatic braking intervention (rear)
- Electronic differential lock
- Electric windows front and rear
- Chrome window surround
- Front grille in waterfall design in high-gloss black
- Cruise control
- Transmission: 8-speed Geartronic automatic transmission
- Front seat belt height adjustment
- Heated rear window
- Interior and exterior mirrors automatically dimming
- Intelligent driver information system
- Keyless Drive
- Keyless Start
- Child safety lock for the rear doors (electric)
- Headrests (5) front and rear
- Headrests of the 2nd row of seats can be folded down (electrically)
- Charging box under the cargo floor
- Cargo area roller blind
- LED headlights "Thor's Hammer"
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Rear center armrest (foldable)
- Fog light
- Emergency brake lights
- Package: Parking Assistance Package
- Parking ticket holder
- Upholstery: Textile comfort seats
- Radio accessories: Digital radio reception (DAB+)
- Rain sensor
- Tire pressure monitoring system
- Wheels: 18" 5-spoke alloy wheels
- Rear seats in a 40/60 split or completely foldable with pass-through function
- Speed-sensitive power steering



- Safety braking system with disc brakes all around (internally ventilated)
- Seats: Lumbar support (2-way adjustable) for driver and front passenger seats
- Power socket
- Phone: Inductive smartphone charging system
- Glazing: Colored glazing
- Volvo On Call
- Warning tone/indicator when seat belts are not fastened (for all seats)
- Central locking system with two remote controls and integrated emergency keys

- Seat belts
- Seats: Driver and front passenger seats are height-adjustable (electrically)
- Start/Stop technology
- 12-volt socket at the front
- First aid kit and warning triangle
- Lashing eyes in the luggage compartment (foldable)
- Preparation for Trailer Stability Assist (TSA)
- Immobiliser
- WHIPS whiplash protection system

Extra equipment

- 18" winter complete wheels 5-Y spoke design
- Package: Driver Assistance Package
- Package: Winter Package (front seat heating - rear seat heating - steering wheel heating)
- Package: Winter Package (front seat heating - steering wheel heating)
- Paint finish: Crystal White Pearl Effect
- Seats: Heated rear seats (outer seats of the 2nd row)
- Towbar (semi-electric)
- Windscreen, heater

- Package: Driver Assistance Package (Driver Assistance: - Adaptive Cruise Control - Emergency Stop Assist - Automatic emergency braking system if warnings are ignored - Pilot Assist - Lane Keeping Assist up to speeds of 130 km/h Driver Awareness: - Blind Spot Information System - Blind Spot Assist including Lane Change Warning for rapidly approaching vehicles including steering intervention - Cross Traffic Alert - Cross-traffic alert with braking intervention - Rear Impact Mitigation - Preventive protection in case of an impending rear-end collision)

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 1 (registration document) and the vehicle registration certificate Part 2 (title) were not available.
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Equipment	Vehicle key with remote control - Non-operational - Perform diagnosis
2	Door - front left side	Door - Scratched - Smart repair
3	Rear bumper	Spoiler - Scratched - Smart repair
4	Body	B-pillar - left side - Scratched - Smart repair
5	2nd wheel set	2 tyres (3mm) - Does not meet the leasing specifications - Replace
6	Rear bumper	Rear bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 25 Jul 2025	4.649,56 €

Repainting

No.	Repainting
1	Side panel - rear right side, Door - front right side, Professionally carried out

Paint coat thickness measurement

Side panel - rear right side	299 µm	Door - front right side	222 µm
------------------------------	--------	-------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents

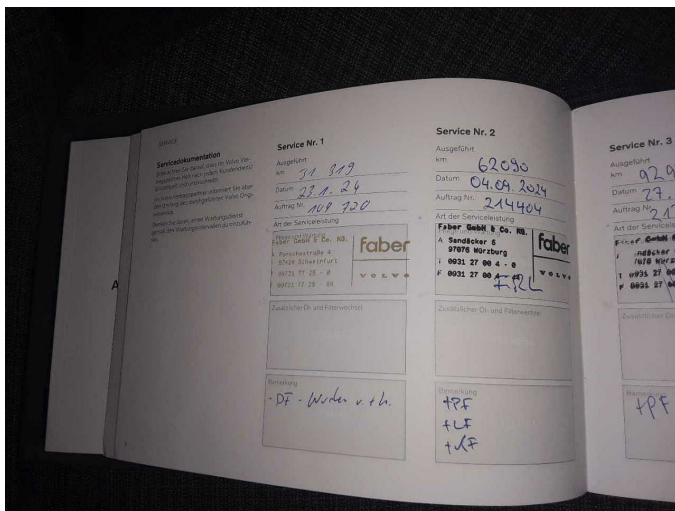


Figure 15: Documents

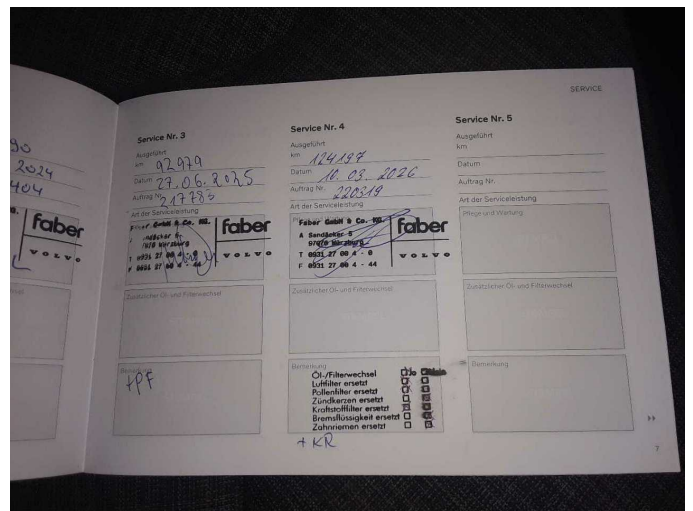


Figure 16: Documents



Figure 17: Additional tyres



Figure 18: Additional tyres



Figure 19: Additional tyres



Figure 20: Additional tyres



Figure 21: Additional tyres

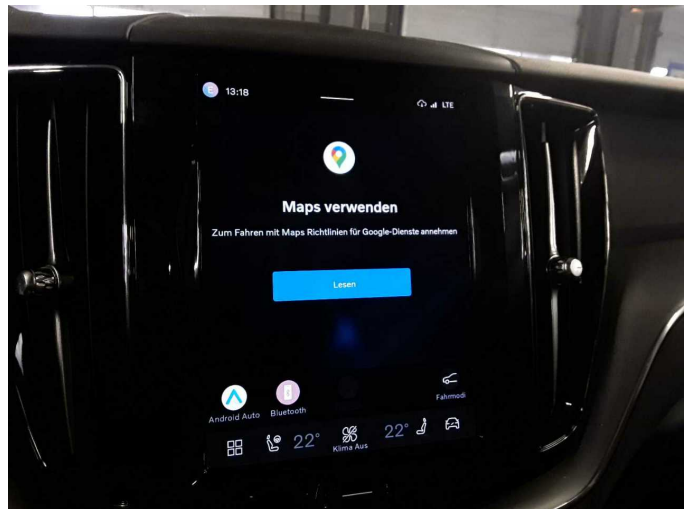


Figure 22: Navigation

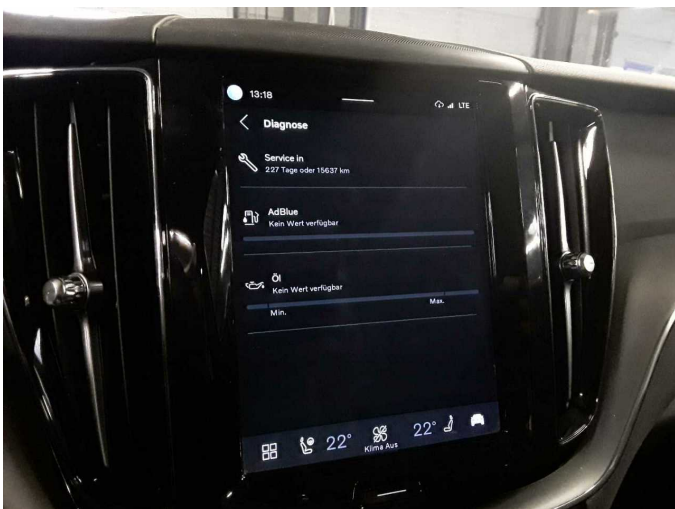


Figure 23: Misc.

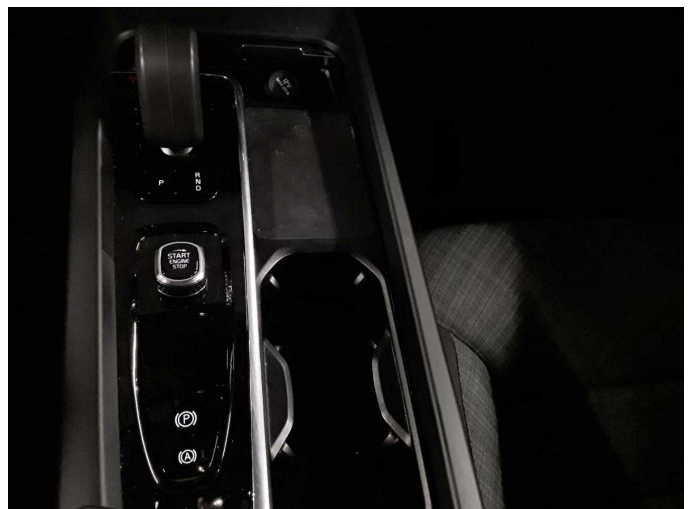


Figure 24: Misc.



Figure 25: Misc.

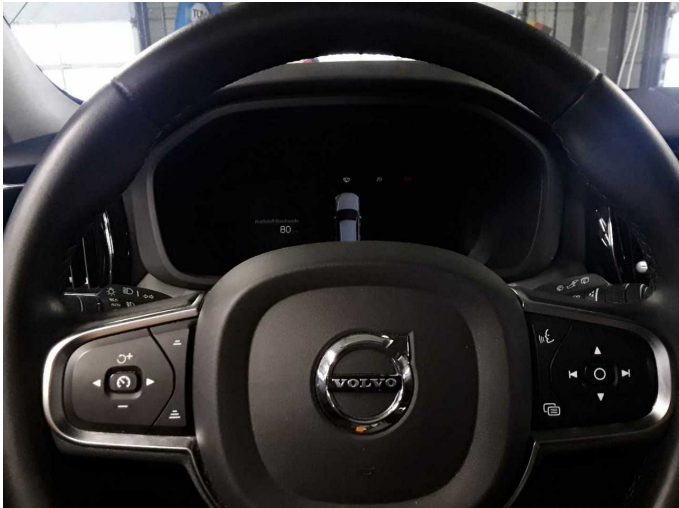


Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

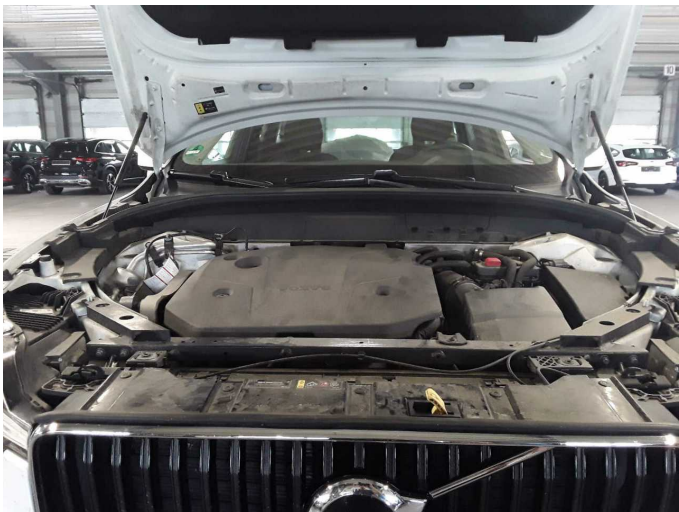


Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.




Figure 38: Misc.



Figure 39: Misc.



Damage 1: Equipment: Vehicle key with remote control - Non-operational
- Perform diagnosis

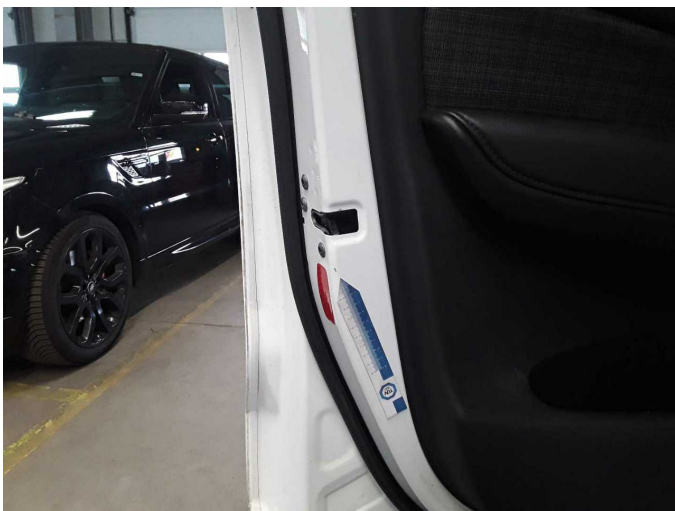

Damage 2: Door - front left side: Door - Scratched - Smart repair




Damage 2: Door - front left side: Door - Scratched - Smart repair




Damage 3: Rear bumper: Spoiler - Scratched - Smart repair



Damage 3: Rear bumper: Spoiler - Scratched - Smart repair

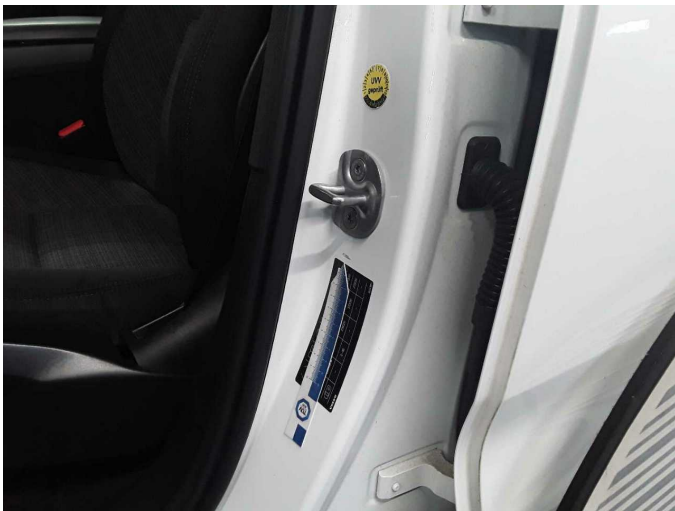

Damage 4: Body: B-pillar - left side - Scratched - Smart repair

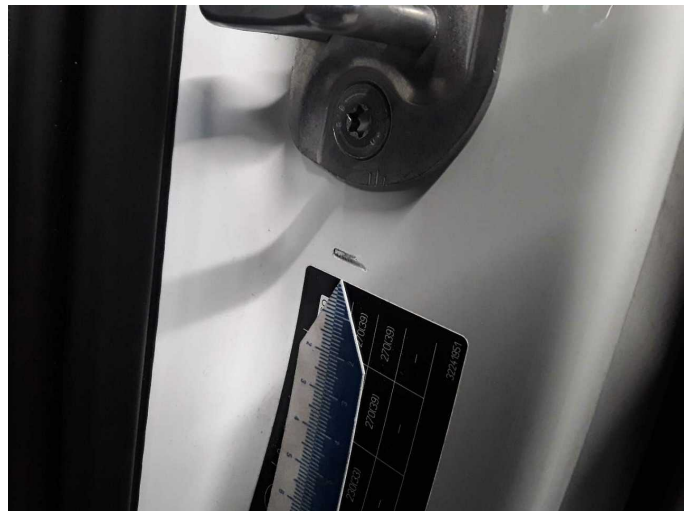

Damage 4: Body: B-pillar - left side - Scratched - Smart repair



Damage 5: 2nd wheel set: 2 tyres (3mm) - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 2 tyres (3mm) - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 2 tyres (3mm) - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 2 tyres (3mm) - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 2 tyres (3mm) - Does not meet the leasing specifications - Replace



Damage 5: 2nd wheel set: 2 tyres (3mm) - Does not meet the leasing specifications - Replace



Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Damage 6: Rear bumper: Rear bumper - Scratched - Paint



Side panel - rear right side: 299 µm



Door - front right side: 222 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1UZZK5V0P1380057
Hersteller / Modell: VOLVO VOLVO XC60 B4 D AWD Core

Datum	KM-Stand	Beschreibung
10.06.2026	138.299	Dieselpartikelfilter ern; Reparatur Sonstiges; Systemtest/Eigendiagnose
20.05.2026	135.429	Bremse Sonstiges; Bremsklötze hinten; Bremsscheiben + Klötze h; Bremsscheiben hinten; HU + AU
10.03.2026	124.197	Keilrippenriemen; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
30.06.2025	92.979	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
04.09.2024	62.090	Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Reparatur Sonstiges; Wartung Sonstiges
23.01.2024	31.319	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
31.07.2023	72.652	Wartung Sonstiges