



DS 7 CROSSBACK: [redacted]			
Vinnumber:	VR1JCYHZUMY006008	Versionname:	1.5 BlueHDi 130 Automatic Grand Chic
First Registrationdate:	1/04/2021	Fiscalpower:	
Expertise Mileage:	146764	Power Kw:	96
Bodytype:		Body colour	Black
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:		Parking lot	2113
Fueltype:	Diesel		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Registration Certificate Home (BE)	No		

Options			
Number of keys total	2	Seats electric F L	
Cruise Control		Seats electric F R	
Steering wheel multifunctional		Luggage cover	
Seats F heated		Front parking sensors	
Radio multimedia		Rear parking sensors	
Type of headlighting	Headlighting LED	Type of Tow bar	No Tow bar
Type of GPS	GPS big screen color		
Type of Lining	Lining artificial leather		
Type of climate control	Autom climate control		

Limited Technical Inspection			
Tyres			

235/50/19/103 V			
Summer tyres:	Fr.L.	Michelin: 4 mm	Fr.R. Michelin: 4 mm
	Re.L.	Michelin: 4 mm	Re.R. Michelin: 4 mm
Tyre profile depth FL			4.0
Tyre profile depth FR			4.0
Tyre profile depth RL			4.0
Tyre profile depth RR			4.0
Tyre size FL			235/50 R 19 103 V
Tyre size FR			235/50 R 19 103 V
Tyre size RL			235/50 R 19 103 V
Tyre size RR			235/50 R 19 103 V
Tyre type FL			Summer
Tyre type FR			Summer
Tyre type RL			Summer
Tyre type RR			Summer
Tyre make FL			261
Tyre make FR			261
Tyre make RL			261
Tyre make RR			261

Assistance equipment			
Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		
Total cost ex VAT			4257,97
Interior, Dirty, Cleaning			175,04



Bonnet, Chemical polution, Repair and paint (complete)	487,44
--	--------



Bumper spoiler F, Broken, Replace	81,38
-----------------------------------	-------



Alloy rim FL polished, Scratch(es), Repair and paint (complete)	204,21
---	--------



Roof pillar L, Scratch(es), Polish	0,00
------------------------------------	------



Alloy rim RL polished, Chemical polution, Acceptable	0,00
--	------



Bumper R, Scratch(es), Acceptable	0,00
-----------------------------------	------



Rear light R, Scratch(es), Replace	456,86
------------------------------------	--------




Rear window, Scratch(es), Replace	489,74
-----------------------------------	--------



Alloy rim FR polished, Chemical polution, Acceptable	0,00
--	------



Door RR, Scratch(es), Spot repair	148,33
-----------------------------------	--------

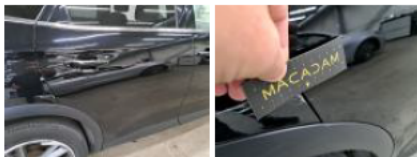


Door FR, Dent(s) and scratch(es), Repair and paint (complete)	534,95
---	--------



Wing RR, Dent(s) and scratch(es), Repair and paint (complete)	517,89
---	--------



Wing trim RR, Scratch(es), Replace	148,43
------------------------------------	--------

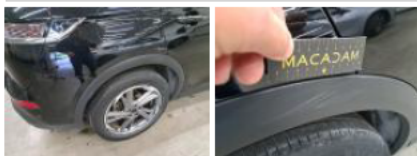

Alloy rim RR polished, Scratch(es), Acceptable	0,00
--	------



Wheel cover RR, Missing, Replace

42,77



Step R, Dent(s) and scratch(es), Repair and paint (complete)

161,81



Roof, Chemical polution, Repair and paint (complete)

809,12

