



Expertise

Protocol number: 46506893
Order No. / Reference: 26664348
Inspection date: 14 Jul 2026

Manufacturer: Opel	Model: Grandland 1.5 D Automatik Business Edition
VIN: W0VZCYHZ4N6828577	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Grandland 1.5 D Automatik Business Edition	
Vehicle Identification number	W0VZCYHZ4N6828577
Mileage (Read)	84,446 km
First registration	30 Sept 2022
Number of holders	1
Next periodical technical inspection	09/2027
(Report on hand)	
Power / Engine displacement	96 kw / 1,499 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	SUV
Colour / colour code	Jade Weiß
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black-Anthracite



Vehicle details			
Maintenance booklet / proof	Available / complete	Next maintenance in	7 Monat(e)
Last service on / at	01/2026 at 68,449 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GN180745
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	1844 / AHG 00224		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,000 kg	Empty weight	

Tyres			
Mounted tyres			
#	Tyre size	Type of tyre	Tread depth
1)	215/65 R16 103V	Summer tyres on Light alloy	4mm / 4mm
2)	215/65 R16 103V	Summer tyres on Light alloy	5mm / 5mm

Replacement			
Typ	Tyre size	Type of tyre	Tread depth
	Tirefit	Expiration date 01/2028	

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 ignition keys, both foldable
- Storage compartments
- Airbag: Front and side airbags
- Anti-lock braking system (ABS) with cornering brake control and brake assist
- Hill Start Assist
- On-board computer
- Decorative strips, Erino/Palladium Medium
- Tachometer
- Electronic brake force distribution (EBD)
- Electric windows front and rear
- Luggage compartment cover
- Transmission: 8-speed automatic
- Interior lighting, front and rear
- Child safety lock in the rear doors, manual
- Rear headrests (3), height adjustable
- LED headlights
- Steering wheel, height and reach adjustable
- Center armrest, sliding, front, including storage compartment and cup holder
- Park & Go
- Radio: Multimedia Radio
- Rain sensor
- Wheels: Light alloy 7 J x 17 with 5 double spokes, Technical Grey
- Seat belts
- Seats: Rear seat backrest split 40:60 and foldable
- Start/Stop System
- Pre-wiring for ISOFIX child seat mounting system, including top tether attachment points, rear outer
- Central locking with remote control and interior switches
- 230V equipment
- Driver and passenger side airbags
- Airbag: Head airbags, front and rear outer
- Automatic activation of the hazard warning lights
- Exterior mirrors, electrically adjustable and heated, electrically folding
- Roof design line in black
- Diesel particulate filter with SCR and oxidation catalyst
- Electric parking brake
- Electronic Stability Program Plus (ESP Plus)
- Front collision warning
- Cruise control with intelligent speed limiter
- Rear window wiper
- Interior rearview mirror, automatically dimming
- Dual-zone automatic climate control
- Front headrests, height adjustable
- Leather steering wheel including remote control
- Illuminated makeup mirror in sun visor, for driver and front passenger
- Fog light
- Quickheat heating system
- Radio accessories: Digital radio reception DAB+
- Tire pressure warning
- Wheels: Tire repair kit
- Speed-sensitive power steering
- Seats: Comfort seats, front
- Lane Assist
- 12-volt power outlet
- Immobiliser
- Tinted heat-insulating glazing

Extra equipment

- Detachable trailer hitch (trailer stability program)
- Radio: Multimedia Navi Pro (with 10" color touchscreen display and voice control for audio, telephone and navigation - Navigation: with integrated memory, European road map, 3D map display, dynamic route guidance via map and/or arrow display, GPS module - Display and readout of emails - 2 USB ports - High-gloss black shark fin antenna - Bluetooth audio streaming - Hands-free system - Smartphone integration, Apple CarPlay, Android Auto - Radio)
- Paint finish: Uni Jade White
- Safety net
- Solar Protect heat-insulating glazing (heavily tinted, in the rear)
- Winter equipment (Heated leather steering wheel - Heated seats, multi-stage, driver and front passenger - Heated ThermoTec windshield - FlexFold rear seat backrest split and foldable in a 40:60 ratio and center armrest, rear, with pass-through from the luggage compartment)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Door - front left side	Door - Scratch(es) - Smart repair
2	Cab	Insulation lining - Damaged - Replace

Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Stone chips - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction
3	Bonnet	Bonnet - Stone chips - No deduction
4	Rear bumper	Rear bumper (unpainted) - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view

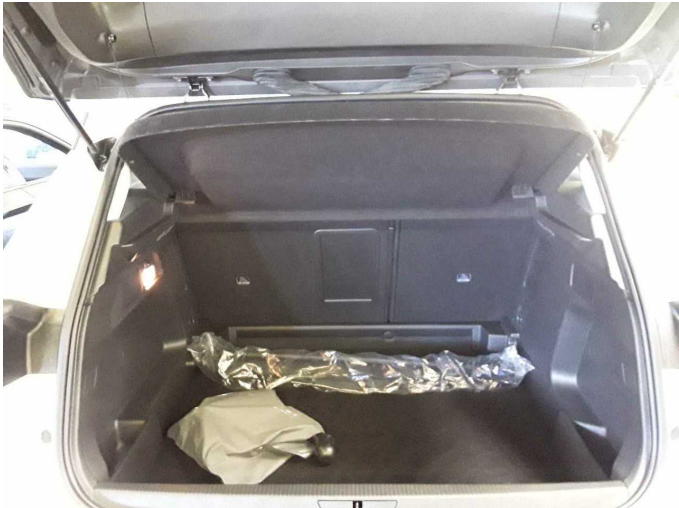


Figure 10: Cargo area

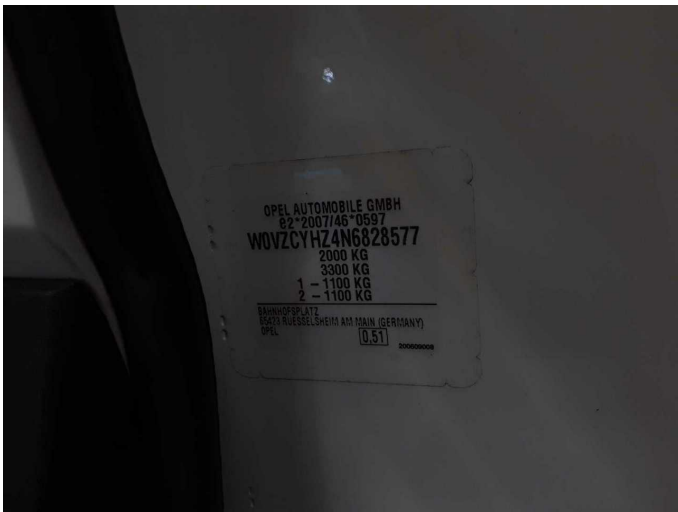


Figure 11: VIN



Figure 12: Mounted tyres

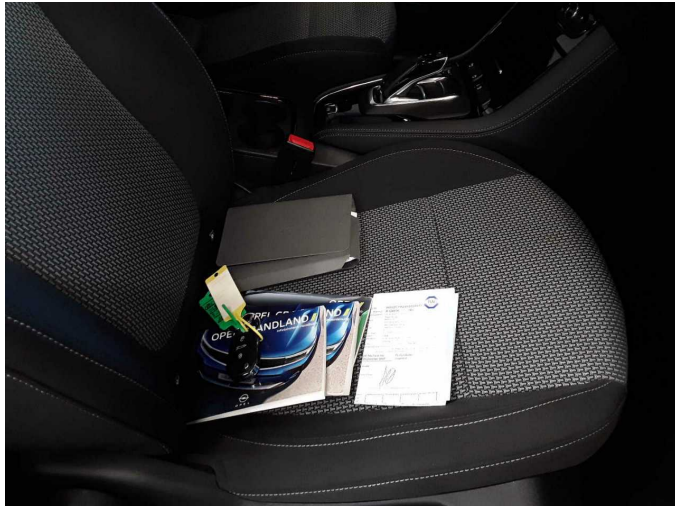


Figure 13: Documents

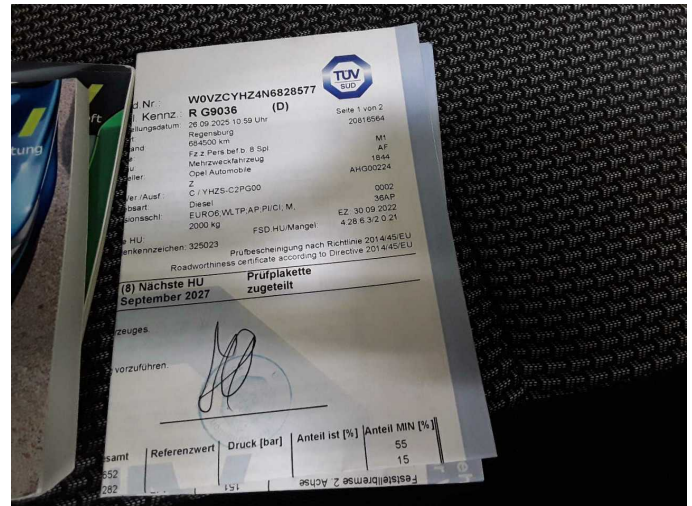


Figure 14: Documents

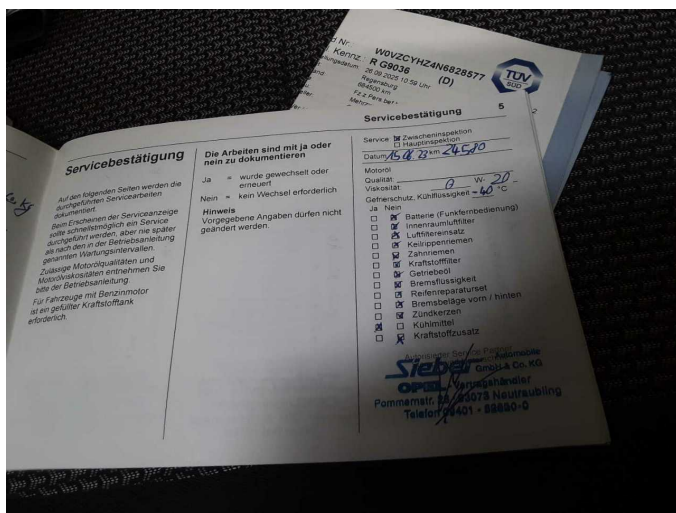


Figure 15: Documents

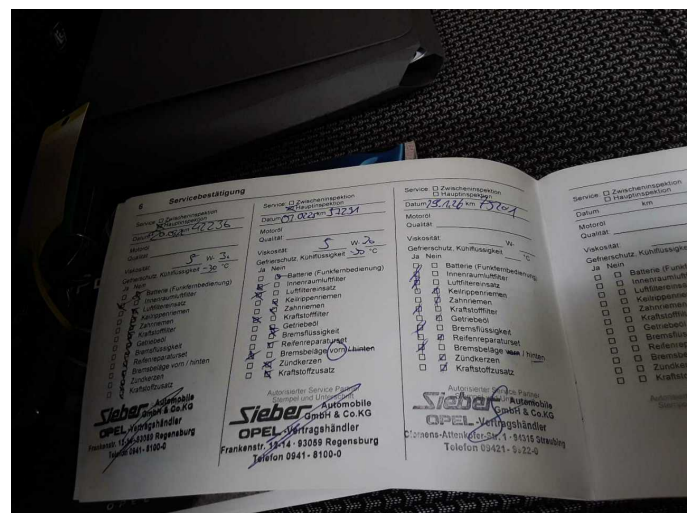


Figure 16: Documents



Figure 17: Navigation

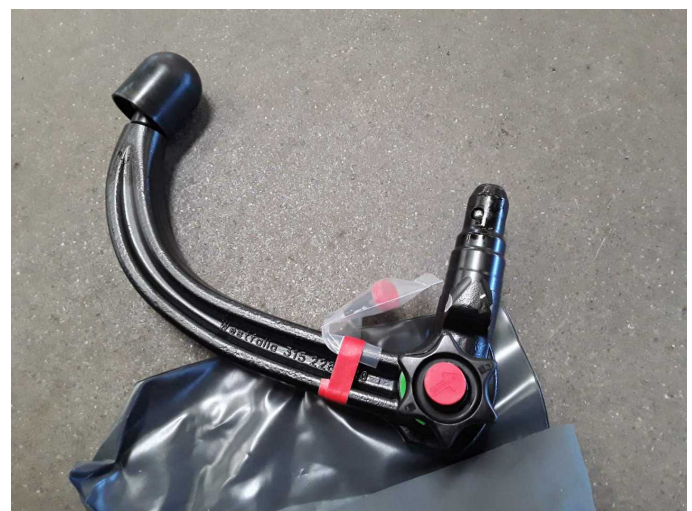


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.

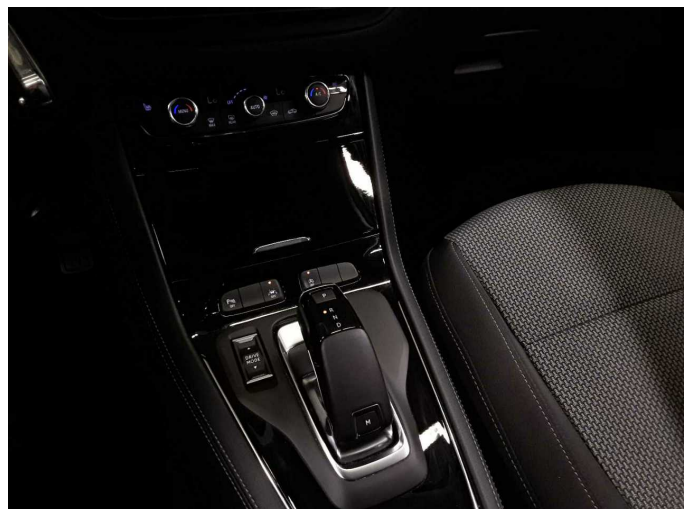


Figure 24: Misc.

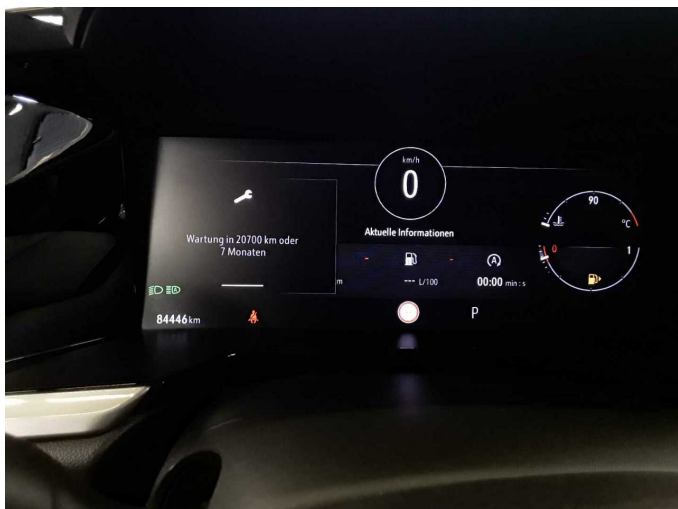


Figure 25: Misc.

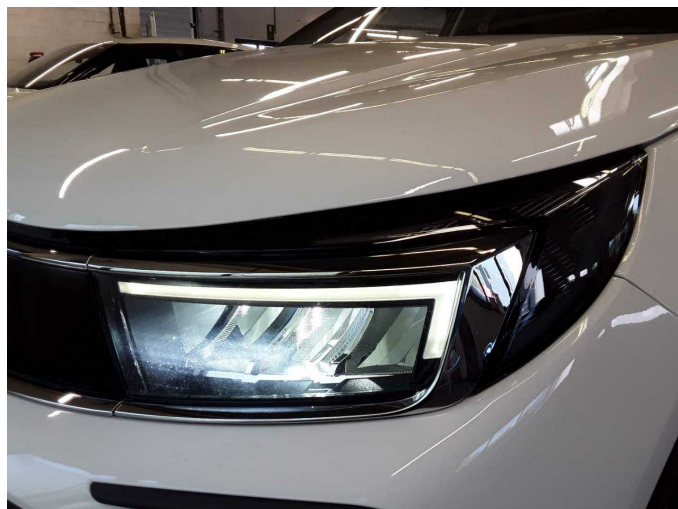


Figure 26: Misc.

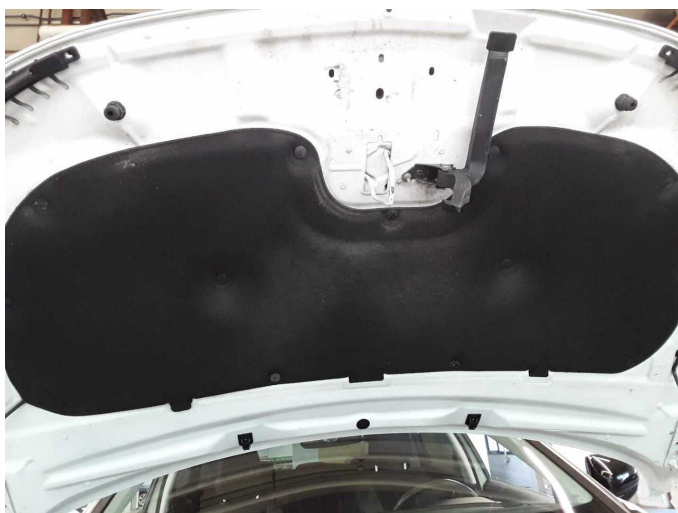


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Damage 1: Door - front left side: Door - Scratch(es) - Smart repair



Damage 1: Door - front left side: Door - Scratch(es) - Smart repair



Damage 2: Cab: Insulation lining - Damaged - Replace



Damage 2: Cab: Insulation lining - Damaged - Replace



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W0VZCYHZ4N6828577

Hersteller / Modell: OPEL OPEL Grandland 1.5 D Automatik Business Edition

Datum	KM-Stand	Beschreibung
25.03.2026	77.832	Systemtest/Eigendiagnose
30.01.2026	68.449	Bremsflüssigkeit ern; Bremsklötze hinten; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
28.11.2025	68.449	Systemtest/Eigendiagnose
27.11.2025	68.449	AU
07.02.2025	57.291	Bremsklötze vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
20.03.2024	42.236	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
29.06.2023	24.580	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges