



Expertise

Protocol number: 46650311
Order No. / Reference: 26657577
Inspection date: 21 Jul 2026

Manufacturer: Opel	Model: Insignia Sports Tourer 2.0 Diesel Aut. Ultimate
VIN: W0VZS8GP5N1037300	



Vehicle details	
Manufacturer / Type / Model / Equipment	
Opel Insignia Sports Tourer 2.0 Diesel Aut. Ultimate	
Vehicle Identification number	W0VZS8GP5N1037300
Mileage (Read)	165,459 km
First registration	7 Dec 2022
Number of holders	1
Next periodical technical inspection	01/2028
(Report on hand)	
Fuel type	Diesel
Engine displacement / Cylinder	1,995 ccm / 4
Power	128 kW
Gearbox / Number of gears	Automatic / 8
Type of drive	Front drive
Type of vehicle	Station wagon
Colour / colour code	Nautic Blau Metallic
Doors / Seats	5 / 5
Upholstery type	Alcantara / Leather
Colour of upholstery	Black
Re-import	no
readiness to drive	Roadworthy



Vehicle details

Maintenance booklet / proof	Available / incomplete	Next maintenance in	42 %
Last service on / at	07/2025 at 117,219 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ327232
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
readiness to drive	Roadworthy		
Manufacturer key number/ type code number	1844 / AMC 00298		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,215 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/35 R20 95Y	Summer tires (with run-flat tires) on Light alloy	Michelin	4mm / 6mm
2)	245/35 R20 95Y	Summer tires (with run-flat tires) on Light alloy	Michelin	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	225/55 R17 101V	Winter tyres on Light alloy	Pirelli	3mm / 3mm
2)	225/55 R17 101V	Winter tyres on Light alloy	Pirelli	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 09/2026		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- Storage compartments (storage compartment in the center console, pockets in the front doors suitable for 1.5-liter beverage bottles, pockets in the rear doors suitable for 1-liter beverage bottles, cup holder in the center console, illuminated glove compartment)
- Ambient lighting (dashboard and doors (front))
- Electrically adjustable and heated exterior mirrors for driver and passenger side (manually foldable)
- third brake light
- Diesel particulate filter
- Electronic brake force distribution (EBD)
- Chassis: FlexRide Premium chassis (Innovative chassis system with adaptive driving style recognition and three selectable driving modes: Standard, Sport (personalizable) and Tour, including: - Electronic damper control - Speed-sensitive power steering - Networking of all driving dynamics systems)
- Speed controller
- Transmission: 8-speed automatic transmission
- rear window wiper
- Child safety lock in the rear doors, manual
- Front headrests (height adjustable)
- Rear headrests (3 pieces) (height adjustable)
- Paintwork: Solid special color Snow White
- LED headlights (automatic headlight range control)
- LED fog lights
- Steering column adjustable for height and reach
- Illuminated makeup mirrors in both sun visors
- Package: Charging (Sports Tourer) (Wireless Charging (wireless charging of smartphones in the center console) - 2 USB ports, rear center console (charging function) - 12V socket, in the trunk)
- Package: Sound (Noise-reducing, laminated side windows (front) - Bose sound system)
- Electric parking brake (including 12-volt socket)
- Parkpilot, front and rear parking aid (with acoustic warning signal when parking forwards and backwards)
- Upholstery: Siena leather interior, perforated, black, including Seat Comfort Package 2 (Ergonomic active seat (AGR), driver and front passenger - Leather upholstery (seat contact surfaces in leather; 2nd row center seat, headrests, door panels and outer seat bolsters in leatherette) - Multi-stage seat heating, driver and front passenger - Rear center armrest with cupholder and pass-through from the luggage compartment - Rear seat backrest with FlexFold function, 40:20:40 split-folding - Door sill trims with OPEL lettering, front - Seat Comfort Package 2)
- Radio accessories: 2 USB ports (rear center console)
- Tire repair kit (including tire sealant and 12-volt compressor (without jack))
- Wheels: Alloy wheels 8.5 J x 20 in 5-twin-spoke design (BiColor with tires 245/35 R 20)
- Airbag: Front airbags (multi-stage) and side airbags, driver and front passenger (front and side airbags, front passenger, deactivatable)
- Airbag: Front and rear outer head airbags
- Aluminum sports pedals
- Anti-lock braking system (ABS) (with cornering brake control (CBC) and brake assist)
- Hill Start Assist
- Roof rails, silver anodized
- Tachometer
- Electronic Stability Program (ESP Plus)
- Electric windows front and rear (with one-touch function and anti-pinch protection)
- Front collision warning system with pedestrian detection and automatic emergency braking
- Pedestrian protection including active hood
- Luggage compartment cover (extendable with comfort operation)
- GS Line interior equipment (GS Line sport leather steering wheel, heated - aluminum - sport pedals - black headliner)
- Automatic climate control, two zones (with separate temperature control for driver and front passenger, including: - recirculation mode, manual - particle/activated carbon filter - automatic air distribution - sun position sensor - humidity sensor)
- LED daytime running lights including LED indicators, front and LED taillights
- Center armrest, front
- Package: Easy-Access (Keyless locking and starting system (Keyless Open & Start) - Sensor-controlled tailgate, electric - Loading sill protection, stainless steel)
- Package: Innovations 1 (IntelliLux LED Pixel Light - Adaptive LED Matrix Headlights: City Light, Highway Light, Country Road Light, Static Cornering Light, Turning Light, Parking Light, High Beam: Traffic-Dependent Dimming Taking into Account of Oncoming and Ahead Vehicles, Automatic Headlight Range Control - Traffic Sign Assist)
- Quickheat rapid heating system
- Radio: Digital radio reception DAB+
- Radio: Multimedia Navi Pro with 8" color touchscreen display (Multimedia radio, voice control for audio, telephone and navigation, navigation system with SD card storage, road map for over 30 European countries, map display in 2D and 3D, dynamic route guidance via map and/or arrow display and voice prompts, connected navigation services, predictive navigation, online map updates, real-time traffic information, 8" driver information display, 2 USB ports, steering wheel controls, Apple CarPlay and Android Auto)
- Tire pressure display (with tire pressure warning - direct system with automatic calibration after wheel change)
- Power steering (speed-dependent)
- Seat belts: Three-point seat belts in all seats (belt force limiter and belt tensioner in the front and on the outer rear seats - warning tone and light for unfastened seat belts in all seats)



- Visibility equipment (rain sensor, front interior mirror, automatically dimming, automatic dimming headlights with tunnel detection, high beam assist)
- Solar Protect heat-insulating glazing (in the rear, heavily tinted)
- Start/Stop system (reinforced starter, high-performance battery, brake energy recuperation, switch to deactivate the start/stop function)
- Bumpers painted in body color
- Traction Control (TC) Plus (traction control with engine and brake intervention)
- Immobiliser
- Central locking with remote control (and interior switches)

- Lane Keeping Assist (warning in case of unintentional lane departure (between 60 km/h and 180 km/h) via a warning light in the driver information display. The Lane Keeping Assist also alerts the driver by gently counter-steering, but does not continuously steer the vehicle.)
- Pre-installation for child seat mounting system "ISOFIX" (rear)
- Thermal insulation glazing, green tinted
- Second folding ignition key

Extra equipment

- Airbag: Side airbags, rear outer (seatbelt warning for unfastened seatbelts, rear (child seat attachment system remains activated))
- Package: Innovations 2 (Sports Tourer automatic transmission) (Head-up display, Adaptive cruise control (Generation 3), Stop & Go function, Forward collision alert with pedestrian detection and automatic emergency braking, active from 4 km/h, range 150 m. In case of collision risk, the braking system is prepared and, if necessary, emergency braking/automatic emergency braking is initiated. Lane keeping assist, keyless entry and start system, sensor-controlled electric tailgate, stainless steel loading sill protector)
- High Gloss Black Exterior Equipment (Sports Tourer) (Window trim strips in high gloss black, all around the sides - Radiator grille frame in high gloss black - Fog light surrounds in high gloss black - Roof rails in high gloss black)
- Package: Winter 3 XYDP
- Paint finish: Metallic
- Park & Go with digital reversing camera (digital reversing camera - reversing assistant - lane change assistant - blind spot warning in both exterior mirrors)
- Swiveling trailer hitch (including trailer stability program)
- Wheels: Additional set of 17" alloy winter wheels SFP

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.
readiness to drive	The vehicle was roadworthy at the time of inspection.

Value reducing factors

No.	Component group	Description
1	Wing mirror - right side	Cap - Scratch(es) - Smart repair
2	Front bumper	Spoiler - Scratch(es) - Smart repair
3	2nd wheel set	2 tyres - Worn - Replace
4	Wheel / tyres	Alloy rim - rear right side - Unprofessionally repaired - Replace
5	Wheel / tyres	Alloy rim - front right side (Sicherheitsrelevant) - Scratched - Replace
6	Rear bumper	Rear bumper - Scratch(es) - Paint



Wear and tear

No.	Component group	Description
1	Front bumper	Front bumper - Scratch(es) - No deduction
2	Bonnet	Bonnet - Stone chips - No deduction
3	Door - front right side	Door edge - Scratch(es) - No deduction
4	Side panel - rear right side	Side panel - dent(s) - No deduction
5	Boot lid / rear door	Boot lid - dent(s) - No deduction
6	Wheel / tyres	Alloy rim - rear left side - Scratch(es) - No deduction
7	Side panel - rear left side	Sill - dent(s) - No deduction
8	Body	Underbody panelling - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Paint coat thickness measurement

Roof	106 µm	Roof rail - left side	99 µm
Boot lid / rear door	85 µm	Mudguard - left side	106 µm
Mudguard - right side	104 µm	Bonnet	96 µm
Side panel - rear left side	83 µm	Side panel - rear right side	105 µm
Door - rear left side	107 µm	Door - rear right side	113 µm
Door - front left side	115 µm	Door - front right side	107 µm

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.



Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel

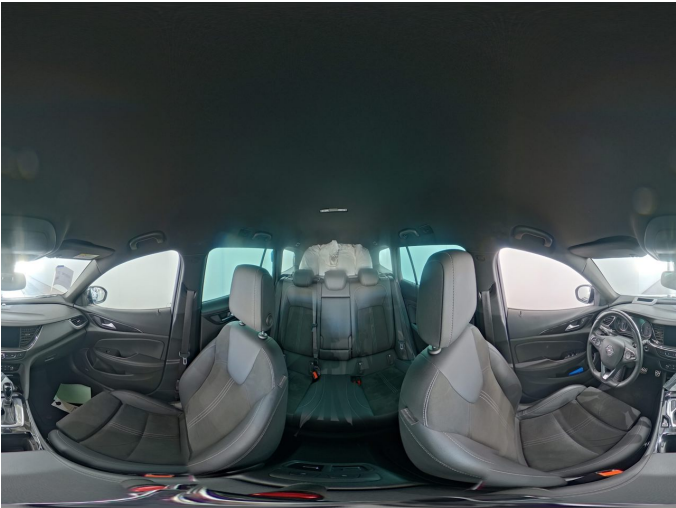


Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Additional tyres



Figure 16: Additional tyres



Figure 17: Additional tyres



Figure 18: Additional tyres



Figure 19: Additional tyres



Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.

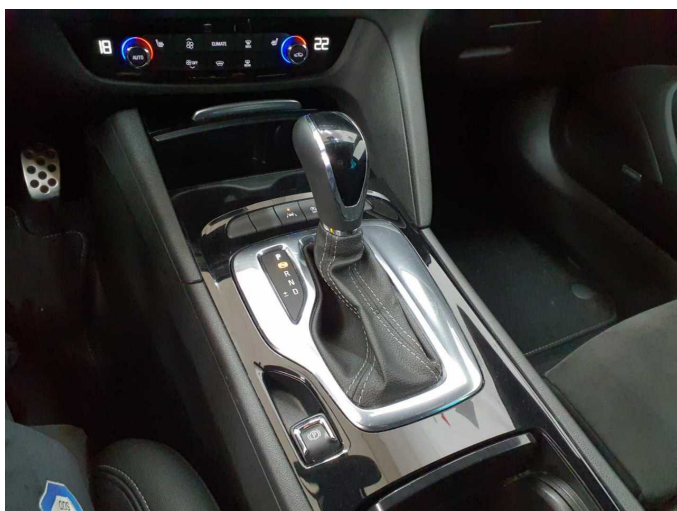


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

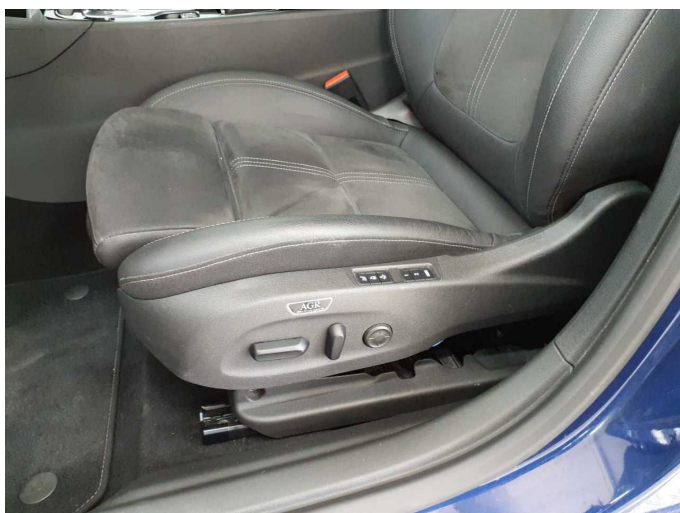


Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.

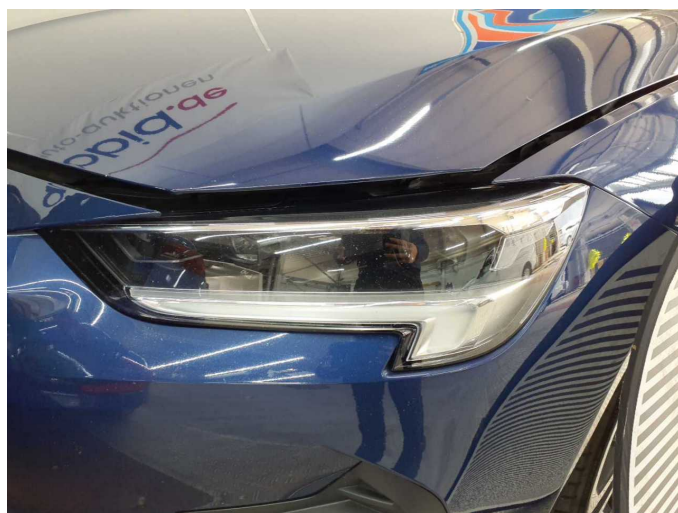


Figure 30: Misc.

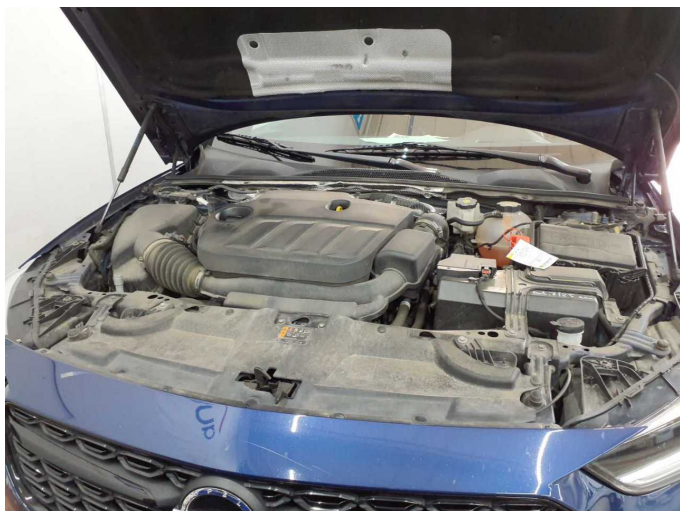


Figure 31: Misc.

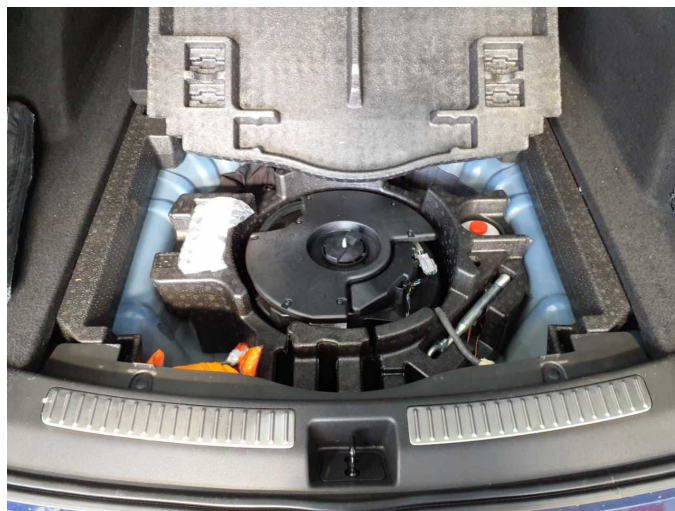


Figure 32: Misc.



Figure 33: Misc.

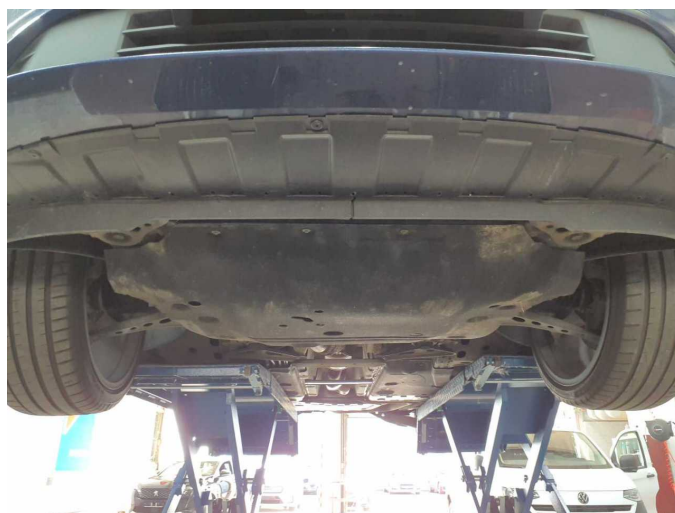


Figure 34: Misc.


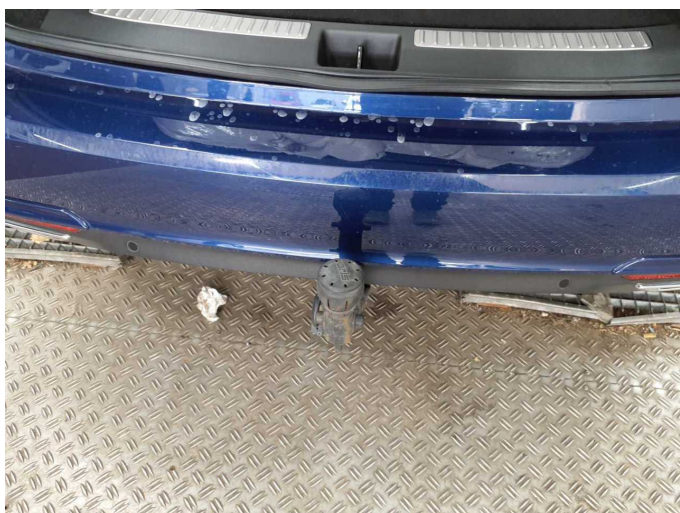



Figure 35: Misc.




Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair

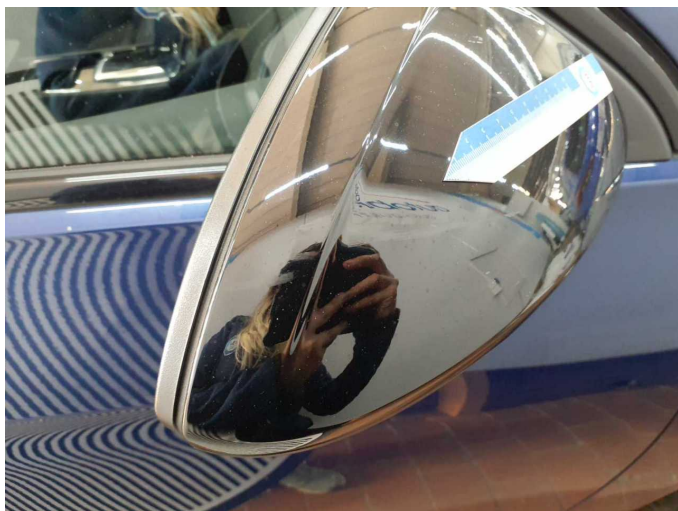

Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair

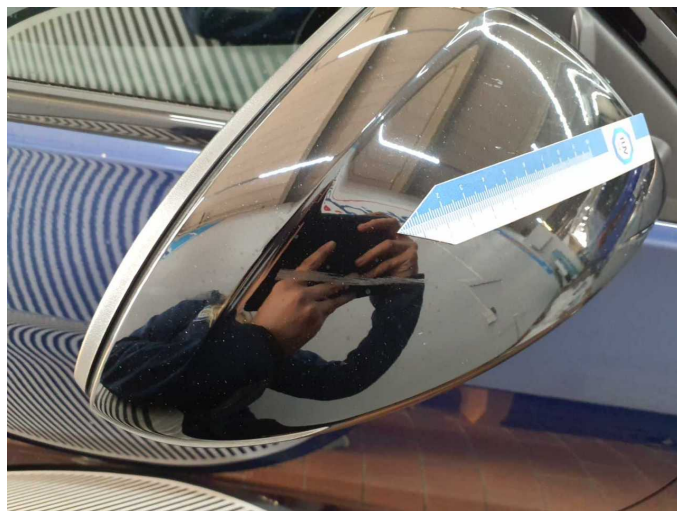

Damage 1: Wing mirror - right side: Cap - Scratch(es) - Smart repair

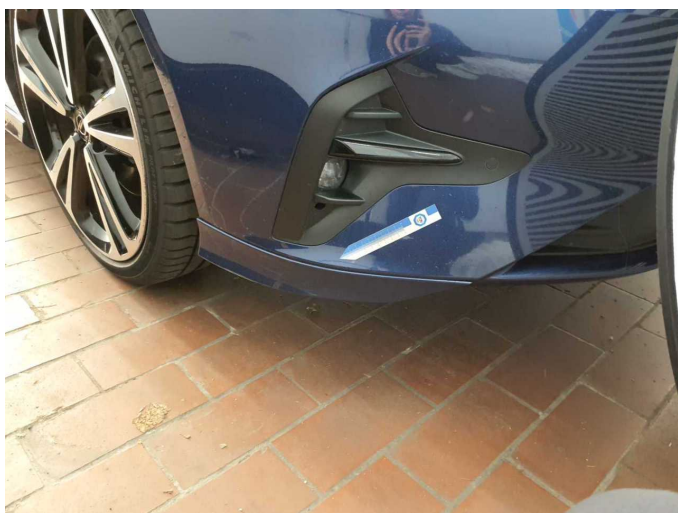

Damage 2: Front bumper: Spoiler - Scratch(es) - Smart repair



Damage 2: Front bumper: Spoiler - Scratch(es) - Smart repair




Damage 2: Front bumper: Spoiler - Scratch(es) - Smart repair



Damage 3: 2nd wheel set: 2 tyres - Worn - Replace




Damage 3: 2nd wheel set: 2 tyres - Worn - Replace

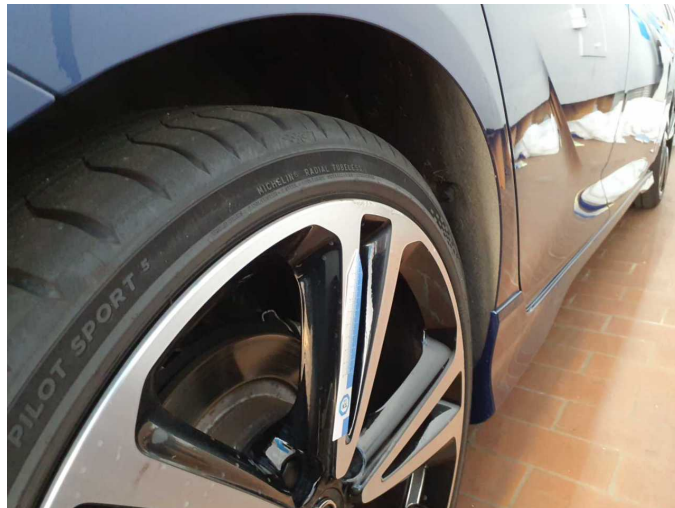

Damage 4: Wheel / tyres: Alloy rim - rear right side - Unprofessionally repaired - Replace



Damage 4: Wheel / tyres: Alloy rim - rear right side - Unprofessionally repaired - Replace

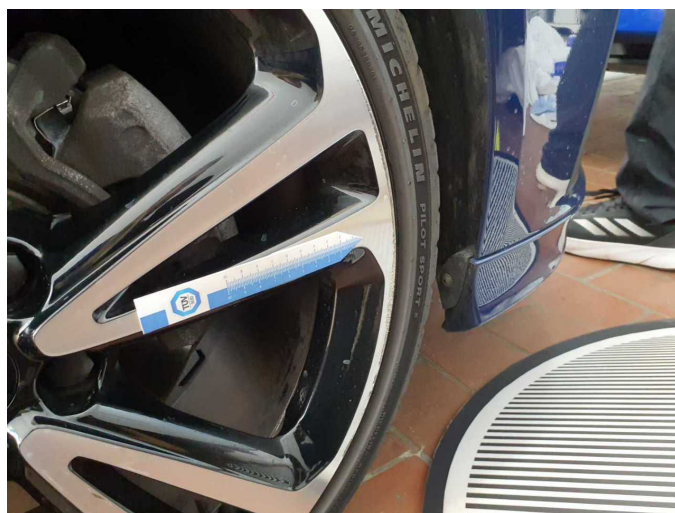

Damage 5: Wheel / tyres: Alloy rim - front right side (Sicherheitsrelevant) - Scratched - Replace




Damage 5: Wheel / tyres: Alloy rim - front right side (Sicherheitsrelevant) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side (Sicherheitsrelevant) - Scratched - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side (Sicherheitsrelevant)
- Scratched - Replace

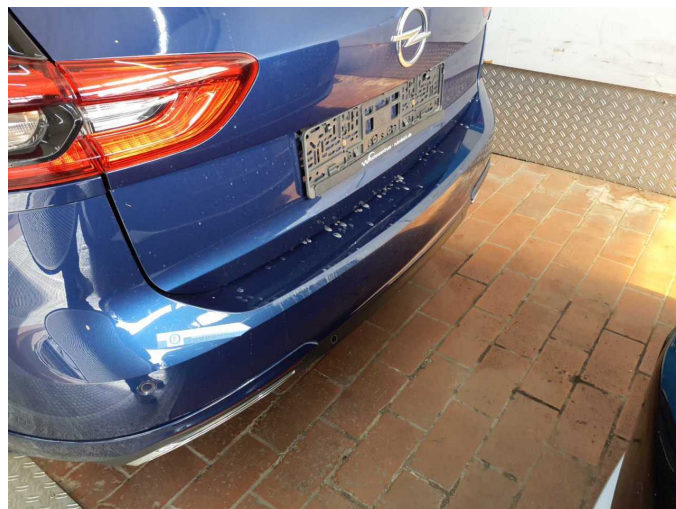


Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 6: Rear bumper: Rear bumper - Scratch(es) - Paint

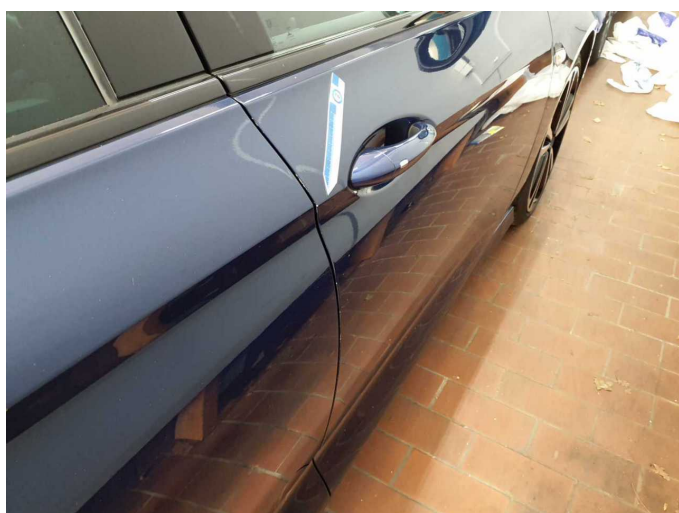

Wear and tear 3: Door - front right side: Door edge - Scratch(es) - No deduction



Wear and tear 6: Wheel / tyres: Alloy rim - rear left side - Scratch(es) - No deduction