

VSSZZZKMZNR070197

## Angaben zum Fahrzeug

|                   |                    |                          |                              |
|-------------------|--------------------|--------------------------|------------------------------|
| Halter            |                    | Besichtigungszustand     | bedingt: Licht/Nässe/Schmutz |
| Kennzeichen       |                    | Laufleistung (abgelesen) | 56.122 km                    |
| Hersteller        | CUPRA              | Restlauf bis Service     | 179 Tag(e)                   |
| Typ/Modell        | FORMENTOR          | HU (Bericht lag vor)     | 06/2027                      |
| Fahrgestellnummer | VSSZZZKMZNR070197  | Leistung / Hubraum       | 228 kW / 1.984 ccm           |
| Erstzulassung     | 13.06.2022         | Polster/Farbe            | Leder / Anthrazit            |
| Letzte Wartung    | 10/2025, 49.757 km | Lackierung               | Grau                         |
| Kraftstoffart     | Benzin             | Getriebe                 | Automatik                    |

## Zustandsbericht

### Wertmindernde Faktoren

| Nr. | Bauteilgruppe | Beschreibung                                                                       |
|-----|---------------|------------------------------------------------------------------------------------|
| 1   | Rad/Reifen    | Leichtmetallfelge vorn links (Materialabrieb) - verkratzt / verschürft - erneuern  |
| 2   | Rad/Reifen    | Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern |

### Gebrauchsspuren

| Nr. | Bauteilgruppe | Beschreibung                                          |
|-----|---------------|-------------------------------------------------------|
| 1   | Rad/Reifen    | Leichtmetallfelge hinten links - Kratzer - kein Abzug |

### Fehlteile

| Fehlteil |
|----------|
|----------|

### Festgestellte Nachlackierungen

| Nr. | Ort                                                   |
|-----|-------------------------------------------------------|
| 1   | Kotflügel links, Stoßfänger hinten, Tür hinten rechts |

### Hauptbereifung

| Achse | Reifengröße    | Hersteller  | Reifentyp    | Profiltiefe | Verktgl. | Zul. |
|-------|----------------|-------------|--------------|-------------|----------|------|
| 1     | 245/40 R19 94W | Bridgestone | Sommerreifen | 5mm - 5mm   | i.O.     | i.O. |
| 2     | 245/40 R19 94W | Bridgestone | Sommerreifen | 4mm - 4mm   | i.O.     | i.O. |

### Ersatz

| Typ    | Reifengröße    | Hersteller | Reifentyp    | Profiltiefe | Ablaufdatum |
|--------|----------------|------------|--------------|-------------|-------------|
| Notrad | 125/70 R18 99M | Sonstige   | Sommerreifen | 4           |             |

Der Verschleißzustand sowie evtl. Schäden an der Bereifung sind wertmäßig berücksichtigt.



## Angaben zum Fahrzeug

|                          |                   |                                 |                              |
|--------------------------|-------------------|---------------------------------|------------------------------|
| <b>Hersteller</b>        | CUPRA             | <b>Besichtigungszustand</b>     | bedingt: Licht/Nässe/Schmutz |
| <b>Typ/Modell</b>        | FORMENTOR         | <b>Laufleistung (abgelesen)</b> | 56.122 km                    |
| <b>Fahrgestellnummer</b> | VSSZZZKMZNR070197 | <b>Erstzulassung</b>            | 13.06.2022                   |

### Angaben zum Auftrag:

Auftragsgemäß erfolgte die Fahrzeugzustandsbewertung in demontagefreien Zustand.

Grundlage dieses Produktes stellt der Leitfaden für Fahrzeugrücknahmen und Bewertungen gemäß des Schadengrenzmusterkatalog des Auftraggebers dar. Die expliziten Feststellungen im Einzelfall trifft der Sachverständige objektiv im Rahmen der vorgegebenen Standards aufgrund eigener Sachkunde.

### Fahrzeug-Identifizierung:

Die Fahrzeug-Identifizierungsnummer (FIN) wurde am Fahrzeug abgelesen und die Übereinstimmung im Verlauf der Besichtigung durch den Unterzeichner mit den vorgelegten Unterlagen festgestellt.

### Besichtigungsbedingungen:

Eine ordnungsgemäße Sichtprüfung der Lackierung und der Karosserie war wegen unzureichender Lichtverhältnisse/ Nässe oder Verschmutzung nur eingeschränkt möglich.

### Allgemeinzustand:

Das Fahrzeug weist dem Alter und Einsatzzweck entsprechende Gebrauchsspuren auf.

Unterschrift Sachverständiger (Markus Böttcher)

Vorliegendes Druckexemplar wurde auf elektronischem Wege erzeugt. Der benannte Sachverständige versichert, dass der Inhalt die von ihm getroffenen Feststellungen korrekt wiedergibt. Es ist ohne Originalunterschrift gültig.

## Übersichtsfotos



**Abbildung 1:** FIN



**Abbildung 2:** Schräg vorne



**Abbildung 3:** Schräg vorne




**Abbildung 4:** Schräg hinten



**Abbildung 5:** Schräg hinten



**Abbildung 6:** Montierte Bereifung

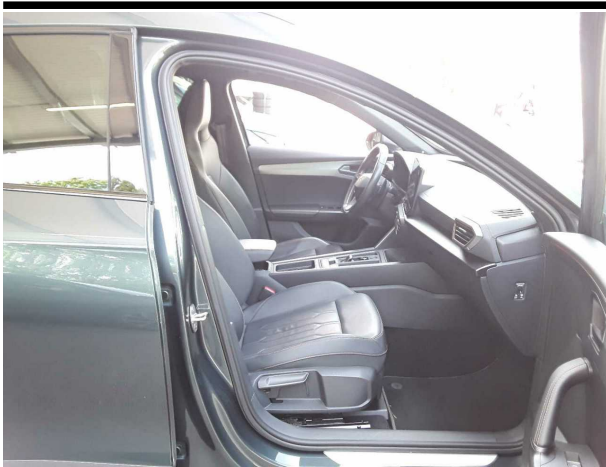

**Abbildung 7:** Innenraum vorne



**Abbildung 8:** Laderaum



**Abbildung 9:** Kombiinstrument



**Abbildung 10:** Kombiinstrument



**Abbildung 11:** Instrumententafel




**Abbildung 12:** Instrumententafel

**TÜV SÜD Auto Partner GmbH**  
Wiesenring 2  
04159 Leipzig

**Besichtigungsort**  
MVI Oberschleißheim  
Mittenheimer Straße 64  
85764 Oberschleißheim

**Besichtigungsdatum:** 23.06.2026  
**Protokollnummer:** 46157717  
**Erstellt durch:** Markus Böttcher  
**Besichtigt durch:** Baumgartner

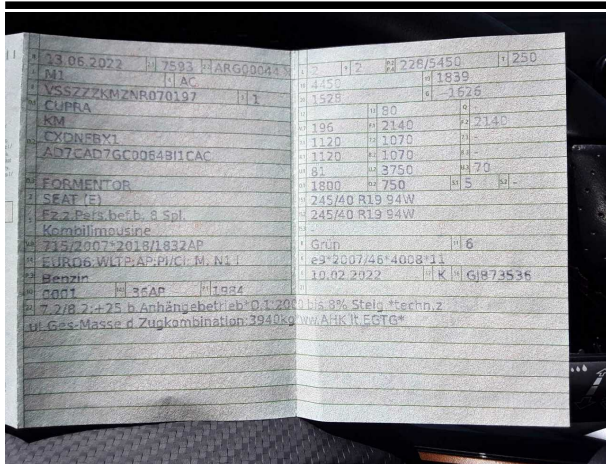

**Abbildung 13: Dokumente**



**Abbildung 14: Dokumente**



**Abbildung 15: Sonstiges**

## Beschädigungsfotos



**Beschädigung #1:** Rad/Reifen: Leichtmetallfelge vorn links (Materialabrieb) - verkratzt / verschürft - erneuern



**Beschädigung #1:** Rad/Reifen: Leichtmetallfelge vorn links (Materialabrieb) - verkratzt / verschürft - erneuern



**Beschädigung #2:** Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern



**Beschädigung #1:** Rad/Reifen: Leichtmetallfelge vorn links (Materialabrieb) - verkratzt / verschürft - erneuern



**Beschädigung #1:** Rad/Reifen: Leichtmetallfelge vorn links (Materialabrieb) - verkratzt / verschürft - erneuern



**Beschädigung #2:** Rad/Reifen: Leichtmetallfelge vorn rechts (Materialabrieb) - verkratzt / verschürft - erneuern



**Beschädigung #2:** Rad/Reifen: Leichtmetallfelge vorn rechts  
(Materialabrieb) - verkratzt / verschürft - erneuern



**Beschädigung #2:** Rad/Reifen: Leichtmetallfelge vorn rechts  
(Materialabrieb) - verkratzt / verschürft - erneuern

## Nachlackierungsfotos



**Nachlackierung 1:** Kotflügel links, Stoßfänger hinten, Tür hinten rechts

EC Certificate of Conformity

046CC0126517



www.PS-Team.de

Complete vehicles

The undersigned hereby certify that the vehicle:

- 0.1.

Make (Trade name of manufacturer):

CUPRA
- 0.2.

Type:

KM
- 0.3.

Variant:

CXDNFBX1
- 0.4.

Version:

AD7CAD7GC0064B11CAC
- 0.5.

Commercial name:

FORMENTOR
- 0.6.

Interpolation family's identifier:

IP-MQB37WZ\_A0\_0862-VSS-1
- 0.7.

ATCT family's identifier:

AT-5Q0\_OV\_0258\_000-VSS-1
- 0.8.

PEMS family's identifier:

09-VSS-715W\_KM\_DNFB\_AD7\_A-000
- 0.9.

Roadload family's identifier:

RL-DQ381\_7A\_19\_002-WVW-1
- 0.10.

Roadload matrix family's identifier (if applicable):

-----
- 0.11.

Periodic regeneration family's identifier:

PR-AU\_00109\_00\_000-WVW-1
- 0.12.

Evaporative test family's identifier:

EV-A1\_DGW\_D\_AYAAXX-WVW-1
- 0.13.

Vehicle category:

M1
- 0.14.

Company name and address of manufacturer:

SEAT, S.A.  
Autovia A-2, Km. 585  
ES-08760 Martorell

- 0.15.

Location and method of attachment of the statutory plates:

On the right A-pillar, glued or bonded
- 0.16.

Location of the vehicle identification number:

In the engine compartment, right
- 0.17.

Vehicle identification number:

VSSZZZKMZNR070197
- 0.18.

Date of manufacture of the vehicle:

2022-04-28

conforms in all respects to the type described in approval e9\*2007/46\*4008\*11 issued on 2022-02-10 and can be permanently registered in Member States having right hand traffic and using metric units for the speedometer and metric units for the odometer.

Martorell, 2022-04-28

Martorell, 2022-04-28

Daniel Cortina Munuera  
Director Quality Assurance

Robin Christoph Bräutigam  
Head of Technical Conformity

Internal Manufacturer Data

VSSZZZKMZNR070197



49. CO<sub>2</sub> emissions/fuel consumption/electric energy consumption:

1. All power trains except pure electric vehicles (if applicable):

| NEDC values            | CO <sub>2</sub> emissions |                |             | Fuel consumption [l/100 km] |                                 |            |
|------------------------|---------------------------|----------------|-------------|-----------------------------|---------------------------------|------------|
|                        | Petrol/Diesel g/km        | LPG / CNG g/km | Others g/km | Petrol/Diesel [L]           | LPG / CNG [L]/[m <sup>3</sup> ] | Others [L] |
| Urban conditions       | 219                       | -----          | -----       | 9.6                         | -----                           | -----      |
| Extra-urban conditions | 150                       | -----          | -----       | 6.5                         | -----                           | -----      |
| Combined               | 175                       | -----          | -----       | 7.7                         | -----                           | -----      |
| Weighted, combined     | -----                     | -----          | -----       | -----                       | -----                           | -----      |

Deviation factor (if applicable):

Verification factor (if applicable):

2. Pure electric vehicles and OVC hybrid electric vehicles (if applicable)

Electric energy consumption (weighted, combined): [Wh/km]

Electric range: [km]

3. Vehicle fitted with eco-innovation(s):

3.1. General code of the eco-innovation(s):

3.2. Total CO<sub>2</sub> emissions savings due to the eco-innovation(s):

3.2.1. NEDC savings (if applicable)

Diesel / Petrol

LPG / NG [g/km]

Others [g/km]

3.2.2. WLTP savings (if applicable)

Diesel / Petrol

LPG / NG [g/km]

Others [g/km]

4. All power trains, except pure electric vehicles (if applicable)

| WLTP values        | CO <sub>2</sub> emissions |                | Fuel consumption: [l/100 km] |                   |                                 |            |
|--------------------|---------------------------|----------------|------------------------------|-------------------|---------------------------------|------------|
|                    | Petrol/Diesel g/km        | LPG / CNG g/km | Others g/km                  | Petrol/Diesel [L] | LPG / CNG [L]/[m <sup>3</sup> ] | Others [L] |
| Low                | 284                       | ----           | ----                         | 12.6              | ----                            | ----       |
| Medium             | 192                       | ----           | ----                         | 8.5               | ----                            | ----       |
| High               | 168                       | ----           | ----                         | 7.5               | ----                            | ----       |
| Extra High         | 190                       | ----           | ----                         | 8.4               | ----                            | ----       |
| Combined           | 196                       | ----           | ----                         | 8.7               | ----                            | ----       |
| Weighted, combined | ----                      | ----           | ----                         | ----              | ----                            | ----       |

5.1. Pure electric vehicles (if applicable)

Electric energy consumption

[Wh/km]:

Electric range [km]:

Electric range city [km]:

Electric range city (EAER) [km]:

Electric range city (EAER city) [km]:

For special purpose vehicles:

Designation in accordance with Annex II, Section 5:

52. Remarks:

NO 16.2.: with trailer axle 2: +25 kg##NO

35.: alt. to pos 35 with deviating val. in pos 49:##245/40 R19 94W#8,0JX19 ET40

##245/40 R19 98Y#8,0JX19 ET40,##225/50 R18 95W M+S#8,0JX18 ET40,##245/45 R18 96

W M+S#8,0JX18 ET40:##

|       |                                                                                  |                              |
|-------|----------------------------------------------------------------------------------|------------------------------|
| 1.    | Number of axles / wheels:                                                        | 2 / 4                        |
| 3.    | Powered axles (number, position):<br>Interconnection of powered axles:           | 2 Axle 1/2<br>cardan shaft   |
| 3.1.  | Specify if the vehicle is non-automated/automated/fully automated:               | non-automated                |
| 4.    | Wheelbase[mm]:                                                                   | 2679                         |
| 4.1.  | Axle spacing [mm]:                                                               | 2679                         |
| 5.    | Length [mm]:                                                                     | 4450                         |
| 6.    | Width [mm]:                                                                      | 1839                         |
| 7.    | Height [mm]:                                                                     | 1528                         |
| 13.   | Mass in running order [kg]:                                                      | 1626                         |
| 13.2. | Actual mass of the vehicle [kg]:                                                 | 1718                         |
| 16.   | Technically permissible maximum masses:                                          |                              |
| 16.1. | Technically permissible maximum laden mass [kg]:                                 | 2140                         |
| 16.2. | Technically permissible mass on each axle (1./2.) [kg]:                          | 1120 / 1070                  |
| 16.4. | Technically permissible maximum mass of the combination [kg]:                    | 3940                         |
| 18.   | Technically permissible maximum towable mass in case of:                         |                              |
| 18.1. | Drawbar trailer [kg]:                                                            | -----                        |
| 18.3. | Centre-axle trailer [kg]:                                                        | 1800                         |
| 18.4. | Unbraked trailer [kg]:                                                           | 750                          |
| 19.   | Technically permissible maximum static vertical mass at the coupling point [kg]: | 80                           |
| 20.   | Manufacturer of the engine:                                                      | Audi AG                      |
| 21.   | Engine code as marked on the engine:                                             | DNF                          |
| 22.   | Working principle:                                                               | Positive ignition / 4 stroke |
| 23.   | Pure electric:                                                                   | no                           |
| 23.1. | Class of Hybrid (electric) vehicle:                                              | -----                        |
| 24.   | Number and arrangement of cylinders:                                             | 4; in Line                   |
| 25.   | Engine capacity [cm³]:                                                           | 1984                         |
| 26.   | Fuel:                                                                            | petrol                       |
| 26.1. | Mono fuel/Bi fuel/Flex fuel/Dual fuel:                                           | mono fuel vehicle            |
| 26.2. | Type of dual fuel engine:                                                        | -----                        |
| 27.   | Maximum power                                                                    |                              |
| 27.1. | Maximum net power [kW at min⁻¹] (internal combustion engine):                    | 228.00 / 5450                |
| 27.2. | Maximum hourly output [kW] (electric motor):                                     | -----                        |
| 27.3. | Maximum net power [kW] (electric motor):                                         | -----                        |
| 27.4. | Maximum 30 minutes power [kW] (electric motor):                                  | -----                        |

|         |                    |           |
|---------|--------------------|-----------|
| 28.     | Gearbox (type):    | automatic |
| 28.1.   | Gear               | -----     |
| 28.1.   | Gearbox ratios:    | -----     |
| 28.1.2. | Final drive ratio: | -----     |
| 28.1.2. | Total gear ratios: | -----     |

Maximum speed [km/h]: 250

Axle(s) track (1./2.) [mm]: 1585 / 1559

Fitted tyre/wheel combination/energy/efficiency class of RRC/type category used for CO<sub>2</sub> determination:

Axle 1: 245/40 R19 94W / 8.0JX19 ET40 / C / C1

Axle 2: 245/40 R19 94W / 8.0JX19 ET40 / C / C1

Trailer brake connections: -----

Code for bodywork: AC

Colour of vehicle: GREEN

Number and configuration of doors: 5 / ie. 2; ii. 2; ba. 1

Number of seating positions (including the driver): 5

Seat(s) designated for use only when the vehicle is stationary: ---

Number of wheelchair user accessible position: ---

Sound level

Stationary [dB(A) at min⁻¹]: 81.00 / 3750

Drive-by [dB(A)]: 70.00

Exhaust emission level: EURO 6 AP

Parameters for emission testing of Vind:

Test mass [kg]: 1797

Frontal area [m²]: -----

|                        |                 |                        |                          |
|------------------------|-----------------|------------------------|--------------------------|
| Road load coefficients | 47.1.3.0.10 [N] | 47.1.3.1.11 [N/(km/h)] | 47.1.3.2.12: [N/(km/h)²] |
|                        | 188.548685      | 0.115000               | 0.042494                 |

Driving cycle: 3b

Driving cycle class: -----

Downscaling factor (f<sub>acc</sub>): -----

Capped speed: no

Exhaust emissions: 715/2007\*2018/1832AP

1.2. Test procedure: Type 1 (NEDC average values, WLTP highest values) [mg/km] or WHSC (EURO VI)

| Petrol / Diesel | CO    | THC   | NMHC  | NO <sub>x</sub> | THC + NO <sub>x</sub> | NH <sub>3</sub> | Particles | Particles # |
|-----------------|-------|-------|-------|-----------------|-----------------------|-----------------|-----------|-------------|
| Diesel          | 398.3 | 36.3  | 30.6  | 11.9            | -----                 | -----           | 0.2100    | 0.18E11     |
| LPG/CNG         | ----- | ----- | ----- | -----           | -----                 | -----           | -----     | ---         |
| Other           | ----- | ----- | ----- | -----           | -----                 | -----           | -----     | ---         |

2.2. Test procedure: WHTC (EURO VI) [mg/km]

| Petrol / Diesel | CO    | THC   | NMHC  | CH <sub>4</sub> | NO <sub>x</sub> | NH <sub>3</sub> | Particles | Particles # |
|-----------------|-------|-------|-------|-----------------|-----------------|-----------------|-----------|-------------|
| Diesel          | ----- | ----- | ----- | -----           | -----           | -----           | -----     | ---         |
| LPG/CNG         | ----- | ----- | ----- | -----           | -----           | -----           | -----     | ---         |
| Other           | ----- | ----- | ----- | -----           | -----           | -----           | -----     | ---         |

Smoke corrected absorption coefficient [m⁻¹]: -----

Declared maximum RDE values (if NO<sub>x</sub> [mg/km] Particles (number) with exponent (#/km)

Complete RDE trip: 60.0 6.00 E11

Urban RDE trip: 60.0 6.00 E11

# MOBILITY CONCEPT

|                     |                                                           |
|---------------------|-----------------------------------------------------------|
| LVV Nr              | 4288254                                                   |
| Hersteller          | Cupra                                                     |
| Model               | Formentor                                                 |
| Variante            | DE - SUV5 2.0 TSI EU6d, VZ 4Drive, 2020 - 2024 2.0 TSI VZ |
| Listenpreis         | 44.726,90                                                 |
| VIN                 | VSSZZZKMZNR070197                                         |
| Erstzulassungsdatum | 13.6.2022                                                 |
| Kennzeichen         | M-GZ 1687                                                 |

Schadensfälle der int. Belegnummer: 4288254 10.07.2026

| Schadennummer | Unfalldatum | Beschädigung                                                            | Schadenhöhe<br>in EUR |
|---------------|-------------|-------------------------------------------------------------------------|-----------------------|
| 2022110233    | 20.09.2022  | Windschutzscheibe gerissen                                              | 881,81                |
| 2025114016    | 15.09.2025  | Fahrerseite Kotflügel vorne  Scheinwerfer links  Stoßfänger vorne links | 7.193,51              |