



Expertise

Protocol number: 46888966
Order No. / Reference: 26708676
Inspection date: 5 Aug 2026

Manufacturer: Volkswagen

Model: Touran 2.0 TDI SCR DSG Highline

VIN: WVGZZZ1TZNW011702



Vehicle details

Manufacturer / Type / Model / Equipment

Volkswagen Touran 2.0 TDI SCR DSG Highline

Vehicle Identification number	WVGZZZ1TZNW011702
Mileage (Read)	171,027 km
First registration	9 Jun 2022
Number of holders	1
Next periodical technical inspection	06/2027
(Report on hand)	

Fuel type	Diesel
Engine displacement / Cylinder	1,968 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Atlantic Blue Metallic (C5B)
Doors / Seats	5 / 7
Upholstery type	Alcantara / cloth
Colour of upholstery	Black-Anthracite



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	10,200 km
Last service on / at	02/2026 at 151,460 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GJ172425
Previous damage / Accident	Detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / BWS 00717		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	2,230 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 94V	Summer tyres on Light alloy	Continental	3mm / 4mm
2)	215/55 R17 94V	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	2mm / 2mm
2)	205/60 R16 96H	Winter tyres on Light alloy	Pirelli	4mm / 3mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- 2 USB-C ports on the front
- Storage compartments in the overhead console
- Airbag, head airbag system for front and rear passengers
- Electrically adjustable and heated exterior mirrors
- third brake light
- Headliner in Storm Grey
- Decorative inlays "Piano Black"
- Tachometer
- Electronic parking brake including auto-hold function
- Windscreen in heat-insulating glass
- Baggage management package
- Additional luggage compartment lighting
- Speed limiter
- Glove compartment with cooling option
- Rear window wiper with intermittent function
- ISOFIX mounting points on rear seats
- Air conditioning system "Air Care Climatronic"
- Front headrests
- Paint finish: Solid
- Steering wheel: Multifunction steering wheel in leather, with paddle shifters
- "Premium" multifunction display with multicolor screen
- Fog lights and cornering lights
- Emergency braking assistant "Front Assist"
- Package: Ambient lighting
- Upholstery: Cloth
- Radio
- Radio accessories: 8 speakers
- Tire pressure monitoring system (passive)
- Wheels: Tire Mobility Set omitted
- Automatically heated front windshield washer nozzles
- Drawers under the front seats
- Seat belts: 3 three-point automatic seat belts in the rear
- Seats: Front passenger seat backrest folds down completely
- Seats: Top comfort seats in the front
- Start-stop system
- Bumpers in body color
- First aid kit, warning triangle and high-visibility vest
- Prepared for later activation: Discover Media navigation function incl. streaming & internet
- Electronic immobilizer
- Green thermal insulation glazing
- Storage compartment with lid on the instrument panel
- Airbag for driver and front passenger
- Airbag: Side airbags for the outer rear seats
- Exterior mirror housings and door handles in body color
- Chrome trim on the side windows
- Roof rails, silver anodized
- Diesel particulate filter
- Parking assistance
- Electronic Stability Program (ESP) with counter-steering support
- luggage compartment cover
- Height-adjustable luggage compartment floor
- Transmission: 7-speed DSG
- Rear window heated
- Interior lights with delayed shut-off and dimming function, 2 reading lights front and rear
- Headrests (3) in the 2nd row of seats
- Black radiator grille with chrome strips on the slats
- LED headlights
- Illuminated makeup mirrors in the sun visors
- front center armrest
- Fatigue detection
- Non-smoking version
- Emergency call service
- Package: Winter Package
- Proactive occupant protection system in conjunction with "Front Assist"
- Radio accessories: Digital radio reception DAB+
- Wheels: 4 light alloy wheels 6.5 J x 17 "Alexandria"
- Gearshift knob in leather
- Headlight cleaning system
- electromechanical power steering
- Seats: 3 individual seats in the 2nd row
- Seats: Folding tables on the backs of the front seats
- Seats: Lumbar support in the front
- Seats: Front seats are height-adjustable
- 12V power outlet on the rear of the center console
- Textile floor mats
- Prepared for "We Connect" and "We Connect Plus"
- Washer fluid level warning light
- Warning tone and light for unfastened seat belts front and rear
- Central locking without safe locking, with remote control and 2 remote folding keys



Extra equipment

- 2 USB-C ports at the front, 2 USB-C charging ports at the rear of the center console
- Anti-theft alarm system (with interior monitoring, backup horn and tow-away protection)
- Heated windshield (laminated safety glass windshield, noise-reducing and heated)
- Paint finish: Metallic
- Package: Business Premium (Air Care Climatronic, combination filter - ACC stop & go, speed limiter, Front Assist - lumbar support front, driver's side electrically adjustable with massage function - multifunction leather steering wheel, paddle shifters - cargo net partition - heated windshield washer nozzles - headlight cleaning system - drawer under right front seat - microfleece seat center panels - heated top comfort seats front - emergency braking assistant "Front Assist" - height-adjustable front seats, ergoActive seat on the driver's seat - washer fluid warning light.)
- Package: Family (foldable and removable reversible luggage compartment mat - electric child safety lock for rear doors, operable from the driver's seat - sunshade roller blind on the rear door windows)
- Package: "Easy Open" incl. Safe locking (luggage compartment lid with sensor-controlled opening and electric closing - keyless locking and starting system "Keyless Access")
- Electric panoramic tilt/slide sunroof (interior lights with delayed shut-off and dimming function, 2 LED reading lights front and rear - panoramic tilt/slide sunroof with rear panoramic roof)
- Radio accessories: "DYNAUDIO Contour Surround" sound system (8+1 speakers - total output 330 watts - digital 16-channel amplifier)
- Seats: 2 child seats (2 child seats with side support and side headrest, foldable, left and right in the 2nd row of seats)
- Voice control
- 230V power outlet in the luggage compartment on the left
- Towbar, foldable with electric release
- App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto (selected apps for Android smartphones and Apple iPhones can be displayed and operated on the touchscreen of the radio or navigation system)
- Navigation system "Discover Media" incl. "Streaming & Internet"
- Package: Driver Assistance Package "Plus" (DSG) (Automatic Distance Control ACC "stop & go", Dynamic High Beam Control "Dynamic Light Assist", Automatic Headlights, Daytime Running Lights, "Leaving Home" Function and Manual "Coming Home" Function, Pedestrian Detection + Active Front Folding Mirror, Automatically Dimming Interior Mirror, LED Headlights with LED Daytime Running Lights and Cornering Lights, Dynamic Headlight Range Control with Dynamic Cornering Function, Multifunction Camera, Lane Change Assist "Side Assist Plus" including "Lane Assist" and Parking Assist, Rain Sensor)
- Package: Mirror package in conjunction with driver assistance package "Plus" (electrically folding exterior mirrors, dimming on the driver's side, ambient lighting and passenger exterior mirror lowering - automatic headlight control with daytime running lights, "Leaving home" function and manual "Coming home" function - automatically dimming interior mirror - rain sensor)
- Park Assist (automatically steers the vehicle into parallel and perpendicular parking spaces and also parks out of parallel parking spaces)
- Rear View reversing camera (displays the rear of the vehicle in real time on the radio/navigation system display)
- Seats: 2 individual seats in the 3rd row, foldable into the luggage compartment floor (3 individual seats in the 2nd row with armrest, 2 individual seats in the 3rd row, with headrests and "Easy Fold" folding function)
- Auxiliary heating and ventilation
- "Comfort" telephone interface with inductive charging function

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.



Value reducing factors

No.	Component group	Description
1	Body	Body (Baumharz) - Soiled - Conditioning
2	Wing mirror - right side	Cap - Scratch(es) - Smart repair
3	Misc.	Misc. (Adapter und Halter für Ablagenetz) - Missing - Replace
4	Vehicle glazing	Rear window - Scratch(es) - Loss in value
5	Indicator - front	Mirror - right side - Scratched - Replace
6	Side panel - rear left side	Sill - Dent / paintcoat damage - Smart repair
7	Door - rear right side	Door - Dent / paintcoat damage - Smart repair
8	Wheel / tyres	Alloy rim - front right side - Scratched - Loss in value
9	Braking system	Brake pads - rear - Worn - Replace
10	Instrument panel	Instrument cluster - Scratch(es) - Loss in value
11	Rear bumper	Rear bumper - Scratched - Repair and paint
12	Front bumper	Front bumper - Scratched - Repair and paint

Wear and tear

No.	Component group	Description
1	Body	Body - Scratch(es) - No deduction
2	Sill - right side	Sill - dent(s) - No deduction
3	2nd wheel set	1 tyre (Luftleer, Erneuern) - Leaking - No deduction
4	2nd wheel set	Tyres - complete set - Does not meet the leasing specifications - No deduction
5	2nd wheel set	1 alloy rim - Scratched - No deduction
6	2nd wheel set	1 tyre - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side - left, Provided by user / customer, from 25 Feb 2026	717,47 €

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Documents

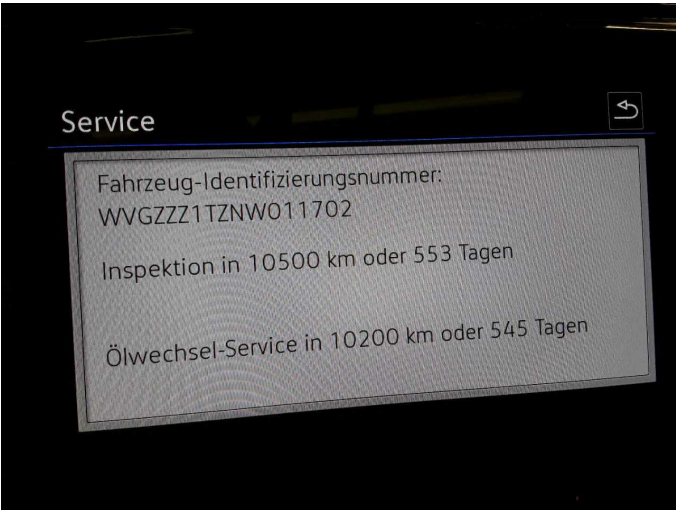


Figure 17: Documents



Figure 18: Additional tyres



Figure 19: Additional tyres

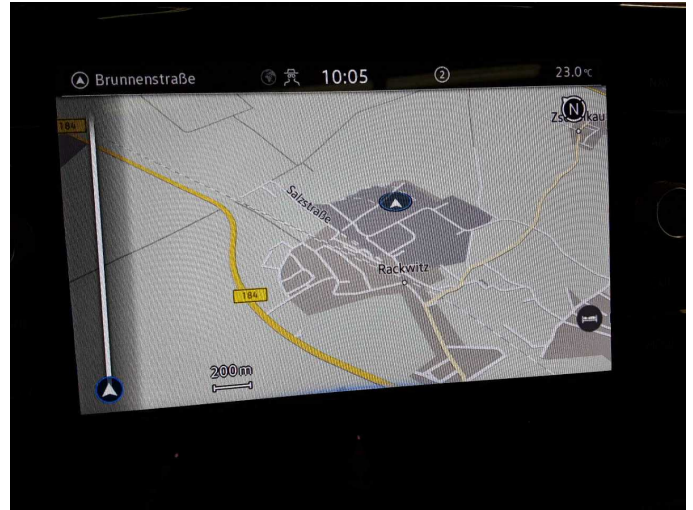


Figure 20: Navigation



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.

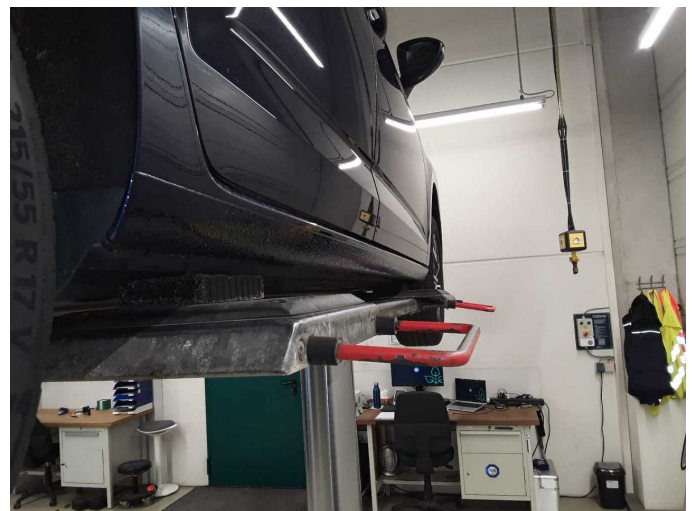


Figure 28: Misc.

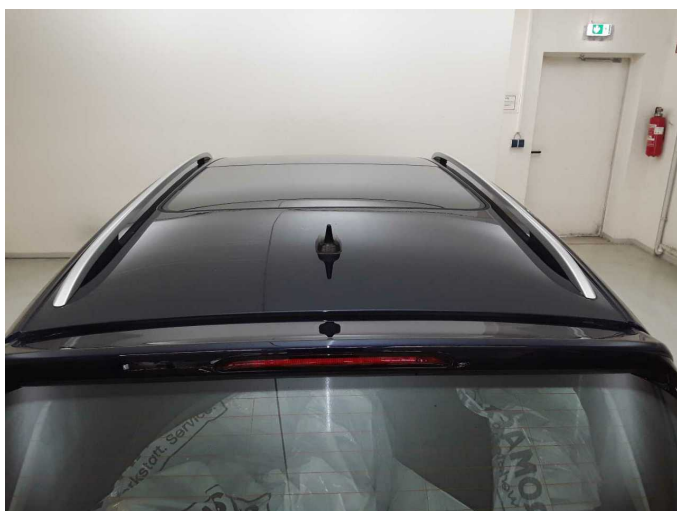


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Figure 35: Misc.



Figure 36: Misc.



Figure 37: Misc.

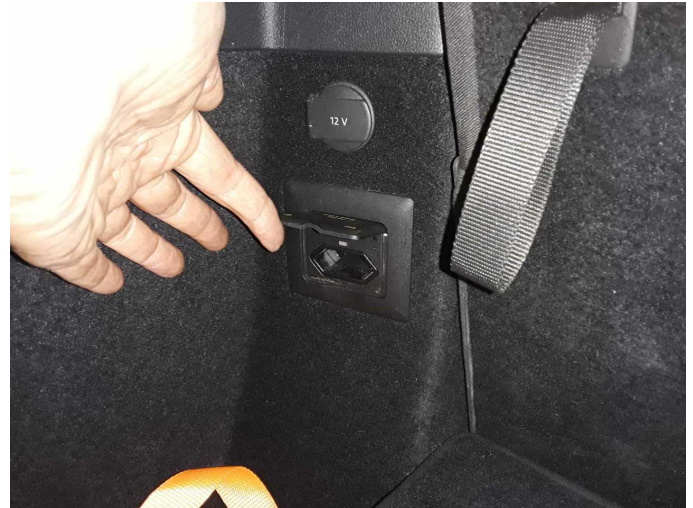


Figure 38: Misc.



Figure 39: Misc.



Figure 40: Misc.



Damage 1: Body: Body (Baumharz) - Soiled - Conditioning



Damage 1: Body: Body (Baumharz) - Soiled - Conditioning



Damage 1: Body: Body (Baumharz) - Soiled - Conditioning



Damage 1: Body: Body (Baumharz) - Soiled - Conditioning



Damage 1: Body: Body (Baumharz) - Soiled - Conditioning



Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 2: Wing mirror - right side: Cap - Scratch(es) - Smart repair



Damage 3: Misc.: Misc. (Adapter und Halter für Ablagenetz) - Missing - Replace



Damage 3: Misc.: Misc. (Adapter und Halter für Ablagenetz) - Missing - Replace



Damage 3: Misc.: Misc. (Adapter und Halter für Ablagenetz) - Missing - Replace



Damage 4: Vehicle glazing: Rear window - Scratch(es) - Loss in value



Damage 4: Vehicle glazing: Rear window - Scratch(es) - Loss in value



Damage 4: Vehicle glazing: Rear window - Scratch(es) - Loss in value




Damage 5: Indicator - front: Mirror - right side - Scratched - Replace



Damage 5: Indicator - front: Mirror - right side - Scratched - Replace




Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

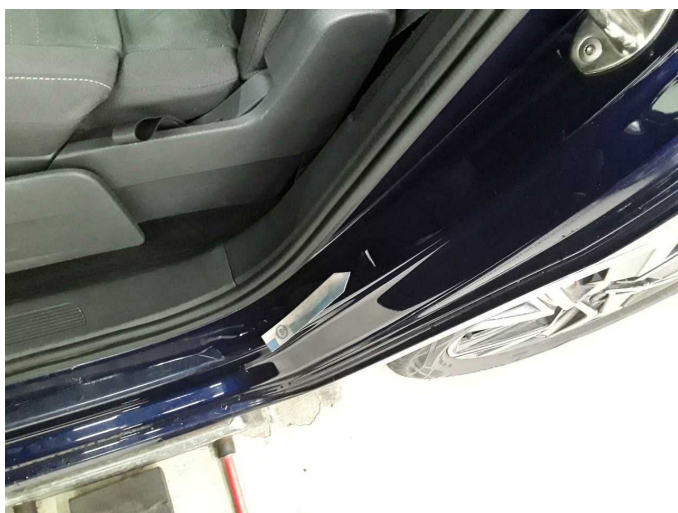

Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair



Damage 6: Side panel - rear left side: Sill - Dent / paintcoat damage - Smart repair

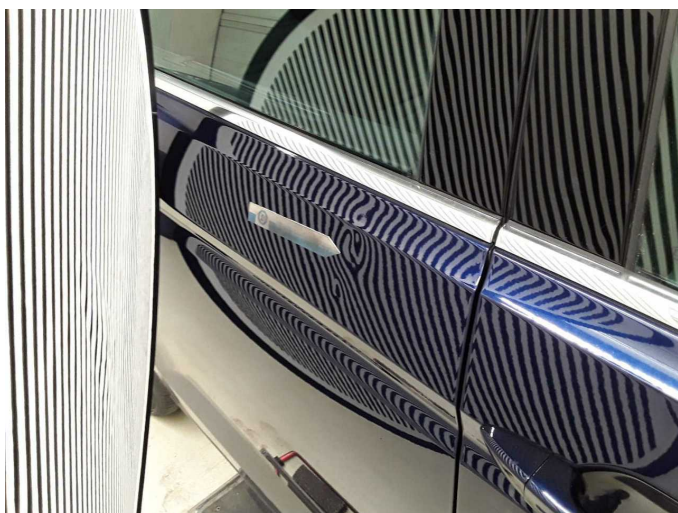

Damage 7: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 7: Door - rear right side: Door - Dent / paintcoat damage - Smart repair



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 8: Wheel / tyres: Alloy rim - front right side - Scratched - Loss in value



Damage 9: Braking system: Brake pads - rear - Worn - Replace



Damage 9: Braking system: Brake pads - rear - Worn - Replace




Damage 9: Braking system: Brake pads - rear - Worn - Replace




Damage 9: Braking system: Brake pads - rear - Worn - Replace




Damage 9: Braking system: Brake pads - rear - Worn - Replace

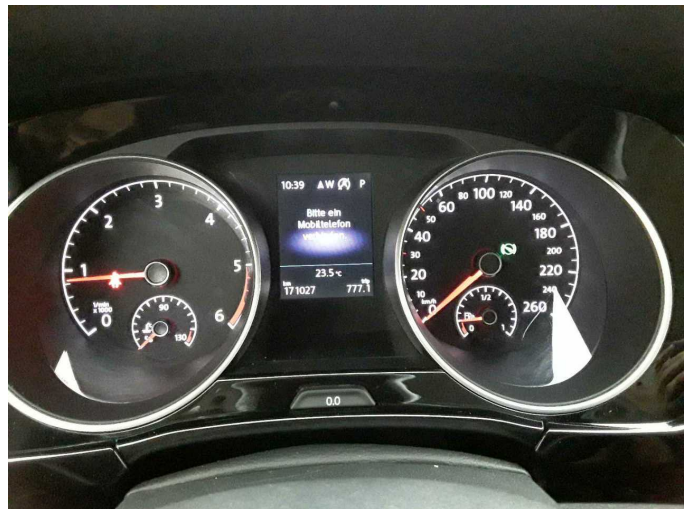

Damage 10: Instrument panel: Instrument cluster - Scratch(es) - Loss in value

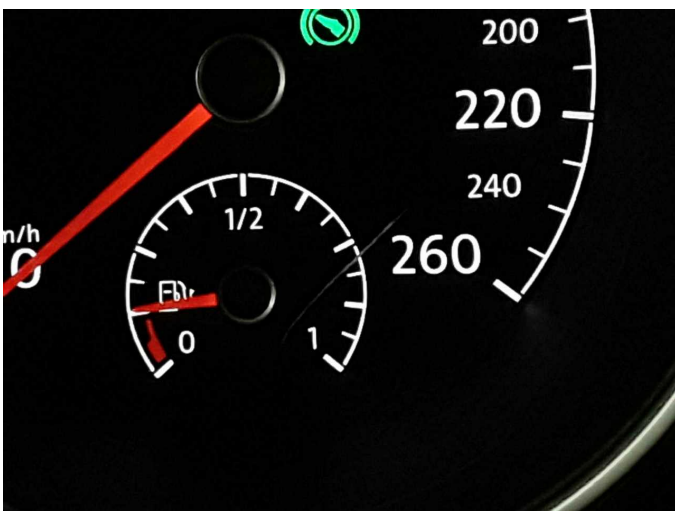

Damage 10: Instrument panel: Instrument cluster - Scratch(es) - Loss in value

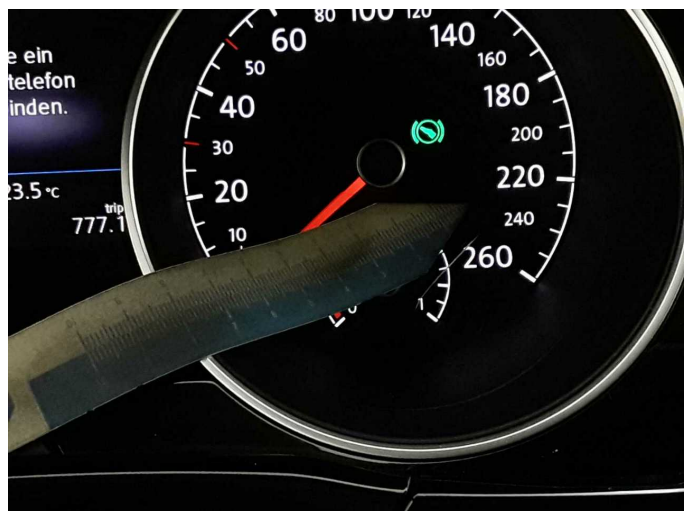

Damage 10: Instrument panel: Instrument cluster - Scratch(es) - Loss in value



Damage 11: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 11: Rear bumper: Rear bumper - Scratched - Repair and paint




Damage 11: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 11: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 11: Rear bumper: Rear bumper - Scratched - Repair and paint

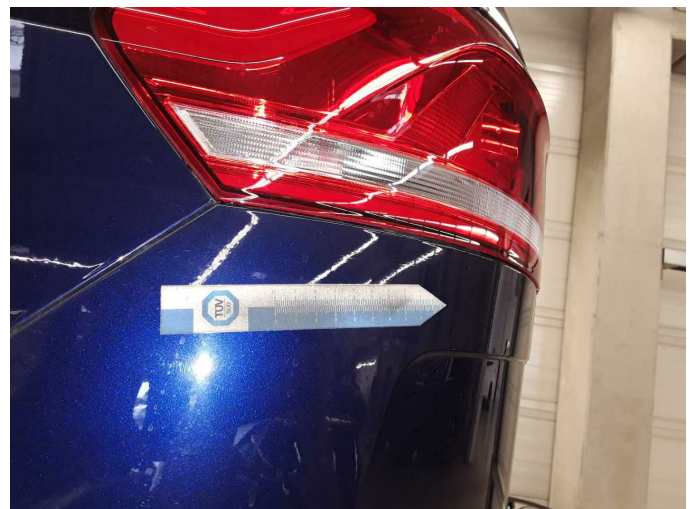


Damage 11: Rear bumper: Rear bumper - Scratched - Repair and paint



Damage 12: Front bumper: Front bumper - Scratched - Repair and paint




Damage 12: Front bumper: Front bumper - Scratched - Repair and paint

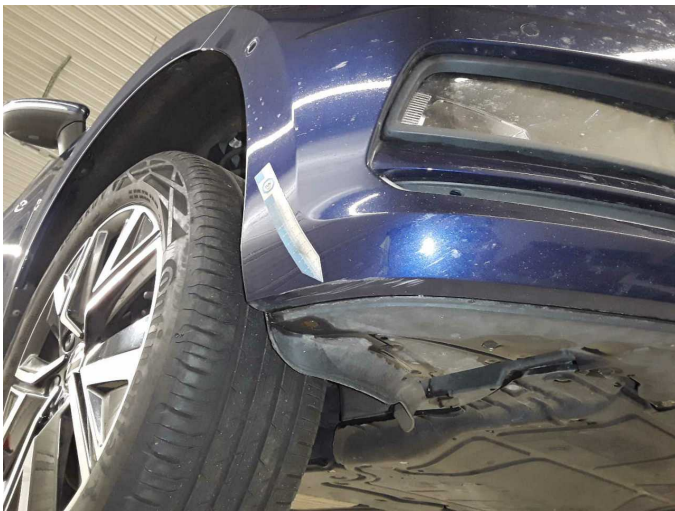

Damage 12: Front bumper: Front bumper - Scratched - Repair and paint




Damage 12: Front bumper: Front bumper - Scratched - Repair and paint

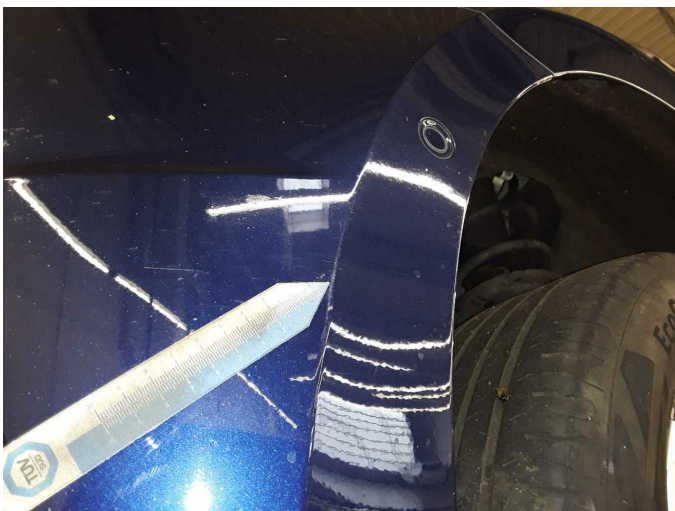

Damage 12: Front bumper: Front bumper - Scratched - Repair and paint



Wear and tear 1: Body: Body - Scratch(es) - No deduction

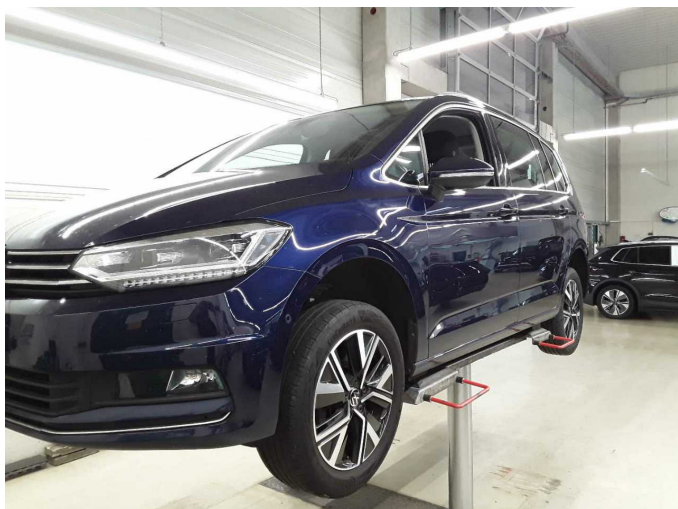

Wear and tear 1: Body: Body - Scratch(es) - No deduction



Wear and tear 2: Sill - right side: Sill - dent(s) - No deduction



Wear and tear 2: Sill - right side: Sill - dent(s) - No deduction



Wear and tear 3: 2nd wheel set: 1 tyre (Luftleer, Erneuern) - Leaking - No deduction



Wear and tear 3: 2nd wheel set: 1 tyre (Luftleer, Erneuern) - Leaking - No deduction



Wear and tear 5: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 5: 2nd wheel set: 1 alloy rim - Scratched - No deduction



Wear and tear 6: 2nd wheel set: 1 tyre - Scratch(es) - No deduction



Wear and tear 6: 2nd wheel set: 1 tyre - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WVGZZZ1TZNW011702

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Touran 2.0 TDI SCR DSG
Highline

Datum	KM-Stand	Beschreibung
09.02.2026	151.460	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
27.06.2025	119.973	Getriebeöl ern/prüfen; HU + AU; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
15.07.2024	89.035	Bremse Sonstiges; Bremsflüssigkeit; Bremsflüssigkeit ern; Bremsklötze hinten; Bremsklötze vorne; Bremsscheiben hinten; Bremsscheiben vorne; Kraftstofffilter ern; Luftfiltereinsatz ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Systemtest/Eigendiagnose; Wartung Sonstiges
13.09.2023	59.587	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
02.01.2023	32.649	Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges