



Peugeot 3008: 2AMG445

Vinnumber:	VF3M4DGZUMS086860	Versionname:	
First Registrationdate:	11/05/2021	Fiscalpower:	
Expertise Mileage:	154888	Power Kw:	
Bodytype:		Body colour	White
Gearbox:	Automatic	Type of rims (mounted)	Aluminium
Transmission:	Front		
Fueltype:	Hybrid Petrol		
Maintenance	NOT OK		
Maintenance	overschreden sinds 33800km		
Number of doors	5		
Number of seats	5		
Number head rests	5		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		
Registration Certificate Home (BE)	No		

Options

Number of keys total	2	Central consol F
Number keys remote	2	Luggage cover
Windows electric F		Front parking sensors
Windows electric R		Rear parking sensors
Board Computer		Roof bar alu
Cruise Control		
Steering wheel multifunctional		
Steering wheel leather		
Type of headlighting	Headlighting LED	
Type of GPS	GPS big screen color	
Type of Lining	Lining leather	
Type of climate control	Autom climate control	
Type of radio	Multimedia	
Type of GPS storage	HD	

Tyres

225/55/18/102 V				
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Continental: 5 mm	Re.R.	Continental: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				5.0
Tyre profile depth RR				4.0
Tyre size FL				225/55 R 18 102 V
Tyre size FR				225/55 R 18 102 V
Tyre size RL				225/55 R 18 102 V
Tyre size RR				225/55 R 18 102 V
Tyre type FL				All seasons
Tyre type FR				All Seasons
Tyre type RL				All seasons
Tyre type RR				All Seasons
Tyre make FL				256
Tyre make FR				256
Tyre make RL				256
Tyre make RR				256

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	1		
Number of charging cables (rapid charge)	0		

Service, Maintenance, Execute



Armrest, Damaged, Acceptable



Backrest cover RM, Scratch(es), Acceptable



Interior covering A pillar R, Scratch(es), Acceptable



Registration document, Incomplete, Check



Bumper F, Scratch(es), Spot repair



Wing trim FL, Scratch(es), Acceptable



Mirror side repeater L, Scratch(es), Replace



Outside rear-view mirror housing L, Scratch(es), Acceptable



Door FL, Dent(s) and scratch(es), Acceptable





Alloy rim FL polished, Chemical polution, Acceptable



Alloy rim RL polished, Chemical polution, Acceptable



Luggage compartment cover, Worn, Acceptable



Internal boot lining L, Scratch(es), Acceptable



Internal boot lining R, Scratch(es), Acceptable



Boot lid covering R, Scratch(es), Acceptable



Tailgate / Boot, Scratch(es), Acceptable



Bumper R, Scratch(es), Spot repair




Rear light L, Scratch(es), Acceptable



Wing trim RR, Scratch(es), Replace



Alloy rim RR polished, Chemical polution, Acceptable

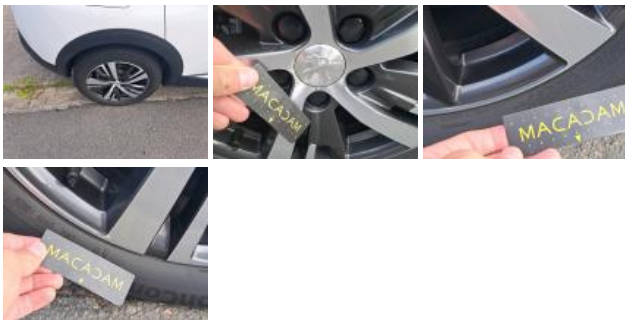

Wing RR, Dent(s), Acceptable



Door FR, Dent(s), Repair and paint (complete)



Alloy rim FR polished, Scratch(es), Repair and paint (complete)

