



Expertise

Protocol number: 45910607
Order No. / Reference: 26559321
Inspection date: 12 Jun 2026

Manufacturer: Mercedes-Benz

Model: GLC 300 de 4Matic 9G-TRONIC AMG Line

VIN: W1N2539111G017985



Vehicle details	
Manufacturer / Type / Model / Equipment	
Mercedes-Benz GLC 300 de 4Matic 9G-TRONIC AMG Line	
Vehicle Identification number	W1N2539111G017985
Mileage (Read)	171,128 km
First registration	3 Nov 2021
Number of holders	2
Next periodical technical inspection	11/2026
(Report on hand)	
Power / Engine displacement	143 kw / 1,950 ccm
Fuel type / Cylinder	Hybr.D/E ext.aufl / 4
Gearbox / Number of gears	Automatic / 9
Type of drive	All-wheel drive
Type of vehicle	SUV
Colour / colour code	CAVANSITBLAU - METALLICLACK
Doors / Seats	5 / 5
Upholstery type	Leather
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	-1,100 km
Last service on / at	06/2025 at 145,055 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GF737984
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	short drive on the company premises	Engine function test	Performed
Manufacturer key number/ type code number	2222 / ASV 00046		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,650 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/60 R18 103H	Winter tyres on Light alloy	Bridgestone	5mm / 5mm
2)	235/60 R18 103H	Winter tyres on Light alloy	Bridgestone	6mm / 6mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	235/55 R19 101V	Summer tires (with run-flat tires) on Light alloy	unterschiedliche Hersteller	1mm / 1mm
2)	235/55 R19 101V	Summer tyres on Light alloy	Michelin	5mm / 5mm

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag for driver and front passenger
- Airbag: Side airbag for driver and front passenger
- Active Brake Assist
- 4MATIC all-wheel drive
- ATTENTION ASSIST
- Heated exterior mirrors (left and right), electrically adjustable from inside
- Roof rails in polished aluminum
- Tachometer
- DYNAMIC SELECT
- Electronic Stability Program (ESP)
- Chassis with higher ground clearance
- electric parking brake
- Transmission: 9G-TRONIC
- rear window wiper
- KEYLESS-GO start function
- Remote trunk lid release
- Instrument cluster with 2 tubular round instruments, 13.97 cm (5.5") multifunction display
- Headrests 5-way
- Charging cable for household socket, 5m, smooth
- LED High Performance Headlights
- Steering column mechanically adjustable in height and length
- Mercedes-Benz emergency call system
- Package: Storage
- Package: OFF-ROAD Exterior
- Radio: MBUX multimedia system
- Radio accessories: Touchpad
- Remote Services Plus
- Power steering
- Seats: Rear seat backrests foldable
- Seats: Front seats electrically adjustable
- High-visibility vest for drivers
- Central locking
- Airbag: Kneebag for driver
- Airbag: Windowbags
- Acoustic environmental protection
- Anti-lock braking system (ABS)
- Automatic passenger airbag deactivation
- On-board computer
- Brake system with larger brake discs on the front axle
- Diesel particulate filter
- Third brake light in LED technology
- EASY-Pack cargo cover (removable)
- Driving light assistant
- Electric windows (4-way)
- Black floor mats with AMG lettering
- Rear window heated
- Interior headliner fabric crystal grey
- Climate: THERMATIC automatic climate control with 2 climate zones
- Communication module (LTE) for the use of Mercedes me connect services
- Paint finish: Solid
- Charging system: AC on-board charger (AC charging)
- Steering wheel: Multifunction sports steering wheel in 3-spoke design in black Nappa leather
- Steering: Sport direct steering
- Navigation accessories: Extended MBUX functions
- Package: Interior light
- Upholstery: ARTICO leatherette/DINAMICA microfiber
- Radio accessories: Digital radio
- Tire pressure monitoring system (TPMS)
- Windscreen wipers with rain sensor
- Seat: Front sports seats
- Seats: i-Size child restraint system on the outer rear seats
- Cruise control
- Immobiliser
- Decorative elements: black piano lacquer finish/light longitudinally brushed aluminum



Extra equipment

- Airbag: Sidebags in the rear, left and right
- Towbar with ESP trailer stabilization (fully electrically foldable and retractable)
- EASY-Pack tailgate with electric operation for opening and closing
- Chassis: AIR BODY CONTROL air suspension (with continuously adjustable damping)
- Instrument panel and door sills in ARTICO man-made leather
- Climate: THERMOTRONIC automatic climate control with 3 climate zones (The THERMOTRONIC automatic climate control with 3 climate zones and 3 climate styles allows for a personalized comfort climate on board. Driver and front passenger can each adjust the temperature, air distribution and climate style according to their personal needs. The third climate zone is located in the rear with separately adjustable temperature and airflow.)
- Navigation accessories: Pre-installation for Live Traffic Information
- Package: AIR-BALANCE (including ionization, improved air filtration and fragrance)
- Package: Business (for plug-in hybrid vehicles) (Advanced Parking Package: Active Parking Assist PARKTRONIC with reversing camera; Advanced Infotainment Package: Media display with touch operation, smartphone integration - Apple CarPlay and Android Auto, connectivity package navigation, traffic sign assist; Comfort Package: Heated seats for driver and front passenger, seat comfort package - electric and manual adjustment options for the front seats; Public Charging Package)
- Package: High End Assistance (Mirror package: Electrically folding exterior mirrors, lowering right exterior mirror, automatic dimming function; Driving assistance package: Active Distance Assist DISTRONIC, Active Steering Assist, Active Brake Assist, Evasive Steering Assist, Active Lane Keeping Assist, Active Blind Spot Assist, PRE-SAFE PLUS)
- Package: High End Comfort (Seat heating for driver and front passenger, driver's seat electrically adjustable with memory function, front right seat electrically adjustable with memory function, multi-contour seat package: individually adjustable air chambers, massage effect in the lumbar region)
- Panoramic sunroof
- Upholstery: Black leather
- Radio accessories: MBUX Interior Assistant (This innovative system detects and interprets your hand and arm movements. Selected functions can thus be activated literally in the blink of an eye. The system can distinguish between driver and front passenger so that you can access exactly the menus you want to use.)
- Wheels: Run-flat tires (instead of TIREFIT tire sealant)
- Heated windshield washer system
- Seats: Seat climate control for driver and front passenger in conjunction with comfort packages (with seat heating and seat ventilation)
- Ambient lighting (Design the interior according to your personal preference or current mood. With a total of 64 colors, the ambient lighting offers almost unlimited possibilities for lighting design and has the right color for every situation. Illuminated door sills on the driver and passenger sides.)
- Head-up display
- KEYLESS-GO (Your KEYLESS-GO vehicle key can stay in your pocket; you don't need to take it out of your hand. Thanks to the stored access and driving authorization, the vehicle recognizes its owner. Simply grasp the door handle, open the door, get in, and drive off – KEYLESS-GO is always a convenient experience.)
- Paint finish: Metallic
- Charging cable for wallboxes and public charging stations, 5m, smooth
- Steering wheel: Steering wheel heating
- Package: Advanced Light (LED High Performance headlights and adaptive LED taillights, Adaptive Highbeam Assist)
- Package: AMG Line Exterior (Plug-in Hybrid) (AMG Styling, consisting of AMG front apron with sporty air intakes and chrome trim element, AMG rear apron in diffuser look with black insert, diamond grille with chrome pins, integrated Mercedes star and matte iridium silver louvre with chrome inlay, 19-inch (48.3 cm) AMG light-alloy wheels in 5-twin-spoke design, painted tremolite grey and high-sheen finish with 235/55 R19 tires on 8 J x 19 ET 38 rims, 2 visible tailpipe trims permanently integrated into the bumper)
- Package: High-end infotainment (Media display with touch controls, smartphone integration: Apple CarPlay and Android Auto, connectivity package, navigation, traffic sign assistant: thanks to intelligent linking of camera and map data, it can recognize not only speed limits, no-overtaking zones and their cancellation, but also fully digital instrument display, wireless charging system for mobile devices in the storage compartment)
- Package: High End Park (Parking package with 360° camera, Active Parking Assist with PARKTRONIC)
- Package: Night for AMG Line Exterior (radiator grille with diamond pattern, silver pins and high-gloss black louvre, 48.3 cm (19") AMG 5-spoke light-alloy wheels painted high-gloss black and polished with 235/55 R 19 tires on 8 J x 19 ET 38 rims, roof rails in black, front and rear underguards painted black, exterior mirror housings painted high-gloss black, beltline trim strip and window surrounds in high-gloss black, heat-insulating dark tinted glass from the B-pillar back)
- Remote and Charging Services Plus
- Wheels: 48.3 cm (19") AMG light-alloy wheels, 4 in 5-twin-spoke design
- Seats: Heated rear seats
- Partition net for luggage compartment separation (and occupant protection)
- Running boards in aluminum look with rubber studs



- Decorative elements: open-pore black ash wood / light longitudinally brushed aluminum

Retrofitted equipment

- 853 Advanced Sound

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	A short maneuvering and shunting exercise was carried out on the company premises.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Misc.	Inspection / maintenance - Due - Perform
2	Front bumper	Licence plate holder - Broken / torn - Replace
3	Seat - rear	Seat cover - 3 seater bench - Soiled - Clean
4	Wheel / tyres	Pressure sensor (Reifendruck) - Electrical fault - Diagnosed and repair if necessary
5	Tail light	Tail lamp - right side - Scratch(es) - Loss in value
6	Mudguard - right side	Mudguard - right side - Scratch(es) - Smart repair
7	Door - front left side	Door edge - Scratch(es) - Smart repair
8	Boot lid / rear door	Boot lid - Dent / paintcoat damage - Smart repair
9	2nd wheel set	2 tyres - Worn - Replace
10	Bonnet	Bonnet - Stone chips - Paint
11	Rear bumper	Rear bumper - Scratch(es) - Paint
12	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Braking system	Brake discs and brake pads - front (Frei Bremsen/ Folgekosten möglich) - Corrosion - No deduction
2	Door - rear right side	Door - Scratch(es) - No deduction
3	Side panel - rear right side	Sill - Scratch(es) - No deduction
4	Trim / covers	Door trim - rear right side - Scratch(es) - No deduction
5	Rear bumper	Spoiler - Scratch(es) - No deduction
6	2nd wheel set	1 alloy rim - Scratch(es) - No deduction
7	Door - rear left side	Door - Scratch(es) - No deduction
8	Sill - right side	Cat walk - Soiled - No deduction
9	Sill - left side	Cat walk - Soiled - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.



Missing parts

Description

Equipment - charging cable (Kabel für Haushaltssteckdose)

Interior - Boot cover / roller cover

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Der montierte Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front

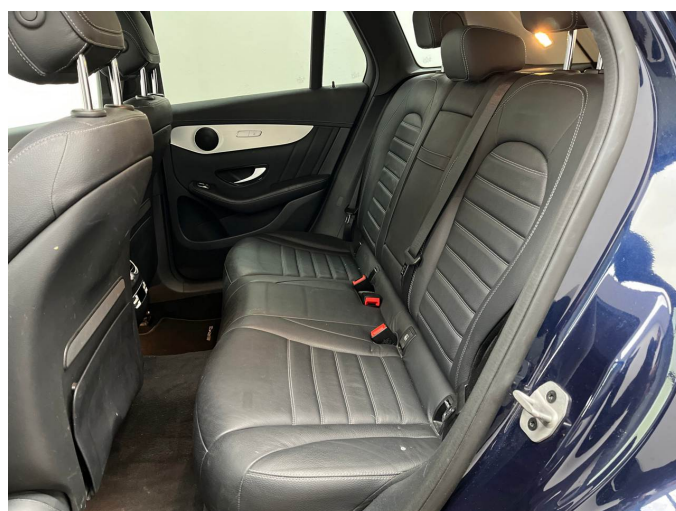


Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents



Figure 14: Documents



Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

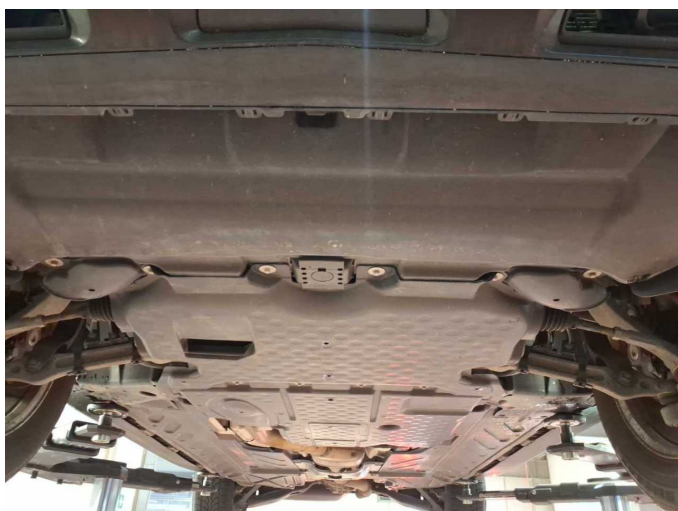


Figure 29: Misc.



Figure 30: Misc.



Figure 31: Misc.



Figure 32: Misc.



Figure 33: Misc.



Figure 34: Misc.



Damage 1: Misc.: Inspection / maintenance - Due - Perform



Damage 2: Front bumper: Licence plate holder - Broken / torn - Replace




Damage 2: Front bumper: Licence plate holder - Broken / torn - Replace



Damage 2: Front bumper: Licence plate holder - Broken / torn - Replace




Damage 3: Seat - rear: Seat cover - 3 seater bench - Soiled - Clean

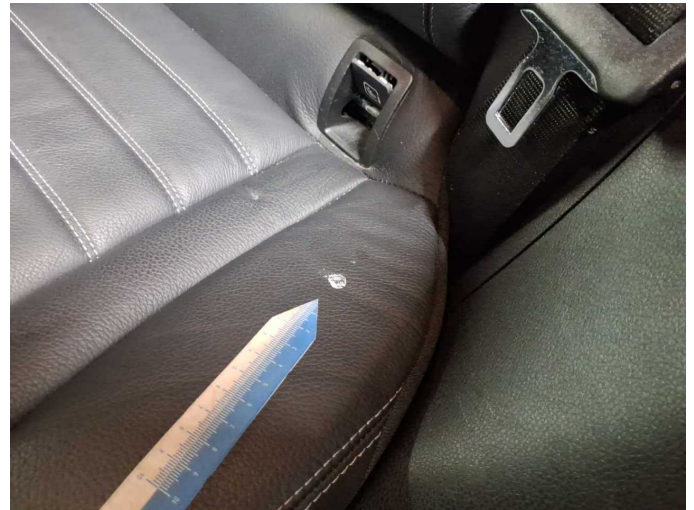


Damage 3: Seat - rear: Seat cover - 3 seater bench - Soiled - Clean



Damage 4: Wheel / tyres: Pressure sensor (Reifendruck) - Electrical fault - Diagnosed and repair if necessary

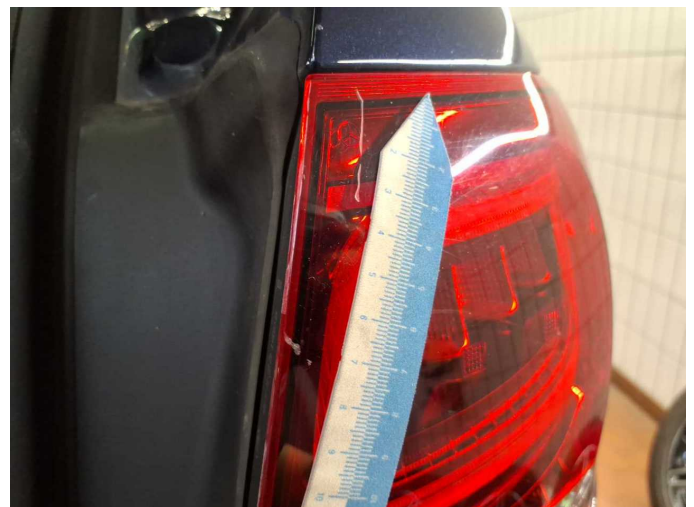

Damage 5: Tail light: Tail lamp - right side - Scratch(es) - Loss in value

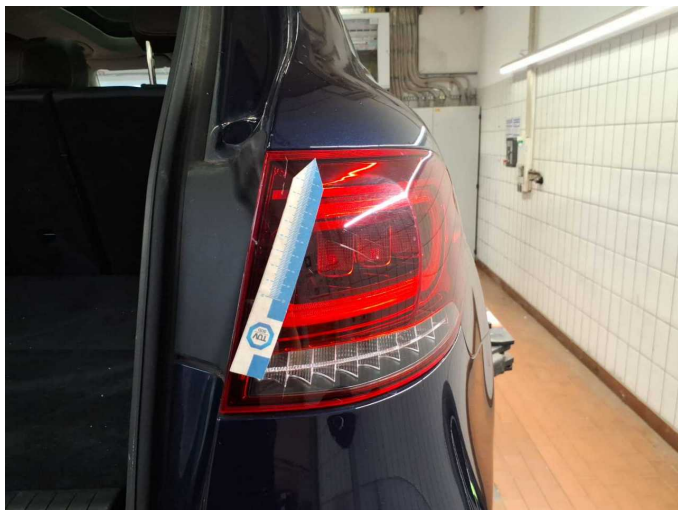


Damage 5: Tail light: Tail lamp - right side - Scratch(es) - Loss in value




Damage 6: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair



Damage 6: Mudguard - right side: Mudguard - right side - Scratch(es) - Smart repair

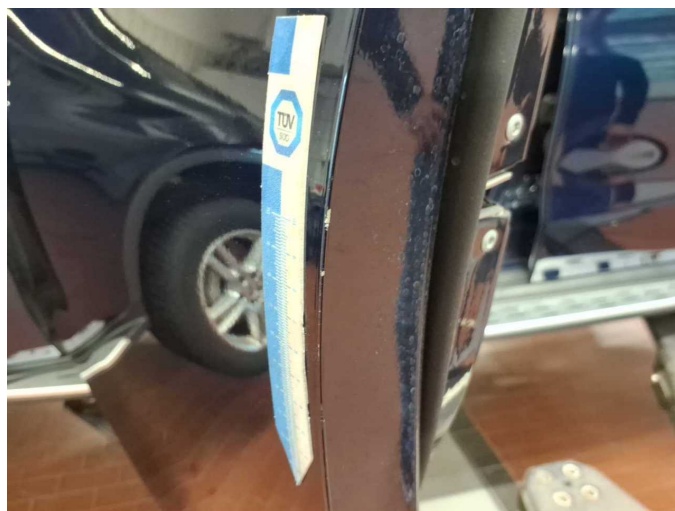

Damage 7: Door - front left side: Door edge - Scratch(es) - Smart repair

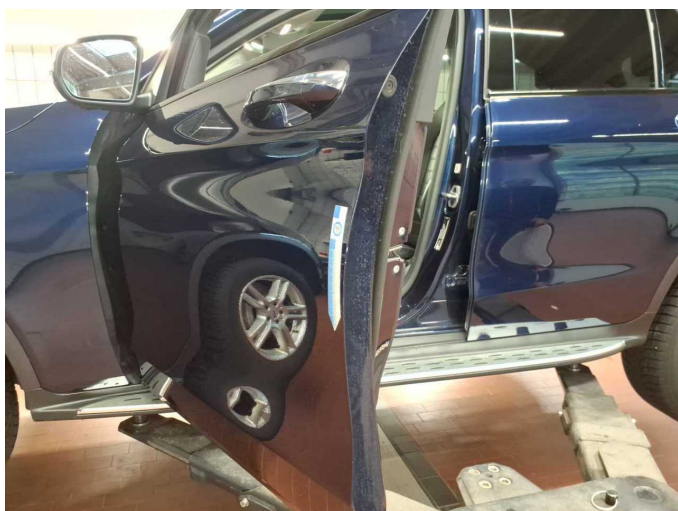

Damage 7: Door - front left side: Door edge - Scratch(es) - Smart repair



Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 8: Boot lid / rear door: Boot lid - Dent / paintcoat damage - Smart repair



Damage 9: 2nd wheel set: 2 tyres - Worn - Replace




Damage 9: 2nd wheel set: 2 tyres - Worn - Replace



Damage 9: 2nd wheel set: 2 tyres - Worn - Replace



Damage 9: 2nd wheel set: 2 tyres - Worn - Replace

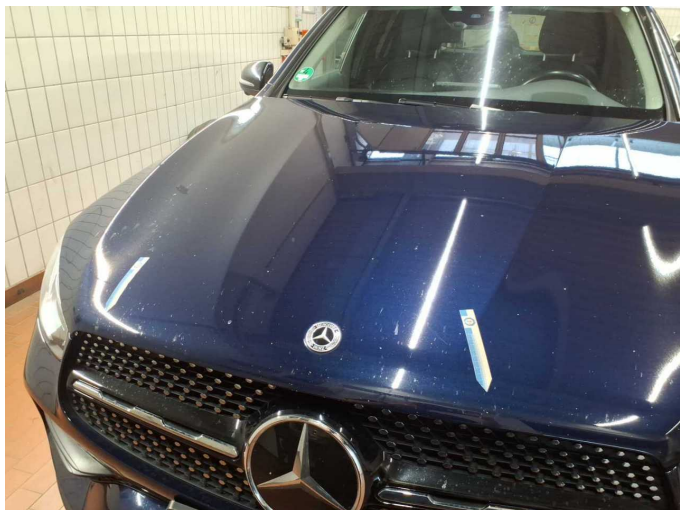

Damage 10: Bonnet: Bonnet - Stone chips - Paint




Damage 10: Bonnet: Bonnet - Stone chips - Paint



Damage 10: Bonnet: Bonnet - Stone chips - Paint



Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint

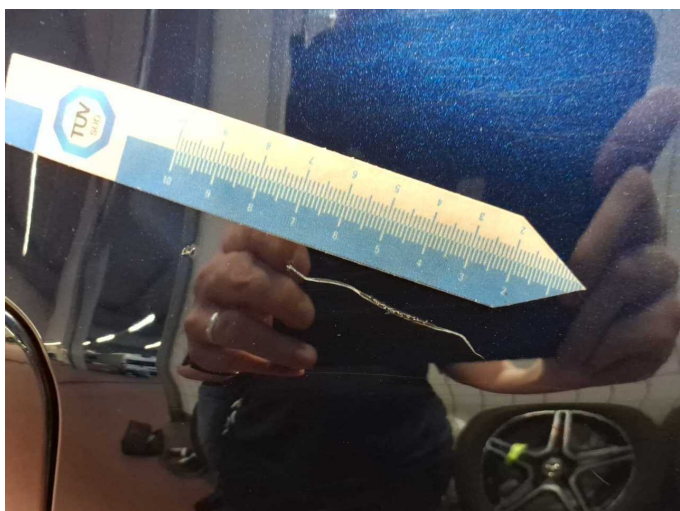

Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 11: Rear bumper: Rear bumper - Scratch(es) - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint



Damage 12: Front bumper: Front bumper - Scratched - Paint



Wear and tear 1: Braking system: Brake discs and brake pads - front
(Frei Bremsen/ Folgekosten möglich) - Corrosion - No deduction



Wear and tear 1: Braking system: Brake discs and brake pads - front
(Frei Bremsen/ Folgekosten möglich) - Corrosion - No deduction



Wear and tear 1: Braking system: Brake discs and brake pads - front
(Frei Bremsen/ Folgekosten möglich) - Corrosion - No deduction



Wear and tear 1: Braking system: Brake discs and brake pads - front
(Frei Bremsen/ Folgekosten möglich) - Corrosion - No deduction



Wear and tear 2: Door - rear right side: Door - Scratch(es) - No deduction



Wear and tear 2: Door - rear right side: Door - Scratch(es) - No deduction




Wear and tear 5: Rear bumper: Spoiler - Scratch(es) - No deduction



Wear and tear 5: Rear bumper: Spoiler - Scratch(es) - No deduction



Wear and tear 7: Door - rear left side: Door - Scratch(es) - No deduction

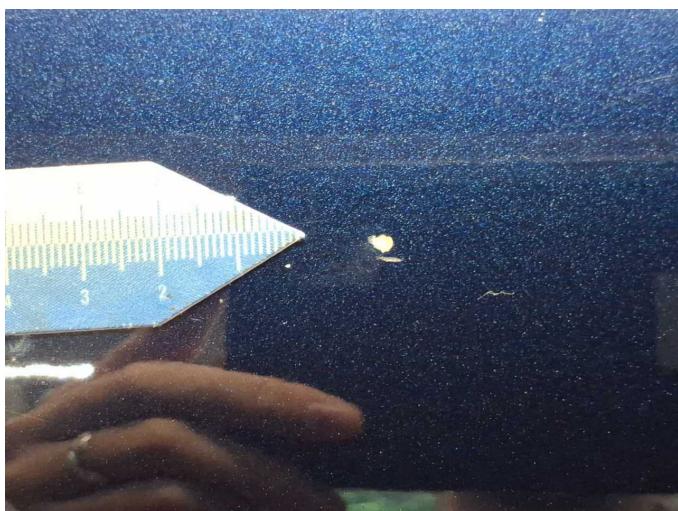

Wear and tear 7: Door - rear left side: Door - Scratch(es) - No deduction



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: W1N2539111G017985

Hersteller / Modell: MERCEDES-BENZ MERCEDES-BENZ GLC 300 de 4Matic 9G-TRONIC AMG Line

Datum	KM-Stand	Beschreibung
11.06.2025	145.055	Regelwartungsdienst
25.07.2024	116.342	Regelwartungsdienst
23.10.2023	80.160	Regelwartungsdienst
27.09.2023	77.335	Bremsscheiben hinten
09.02.2023	53.017	Regelwartungsdienst
18.07.2022	27.344	Regelwartungsdienst