



Opel Corsa (UKL): 2CBV321

Vinnumber:	VXKUPHNEKN4152159	Versionname:	Corsa Edition 1.2 Turbo 100pk/cv Start/Stop 5p
First Registrationdate:	25/05/2022	Fiscalpower:	
Expertise Mileage:	58523	Power Kw:	74
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	MAN 6 VIT		
Transmission:			
Fueltype:			
Maintenance	OK		
Maintenance	over 15960 km		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	No Tow bar
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

	195/55/16/87 H			
Summer tyres:	Fr.L.	Continental: 4 mm	Fr.R.	Continental: 4 mm
	Re.L.	Bridgestone: 4 mm	Re.R.	Bridgestone: 4 mm
Tyre profile depth FL				4.0
Tyre profile depth FR				4.0
Tyre profile depth RL				4.0
Tyre profile depth RR				4.0
Tyre size FL				195/55 R 16 87 H
Tyre size FR				195/55 R 16 87 H
Tyre size RL				195/55 R 16 91 H
Tyre size RR				195/55 R 16 91 H
Tyre type FL				Summer
Tyre type FR				Summer
Tyre type RL				Summer
Tyre type RR				Summer
Tyre make FL				256
Tyre make FR				256
Tyre make RL				255
Tyre make RR				255

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	0		
Number of charging cables (rapid charge)	0		

Interior, Stain, Acceptable



Windscreen, Stone chip(s), Windscreen repair



Windscreen, Stone chip(s), Acceptable




Bonnet, Stone chip(s), Acceptable



Bumper F, Scratch(es), Acceptable



Wing RL, Dent(s) and scratch(es), Acceptable

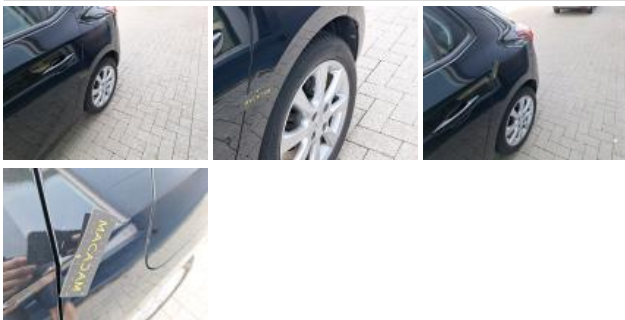

Step L, Dent(s), Acceptable






Step L, Scratch(es), Acceptable



Door RL, Bad repair, Repair and paint (complete)

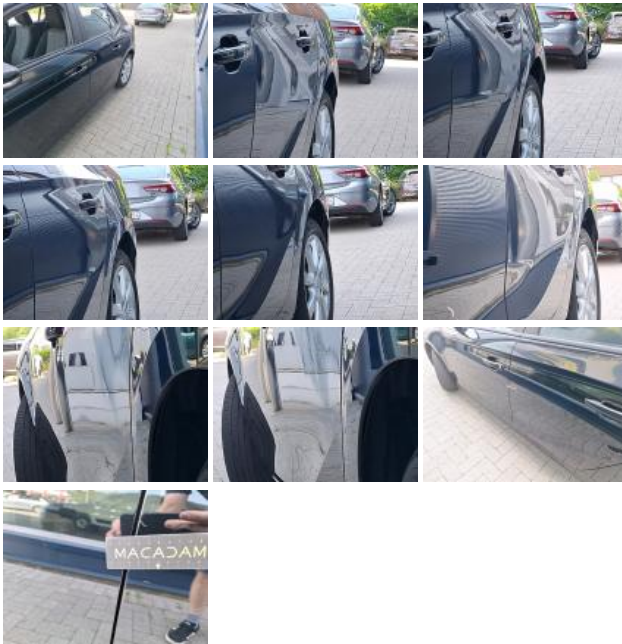

Alloy rim FL, Scratch(es), Repair and paint (complete)



Alloy rim RL, Scratch(es), Repair and paint (complete)



Luggage compartment cover, Damaged, Forfeit



Bumper R, Scratch(es), Acceptable



Boot carpet, Damaged, Replace



Door RR, Dent(s), Acceptable



Wing RR, Dent(s), Acceptable



Door FR, Scratch(es), Acceptable



Outer door handle FR, Scratch(es), Acceptable



Alloy rim RR, Scratch(es), Repair and paint (complete)



Alloy rim FR, Scratch(es), Repair and paint (complete)



Roof, Chemical polution, Repair and paint (complete)



Kenteken	2CBV321
Merk Model	Opel Corsa Edition 1.2 Turbo 100pk/cv Start/Stop 5p
Brandstofsoort	Benzine
Datum deel1	5/25/22

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
1/15/26	60,452	60000 km	Uitvoeren
1/15/26	60,452	luchtfilter	Vervangen
1/15/26	60,452	luchtfilter interieur	Vervangen
1/15/26	60,452	oliezeef	Vervangen
1/15/26	60,452	remvloeistof	Vervangen
1/15/26	60,452	ruitwisserrubber vooraan	Vervangen
1/24/25	47,115	oliezeef	Vervangen
1/24/25	47,115	onderhoud 12 maand	Uitvoeren
1/15/24	39,961	bougie	Vervangen
1/15/24	39,961	luchtfilter	Vervangen
1/15/24	39,961	luchtfilter interieur	Vervangen
1/15/24	39,961	oliezeef	Vervangen
1/15/24	39,961	onderhoud 2e jaar	Uitvoeren
2/9/23	20,184	luchtfilter interieur	Vervangen
2/9/23	20,184	oliezeef	Vervangen
2/9/23	20,184	onderhoud 1e jaar	Uitvoeren