



Expertise

Protocol number: 46506027
Order No. / Reference: 26449962
Inspection date: 14 Jul 2026

Manufacturer: Polestar

Model: 2 Single Motor 78kWh

VIN: YSMVSEGE4PL159213



Vehicle details	
Manufacturer / Type / Model / Equipment	
Polestar 2 Single Motor 78kWh	
Vehicle Identification number	YSMVSEGE4PL159213
Mileage (Read)	66,481 km
First registration	11 Apr 2023
Number of holders	1
Next periodical technical inspection	04/2028
(Report on hand)	
Power / Engine displacement	80 kw /
Fuel type / Cylinder	Electric / 0
Gearbox / Number of gears	Direct drive / 1
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Snow Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Grey



Vehicle details

Maintenance booklet / proof	Available / complete	Next maintenance in	553 Tag(e)
Last service on / at	01/2026 at 60,393 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GQ222506
Previous damage / Accident	None detectable	Repainting	None detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	2219 / AAB 00010		
Emission standard	2017/1151;WLTP;reine Elektrofz	fine dust sticker	
Permitted total weight	2,490 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102V	Winter tyres on Light alloy	Hankook	5mm / 5mm
2)	245/45 R19 102V	Winter tyres on Light alloy	Hankook	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	245/45 R19 102V	Summer tyres on Light alloy	Michelin	4mm / 4mm
2)	245/45 R19 102V	Summer tyres on Light alloy	Michelin	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 02/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Standard equipment

- 2 USB ports on the back
- Acoustic Vehicle Alert System - AVAS
- Airbags: Head/shoulder airbags
- Alarm system
- Automatic braking after a collision
- Frameless, electrically adjustable exterior mirrors
- Bluetooth
- CleanZone
- Driver Alert Control
- Electric tailgate with soft closing
- Driver display 12.3"
- Forward Collision Warning
- Speed limiter and cruise control
- Large, vertical display with touchscreen
- High-performance audio
- Interior rearview mirror with automatic dimming function
- ISOFIX attachment for front passenger seat and outer rear seats
- Collision avoidance and mitigation
- Paint finish: Magnesium Metallic
- Charging cable (7 meters) for standard wall sockets
- Steering wheel: Multifunction steering wheel, height and reach adjustable
- One pedal drive
- Polestar Connect
- Upholstery: embossed fabric with 3D etched decor
- Rain sensor
- Tire repair kit
- Rear view camera
- Rear lights, full-LED
- Keyless opening and starting
- Seat belts
- Seats: Semi-electric seats, front
- Lane Assist (LKA)
- 12V socket in the trunk
- Vehicle Deceleration Control
- Immobiliser
- 2 USB ports on the front
- Airbags, driver and front passenger
- Airbags: SIPS side airbags
- Armrest with cup holder and storage compartment
- Automatically folding exterior mirrors
- Hill start assist
- third brake light
- Connected Safety
- Front and rear parking assist
- First aid kit
- electric window regulator
- Front storage compartment 41 liters
- Transmission: Direct drive
- Back window, heater
- Infotainment powered by Android
- Integrated eSIM
- Electric child safety lock
- ECC 2-zone air conditioning
- Front and rear headrests
- Charging cable (6 meters)
- LED headlights, adaptive
- Automatic headlight range control
- Navigation system
- Electric parking brake
- Polestar Digital Key
- Radio accessories: Digital radio DAB+
- Indirect tire pressure monitoring
- Wheels: 19" alloy wheels with 5 V-spokes, black, diamond cut
- whiplash protection system
- Servotronic
- Seats: Split and foldable rear bench seat (40/60)
- Seats: Front seats with seat heating
- Electronic Stability Control (ESC) and traction control
- Textile floor mats
- Traffic Sign Information, RSI
- Hexagonal gear selector with illuminated Polestar symbol

Extra equipment

- Paint finish: Metallic
- Package: Pilot Little (Pilot Assist: keeps the vehicle in the center of the lane by intervening in the steering - Blind Spot Information system with steer assist - Adaptive Cruise Control - Cross Traffic Alert with brake support - Rear Collision Warning & Mitigation - Emergency Stop Assist - 360° camera - Side parking aid - LED front fog lights - Automatically dimming exterior mirrors)
- Long Range Single Engine
- Package: Plus (Panoramic glass roof with projected Polestar logo, heat pump, WeaveTech seats - Black Ash decor, electrically adjustable front seats with 4-way power lumbar support (memory for driver's seat), leg rest and storage nets in the backrest, heated rear seats, steering wheel and windshield washer nozzles, high-level interior lighting, Harman Kardon premium sound system with 13 speakers, 15W wireless smartphone charging, bag holders, tinted rear window, air quality)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Front bumper	Spoiler - Scratched - Smart repair
2	Rear bumper	Rear bumper - Scratch(es) - Smart repair
3	Interior	Interior - Odour - Ozone treatment
4	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value
5	2nd wheel set	1 alloy rim - Scratch(es) - Loss in value

Wear and tear

No.	Component group	Description
1	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - No deduction
2	Front bumper	Front bumper - Stone chips - No deduction
3	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.

Comments

Wartungshistorie gemäß Auftraggeber Informationen.

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.

ALPHABET



Figure 1: Diagonal front (left)

ALPHABET



Figure 2: Diagonal front (right)

ALPHABET



Figure 3: Diagonal rear (left)

ALPHABET



Figure 4: Diagonal rear (right)

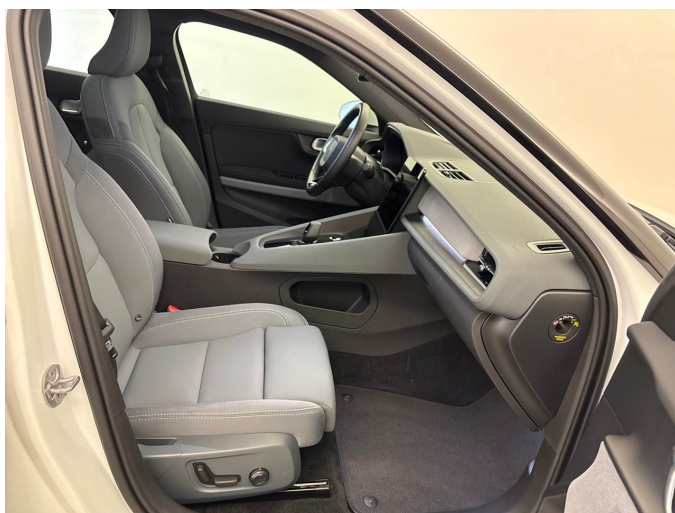


Figure 5: Interior - front

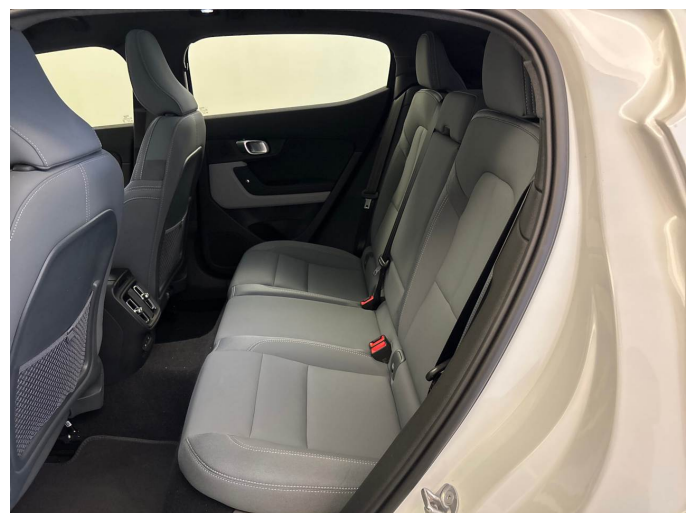


Figure 6: Interior - rear

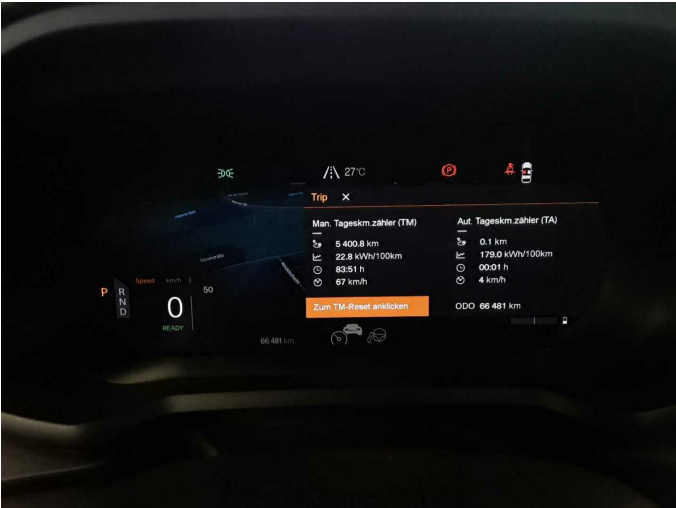


Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

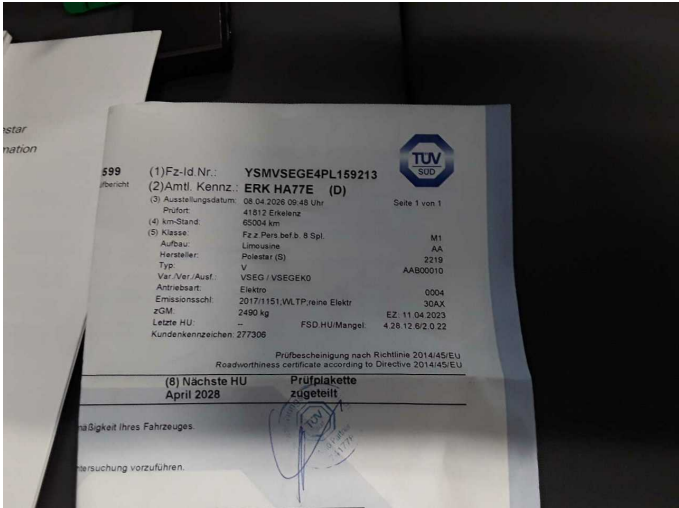


Figure 14: Documents

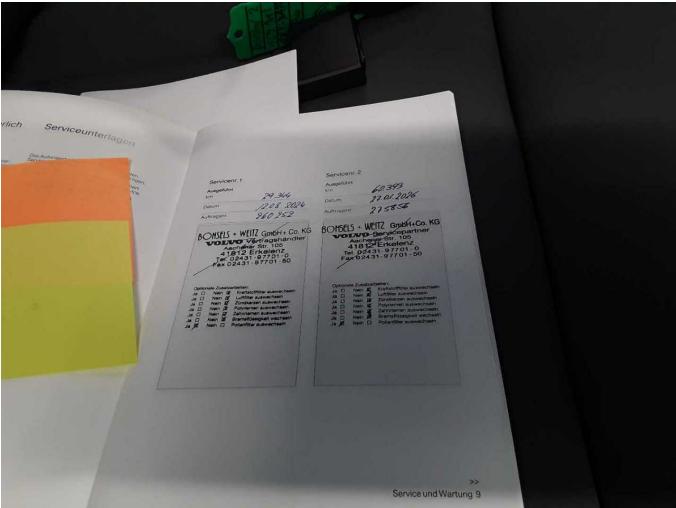


Figure 15: Documents



Figure 16: Additional tyres



Figure 17: Navigation



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.

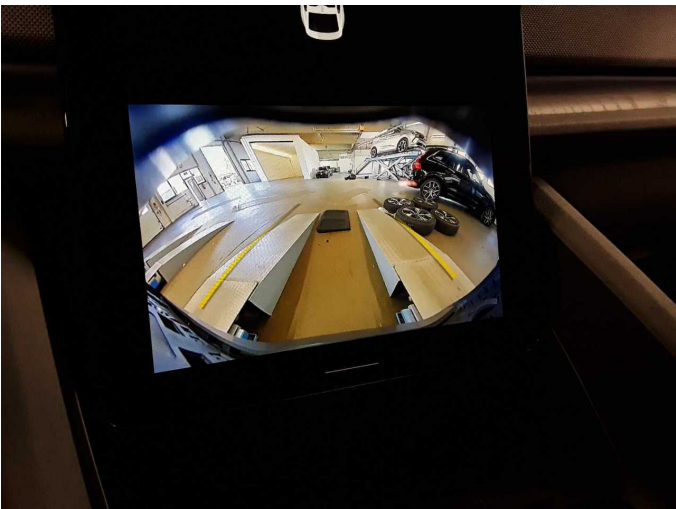


Figure 29: Misc.

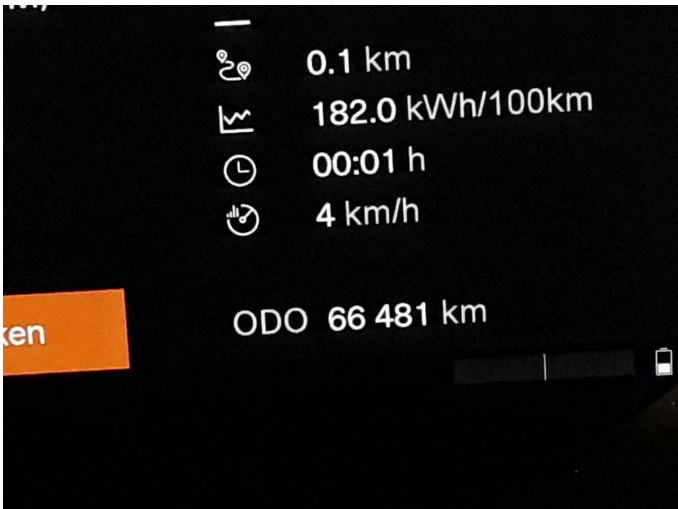


Figure 30: Misc.

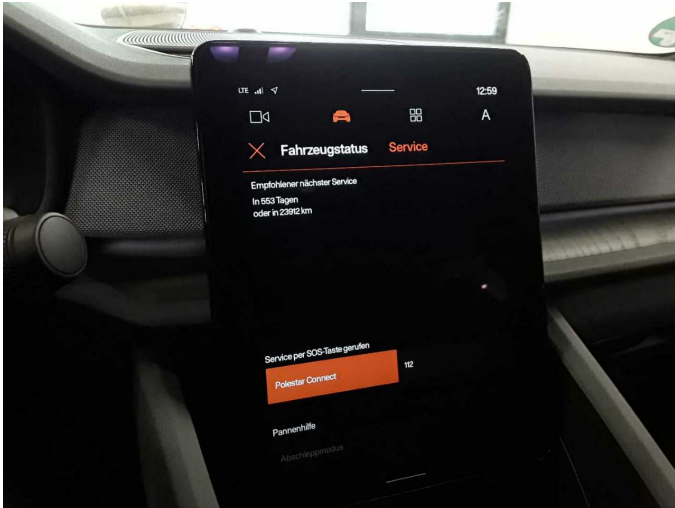


Figure 31: Misc.



Figure 32: Misc.



Damage 1: Front bumper: Spoiler - Scratched - Smart repair



Damage 1: Front bumper: Spoiler - Scratched - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 4: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 4: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 5: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Damage 5: 2nd wheel set: 1 alloy rim - Scratch(es) - Loss in value



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YSMVSEGE4PL159213

Hersteller / Modell: POLESTAR POLESTAR Polestar 2 Single Motor 78kWh

Datum	KM-Stand	Beschreibung
27.01.2026	60.393	Regelwartungsdienst