



Opel Grandland (UKL): 2CCP283

Vinnumber:	W0VZ4DGZ7N6818620	Versionname:	Grandland Ultimate 1.6T S/S Hybrid 225pk/cv 5p E-AT8
First Registrationdate:	3/06/2022	Fiscalpower:	
Expertise Mileage:	73210	Power Kw:	133
Bodytype:		Type of rims (mounted)	Aluminium
Gearbox:	Automatic		
Transmission:			
Fueltype:	Hybrid Petrol		
Maintenance	OK		
Battery functioning	Yes		
Type of rims (mounted)	Aluminium		
Certificate of Conformity	Yes		
Category	Passenger Car		
Registration Certificate Car (BE)	Yes		

Options

Number of keys total	2	Luggage cover	
GPS		Type of Tow bar	Tow bar removable
Type of Maintenance book	Digital maintenance		
Type of GPS storage	HD		

Tyres

225/55/18/102 V				
Winter tyres:	Fr.L.	Continental: 2 mm	Fr.R.	Continental: 3 mm
	Re.L.	Continental: 6 mm	Re.R.	Dunlop: 4 mm
Tyre profile depth FL	2.0			
Tyre profile depth FR	3.0			
Tyre profile depth RL	6.0			
Tyre profile depth RR	4.0			
Tyre size FL	225/55 R 18 102 V			
Tyre size FR	225/55 R 18 102 V			
Tyre size RL	225/55 R 18 102 V			
Tyre size RR	225/55 R 18 102 V			
Tyre type FL	Winter			
Tyre type FR	Winter			
Tyre type RL	Winter			
Tyre type RR	Winter			
Tyre make FL	256			
Tyre make FR	256			
Tyre make RL	256			
Tyre make RR	257			

Assistance equipment

Repair kit	Yes	Compressor	Yes
Number of charging cables (normal)	1		
Number of charging cables (rapid charge)	0		

Seat cover FL, Worn, Acceptable



Steering wheel, Worn, Acceptable



Bonnet, Dent(s), Acceptable



Bumper F, Scratch(es), Spot repair



Step L, Scratch(es), Acceptable



Door FL, Dent(s), Paintless dent repair



Door RL, Dent(s) and scratch(es), Acceptable



Internal boot lining R, Scratch(es), Acceptable



Charging cable (fast), Missing, Check



Boot carpet, Not original part, Check



Tailgate / Boot, Scratch(es), Repair and paint (complete)



Bumper R, Scratch(es), Repair and paint (complete)



Bumper moulding R, Scratch(es), Acceptable



Step R, Scratch(es), Acceptable




Alloy rim RR polished, Scratch(es), Repair and paint (complete)



Door RR, Scratch(es), Acceptable



Wing RR, Scratch(es), Acceptable

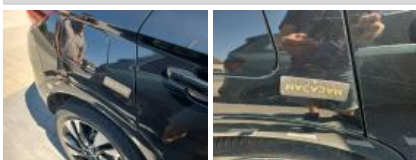

Wing FR, Scratch(es), Acceptable



Alloy rim FR polished, Scratch(es), Repair and paint (complete)



Tyres, Worn, Check



Kenteken	2CCP283
Merk Model	Opel Grandland Ultimate 1.6T S/S Hybrid 225pk/cv 5p E-AT8
Brandstofsoort	Benzine
Datum deel1	6/3/22

Datum reparatie	Kilometerstand	Reparatie omschrijving	Bewerking
9/18/25	60,750	bougie	Vervangen
9/18/25	60,750	onderhoud 3e jaar	Uitvoeren
7/19/24	41,257	luchtfILTER interieur	Vervangen
7/19/24	41,257	oliezeef	Vervangen
7/19/24	41,257	onderhoud 2e jaar	Uitvoeren
7/19/24	41,257	remvloeistof	Vervangen
7/20/23	25,469	oliezeef	Vervangen
7/20/23	25,469	onderhoud 1e jaar	Uitvoeren