



Expertise

Protocol number: 46820956
Order No. / Reference: 26781739
Inspection date: 31 Jul 2026

Manufacturer: Volvo

Model: XC40 Recharge 82 kWh Single M. Extended Range RWD
Ultimate

VIN: YV1XZEHR5R2350546



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volvo XC40 Recharge 82 kWh Single M. Extended Range RWD Ultimate	
Vehicle Identification number	YV1XZEHR5R2350546
Mileage (Read)	31,384 km
First registration	16 May 2024
Number of holders	1
Next periodical technical inspection	05/2027 (Report not on hand)
Fuel type	Electric
Power	128 kW
Gearbox / Number of gears	Direct drive / 1
Type of drive	Rear drive
Type of vehicle	SUV
Colour / colour code	FJORD BLUE Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black



Vehicle details			
Maintenance booklet / proof	Available / complete	Next maintenance in	27,374 km
Last service on / at	04/2026 at 28,758 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GY643142
Previous damage / Accident	None detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	9101 / BYK 00007		
Emission standard	2017/1151	fine dust sticker	
Permitted total weight	2,520 kg	Empty weight	

Tyres			
Mounted tyres			
#	Tyre size	Type of tyre	Tread depth
1)	235/50 R19 103H	All-season tyres on Light alloy	6mm / 6mm
2)	235/50 R19 103H	All-season tyres on Light alloy	6mm / 6mm

Replacement			
Typ	Tyre size	Type of tyre	Tread depth
	Tirefit	Expiration date 03/2029	

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment

Equipment

- Klimaautomatik

|



Standard equipment

- Waste bin integrated into center console (removable)
- Acoustic Vehicle Alerting System (AVAS)
- Passenger side airbag can be deactivated
- Airbags
- Airbags (airbags for driver and front passenger with two-stage deployment system - knee airbag for driver - side airbags for driver and front passenger - head/shoulder airbags for all occupants)
- Android infotainment system
- Android infotainment system (9" touchscreen (22.9 cm diagonal) - Bluetooth hands-free system incl. audio streaming - Digital vehicle owner's manual - Digital radio reception (DAB+) - Over-the-air updates (OTA)
- Fold-out (bag) hook on the glove compartment
- Heated exterior mirrors and rear window
- Hill start assist
- third brake light
- Convenient Entry and Start (vehicle start by pressing the brake pedal and engaging the forward (D) or reverse (R) gear)
- Deactivating the high-voltage battery
- Digital services including Google Maps navigation system
- Digital Services including Google Maps navigation system (Google Services (includes Google Maps, Google Assistant, Google Play Store and unlimited data volume) - Volvo On Call (includes, among other things, alerting the Volvo On Call service center at the touch of a button as well as additional convenience services via the Volvo Cars App))
- Driver Awareness
- Driver Awareness (Blind Spot Information System (BLIS) - Blind Spot Assist including Lane Change Warning for rapidly approaching vehicles - Cross Traffic Alert (CTA) - Cross Traffic Warning with braking intervention - Warning of vehicles, cyclists and pedestrians approaching from the side when reversing out of a parking space, including braking to a standstill if warning signals are ignored - Rear Impact Mitigation - Preventive protection in case of impending rear-end collisions)
- Advanced air purification system
- Foldable cargo floor with fastening system for carrier bags in the luggage compartment
- Electric windows front and rear (with auto-down and auto-up function)
- Front luggage compartment (31 liters)
- Luggage compartment partition net
- Transmission: 1-speed direct drive
- Front seat belt height adjustment
- Hooks for carrier bags in the luggage compartment (two on each side)
- Heated rear window
- Interior and exterior mirrors automatically dimming
- ABS - Anti-lock Braking System
- Acoustic Vehicle Alerting System (AVAS) (Acoustic pedestrian/cyclist protection through artificially generated driving noises in the speed range up to 20 km/h)
- Active safety belts with belt tensioners
- Alarm system with motion/tilt sensor and security lock
- Ambient lighting
- Ambient lighting (Extended interior lighting with: - Ambient lighting front and rear - Exit lights front and rear - Illuminated door pockets front and rear - Illuminated decorative inserts (in dashboard and front doors) - Work light on the tailgate - Illuminated footwell front and rear - Reading lights front and rear)
- Electrically adjustable exterior mirrors
- Hill descent control
- LED turn signals integrated into the exterior mirrors
- Convenient Entry and Start
- Anthracite headliner
- Roof edge spoiler
- Roof rails in high-gloss black (integrated)
- Deactivation of the high-voltage battery (in case of a collision)
- Digital Instrumentation 2nd Gen.
- Digital instrumentation 2nd generation (Full graphic 12.3" driver display (31.2 cm diagonal) with two variable round instruments and information display (e.g. for navigation map view))
- Driver Assistance
- Driver Assistance (Adaptive Cruise Control - Emergency Stop Assist (automatic emergency stop system if warnings are ignored due to the driver's failure to steer, brake and accelerate, including activation of the hazard warning lights and automatic braking to a standstill) - Pilot Assist (lane guidance assistant with adaptive cruise control up to speeds of 130 km/h))
- Pass-through hatch behind the center armrest in the rear
- Aluminum door sill plates with Recharge lettering, front
- Electronic Stability Control (ESC)
- Electronic differential lock
- Enhanced air purification system (with fine dust filtration according to air quality standard PM2.5)
- Electric windows front and rear
- Automatic emergency braking
- Automatic emergency braking (locking the vehicle after the airbags or seatbelt pretensioners have been deployed to prevent secondary accidents.)
- Cup holders (two) in the center console
- Hooks for carrier bags in the luggage compartment
- Automatic tailgate
- Automatic tailgate (electric)
- rear window wiper
- Interior lighting
- Intelligent Speed Assist



- Interior lighting (ambient lighting (white) front, illuminated make-up mirrors on driver and passenger side, welcome lighting front, headliner, front footwell, luggage compartment lighting on both sides, glove compartment, reading lights front)
- Keyless Drive
- Keyless Drive (electronic access system) with sensor-controlled tailgate, illuminated door handles and puddle lights
- Comfort opening/closing of the side windows via radio remote control
- Headrests of the 2nd row of seats can be folded down (electrically)
- Paint finish: Silver Dawn Metallic
- Charging cable Type 2/Type 2 (Mode 3) (6 m length, 3-phase, 16A (for connection to a charging station with Type 2 connector))
- LED fog lights
- LED headlights "Thor's Hammer"
- Steering wheel adjustable for height and reach
- Steering wheel: Multifunction buttons on the steering wheel
- Illuminated makeup mirror for driver and front passenger
- Front center armrest with integrated storage compartment
- Emergency brake lights (brake lights flash rapidly during heavy deceleration; hazard warning lights are automatically activated below 10 km/h)
- Optical override protection front and rear in high-gloss black
- Package: Winter Package
- Package: Winter Package (front seat heating - steering wheel heating - heat pump, support for air conditioning as well as heating or cooling of the high-voltage battery for range optimization)
- Electric parking brake
- Parking camera with 360° surround view (including front, side and rear parking aid with automatic braking intervention (rear))
- Radio: Premium Sound audio system by Harman Kardon
- Radio accessories: Voice function
- Radio accessories: Two USB-C ports in the center tunnel (front and rear)
- Recharge emblem on the C-pillar
- Rain sensor
- Tire pressure monitoring system
- Roadside Assistance
- Roadside Assistance (free mobility promise, 3 years and almost throughout Europe. Covers, for example, mechanical or electrical defects, tire problems, traffic accidents in which the vehicle is so badly damaged that it is unroadworthy, etc. Also applies in the event of premature change of ownership.)
- Wheels: 19" 5-spoke aero-design alloy wheels (diamond cut/high-gloss black with all-season tires 8.5 x 19", 235/50 R19 (front) and 8.5 x 19", 255/45 R19 (rear))
- Rear view camera
- Safety Assistance
- Intelligent Speed Assist (Intelligent speed assistant - warning when exceeding the maximum permitted speed)
- ISOFIX mounts
- ISOFIX mounting points (for the front passenger seat and the outer rear seats)
- Child safety lock for the rear doors (electric)
- Automatic climate control with 2-zone temperature control
- Automatic climate control with 2-zone temperature control (including separate temperature control for driver and front passenger, automatic blower control and air distribution - including air quality system with activated carbon filter)
- Front headrests
- Charging cable Type 2 / Type 2 (Mode 3)
- Charging indicator
- Charge control display (set current limit (from 6A) and charge level in steps of 10 % b to 100 %)
- LED fog lights (integrated into the front spoiler)
- LED headlights "Thor's Hammer" (with high beam assist and integrated LED daytime running lights)
- Steering wheel: Sports steering wheel
- Rear center armrest with two integrated cup holders
- Emergency brake lights
- One Pedal Drive
- One Pedal Drive (acceleration and deceleration to a standstill via the accelerator pedal - activation/deactivation via the menu - recuperation (brake energy recovery) as soon as the foot is taken off the accelerator pedal, to optimize the range)
- Panoramic glass sunroof with lifting function (electric)
- Panoramic glass sliding sunroof with lifting function (electric) (with integrated, continuously adjustable sunshade)
- Parking camera with 360° surround view
- Upholstery: Textile (Rivel Chine)
- Upholstery: Textile (Rivel Chine) (incl. rear center armrest - insert: Origin - headliner: Anthracite)
- Radio: Premium Sound audio system by Harman Kardon (600 watts of power - 13 speakers - Fresh Air subwoofer - Dirac Unison sound optimization)
- Recharge emblem on the rear of the vehicle
- Recharge Pure Electric front grille and grille surround in body color
- Tire pressure monitoring system (with tire-specific pressure loss warning)
- Run-off Road Protection
- Run-off Road Protection (preventive protection system in case of unintentional leaving the road or impending rollovers including emergency call via Volvo On Call and door unlocking)
- Wheels: 19" 5-spoke aero-design alloy wheels
- Wheels: Tire sealant
- Wheels: Tire sealant (Incl. 12-volt compressor, maximum speed 80 km/h)
- Rear seats can be folded down in a 60/40 split or completely.
- Headlight cleaning system
- Whiplash Protection System (WHIPS)



- | | |
|---|--|
| <ul style="list-style-type: none"> • Safety Assistance (Automatic emergency braking system with detection of vehicles, cyclists, pedestrians and large animals including intersection braking assistant and emergency braking assistant for oncoming traffic - Connected Safety - Driver Alert - Attention warning - Variable speed limiter - Cruise control - Lane Keeping Aid (LKA) - Active lane keeping assistant - Oncoming Lane Mitigation - Ready to Drive notification - Road Edge Detection - Road Sign Information (RSI) - Traffic sign recognition) • Speed-sensitive power steering • Seats: Passenger seat adjustable in height and length • Seats: Adjustable (manual) leg rest for driver and front passenger seats • Seats: Driver's seat height and length adjustable including tilt adjustment • Seats: Lumbar support (4-way adjustable) for driver and front passenger seats • Electric auxiliary heater with timer • Phone: Inductive smartphone charging system • Textile floor mats front and rear • Textile floor mats: Sport textile floor mats front and rear • First aid kit and warning triangle • Lashing eyes (four) in the luggage compartment • Warning tone/indicator when seat belts are not fastened (for all seats) • Central locking with two remote controls and integrated emergency key (including automatic locking of the doors while driving (can be deactivated)) | <ul style="list-style-type: none"> • Whiplash Protection System (WHIPS) (including immersion protection on all seats and energy-absorbing front seat cushions) • Side window surround in high-gloss black (bottom) • Service, maintenance and wear • Service, maintenance and wear and tear (includes vehicle maintenance according to manufacturer specifications as well as the replacement of wear parts. Covers a maximum of 100,000 km or 3 years, remains linked to the vehicle even if ownership changes. Billing is done via QW90.) • Seats: Electrically adjustable driver and passenger seats • Seats: Electrically adjustable driver and front passenger seats (with memory function for driver seat and exterior mirror settings (stored in the remote control)) • Sport exterior mirrors in high-gloss black • Sport front and rear apron • 12-volt socket at the front • Phone: Inductive smartphone charging system (Wirelessly charges smartphones that support the Qi standard on a charging pad) • Glazing: Colored glazing • Preparation for Trailer Stability Assist (TSA) • Immobiliser • Central locking system with two remote controls and integrated emergency keys |
|---|--|

Extra equipment

- | | |
|--|--|
| <ul style="list-style-type: none"> • Paint finish: Metallic paint | <ul style="list-style-type: none"> • Glazing: Side and rear windows tinted (from the B-pillar back) |
|--|--|

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Wheel / tyres	Alloy rim - front left side - Scratch(es) - Loss in value
2	Side panel - rear right side	Interior trim - Scratch(es) - Replace
3	Side panel - rear right side	Side panel (Spachtelmasse eingefallen und Einschluss) - Unprofessionally repaired - Repair and paint
4	Wheel / tyres	Alloy rim - rear right side - Scratch(es) - Replace
5	Wheel / tyres	Alloy rim - front right side - Scratch(es) - Replace



Wear and tear

No.	Component group	Description
1	Vehicle glazing	Windscreen - Stone chips - No deduction
2	Door - front left side	Door edge - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Repainting

No. Repainting

- 1 Door - rear right side, Professionally carried out, Invoice of repair done Non-existent
- 2 Side panel - rear right side, Unprofessionally carried out

Paint coat thickness measurement

Side panel - rear right side	175 µm	Door - rear right side	181 µm
------------------------------	--------	------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

No apparent prior damage that had been repaired could be found on the vehicle.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

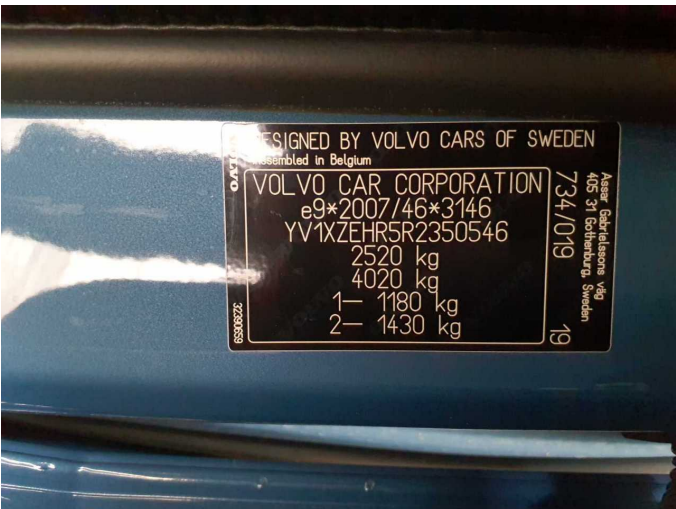


Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

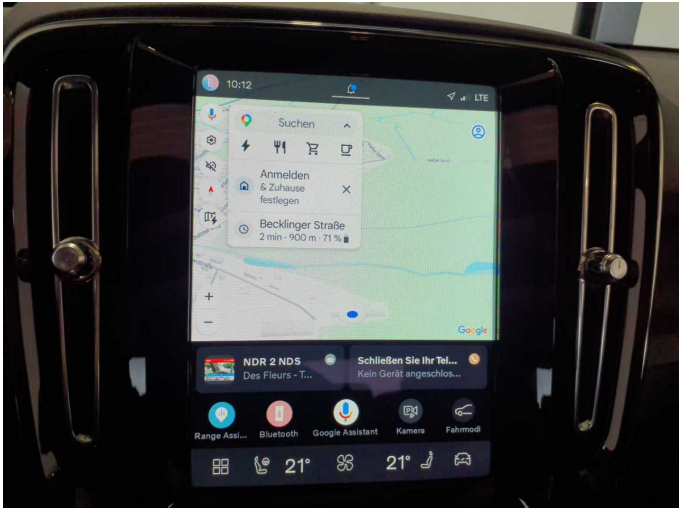


Figure 14: Navigation

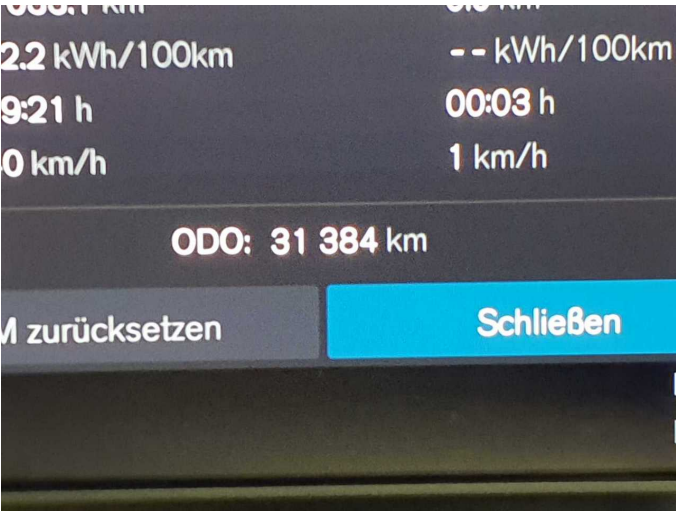


Figure 15: Misc.



Figure 16: Misc.



Figure 17: Misc.



Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

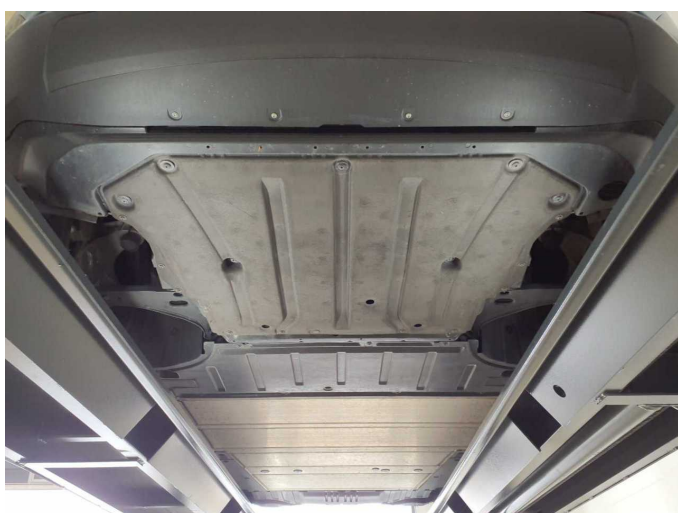


Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.

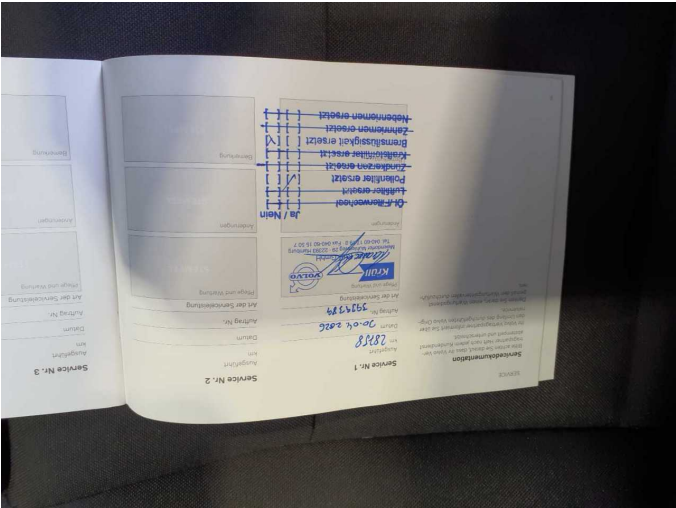


Figure 27: Misc.



Figure 28: Misc.




Damage 1: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 1: Wheel / tyres: Alloy rim - front left side - Scratch(es) - Loss in value



Damage 2: Side panel - rear right side: Interior trim - Scratch(es) - Replace

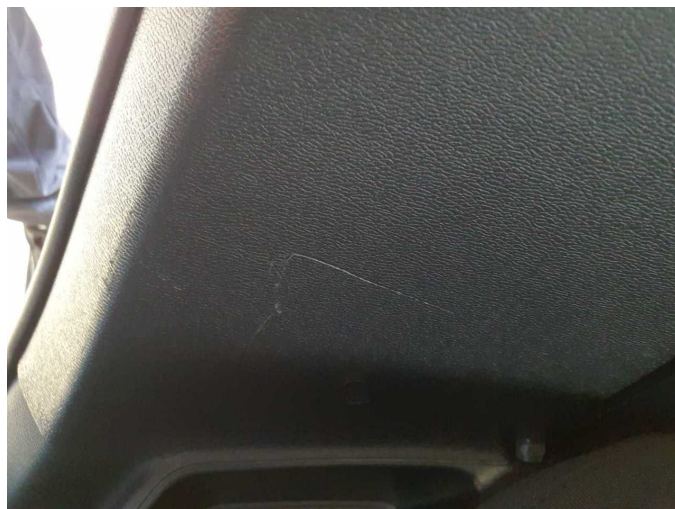

Damage 2: Side panel - rear right side: Interior trim - Scratch(es) - Replace



Damage 3: Side panel - rear right side: Side panel (Spachtelmasse eingefallen und Einschluss) - Unprofessionally repaired - Repair and paint



Damage 3: Side panel - rear right side: Side panel (Spachtelmasse eingefallen und Einschluss) - Unprofessionally repaired - Repair and paint



Damage 3: Side panel - rear right side: Side panel (Spachtelmasse eingefallen und Einschluss) - Unprofessionally repaired - Repair and paint



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Replace



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Replace



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Replace



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Replace



Damage 4: Wheel / tyres: Alloy rim - rear right side - Scratch(es) - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace




Damage 5: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace



Damage 5: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace




Damage 5: Wheel / tyres: Alloy rim - front right side - Scratch(es) - Replace

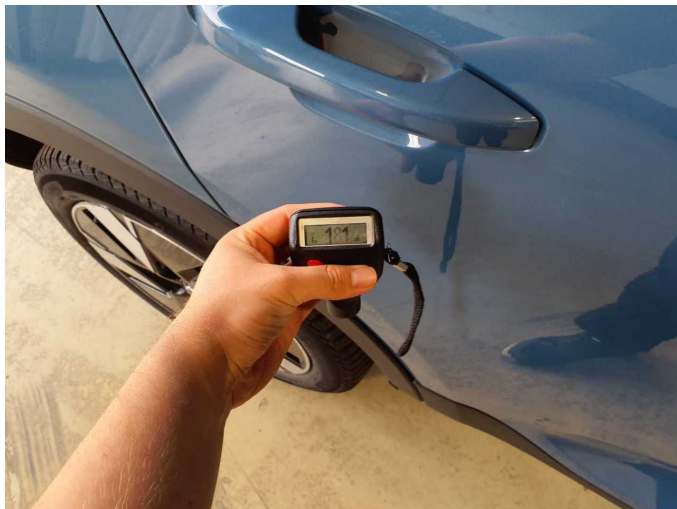

Repainting 1: Door - rear right side



Repainting 1: Door - rear right side

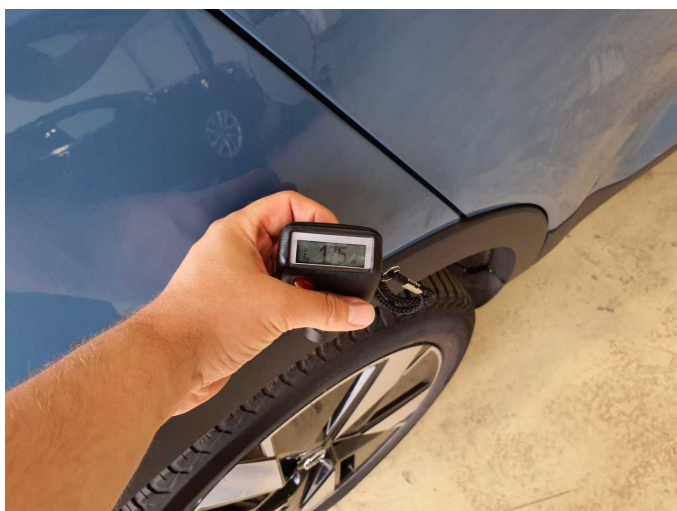

Repainting 2: Side panel - rear right side



Repainting 2: Side panel - rear right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: YV1XZEHR5R2350546

Hersteller / Modell: VOLVO VOLVO XC40 Recharge 82 kWh Single M. Extended
Range RWD Ultimate

Datum	KM-Stand	Beschreibung
30.04.2026	28.758	Regelwartungsdienst; Wartung Sonstiges