



Expertise

Protocol number: 46887899
Order No. / Reference: 26750386
Inspection date: 5 Aug 2026

Manufacturer: Skoda
VIN: TMBEK6PJXP4082534

Model: Fabia 1.5 TSI DSG Style



Vehicle details	
Manufacturer / Type / Model / Equipment	
Skoda Fabia 1.5 TSI DSG Style	
Vehicle Identification number	TMBEK6PJXP4082534
Mileage (Read)	41,958 km
First registration	8 Aug 2023
Number of holders	1
Next periodical technical inspection	08/2026
(Report not on hand)	
Fuel type	Petrol
Engine displacement / Cylinder	1,498 ccm / 4
Power	110 kW
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Saloon car
Colour / colour code	Graphit-Grau Metallic
Doors / Seats	5 / 5
Upholstery type	Cloth
Colour of upholstery	Black
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	9,100 km
Last service on / at	09/2025 at 21,045 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	GT118164
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	8004 / AXJ 00323		
Emission standard	EURO6	fine dust sticker	
Permitted total weight	1,670 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/45 R17 91V	Summer tyres on Light alloy	Bridgestone	4mm / 4mm
2)	215/45 R17 91V	Summer tyres on Light alloy	Bridgestone	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	195/55 R16 91H	Winter tyres on Light alloy	Goodyear	6mm / 6mm
2)	195/55 R16 91H	Winter tyres on Light alloy	Goodyear	7mm / 7mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 06/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.

Equipment

Standard equipment

- Airbag, driver and switchable passenger airbag
- Airbag: Front side airbags
- Traction control (ASR)
- Electrically adjustable and heated exterior mirrors
- Outside temperature display in the instrument cluster
- Hydraulic brake assist (HBA)
- Chrome trim strips on the side windows
- Light grey headliner
- Third brake light
- Electromechanical power steering
- Electronic Stability Control (ESC)
- Electric front windows
- Front radar assistant including city emergency braking function
- Transmission: 7-speed dual-clutch transmission (DSG)
- Tinted windows
- rear window wiper
- ISOFIX preparation on the front passenger seat and the outer rear seats
- The boot cover is stowable and removable.
- Fuel tank 40 l
- LED side indicators, integrated into the exterior mirrors
- Steering wheel: height and reach adjustable
- Front center armrest, including storage compartment
- Engine drag torque control (MSR)
- Multi-collision brake assistant (MKB)
- Fatigue detection
- Otto particulate filter
- Upholstery: Cloth
- Radio: Skoda surround sound system
- Radio accessories: 4 speakers
- Radio accessories: Digital radio reception DAB+
- Radio accessories: SmartLink
- Rain sensor including driving light assistant and automatic interior mirror dimming
- Rear disc brakes
- Seats: Rear seat backrest split 60:40, foldable
- SKODA Care Connect
- Sun visors on the driver and passenger side, with make-up mirrors
- Start/stop system including brake energy recuperation
- Immobiliser
- Airbag, head airbags
- Anti-lock braking system (ABS)
- Dashboard in black
- Exterior mirrors and door handles in body color
- Hill start assist
- Glasses compartment in the headliner
- roof grab handles four
- Tachometer
- Ice scraper in the fuel filler flap
- Electronic transverse differential lock (XDS+)
- Driving light assistant
- High Beam Assist (Light Assist)
- Floor mats
- Cruise control system (cruise control) including speed limiter
- Heated rear window
- Interior decor Metallic Grey
- KESSY, keyless entry and start-stop system
- Air conditioning including odor and allergen filter
- Front headrests (2)
- Chrome grille surround
- LED ambient lighting
- Steering wheel: Multifunction leather steering wheel
- Center console in black
- Multifunction display with on-board computer in the instrument cluster
- Fog light
- Package: Winter
- Radio: Bolero infotainment system
- Radio accessories: 2 USB-C ports on the front
- Radio accessories: Bluetooth hands-free system
- Radio accessories: Rear speakers (2 pieces)
- Umbrella and broom compartment in the driver's door
- Tire pressure monitoring
- Wheels: Tire Mobility Kit
- Seat belts
- Seats: Front seats are height-adjustable
- SKODA Infotainment Online
- Speed limiter
- Lane keeping assistant (Lane Assist)
- High-visibility vest compartment in the front doors
- Central locking including remote control and 2 remote folding keys



Extra equipment

- Adaptive cruise control (ACC) with a control range up to 210 km/h
- Fuel tank 50 l
- LED headlights with integrated cornering and turning lights (the turning lights in the headlights may replace the turning lights integrated into the fog lights)
- Package: Colour Concept Black (contrast paint finish of the vehicle roof, exterior mirror caps and A-pillars in Black Magic Pearl Effect)
- Panoramic glass roof
- Parking assist system including front and rear parking sensors
- Wheels: 17" alloy wheels Procyon Black (with black aero cover 7x17 ET51 tires 215/45 R17)
- Sunset (rear window and rear side windows tinted dark)
- Electrically folding exterior mirrors (interior and exterior mirrors (driver's side) with automatic dimming)
- Paint finish: Metallic and pearl effect for Colour Concept Black
- Package: Business (Bluetooth hands-free system - Phonebox with inductive charging function - Amundsen navigation system: 9.2" multi-touch display, FM, RDS FM, internet radio, MP3 and WMA playback, SD memory card slot, 2x USB-C ports, 3D navigation, 64 GB, gesture control, internet search functions, vehicle information display - Infotainment Online (3-year subscription) - traffic sign recognition - Wireless SmartLink (Android Auto, Apple CarPlay) - variable load floor in the trunk - voice control)
- Reversing camera with washer nozzle

Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Side panel - rear left side	Side panel - dent(s) - Smooth repair work
2	Door - front left side	Door - Scratch(es) - Smart repair
3	Door - rear left side	Door - Scratch(es) - Smart repair
4	Mudguard - right side	Mudguard - right side - Dent / paintcoat damage - Repair and paint
5	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Misc.	Main inspection - No evidence - No deduction
2	Vehicle glazing	Windscreen - Stone chips - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Front, Provided by user / customer	1.044,30 €

Repainting

No.	Repainting
1	Bonnet, Professionally carried out



Paint coat thickness measurement

Bonnet

347 µm |

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(*Delivery by third-party service providers*)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(*Functional testing of driver assistance systems is not included in the scope of services!*)
- a photographic documentation of the vehicle

Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

- Winterradsatz ist kein Bestandteil des Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area

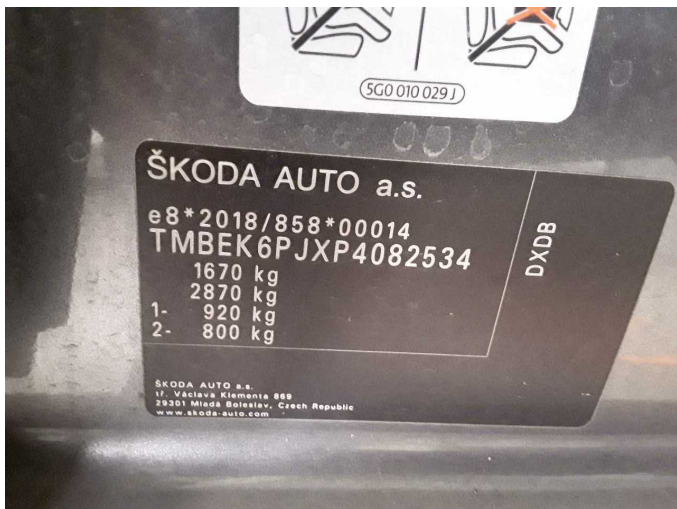


Figure 11: VIN



Figure 12: Mounted tyres

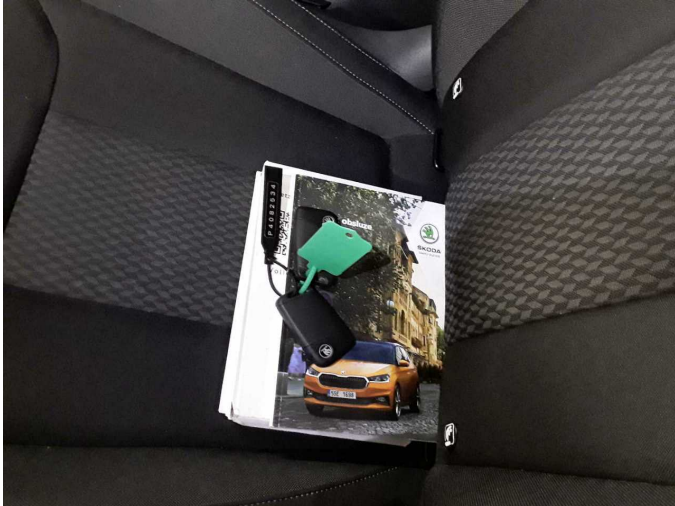


Figure 13: Documents



Figure 14: Additional tyres



Figure 15: Additional tyres



Figure 16: Navigation

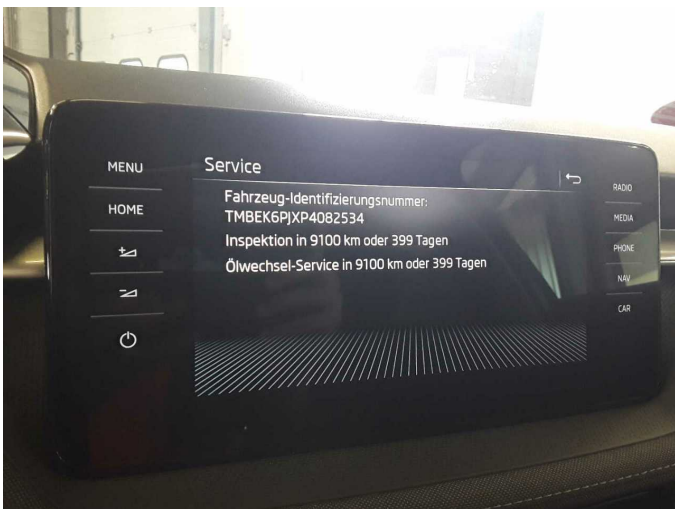


Figure 17: Misc.

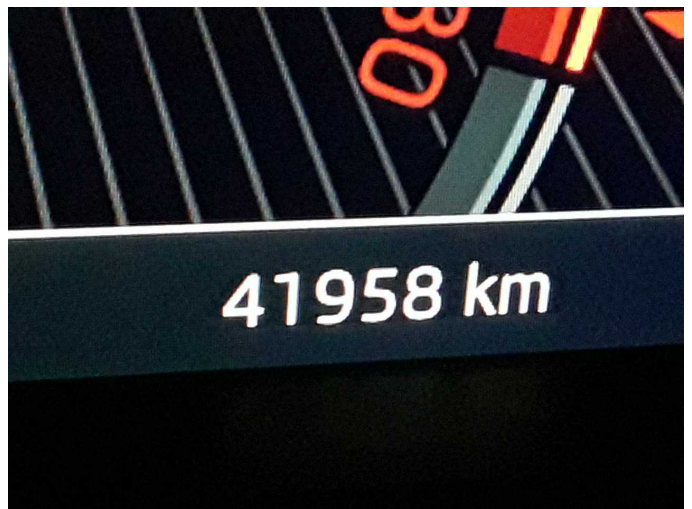


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.

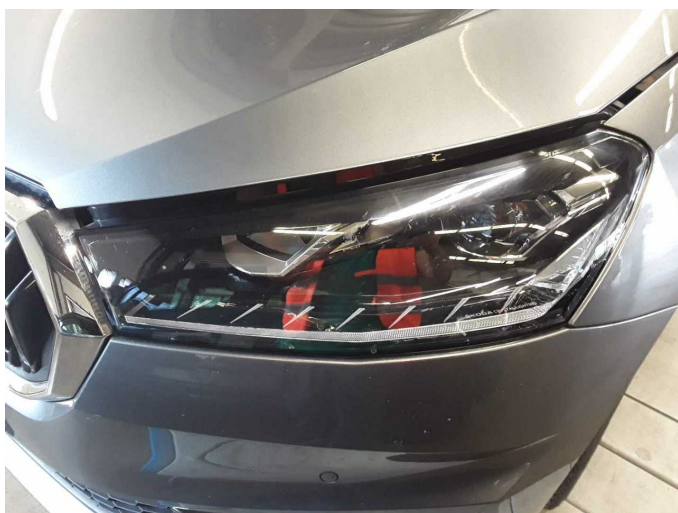


Figure 23: Misc.

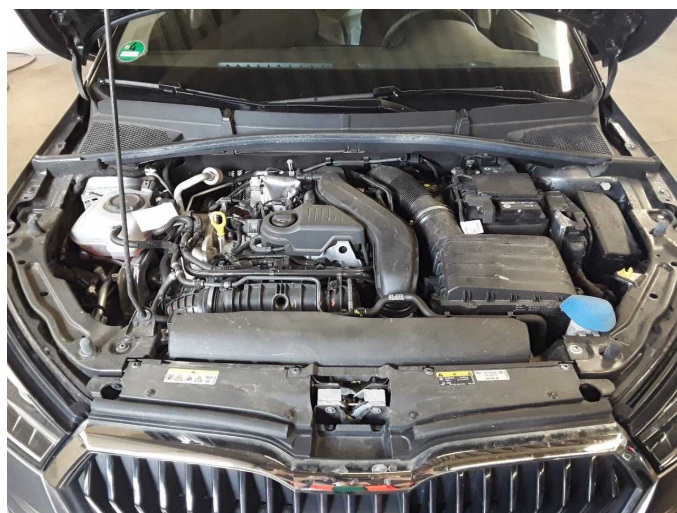


Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.


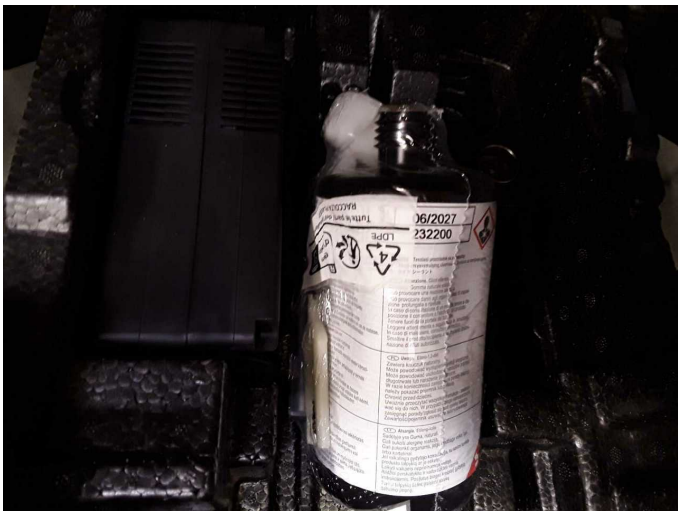



Figure 28: Misc.



Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

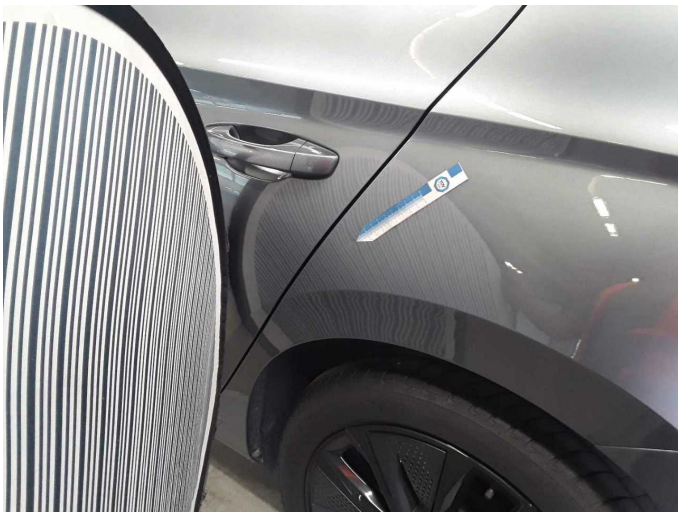

Damage 1: Side panel - rear left side: Side panel - dent(s) - Smooth repair work

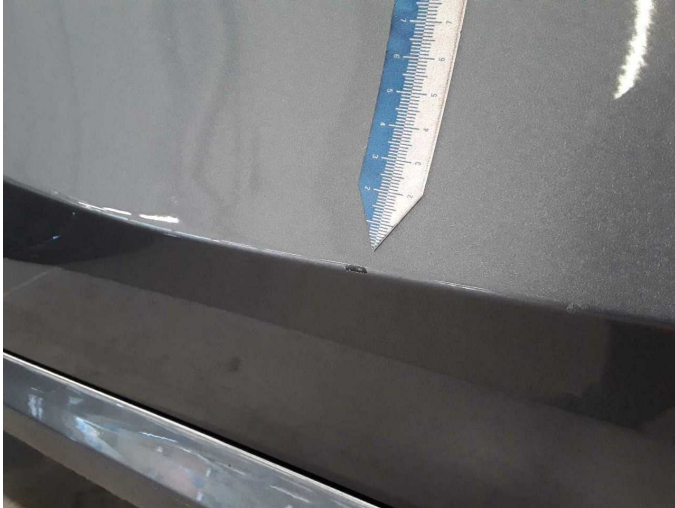

Damage 2: Door - front left side: Door - Scratch(es) - Smart repair



Damage 2: Door - front left side: Door - Scratch(es) - Smart repair



Damage 3: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 3: Door - rear left side: Door - Scratch(es) - Smart repair



Damage 4: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Repair and paint



Damage 4: Mudguard - right side: Mudguard - right side - Dent / paintcoat damage - Repair and paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Damage 5: Front bumper: Front bumper - Scratched - Paint



Bonnet: 347 µm



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: TMBEK6PJXP4082534

Hersteller / Modell: SKODA SKODA Fabia 1.5 TSI DSG Style

Datum	KM-Stand	Beschreibung
08.09.2025	21.045	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges