



PEUGEOT 2008: GE-622-JF

Vinnumber:	VR3USHNKKMJ950511	Versionname:	PEUGEOT 2008 PureTech 100 S&S ACTIVE PACK VP [5P] bvm 6-100CH-5cv (SUV)
First Registrationdate:	27/01/2022	Fiscalpower:	
Expertise Mileage:	88729	Power Kw:	75
Bodytype:	Berline	Body colour:	Dark Grey
Gearbox:	MAN 6 VIT	Paint type:	Metallic
Transmission:	Front	Interior colour:	Black
Fueltype:	Petrol	Type of rims (mounted):	Aluminium
Engine functioning:	Yes	Dashboard color:	Black
Battery functioning:	Yes		
Vehicle running:	Yes		
Number of doors:	5		
Number of seats:	5		
Number head rests:	5		
Type of rims (mounted):	Aluminium		
Category:	Passenger Car		

Options


Number of keys total	2	Radio	
Number keys remote	1	Luggage cover	
GPS big screen color		Headlights Xenon/LED/Laser	
Windows electric F		Rear parking sensors	
Windows electric R		Seat cover lining	Lining Other
Cruise Control			
Steering wheel multifunctional			
Steering wheel leather			
Type of climate control	Autom climate control		

Tyres

215/65/16/102 H				
Winter tyres:	Fr.L.	Michelin: 65%	Fr.R.	Michelin: 65%
	Re.L.	Michelin: 40%	Re.R.	Michelin: 55%
Tyre profile depth FL				4.0
Tyre profile depth FR				4.1
Tyre profile depth RL				5.6
Tyre profile depth RR				4.5
Tyre size FL				215/65 R 16 102 H
Tyre size FR				215/65 R 16 102 H
Tyre size RL				215/65 R 16 102 H
Tyre size RR				215/65 R 16 102 H
Tyre type FL				Winter
Tyre type FR				Winter
Tyre type RL				Winter
Tyre type RR				Winter
Tyre make FL				261
Tyre make FR				261
Tyre make RL				261
Tyre make RR				261

Assistance equipment

Seat cover FL, Stain, Cleaning

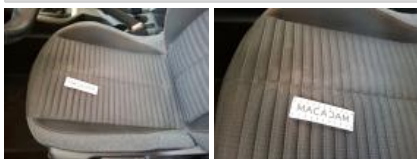

Seat cover RR, Stain, Cleaning



Tyre FL, Out of tolerance, Replace



Tyre RL, Out of tolerance, Replace



Tyre RR, Out of tolerance, Replace



Tyre FR, Out of tolerance, Replace



Alloy rim FR, Scratch(es), Repair/replace (lump sum)



Wing FL, Scratch(es), Paint



Outside rear-view mirror housing L, Scratch(es), Paint



Side repeater L, Scratch(es), Replace



Door FL, Dent(s) and scratch(es), Repair and paint (complete)



Door RL, Dent(s) and scratch(es), Repair and paint (complete)



Wing trim FL, Scratch(es), Replace



Bumper F, Scratch(es), Paint



Bumper spoiler F, Scratch(es), Replace



Bonnet, Scratch(es), Paint



Wing RR, Dent(s), Repair and paint (complete)



Door RR, Dent(s) and scratch(es), Repair and paint (complete)



Side repeater R, Scratch(es), Replace



Outside rear-view mirror housing R, Scratch(es), Paint



Door FR, Scratch(es), Paint



Wing FR, Scratch(es), Paint



Wing trim FR, Scratch(es), Replace



Door trim RR, Scratch(es), Replace



Door trim FR, Scratch(es), Replace



Bumper moulding R, Scratch(es), Paint



Bumper corner RR, Scratch(es), Paint



Tailgate / Boot, Dent(s), Repair and paint (complete)



Roof, Hail damage, Repair and paint (complete)





Historique Maintenance

Immatriculation: **GE-622-JF** Date de 1ère immatriculation: **27/01/2022**

Modèle: **Peugeot 2008 PureTech 100 S&S ACTIVE PACK VP [5P] bvm 6-100CH-5cv (SUV)**

Date	Kilométrage	Fournisseur	Descriptif
25/03/2026	85.662	DEKRA AUTOMOTIVE TRAPPES	Contrôle technique
03/03/2026	83.946	SOCIETE DE DISTRIBUTION DES AUTOMOBILES DU LIMOUSIN	TUYAU DE CARBURANT RPLT
	0		REVISION
	0		DIVERS CLIM
	0		BOITIER D ALLUMAGE RPLT
	0		FILTRE A AIR RPLT
	0		DIVERS ELEC
	0		LIQUIDE DE FREIN
	0		FILTRE CLIM RPLT
04/09/2025	75.102	STELLANTIS &YOU FRANCE SAS	DIAG
15/05/2025	62.776	STELLANTIS &YOU FRANCE SAS	FILTRE CLIM RPLT
	0		BALAI ESSUIE GLACE AR
	0		BALAIS ESSUIE GLACE AV
	0		DISQUES PLAQUETTES AV RPLT
	0		REVISION
14/03/2023	19.355	XXEME CORPS AUTOMOBILE	RECYCLAGE
	0		FILTRE CLIM RPLT
	0		REVISION