



Expertise

Protocol number: 46547019
Order No. / Reference: 26681055
Inspection date: 16 Jul 2026

Manufacturer: Volkswagen

Model: Caddy 2.0 TDI BMT (5-Si.) DSG Style

VIN: WV2ZZZSK5RX055064



Vehicle details	
Manufacturer / Type / Model / Equipment	
Volkswagen Caddy 2.0 TDI BMT (5-Si.) DSG Style	
Vehicle Identification number	WV2ZZZSK5RX055064
Mileage (Read)	95,129 km
First registration	29 Feb 2024
Number of holders	1
Next periodical technical inspection	02/2027
(Report not on hand)	
Power / Engine displacement	90 kw / 1,968 ccm
Fuel type / Cylinder	Diesel / 4
Gearbox / Number of gears	Automatic / 7
Type of drive	Front drive
Type of vehicle	Van
Colour / colour code	Deep Black Perleffekt (C9X)
Doors / Seats	5 / 5
Upholstery type	Cloth / leather combination
Colour of upholstery	Black-Anthracite
Vehicle with smoke odor	no



Vehicle details

Maintenance booklet / proof	digital proof / complete	Next maintenance in	300 km
Last service on / at	01/2026 at 65,336 km		
Key is / should be	2 / 2	FZG documents	ZB#2 (B) was available (copy), ZB#1 (S) was not available.
		Letter No.	HA887691
Previous damage / Accident	Detectable	Repainting	Detectable
Inspection conditions	sufficient	Lifting equipment / pit	yes
Test drive	Not performed	Engine function test	Performed
Manufacturer key number/ type code number	0603 / CLH 01117		
Emission standard	EURO6;WLTP;AP;PI/CI; M, N1 I	fine dust sticker	
Permitted total weight	2,250 kg	Empty weight	

Tyres

Mounted tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98H	Summer tyres on Light alloy	Continental	4mm / 4mm
2)	215/55 R17 98H	Summer tyres on Light alloy	Continental	5mm / 5mm

Additional tyres

#	Tyre size	Type of tyre	Manufacturer	Tread depth
1)	215/55 R17 98V	Winter tyres on Light alloy	Semperit	4mm / 4mm
2)	215/55 R17 98V	Winter tyres on Light alloy	Semperit	4mm / 4mm

Replacement

Typ	Tyre size	Type of tyre	Manufacturer	Tread depth
	Tirefit	Expiration date 12/2027		

Legend: Tread depth information for the left tire is listed first, for the right tire it is listed second on the axle in the direction of travel.



Equipment



Standard equipment

- Waste bin with removable lid (for driver's cab)
- Storage compartments: Storage tray on the headliner with 2 roof grab handles in the driver's cab
- Airbag: Side and head airbags for driver and front passenger (head airbags for the outer rear seats - center airbag in the front)
- Exterior mirror housings in black, door handles in body color and sliding door track in black
- Floor coverings, carpeting in the driver's cab and passenger compartment (carpeting in the driver's cab and passenger compartment)
- Roof rails, painted silver
- Parking assistance in the front and rear areas
- Electrical interface for external use (2 USB ports (Type C) in the center console, front - 2 USB charging ports (Type C) on the center armrest at the rear)
- Automatic headlight control, with daytime running lights (greeting and farewell lights)
- Window: Side window in the passenger/cargo compartment, rear left, permanently installed
- Window: Side window in the passenger/cargo compartment, front left, permanently installed
- Windows: Front side windows in heat-insulating glass (rear side windows and rear window tinted, 74% light-absorbing)
- Cruise control system including speed limiter
- Glove compartment with lid, illuminated
- Tailgate with window cutout
- Interior lighting: in the passenger compartment (LED reading lights)
- Electric child safety lock for sliding doors
- Child seat anchorage (I-Size) and top tether (for seats in the passenger compartment (except the middle seat of the 2nd row))
- Fuel fill quantity, standard fuel initial fill (5 liters)
- Paint protection/transport protection film (transport protection film (minimum protection) with additional transport protection measures)
- Steering column adjustable in height and tilt
- Headlight range control
- Front center armrest (height and length adjustable with 2 cup holders in the front and 2 air vents in the rear)
- Fatigue detection
- Emergency braking assistant "Front Assist" (with pedestrian and cyclist detection)
- Upholstery: Microfleece/leather look (seat center panel in microfleece "ArtVelours", seat bolsters in leather look)
- Radio accessories: 6 speakers
- Radio accessories: Digital radio reception DAB+
- Wheels/Tires: 215/55 R 17 98 H XL, optimized for low rolling resistance
- Wheels/Tires: Tire pressure monitoring system
- Rear View reversing camera
- Gearshift DSG (with shift-by-wire technology)
- Storage compartments and boxes (drawers under the front seats)
- Airbag for driver and front passenger (with passenger airbag deactivation)
- Evasive steering assist and turn assist
- Exterior mirrors, electrically adjustable, heated and folding
- Reinforced battery (70 Ah/ 420 A)
- Operating voltage 12 V
- Brake booster
- third brake light
- Cockpit trim, high-gloss black
- Three-phase generator 140 A
- Front door sill trims in silver
- Electronic parking brake including auto-hold function
- Electronic Stability Program with Brake Assist (including Anti-lock Braking System (ABS), Traction Control System (ASR), (EDS and MSR))
- Windows: Heated rear window
- Window: Side window in the passenger/cargo compartment, rear right, permanently installed
- Window: Side window in the passenger/cargo compartment, front right, permanently installed
- Windows: Laminated glass front pane in heat-insulating glazing
- Luggage compartment cover, extendable and removable
- Transmission: DSG (dual-clutch transmission), 7-speed automatic
- Rear window wiper/washer system with intermittent function
- Instrument cluster (km/h) (displays for speed, total/trip distance, engine speed, fuel level and time)
- Air conditioning system "Air Care Climatronic" with 2-zone temperature control and air purification function
- Headrests (2), height adjustable
- Paint finish: Solid (Candy White)
- LED headlights with LED daytime running lights
- LED taillights
- Steering wheel: Multifunction steering wheel in leather (DSG)
- Air vents, front with chrome trim
- Multifunctional camera
- Multi-collision brake
- Non-smoking version
- eCall emergency call system
- Particulate filter: Diesel particulate filter (incl. SCR and AdBlue tank)
- "Composition Audio" radio with 20.96 cm (8.25 inch) color touchscreen
- Wheels, tires: Covers for alloy wheels
- Wheels/Tires: "Colombo" alloy wheels 6.5 J x 17, glossy black
- Wheels: Tire Mobility Set (12-volt compressor and tire sealant)
- Windscreen wiper intermittent control with light and rain sensor
- Keys for locking system: 2 remote control flip keys
- Side indicator lights



- Sliding door, left side in the passenger/cargo area
- Sliding door, on the right in the passenger/cargo area
- Side paneling for comfort in the passenger compartment
- Speed-sensitive power steering (Servotronic)
- Seat belts: in the passenger compartment (with belt tensioners for the outer seats in the 2nd row)
- Driver's cab seats: Height adjustment for both front seats, manual
- Seats in the driver's cab: Lumbar support manually adjustable, left and right
- Seats: Folding tables on the backrests of the seats in the 1st row.
- Seats: Seat left and right, in the 1st row
- Lane keeping assistant "Lane Assist"
- Start-stop system (with brake energy recuperation)
- Bumpers in body color
- First aid kit, warning triangle and high-visibility vest
- Prepared for "We Connect" and "We Connect Plus"
- Electronic immobilizer
- Registration as a passenger car
- Auxiliary heating: Electric auxiliary air heater

Extra equipment

- Operating voltage 12 V with 230 V socket (Schuko socket)
- Driver assistance systems "Travel Assist", lane keeping assist "Lane Assist" and "Emergency Assist"
- High beam assistant "Light Assist"
- Tailgate with window cutout and closing aid
- Child seat anchorage (I-Size) and Top Tether (for seats in the passenger compartment (except middle seat of the 2nd row) plus I-Size front passenger side)
- Navigation system "Discover Pro" (Life, PanAmericana, Style) (25.4 cm (10 inch) color touchscreen - Streaming & Internet - Voice control - "Comfort" phone interface with inductive charging function - App-Connect including App-Connect Wireless for Apple CarPlay and Android Auto - Traffic sign recognition)
- Park Assist and front and rear parking aid
- Smoker's version (12V socket with cigarette lighter and ashtray)
- Wheels/Tires: Tire pressure monitoring system (direct measuring)
- Sliding door, right side in passenger/cargo compartment with closing aid
- Lane change assistant "Side Assist" including "Blind Spot Detection"
- 12-volt sockets in the instrument panel and in the cargo area
- Underride protection (for engine and transmission, made of plastic)

- Seat belts: Three-point automatic seat belts (front with belt height adjustment and electric belt tensioners)
- Automatically dimming interior safety mirror
- Seats in the driver's cab: Backrest release for the right front seat
- Seats in the passenger compartment: 3-seater bench in the 2nd row (foldable, rollable and removable) (ISOFIX and Top Tether on outer seats in the passenger compartment - 3 rear headrests)
- Sun visors with mirrors, airbag label on passenger sun visor
- Power outlets: 12-volt socket in the cargo area
- Telephone: Mobile phone interface
- Lashing points: 4 lashing points for securing cargo
- Warning tone and light for unfastened front seat belts
- Central locking with keyless start system "Keyless Start" without safe locking
- Additional dust protection seal on the outside

- Anti-theft alarm system with interior monitoring, backup horn and tow-away protection (central locking with separate driver's door unlocking)
- Floor mats: Textile floor mats front and rear
- Interior lighting: in the passenger compartment (LED reading lights - LED tailgate lighting)
- Paint finish: Pearl effect
- LED main headlights (Style) (Dynamic headlight range control - Bad weather light and cornering light (LED technology))
- Package: Winter package "Basic" and auxiliary heater (heated windshield washer nozzles at the front - seat heating for seats in the driver's cab, left and right, separately adjustable - auxiliary heater for windshield defrosting and heating/ventilation with remote control - washer fluid level indicator with enlarged washer fluid reservoir)
- Sliding door, left side in passenger/cargo compartment with closing aid
- Cab seats: AGR ergoComfort seats, left and right (Life, Move, Style) (front seats height-adjustable and seat cushion tilt and depth adjustment for both front seats - 4-way lumbar support, electrically adjustable, left and right)
- Partition net: Luggage net in the cargo/passenger compartment
- First aid kit, warning triangle and 2 high-visibility vests
- Central locking with keyless locking and starting system "Keyless Access/Advanced" (with safe locking)



Brief expert findings

Documents submitted	At the time of the inspection, the vehicle registration certificate Part 2 (title) was available, but the vehicle registration certificate Part 1 (document) was not. (Copy)
VIN comparison	The vehicle identification number (VIN) was read from the vehicle and its conformity with the submitted documents was confirmed by the undersigned during the inspection.
Inspection	The inspection conditions were sufficient for the assessment of the vehicle. Lifting equipment and/or a pit were available for examining the vehicle.
Test drive	No test drive/shunting maneuver was carried out during the inspection of the vehicle.
Engine function test	An engine test run was performed.

Value reducing factors

No.	Component group	Description
1	Sill - right side	Sill - dent(s) - Smooth repair work
2	Rear bumper	Rear bumper - Scratch(es) - Smart repair
3	Front bumper	Front bumper - Scratched - Paint

Wear and tear

No.	Component group	Description
1	Side panel - rear left side	Side panel - Scratch(es) - No deduction
2	Boot lid / rear door	Trim rear door - plywood - lower - Scratch(es) - No deduction

The vehicle shows signs of wear and tear commensurate with its age and use.

Previous damages

No.	Previous damage	Extent of damage (Net)
1	Side right, Provided by user / customer, from 19 Nov 2021	970,00 €

Repainting

No.	Repainting
1	Door - front right side, Professionally carried out, Invoice of repair done Non-existent

Paint coat thickness measurement

Door - front right side	248 µm
-------------------------	--------

Order/Scope of Order

An order was placed to prepare a sales report for the described vehicle. This report includes the following:

- Description of key vehicle information
- Documentation of equipment features
(Delivery by third-party service providers)
- Documentation of damage, defects, missing parts
- Documentation of prior damage, unrepaired prior damage, repainting
- A brief visual or functional inspection of the equipment details, if possible.
(Functional testing of driver assistance systems is not included in the scope of services!)
- a photographic documentation of the vehicle



Basis for the order

This product is based on the guidelines for vehicle returns and valuations published by Alphabet Fleet GmbH. The expert makes the specific findings in each individual case objectively, within the framework of the prescribed standards, based on their own expertise.

The vehicle inspection takes place in a fully assembled, unassembled state.

Damage or defects that can only be detected during disassembly/diagnostic work or through further investigation remain within the realm of prognostic risk. An increased risk exists due to concealed defects caused by fraudulent misrepresentation and which were not identifiable by the expert.

Damage or defects resulting from normal use or wear and tear of the vehicle will be accepted in accordance with the applicable standard.

There was no explicit identification or monetary consideration of the expected features within the product.

Features which, in their nature and extent, slightly exceed normal use but do not constitute unacceptable damage, will be documented and indicated as signs of wear, if applicable.

Damage or defects that, according to the applicable standard, can no longer be attributed to normal use or wear and tear are listed under "Value Reducing Factors" in the product description.

Depending on the product specification, a monetary ID can be provided. If this takes place, the costs can be 100% d or pro rata depending on the vehicle's age and mileage.

Previous damages

According to available information previous damages were repaired at the vehicle. Traces of repairs, which allow conclusions about the area of repair, were not recognizable during the inspection.

Comments

Der beiliegende Winterradsatz ist kein Bestandteil der Auslieferungsumfangs.



Figure 1: Diagonal front (left)



Figure 2: Diagonal front (right)



Figure 3: Diagonal rear (left)



Figure 4: Diagonal rear (right)



Figure 5: Interior - front



Figure 6: Interior - rear



Figure 7: Instrument cluster



Figure 8: Instrument panel



Figure 9: Interior 360° view



Figure 10: Cargo area



Figure 11: VIN



Figure 12: Mounted tyres



Figure 13: Documents

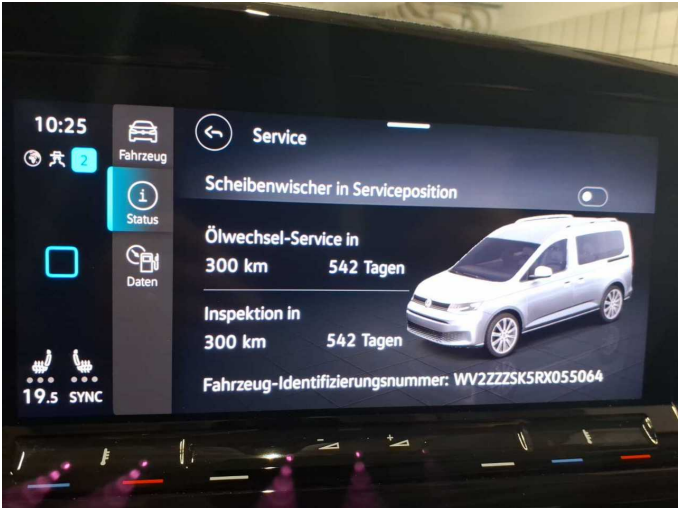


Figure 14: Documents



Figure 15: Additional tyres

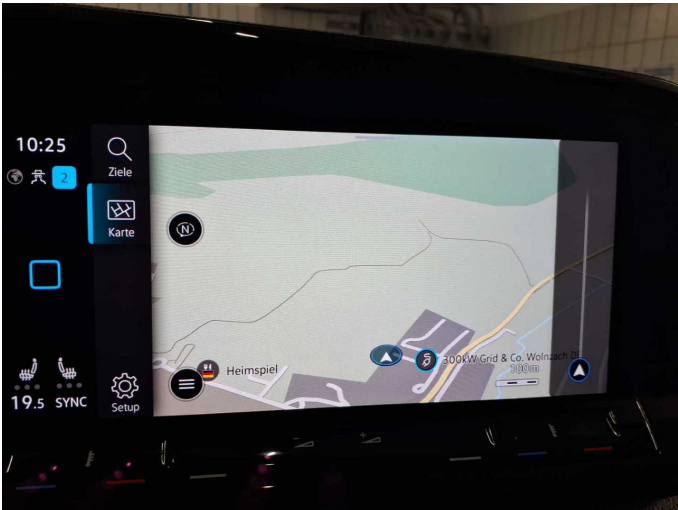


Figure 16: Navigation



Figure 17: Misc.

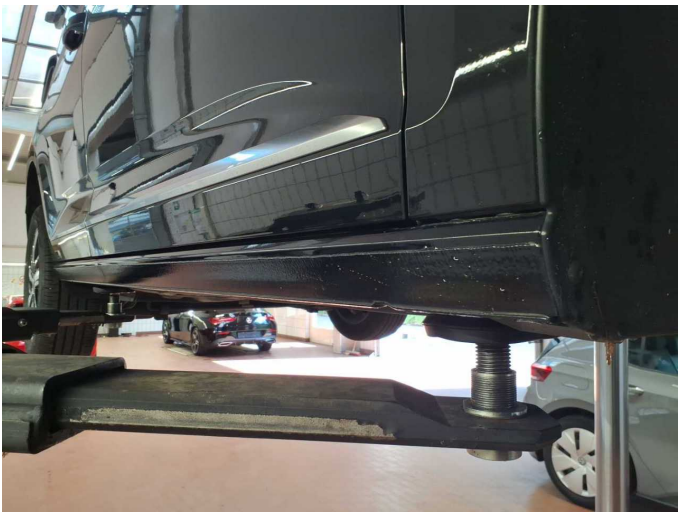


Figure 18: Misc.



Figure 19: Misc.



Figure 20: Misc.



Figure 21: Misc.



Figure 22: Misc.



Figure 23: Misc.



Figure 24: Misc.



Figure 25: Misc.



Figure 26: Misc.



Figure 27: Misc.



Figure 28: Misc.



Figure 29: Misc.


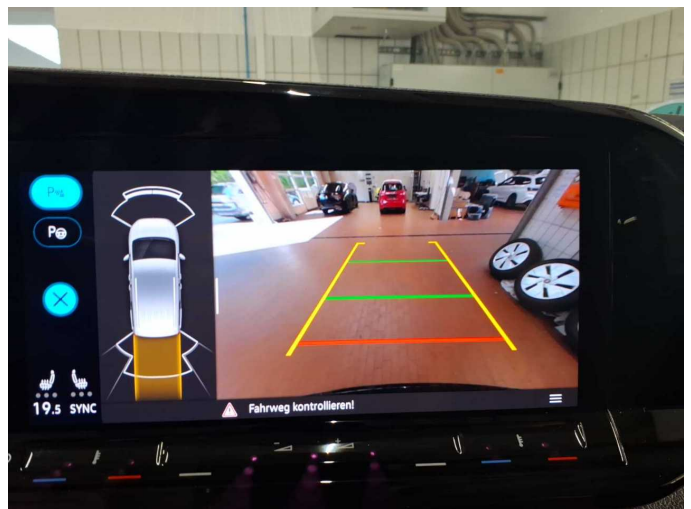


Figure 30: Misc.



Damage 1: Sill - right side: Sill - dent(s) - Smooth repair work

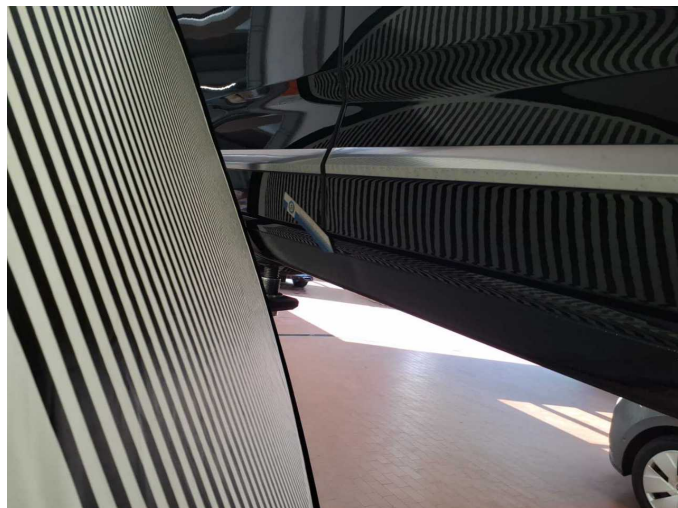

Damage 1: Sill - right side: Sill - dent(s) - Smooth repair work



Damage 1: Sill - right side: Sill - dent(s) - Smooth repair work



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair




Damage 2: Rear bumper: Rear bumper - Scratch(es) - Smart repair



Damage 3: Front bumper: Front bumper - Scratched - Paint



Damage 3: Front bumper: Front bumper - Scratched - Paint

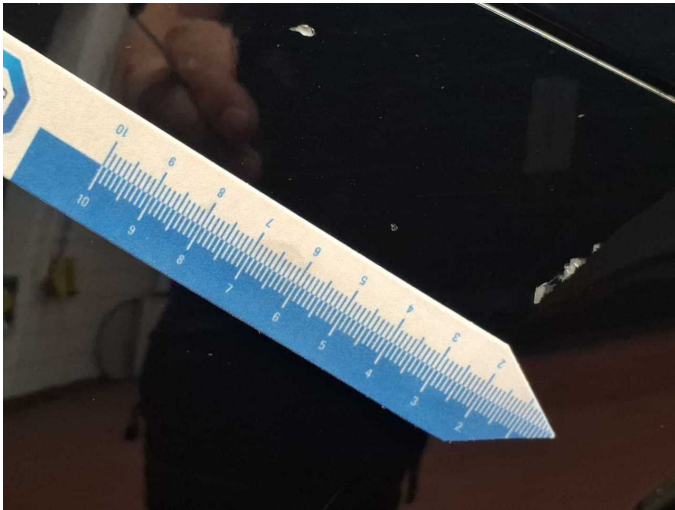

Damage 3: Front bumper: Front bumper - Scratched - Paint



Damage 3: Front bumper: Front bumper - Scratched - Paint



Wear and tear 1: Side panel - rear left side: Side panel - Scratch(es) - No deduction



Wear and tear 1: Side panel - rear left side: Side panel - Scratch(es) - No deduction



Repainting 1: Door - front right side



Wartungshistorie

(gemäß Auftraggeber Informationen)

Fahrgestellnummer: WV2ZZZSK5RX055064

Hersteller / Modell: VOLKSWAGEN VOLKSWAGEN Caddy 2.0 TDI BMT (5-Si.) DSG
Style

Datum	KM-Stand	Beschreibung
09.01.2026	65.336	Bremsflüssigkeit; Bremsflüssigkeit ern; Motoröl b. Wartung; Ölfilter ern; Regelwartungsdienst; Wartung Sonstiges
11.09.2025	48.824	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges
27.05.2025	35.861	Regelwartungsdienst; Wartung Sonstiges
04.02.2025	24.616	Motoröl b. Wartung; Ölfilter ern; Ölwechsel; Wartung Sonstiges